
TRANSPORTATION

FINAL DESIGN REPORT / ENVIRONMENTAL IMPACT STATEMENT

<u>Appendix K – Hazardous Waste/Contaminated Materials Screening</u>
August 2014

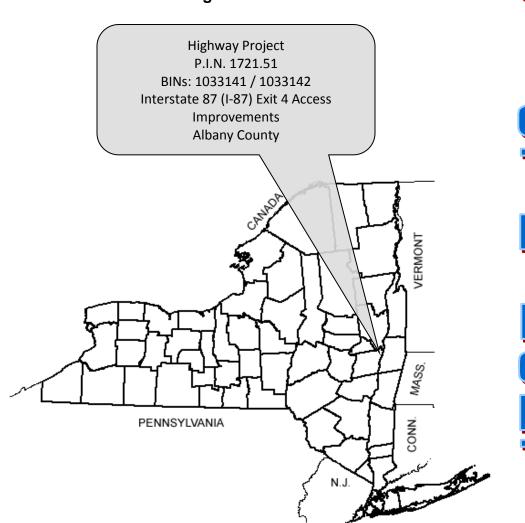

U.S. Department of Transportation Federal Highway Administration





TABLE OF CONTENTS

1.0	INTR	ODUCTION	1-1
	1.1	PROJECT DESCRIPTION	1-1
		1.1.1 Diamond Alternative	
	1.2	PURPOSE	1-4
2.0	SCO	PE AND METHODOLOGY	2-1
	2.1	INVESTIGATION OF PREVIOUS LAND USE	2-1
	2.2	REVIEW OF PUBLISHED DATABASES AND GOVERNMENT RECORDS	2-3
	2.3	FIELD INSPECTION	2-4
3.0	FIND	DINGS	3-1
	3.1	PREVIOUS AND CURRENT LAND USE	3-1
	3.2	3.1.1 Historical Maps 3.1.2 Aerial Photographs 3.1.3 City Directories 3.1.4 Local Government Agency Records 3.1.5 Interviews GOVERNMENT RECORDS REVIEW RESULTS	3-3 3-6 3-9 3-10
		3.2.1 Project Corridor Listings	3-20
	3.3	FIELD INSPECTION	3-32
4.0	CON	CLUSIONS AND RECOMMENDATIONS	4-1
	4.1	DIAMOND ALTERNATIVE	4-1
	4.2	FLYOVER ALTERNATIVE	4-2

5.0 LIMITA	ΓΙΟΝS
	FIGURES
Figure No.	
1	PROJECT CORRIDOR LOCATION MAP
2A	SITE SCHEMATIC – DIAMOND ALTERNATIVE
2B	SITE SCHEMATIC – FLYOVER ALTERNATIVE
3A	POTENTIAL HW/CM AOCs – DIAMOND ALTERNATIVE
3B	POTENTIAL HW/CM AOCs – FLYOVER ALTERNATIVE
	APPENDICES
APPENDIX A:	HISTORICAL MAPS
APPENDIX B:	AERIAL PHOTOGRAPHS
APPENDIX C:	LOCAL GOVERNMENT AGENCY DOCUMENTATION
APPENDIX D:	EDR ENVIRONMENTAL DATABASE REPORTS

1.0 INTRODUCTION

This Hazardous Waste/Contaminated Materials (HW/CM) Screening Report has been completed for the New York State Department of Transportation (NYSDOT) Interstate 87 (I-87) Exit 4 Access Improvement project (PIN 1721.51). This HW/CM Screening Assessment has been prepared in technical support of new highway construction associated with access improvements between I-87, Wolf Road, and the Albany International Airport. This report addresses the two (2) alternatives considered and identified as the Diamond Alternative and the Flyover Alternative.

A project corridor location map is provided as Figure 1. Figures showing the location of the project alternatives being studied are included as Figure 2A and Figure 2B. Aerial photographs depicting land use and potential areas of environmental concern along the project corridor are shown on Figure 3A and Figure 3B.

1.1 PROJECT DESCRIPTION

Approximately 10.3 miles of highway, auxiliary lanes, and local roadways are included in the study area. The roadways include I-87 between Exit 2 (RM 871 1108 2009) and Exit 5 (871 1108 2038), Wolf Road known as Old Wolf Road between Watervliet-Shaker Road and Albany-Shaker Road, Wolf Road between Albany-Shaker Road and Sand Creek Road, and Albany-Shaker Road between Maxwell Road and the airport. The primary objective is to improve access between I-87 and both Albany International Airport and Wolf Road. The required services for preliminary design include the development and evaluation of feasible alternatives as described in Chapter 3 of the Design Report/Environmental Impact Statement. The alternatives are summarized below:

1.1.1 Diamond Alternative

The Diamond Alternative (Figure 2A) includes replacement of the existing Exit 4 ramps through construction of a full-access, grade-separated diamond interchange, which will connect to Wolf Road and Albany-Shaker Road via a new connector road. Key elements of this alternative include:

- Construction of a new connector road between Wolf Road, at Metro Park Road, and Albany-Shaker Road, approximately 1,000 ft. west of Old Wolf Road.
- Construction of new Exit 4 interchange ramps to connect I-87 to the connector road.
- Replacement of the I-87 bridges over Albany-Shaker Road and reconstruction of the bridge approaches on I-87 northbound and southbound.
- Construction of a new bridge to carry the connector road over I-87 northbound and southbound.
- Reconstruction of 3,900 ft. of I-87 northbound at the new interchange ramp to shift the
 mainline into the existing median and avoid impacts to the existing overhead electric
 utility line.
- Pavement widening for additional travel lanes, turn lanes, and medians on Wolf Road and Albany-Shaker Road.
- Construction of a new intersection on Albany-Shaker Road at the connector road approximately 1,300 ft. west of Old Wolf Road.
- Removal of the existing Exit 4 northbound exit ramp, northbound entrance ramp, southbound exit ramp, and southbound entrance ramp.
- Removal of the C-D road between the existing Exit 5 southbound entrance ramp and Exit 4 southbound exit ramp.
- Replacement of the existing Exit 5 southbound entrance ramp with a new direct ramp connection from Watervliet-Shaker Road to I-87 southbound.

Although the Diamond Alternative is included in this report and its impacts are discussed, the Diamond Alternative has been dismissed from consideration as a reasonable alternative.

A summary of the reasons for its dismissal are included in Section 3.2.1 of the draft Environmental Impact Statement (EIS).

1.1.2 Flyover Alternative

The Flyover Alternative includes construction of new Exit 4 ramps to replace and/or complement the existing Exit 4 interchange ramps (Figure 2B). This alternative has been identified as the preferred alternative because it meets all of the project objectives and results in the least amount of environmental impacts. Key elements of this alternative include:

- Construction of a new flyover ramp to connect I-87 northbound to Albany-Shaker Road (1,300 ft. west of Old Wolf Road).
- Construction of a new ramp to connect I-87 southbound to Albany-Shaker Road (1,000 ft. west of Old Wolf Road).
- Construction of new ramp to connect Albany-Shaker Road (1,000 ft. west of Old Wolf Road) to I-87 southbound.
- Construction of a new intersection on Albany-Shaker Road at the flyover ramp approximately 1,000 ft. west of Old Wolf Road.
- Replacement of the I-87 bridges over Albany-Shaker Road and reconstruction of the bridge approaches on I-87 northbound and southbound.
- Construction of new bridge(s) to carry the I-87 northbound to Albany-Shaker Road flyover ramp over I-87 northbound and southbound.
- Pavement widening for additional travel lanes, turn lanes, and medians on Albany-Shaker Road.
- Pavement widening to create an auxiliary lane between the existing Exit 4 northbound entrance ramp and Exit 5 northbound exit ramp.
- Restriping the existing Exit 4 northbound exit ramp to create a one lane ramp allowing
 right-turns only onto Wolf Road and removal of the existing traffic signal at the
 intersection with Wolf Road.
- Removal of the existing Exit 4 southbound exit ramp and southbound entrance ramp.

- Removal of the C-D road between the existing Exit 5 southbound entrance ramp and Exit 4 southbound exit ramp.
- Replacement of the existing Exit 5 southbound entrance ramp with a new direct ramp connection from Watervliet-Shaker Road to I-87 southbound.

The Flyover Alternative has been identified as the only feasible alternative.

1.2 PURPOSE

The purpose of this HW/CM Screening is to identify potential areas of environmental concern (AOC) that may represent an impact to the health and safety and/or budget to the I-87 Exit 4 Access Improvement project. It is NYSDOT policy to identify potential AOCs prior to site work to avoid unexpected costs and significant delays in the development of a project.

2.0 SCOPE AND METHODOLOGY

This HW/CM screening assessment conforms to the procedures recommended in Section 5.1 of the New York State Department of Transportation (NYSDOT) 1999 Environmental Procedures Manual (EPM) produced by the Environmental Analysis Bureau (EAB). The HW/CM assessment includes the screening techniques listed below.

2.1 INVESTIGATION OF PREVIOUS LAND USE

A records search was conducted to assess past land use on or near the project corridor alternatives that may represent potential environmental impacts to the project. The following sources were reviewed:

- <u>Historical Maps</u>: The historical maps obtained and reviewed (Appendix A) for this study were:
 - Sketch of Roads, Streams and Localities of Watervliet, for the year 1850, published by Gerrit T. Whitbeck and available for review at the Town of Colonie Historian's office in Loudonville, New York.
 - > Map of the Albany and Troy Vicinity, for the year 1851, published by R. P. Smith and available for review at the Town of Colonie Historian's office in Loudonville, New York.
 - Map of Albany County New York, for the year 1854, published by Jay Gould and available for review at the Town of Colonie Historian's office in Loudonville, New York.
 - > Beers Map Watervliet Center, for the year 1866, published by Beers and available for review at the Town of Colonie Historian's office in Loudonville, New York.

- Map of the Town of Colonie Albany County, New York, for the year 1932, published by Solomon & Kies Engineers, revised by Nordin J. Shambrook 1943, and available for review at the Town of Colonie Historian's office in Loudonville, New York.
- A USGS 15-Minute Albany, New York Quadrangle Map from the year 1891-1892 available for review at the Town of Colonie Historian's office in Loudonville, New York. USGS 15-Minute Albany, New York Quadrangle Maps from the years 1898, 1927, and 1950 provided by Environmental Data Resources, Inc. (EDR).
- USGS 7.5-Minute Albany, New York Quadrangle Maps from the years 1953, 1980, and 1994 provided by EDR.
- Sanborn and other fire insurance maps were not available for this project location.
- Aerial Photographs: Aerial photographs dated 1940, 1952, 1961, 1969, 1977, and 1986, available from the USDA Natural Resource Conservation Service (NRCS) and Farm Service Agency offices in Voorheesville, New York, were reviewed for this study. Aerial photographs dated 1968, 1982, 1985, 1991, 1994, and 1999 were reviewed at the New York State Archives in Albany, New York. Aerial photographs dated 1973, 1978, and 2006 were provided by EDR. In addition, an aerial photograph dated 1974 available from the Town of Colonie Historian's office, was reviewed for this study. Finally, aerial photographs dated 2001, 2004, and 2007 were available on the New York State Geographic Information **Systems** (NYSGIS) Clearinghouse website (www.nysgis.state.ny.us). Copies of reproducible aerial photographs are located in Appendix B.
- <u>City Directories</u>: City directories for the years 1956-2009 were reviewed at the William K. Sanford Town Library in Colonie, New York for this study.

- Local Government Agency Records: Property record card files for select commercial properties located along project corridor alternatives were reviewed at the Town of Colonie Assessor's Office in Loudonville, New York. Additional property specific information was reviewed at the Town of Colonie's Attorney's Office as a result of a Freedom of Information Act (FOIA) request. Copies of information acquired are included in Appendix C.
- Newspaper Article Excerpt: "Mobil Mart may Replace Naughter's Gas Station", Albany Time Union (Albany, NY), dated June 15, 1993.
- <u>Interviews</u>: Interviews were conducted with personnel at the Town of Colonie with regard to this project.
- Government Environmental Databases: Searches of federal and state environmental databases were conducted by EDR. The results of the searches were provided in EDR Radius Map™ Reports with GeoCheck® dated October 18, 2010 and April 2 2013, which are included as Appendix D.

2.2 REVIEW OF PUBLISHED DATABASES AND GOVERNMENT RECORDS

The EDR Reports incorporated listed facilities on several environmental databases in and surrounding the project corridor. The EDR Reports included a review of the available federal and state environmental databases (listed in detail in Section 3.2) and were compiled in accordance with ASTM standards for a government records review. Copies of the EDR Reports are included as Appendix D. A review of specific case files maintained by the New York State Department of Environmental Conservation (NYSDEC) was not included in this scope of work.

2.3 FIELD INSPECTION

Field inspections of the project corridor alternatives were conducted on November 1-3, 2010, January 28, 2011, and April 18, 2013. The field inspection included exterior evaluations of properties along the project alternatives. Interior inspections or inspections of restricted or inaccessible private property areas were not conducted.

The field inspection was conducted to identify features that may indicate that potential environmental impacts are present. Potential environmental concerns may be visually identified by: stained or discolored soil or building foundations; distressed, dead, or absence of vegetation; air emissions or odors; discolored or oily sheen on surface water or groundwater discharges; evidence of previous fill placement or waste disposal; evidence of fires; underground/aboveground storage tanks; monitoring wells, pipes or pipe lines; drums; bulk chemical use or storage; PCB use or storage, including transformers or former transformer pads; railroad tracks; sumps or septic systems; and pits, lagoons, or other surface impoundments.

3.0 FINDINGS

This section includes the results of the available historical information review, government records review, and the field inspections of the project corridor alternatives. Included in these results are those locations that may represent an environmental impact to the project.

3.1 PREVIOUS AND CURRENT LAND USE

This following section presents the results of the review of historical maps, aerial photographs, city directories, local government agency records, and interviews.

3.1.1 Historical Maps

EDR performed a search of Sanborn and other fire insurance maps for the project corridor alternatives. No map coverage of the project corridor area was found by EDR.

Historic maps for the years 1850, 1851, 1854, 1866, 1891-1892, and 1932 available from the Town of Colonie Historian's office's office were reviewed. Historical topographic maps for the years 1898, 1927, 1950, 1953, 1980, and 1994 were provided by EDR. Review of the project corridor area on the historic maps is summarized in the following table. City directory listings for corresponding years are indicated in parentheses for the 1980 and 1994 map summaries. Review of the historical maps is discussed below and non-copyrighted or non-sensitive historical maps have been included as Appendix A.

- 1850, 1851, 1854, 1866, 1891-1892, and 1898 Maps: The project corridor and surrounding areas consisted of rural residential land.
- **1927 Map:** The electrical transmission line crossing Wolf Road was evident on this map. No other significant changes from the previous maps were observed.
- **1932 and 1950 Maps:** No significant changes from the 1927 map were observed.

- 1953 Map: Large buildings were present at the south and west corners of Albany-Shaker Road and Wolf Road. Farm structures were present at the south side of Albany-Shaker Road west of Wolf Road.
- 1980 Map: Commercial buildings were observed in the current locations of the Hess gasoline service station (156 Wolf Road), Best Western hotel (200 Wolf Road), JT Maxies (240 Wolf Road), Country Kitchen (242 Wolf Road), Starbucks Coffee/Nail Art/Moe's Southwest Grill (654 Wolf Road), Times Union (645 Albany-Shaker Road), Desmond Albany Hotel properties (660-680 Albany-Shaker Road), and the Wolf Road Diner (221 Wolf Road). Structures in proximity to the project corridor were also observed in the current locations of the Pier 1 Imports (146 Wolf Road), Albany Park N Fly (264 Wolf Road), and Sunbelt Rentals (272 Wolf Road) properties.
- **1994 Map:** This map depicted beige shading along the project corridor area. This beige shading is indicative of developed use and no specific property details were observed except for structures at the farm market property (681 Albany-Shaker Road).

Features of environmental concern were not noted on the historical maps. The project corridor area consisted predominately of rural residential use from at least 1850 until after 1953 when several commercial buildings were constructed near the intersection of Wolf Road and Albany-Shaker Road. The 1980 topographical map depicted commercial buildings in the current locations of the Hess gasoline service station (156 Wolf Road), Best Western hotel (200 Wolf Road), JT Maxies (240 Wolf Road), Country Kitchen (242 Wolf Road), Starbucks Coffee/Nail Art/Moe's Southwest Grill (654 Wolf Road), Times Union (645 Albany-Shaker Road), and Desmond Albany Hotel properties (660-680 Albany-Shaker Road). Further commercial development occurred along Wolf Road and Albany-Shaker since 1980, and based on other historical sources referenced in the HW/CM Screening report, some of the properties above were determined to include facilities that used, stored, or retailed hazardous materials and/or petroleum products.

3.1.2 Aerial Photographs

Aerial photographs dated 1940, 1952, 1961, 1969, 1977, and 1986, available from the USDA NRCS and Farm Service Agency offices in Voorheesville, New York, were reviewed for this study. Aerial photographs dated 1968, 1982, 1985, 1994, and 1999 were reviewed at the New York State Archives in Albany, New York. In addition, an aerial photograph dated 1974 available from the Town of Colonie Historian's office, was reviewed for this study. Finally, aerial photographs dated 2001, 2004, and 2007 were available on the NYSGIS Clearinghouse website (www.nysgis.state.ny.us). Review of the aerial photographs is discussed below and noncopyrighted or non-sensitive aerial photographs are included in Appendix B.

- **1940 Aerial Photograph:** Commercial structures were located at the west (656 Albany-Shaker Road) and south (654 Albany-Shaker Road) corners of Albany-Shaker Road and Wolf Road. The remainder of the properties along the project corridor appeared agricultural and rural residential.
- 1952 Aerial Photograph: A structure was evident on the Dominion Transmission (154 Wolf Road) property. Two (2) small structures were present on the 215 and 217 Wolf Road properties. No other significant changes from the 1940 aerial photograph were observed.
- 1961 Aerial Photograph: I-87 and its entrance and exit ramps are present in the current locations. In addition, structures are located at 216 Wolf Road, 645 Albany-Shaker Road, 661 Albany-Shaker Road, 260 Wolf Road, 264 Wolf Road, 257-271 Wolf Road. A small structure was present on the north side of Albany-Shaker Road and east side of Wolf Road east of the I-87 north entrance ramp (645 Albany-Shaker Road).
- **1968 Aerial Photograph:** Two (2) structures were present on the current JT Maxies and Country Kitchen property (240 and 242 Wolf Road) west of the I-87 northbound exit ramp to Wolf Road. A rectangular structure (200 Sunset Boulevard) was present north of I-87 and east of the transmission easement. No other significant changes from the 1961 aerial photograph were observed.

- **1969 Aerial Photograph:** The current Times Union/Capital Newspapers (645 Albany-Shaker Road) structure is present. Apparent fill areas were observed around 200 Sunset Boulevard and north of 158-178 Wolf Road. No other significant changes from the 1968 aerial photograph were observed.
- **1973 Aerial Photograph:** Large commercial structures were present on the current Pier 1 Imports (146 Wolf Road), Best Western (200 Wolf Road), Desmond Albany (660 Albany-Shaker Road), and Sunbelt Rentals (272 Wolf Road) properties. No other significant changes from the 1969 aerial photograph were observed.
- **1974 Aerial Photograph:** Structures were present on the current Turf Hotel (205 Wolf Road), Latham Construction (267, 271, and 277 Wolf Road), and Atlantic Detroit Diesel (281 Wolf Road) properties. No other significant changes from the previous aerial photograph were observed.
- **1977 Aerial Photograph:** Structures were evident on the current Hess (156 Wolf Road), Wings and Rings (203 Wolf Road), and Pizza Hut (203A Wolf Road) properties. A fill area was evident north of the 200 Sunset Boulevard structure. No other significant changes from the 1974 aerial photograph were observed.
- **1978 Aerial Photograph:** This photograph is blurry and difficult to decipher details. No significant changes from the 1977 aerial photograph were observed.
- **1982 Aerial Photograph:** Structures were present on the current Burger King (158 Wolf Road), Reel Seafood (195 Wolf Road), and commercial building (187 and 197 Wolf Road) properties. No other significant changes from the 1978 aerial photograph were observed.
- 1985 Aerial Photograph: This photograph is blurry and difficult to decipher details. A structure is present in the current location of the Red Roof Inn hotel facility (188 Wolf Road) property. No other significant changes from the 1982 aerial photograph were observed.
- **1986 Aerial Photograph:** A structure was present on the current Dunkin Donuts commercial plaza (186 Wolf Road) property. No other significant changes from the 1985 aerial photograph were observed.

- 1994 and 1999 Aerial Photographs: Multiple parked vehicles were present on the current Albany Park N Fly (264 Wolf Road) and Atlantic Detroit Diesel (281 Wolf Road) properties. Apparent fill areas and trucks were observed on the current construction company (200 Sunset Boulevard) and New York State (150 Wolf Road) properties. No other significant changes from the 1986 aerial photograph were observed.
- 2001 Aerial Photograph: Structures were present on the current Courtyard by Marriott hotel (160 Wolf Road), Red Lobster (170 Wolf Road), and Olive Garden (178 Wolf Road) properties. The present day Indigo Hotel structure was present on the 661 Albany-Shaker Road property. An oval pond was present on the Albany County Airport Authority (682 Albany-Shaker Road) agricultural property west of the Desmond Albany (660 Albany-Shaker Road) property. No other significant changes from the 1999 aerial photograph were observed.
- **2004 Aerial Photograph:** No farm structures were observed on the current Homewood Suites (216 Wolf Road) property. No other significant changes from the 2001 aerial photograph were observed.
- 2006 Aerial Photograph: Construction is evident on the current Dunkin Donuts commercial plaza (186 Wolf Road) and Homewood Suites (216 Wolf Road) properties.

 This construction consists of cleared land and a building foundation, respectively. No other significant changes from the 2004 aerial photograph were observed.
- **2007 Aerial Photograph:** The current Dunkin Donuts commercial plaza (186 Wolf Road) and Homewood Suites (216 Wolf Road) structures were observed. A fill area was observed on the 682 Albany-Shaker Road property along the road. No other significant changes from the 2006 aerial photograph were observed.

The project corridor and adjoining property use generally consisted of rural residential and farm uses in 1940. Construction of I-87 circa 1960 initiated commercial development along Albany-Shaker Road and Wolf Road. Expanding commercial growth along Wolf Road occurred in the 1970s and 1980s. Although not readily apparent in the aerial photographs, gasoline stations were (or are) present on the Hess (156 Wolf Road), Country Kitchen (242 Wolf Road), SUNOCO (656 Albany-Shaker Road), JJ Naughters (654 Albany-Shaker Road), and Bieniek's (264 Wolf

Road) properties and these properties are potential environmental concerns as discussed in other sections of this report. Fill areas are noted at 200 Sunset Boulevard, 680 Albany-Shaker Road and in a wooded area west of 158-178 Wolf Road. No other features of environmental concerns were identified based on review of the aerial photographs.

3.1.3 City Directories

City directories of the project corridor vicinity were reviewed at the William K. Sanford Town Library on Albany-Shaker Road in the Town of Colonie, New York. Coverage of the project corridor in the city directories was found from 1956-2009. Review of the directories was performed in approximate 3-year intervals. A summary of the city directories reviewed is provided below:

CITY DIRECTORY SUMMARY

ADDRESS	DATE(S)	LISTING	PROJECT CORRIDOR ORIENTATION
645 Albany-Shaker Road	1956-1968 1971-1997 2000-2009	Hoffman & Sons Livestock Capital Newspapers Times Union	Intersection Albany-Shaker Road, Wolf Road and I-87 Northbound entrance ramp
647 Albany-Shaker Road	1968	Albany Beverage Center	Intersection Albany-Shaker Road, Wolf Road and I-87 Northbound entrance ramp
654 Albany-Shaker Road (243 Wolf Road)	1960-1991 1994	JJ Naughter auto repair Vacant	South corner of Albany-Shaker Road – Wolf Road intersection
656 Albany-Shaker Road	1968-2009	Gasoline service station	West corner of Albany-Shaker Road – Wolf Road intersection
660 Albany-Shaker Road	1956-1968 1971 1974 1977-2009	Gordon Ahl Fuel Company No return Flagship Inn Motel Desmond Albany Hotel Inn hotel	West corner of Albany-Shaker Road – Old Wolf Road and I-87 Southbound entrance ramp intersection
661 Albany-Shaker Road	1956-1968 1971-2009	Raz Delivery Restaurant	North corner of Albany-Shaker Road – Old Wolf Road intersection
664 Albany-Shaker Road	1965-1968	Greenhouse	South side of Albany-Shaker Road west of Old Wolf Road
667 Albany-Shaker Road	1965-2009 2003-2009	Ed and Helen Engel Engel's Farm & Market	North side of Albany-Shaker Road west of Old Wolf Road
672 Albany-Shaker Road	1956-1971 1974-1991 1994-1997	Sleasman Market Gardeners Residential Vacant house	South side of Albany-Shaker Road west of Old Wolf Road

ADDRESS	DATE(S)	LISTING	PROJECT CORRIDOR ORIENTATION
676 Albany-Shaker Road	1968-1991	Residential	South side of Albany-Shaker Road
orornouny snaker Road	1994-1997	Vacant house	west of Old Wolf Road
680 Albany-Shaker Road	1965-2009	Residential	South side of Albany-Shaker Road
	-,		west of Old Wolf Road
681 Albany-Shaker Road	1965-1968	Engel and Son Landscaping	North side of Albany-Shaker Road
	1971-2000	Engels Farm and Market	west of Old Wolf Road
696 Albany-Shaker Road	1965-1983	Residential	South side of Albany-Shaker Road
	1987-1994	Storage	west of Old Wolf Road
698 Albany-Shaker Road	1965-1987	Budget Rent A Car	South side of Albany-Shaker Road
	1991-2003	Airport Rapid Park	west of Old Wolf Road
70 (200) Sunset Boulevard	1971-1973	John J. Cerone Construction	West of I-87 at terminus of Sunset
	1974-1997	Town of Colonie Seer Pump	Boulevard
		Station	
	2000-2006	Hansen Lawn & Landscape/	
		John Cerone, Inc. developers	
	2009	No listing	
156 Wolf Road	1980-2009	Hess gasoline station	West side of Wolf Road
158 Wolf Road	1980-2009	Burger King	West side of Wolf Road
168 Wolf Road	2000-2009	Courtyard by Marriott	West side of Wolf Road
170 Wolf Road	1965-1997	Residential	West side of Wolf Road
	2000	No listing	
	2003-2009	Red Lobster restaurant	
178 Wolf Road	1997-2009	Olive Garden restaurant	West side of Wolf Road
186 Wolf Road	1965-1991	Residential	West side of Wolf Road
	1994-2003	Beauty salon	
	2006	No listing	
	2009	Dunkin Donuts	
188 Wolf Road	1987-2009	Red Roof Inn	West side of Wolf Road
200 Wolf Road 1974		Rowntowner Motor Inn	West side of Wolf Road
	1977-1991	Sheraton Airport Inn	
200 XX 10D	1994-2009	Best Western hotel	W
208 Wolf Road	1962-2006	Leatso residence	West side of Wolf Road
216 Wolf Road	1962-2003	Leatso residence, farm and	West side of Wolf Road
	2007 2000	greenhouses	
224 W. 16 D 1	2006-2009	Homewood Suites	Wind of the CWI-1CD and
234 Wolf Road	2003-2009	US Army Recruiting	West side of Wolf Road
240 Wolf Road	1968-1971	Albany Beverage Company	West side of Wolf Road and south
	1974-1994 2000-2009	Harold's Office (bar)	side of I-87 Northbound exit ramp
242 Wolf Road	1971-1977	JT Maxies (bar) Albany Beverage Company	West side of Wolf Road and south
242 WOII KOAU	19/1-19//	Robert's Piano	side of I-87 Northbound exit ramp
	1983-1987	Entenmann's bakery outlet	side of 1-07 Hornibound exitrallip
	1991-2009	Country Kitchen bakery outlet	
243 Wolf Road	1962-1994	Residential	South corner of Wolf Road –
(654 Albany-Shaker Road)	1997	Vacant	Albany-Shaker Road intersection
(50 . 125an) Shaker Roud)	2000-2006	No listing	
	2009	Moe's Southwest	
		Grill/Starbuck's Coffee	
		OTHI/STATUUCK 8 COTTEE	

ADDRESS	DATE(S)	LISTING	PROJECT CORRIDOR ORIENTATION
254 Wolf Road	1956-1971	Charles Bieniek	North corner of Albany-Shaker
	1974-1983	Vacant	Road – Old Wolf Road intersection
	1987	RHD Construction	
	1991-1997	No listing	
	2000-2009	Wingate Hotel	
256 Wolf Road	1965-1983	Charlie's Northway Diner	North corner of Albany-Shaker
	1987-1991	China Pavilion restaurant	Road – Old Wolf Road intersection
260 Wolf Road	1994-2000	Silver Pavilion Restaurant	North corner of Albany-Shaker
	2003	Peony Restaurant	Road – Old Wolf Road intersection
	2006-2009	Koto Japanese Steakhouse	
264 Wolf Road	1956-1987	Gasoline service station	North of north corner of Albany
	1991-2009	Albany Park N Fly	Shaker Road – Old Wolf Road
			intersection
266 Wolf Road	1962-1965	Niagara Mohawk Power	North of north corner of Albany-
	1968	No listing	Shaker Road – Old Wolf Road
	1971	Vacant	intersection
267 Wolf Road	1965	Residential	East side of Old Wolf Road south
			of I-87 Exit 4 exit ramp
257 Wolf Road	1965-1971	Residential	East side of Old Wolf Road south
	1974-1991	County Excavation	of I-87 Exit 4 exit ramp
271 Wolf Road	1956-1987	County Excavation	East side of Old Wolf Road south
	1991-2009	Latham Construction	of I-87 Exit 4 exit ramp
270 Wolf Road	1956-1965	Western Express Company	West side of Old Wolf Road north
	1968	Roadway Express	of Albany-Shaker Road
	1971-2009	No listing	_
272 Wolf Road	1971	No listing	West side of Old Wolf Road north
	1974-1991	Rushmore & Weber	of Albany-Shaker Road
	1994-1997	Vacant	
	2000-2006	Nations Rent	
	2009	Sunbelt Rentals	

Listings for gasoline service stations and/or automobile repair facilities at 654 Albany-Shaker Road, 656 Albany-Shaker Road, 156 Wolf Road, and 264 Wolf Road are discussed in other sections of this report. In addition, listing of the Gordon Ahl Fuel Company at 660 Albany-Shaker Road from 1956-1968 is a potential environmental concern based on the likelihood of former fuel storage tanks. Several of the addresses noted in the City Directory are also listed on the October 18, 2010 EDR report databases as discussed in Section 3.2 including: 645 Albany-Shaker Road, 654 Albany-Shaker Road, 656 Albany-Shaker Road, 660 Albany-Shaker Road, 674 Albany-Shaker Road, 70/200 Sunset Boulevard, 156 Wolf Road, 216 Wolf Road, 242 Wolf Road, 257 Wolf Road, 264 Wolf Road, 270 Wolf Road, 271 Wolf Road, and 272 Wolf Road.

3.1.4 Local Government Agency Records

The Town of Colonie Assessor's Office was visited for information regarding specific commercial properties along the project corridor where historical land use was not well defined. Additional information was reviewed at the Town of Colonie's Attorney's Office as a result of a Freedom of Information Act (FOIA) request. The following table provides a summary of the property record card files and Attorney's documents reviewed for the properties along the project corridor:

LOCAL GOVERNMENT AGENCY RECORD REVIEW SUMMARY

PARCEL NO.	CURRENT USE	ADDRESS	COMMENTS
305-8	Desmond Albany Hotel	660 Albany-Shaker Road	Original hotel structure built 1975; 4-story section added in 1983. Oil tank was relocated in 1982. Storage barn demolished in 2005 after fire damage.
305-7	Desmond Albany Hotel parking lot	668 Albany-Shaker Road	1.5-story building constructed in 1935.
305-5	Desmond Albany Hotel parking lot and building	676 Albany-Shaker Road	Demolish greenhouses and fill 1.5 acres in 1984. Demolish 1-family dwelling in 1993.
305-1	Agricultural field	682 Albany-Shaker Road	Land sold by John and Ed Engel to Albany County Airport Authority November 6, 2009.
42.1-1-31	Dominion Transmission, Inc. natural gas transmission	148 Wolf Road	Building constructed 1960.
42.1-1-31	Hess gasoline service station	156 Wolf Road	Install one (1) 550-gallon fuel oil and four (4) 10,000-gallon gasoline USTs in 1976. Install USTs and demolition of gasoline station in 1993. Hess Mart built in 1994. Gas dispensing units and piping added in 1999.
30.4-1-6.1	Courtyard by Marriott hotel	168 Wolf Road	Hotel structure built in 1995. Gazebo and storage shed constructed in 1997 and 2002, respectively.
30.4-1-7.2	Best Western hotel	200 Wolf Road	Rowntowner hotel building constructed 1972. Sheraton Inn 1976.
30.4-1-10	Country Kitchen Bakery Outlet and JT Maxi's Bar and Restaurant	240-242 Wolf Road	A 6,000-gallon tank installed in 1970. Remodel abandoned gas station (no date provided). Proposed depot and thrift building with 10,000-gallon gasoline UST at southwest corner of north building. Fuel canopy over pump and 10,000-gallon UST removed 1989. Parcels for 240 and 242 Wolf Road combined in 1991.

PARCEL	CURRENT USE	ADDRESS	COMMENTS
NO.			
305-10	Construction Company	200 Sunset Boulevard	1,000-gallon gasoline, 2,000-gallon diesel fuel
			USTs closed in place in 1997

Potential environmental concerns were indicated for the 660 Albany-Shaker Road, 156 Wolf Road, 240-242 Wolf Road, and 200 Sunset Boulevard properties. Land use as a natural gas transmission facility at 148 Wolf Road may also be a potential environmental concern. These properties were listed in the database search report as discussed in more detail in Section 3.2.1. No other uses of environmental concern were indicated in the local government agency review.

3.1.5 Interviews

Local government agency officials were queried regarding project corridor information. Information regarding the project corridor was submitted under a Freedom of Information Legislation (FOIL) request to the Town Attorney's Office. The response provided Town of Colonie Department of Fire Prevention & Investigation details on underground storage tanks (USTs) at the 200 Sunset Boulevard property as summarized in 3.1.4. Further discussion of this property is provided in Section 3.2. A copy of the documentation is included in Appendix C.

3.2 GOVERNMENT RECORDS REVIEW RESULTS

Reviews of Federal and State databases provided by EDR were conducted by SCE. The results of these reviews were presented by EDR in the Radius MapTM Reports with GeoCheck[®] dated October 18, 2010 and April 2, 2013. The EDR reports contain a search of ASTM required databases within recommended search distances of the planned project. The EDR reports are included in Appendix D. The Federal and State databases searched as part of this HW/CM Screening Assessment are listed on pages 1 and 2 of the Executive Summary section of the EDR reports. Pertinent sites listed within the search distances queried are discussed below.

The database listings mapped within the standard approximate minimum search distances (AMSD) or indicated search distances are identified in the EDR Reports. A review of the NYSDEC Spill Program Online Database was also performed by SCE to supplement the original EDR search (October 18, 2010 report). Any Spill Program facilities not included in the original EDR report were submitted to EDR for additional information. Information resulting from such inquiries is included with the database listing discussions. The April 2, 2013 EDR Report was obtained to evaluate the Exit 5 area in support of the replacement of the existing Exit 5 southbound entrance ramp with a new direct ramp connection from Watervliet-Shaker Road to I-87 southbound. The following table summarizes the databases searched and respective AMSD recommended search distances.

FEDERAL DATABASES

FEDERAL DATABASE LISTING/ACRONYM	FEDERAL DATABASE DESCRIPTION	SEARCH DISTANCE (MILE)
NPL	National Priority List (Superfund) Facilities	1.0
Proposed NPL	Proposed NPL Facilities	1.0
NPL Liens	Federal Superfund Liens	Site only
Delisted NPL	Delisted NPL Facilities	1.0
CERCLIS	Comprehensive Environmental Response, Compensation, and Liability Information System (CERCLIS)	0.5
CERCLIS NFRAP	CERCLIS No Further Remedial Action Planned	0.5
Federal Facility	Federal Facility Site Information Listing	1.0
RCRA CORRACTS	Resource Conservation and Recovery Act (RCRA) Corrective Action Report	1.0
RCRA Non-CORRACTS	RCRA Non-CORRACTS Transporters, Storage, and Disposal (TSD) Facilities	0.5
RCRA-LQG	RCRA Large Quantity Generator (LQG)	Site and Adjoining
RCRA-SQG	RCRA Small Quantity Generator (SQG)	Site and Adjoining
RCRA-CESQG	RCRA Conditionally Exempt Small Quantity Generator (CESQG)	Site and Adjoining
RCRA NonGen	RCRA Non Generators	Site and Adjoining
US ENG CONTROLS	Engineering Controls Sites List	0.5
US INST CONTROLS	Sites with Institutional Controls	0.5
ERNS	Emergency Response and Notification System	Site only
US BROWNFIELDS	Brownfields Site List	0.5
ODI	Open Dump Inventory	0.5
US CDL	Clandestine Drug Labs	Site only
US HIST CDL	National Clandestine Laboratory Register	Site only
LIENS 2	CERCLA Lien Information (US EPA)	Site only

FEDERAL DATABASE LISTING/ACRONYM	FEDERAL DATABASE DESCRIPTION	SEARCH DISTANCE (MILE)
LUCIS	Land Use Control Information System (Department of the Navy)	0.5
HMIRS	Hazardous Materials Information Reporting System (US DOT)	Site only
DOT OPS	Incident and Accident Data (US DOT, Office of Pipeline Safety)	Site only
DOD	Department of Defense (US Geological Survey)	1.0
FUDS	Formerly Used Department of Defense Sites (US Army Corps of Engineers)	1.0
CONSENT	Superfund (CERCLA) Consent Decrees (US Department of Justice)	1.0
ROD	Records of Decision (US EPA)	1.0
UMTRA	Uranium Mill Tailings Sites (US Department of Energy)	0.5
MINES	Mines Master Index File (US Department of Labor, Mine Safety and Health Administration)	Site and Adjoining
TRIS	Toxic Release Inventory System (US EPA)	Site only
TSCA	Toxic Substances Control Act (US EPA)	Site only
FTTS	Federal Insecticide, Fungicide, & Rodenticide Act (FIFRA)/TSCA Tracking System	Site only
HIST FTTS	FIFRA/TSCA Tracking System Administrative Case Listing	Site only
SSTS	Section 7 (of FIFRA) Tracking Systems (US EPA)	Site only
ICIS	Integrated Compliance Information System (US EPA)	Site only
PADS	PCB Activity Database System (US EPA)	Site only
MLTS	Material Licensing Tracking System (Nuclear Regulatory Commission)	Site only
RADINFO	Radiation Information Database (US EPA)	Site only
FINDS	Facility Index System/Facility Registry System (US EPA)	Site only
RAATS	RCRA Administrative Action Tracking System (US EPA)	Site only
SCRD DRYCLEANERS	State Coalition for Remediation of Drycleaners Listing (US EPA)	0.5
PCB Transformer	PCB Transformer Registration Database (US EPA)	Site only
Coal Ash EPA	Coal Combustion Residues Surface Impoundments List (US EPA)	0.5
Coal Ash DOE	Steam-Electric Plan Operation Data (US Department of Energy)	Site only

STATE DATABASES

STATE DATABASE		SEARCH DISTANCE
LISTING/ACRONYM	STATE DATABASE DESCRIPTION	(MILE)
SHWS	State Hazardous Waste Sites List-Registry of Inactive Hazardous Waste	1.0
	Disposal Sites	
DEL SHWS	Delisted Registry of Inactive Hazardous Waste Disposal Sites	1.0
VAPOR REOPENED	Vapor Intrusion Legacy Site List	1.0
SWF/LF	Solid Waste Facilities/Landfill Sites	0.5
LTANKS	Listing of Leaking Storage Tanks	0.5
HIST LTANKS	Listing of Leaking Storage Tanks (Prior to 2002)	0.5
INDIAN LUST	Leaking Underground Storage Tank on Indian Land	0.5
UST	Underground Storage Tank	Site and
		Adjoining
HIST UST	Historical Petroleum Bulk Storage Database	Site and
		Adjoining
CBS UST	Chemical Bulk Storage List	Site and
		Adjoining

		SEARCH
STATE DATABASE		DISTANCE
LISTING/ACRONYM	STATE DATABASE DESCRIPTION	(MILE)
MOSF UST	Major Oil Storage Facility Database-Facilities that store greater than	0.5
	400,000 gallons	
INDIAN UST	Underground Storage Tank on Indian Land	Site and
		Adjoining
FEMA UST	FEMA Owned UST Listing	Site and
		Adjoining
AST	Aboveground Storage Tank	Site and
		Adjoining
HIST AST	Historical Aboveground Storage Database	Site only
CBS AST	Chemical Bulk Storage Aboveground Storage Tank	Site and
		Adjoining
MOSF AST	Major Oil Storage Facility Aboveground Storage Tank	0.5
MOSF	Major Oil Storage Facility	0.5
CBS	Chemical Bulk Storage Facility	Site and
		Adjoining
ENG CONTROLS	Environmental Remediation Sites with Engineering Controls	0.5
INST CONTROLS	Environmental Remediation Sites with Institutional Controls	0.5
RES DECL	Restrictive Declarations Listing (New York City Department of Planning	Site and
	Commission or NYC DCP)	Adjoining
VCP	Voluntary Cleanup Program	0.5
INDIAN VCP	Voluntary Cleanup Program Facility on Indian Land	0.5
ERP	Environmental Restoration Program	0.5
BROWNFIELDS	Brownfields Site List	0.5
SWTIRE	Registered Waste Tire Storage & Facility List	0.5
SWRCY	Registered Recycling Facility List	0.5
INDIAN ODI	Open Dump Inventory on Indian Land	0.5
SPILLS	Spills Information Database	0.5
NY HIST SPILLS	Spills Database (Prior to 2002)	0.5
HSWDS	Hazardous Substance Waste Disposal Site Inventory (NYSDEC)	0.5
MANIFEST	Facility and Manifest Data (NYSDEC)	Site only
Drycleaners	Registered Drycleaning Facilities (NYSDEC)	0.25
NPDES	National Pollutant Discharge Elimination System (NYSDEC)	Site only
AIRS	Air Emissions Data (NYSDEC)	Site only
E DESIGNATION	E Designation Site Listing (NYC DCP)	Site only
INDIAN RESERV	Indian Reservations	Site only
Coal Ash	Coal Ash Disposal Site Listing	0.5

EDR PROPRIETARY RECORDS

DATABASE LISTING	DATABASE DESCRIPTION	AMSD (MILE)
MGP	Manufactured Gas Plants	1.0

Pertinent database listings located within the AMSD or indicated search distances are discussed below. An opinion as to whether they have the potential to impact project alternative activities follows the discussion.

3.2.1 Project Corridor Listings

Project corridor listings are database listings located along or in close proximity to one or more project alternatives where road and/or utility construction is likely to occur. The following project corridor listings are identified:

- 1. Hess Corporation 156 Wolf Road: The Hess Corporation gasoline service station, located at the southern portion of the project corridor, is listed on multiple databases including the RCRA CESQG, FINDS, LTANKS, HIST LTANKS, SPILLS, HIST SPILLS, UST, HIST UST, and MANIFEST databases. The location of the Hess Station is depicted on Figure 3A. This gasoline service station facility has been present since 1977. USTs installed in 1977 were removed during facility upgrade in 1993. Petroleum impacts were discovered during UST removal activities and soil and groundwater remediation was conducted. Seven (7) SPILLS cases are listed for this facility, all having been issued regulatory closure. However, based on the ongoing and long-term use as a gasoline service station and the numerous documented releases, this gasoline service station has the potential to impact project alternative activities.
- 2. Entenmann's Inc. 242 Wolf Road: The Entenmann's Inc. facility, located at the west corner of Albany-Shaker Road and Wolf Road, is listed on the UST/HIST UST databases. The Entemann's site is depicted on Figure 3A. A 10,000-gallon diesel fuel UST installed at this property in 1980 was closed prior to 1991. Based on review of the Town of Colonie Assessor's Office property record card, this property also contained a former 6,000-gallon tank (contents and location not indicated) installed in 1970. Based on review of local government agency records, a 3-bay gasoline station and warehouse/storage structure as well as a service island were depicted on this property. No further details regarding this former facility were indicated in the file documentation reviewed. Based on the former gasoline service station use, potential presence of tanks,

and absence of closure documentation, this property has the potential to impact project alternative activities.

- 3. SUNOCO 656 Albany-Shaker Road: This active gasoline service station, located at the southwest corner of the Albany-Shaker Road and Wolf Road intersection, is listed on the RCRA Non-Gen, LTANKS, HIST LTANKS, UST, HIST UST, AST, SPILLS, HIST SPILLS, and MANIFEST databases. A gasoline service station has been present at this location since at least the 1960s. The location of this site is depicted on Figures 3A and 3B. Three (3) active USTs (each 12,000-gallon gasoline-ethanol USTs) were installed at this facility in 1983. No previous USTs were listed in the database or on the NYSDEC website. At least seven (7) SPILLS cases were listed for this facility since 1994. Soil and groundwater impacts were identified. All seven (7) cases have been issued regulatory closure. However, based on the ongoing and long-term use as a gasoline service station and the numerous documented releases, this gasoline service station has the potential to impact project alternative activities.
- 4. JJ Naughter Inc. – 654 Albany-Shaker Road (243 Wolf Road): This former gasoline service station, located at the southeast corner of the Albany-Shaker Road and Wolf Road intersection, is listed as a UST/HIST UST and SPILLS/HIST SPILLS facility. The location of this site is depicted on Figure 3B. Current use of this property is a commercial plaza containing Starbucks Coffee, Nail Art Beauty Salon, and Moe's Southwest Grill tenant spaces. The former JJ Naughter gasoline service station and automobile repair service opened on this property in 1928. A total of 12 USTs were listed at this facility. This facility went out of business in 1995 and eight (8) of the USTs were removed in 1996. The remaining four (4) USTs were closed before 1991 and may remain at this site. An equipment failure listed for 243 Wolf Road resulted in the release of 25 gallons of diesel fuel on November 8, 1988 (Spill No. 8807293). The release was diluted with water by the fire department and washed into the sewer. The spill was issued regulatory closure with standards designation meets on December 5, 1988. Based on the duration as a gasoline service station, documented

releases, and the potential presence of USTs, this former gasoline service station property facility has the potential to impact project alternative activities.

5. Capital Newspapers/Albany Times Union – 645 Albany-Shaker Road: This newspaper facility is located at the east corner of the Albany-Shaker Road and Wolf Road intersection (Figure 3B). Capital Newspapers is listed on multiple databases including the RCRA SQG, FINDS, LTANKS, HIST LTANKS, SPILLS, HIST SPILLS, UST, HIST UST, and MANIFEST databases. This RCRA SQG facility was also listed as a RCRA LQG and CESQG. Recordkeeping violations assessed during an inspection were corrected and compliance was achieved. Storage tanks listed at this property included a former 10,000-gallon gasoline UST (installed in 1970), an active 275-gallon lube oil AST, and two (2) active 6,000-gallon diesel fuel USTs (installed in 1992). A tank tightness failure was reported on January 14, 1992 (Spills No. 9110717). Removal of the 10,000-gallon gasoline UST was performed. Soil and groundwater testing revealed the presence of xylene above the groundwater standard. Subsequent re-testing in September 1992 revealed that "minor residual" impact to groundwater remained. The spill was issued regulatory closure with a meets standards designation by NYSDEC on February 12, 1992. A defective gasket resulting in the release of 5 gallons of gasoline occurred during vehicle fueling on February 18, 1992 (Spills No. 9111828). The spill was issued regulatory closure with a meets standards designation by NYSDEC on March 17, 1992. A release of 40 gallons of ink occurred on January 25, 1994 (Spills No. 9312547). The release was remediated and was issued regulatory closure with a meets standards designation by NYSDEC on February 9, 1994. A leak from a delivery truck resulted in the release of 30 gallons of diesel fuel on March 8, 1994 (Spills No. 9314320). The spill was issued regulatory closure with a meets standards designation by NYSDEC on March 8, 1994. A jug of blue liquid was discovered in the facility parking lot on April 13, 2009 (Spill No. 0900474). The material was disposed and the spill was issued regulatory closure with a does not meet standards designation by NYSDEC on May 14, 2009. Based on the numerous releases, use of USTs, and history as a hazardous waste generator, this property has the potential to impact project alternative activities.

- 6. West Central Environmental I-87/Albany-Shaker Road: A traffic accident at the intersection of I-87 and Albany-Shaker Road resulted in the release of antifreeze on March 22, 1990 (Spill No. 8912174). The spill was remediated and issued regulatory closure with a meets standards designation the same day. Based on the limited impact and remediated status, this spill is not considered a potential impact to the project alternative activities.
- 7. Atlantic Wolf Road New York Telephone Wolf Road at Albany-Shaker Road: This SPILLS/HIST SPILLS listing is located at the Albany-Shaker Road and Wolf Road intersection. New York Telephone (NYT) workers reported gasoline in a NYT manhole on July 24, 1992 (Spill No. 9204711). The source was not identified but the spill was remediated and issued regulatory closure with a meets standards designation on August 6, 1992. This documented subsurface gasoline impact has the potential to impact project alternative activities.
- 8. Desmond Albany Hotel 660/668 Albany-Shaker Road: This hotel property, located at the west corner of the Albany-Shaker Road and Old Wolf Road intersection, is listed on the RCRA NonGen, FINDS, UST/HIST UST, and SPILLS/HIST SPILLS databases. The location of this site is depicted on Figures 3A and 3B. This facility was listed as a RCRA LQG in 1989 and no violations were indicated on the USEPA website. Its current status is a RCRA NonGen facility. A 6,500-gallon No. 2 fuel oil UST installed in 1982 was closed in place in 1996. No Spills associated with this closed UST were listed. However, two (2) other Spills were listed at this facility. The first involved an odor that was attributed to mixing of hydrofluoric acid and another chemical in the laundry room (Spills No. 8808977). Approximately 6,000 gallons of liquid was pumped out of the cesspool by Clean Harbors. The spill was issued regulatory closure with a meets standards designation by NYSDEC on February 17, 1989. The second spill consisted of a reported discharge of paint thinner, mineral spirits, and paint materials to a nearby farmer's field on March 21, 2005 (Spills No. 0413281). NYSDEC investigated and

found no evidence to support the claim; the reported discharge was attributed to a former disgruntled employee. The spill was issued regulatory closure with a does not meet standards designation on March 21, 2005. This property was listed as a fuel company from 1956-1968 as discussed in Section 3.1.3. Based on the former use as a fuel company and the presence of a closed-in place UST, a potential impact to the project alternative activities exists.

- 9. Avis – 674/676 Albany-Shaker Road: The former Avis rental car facility is located on the south side of Albany-Shaker Road west of the Desmond Albany Hotel property. This facility is listed on the LTANKS/HIST LTANKS databases. Contamination was encountered during removal of three (3) 4,000-gallon gasoline USTs on August 19, 1986 (Spill No. 8603326). A "large amount" was spilled and recovered. The spill was remediated and issued regulatory closure with a meets standards designation on November 15, 1986. Extensive contamination was encountered during removal of an UST on November 11, 1986 (Spill No. 8605116). An estimated 800 gallons of gasoline was recovered of the approximately 1,200 gallons of gasoline released. Groundwater was impacted by the release. The spill was remediated and issued regulatory closure with a meets standards designation on September 11, 1987. In addition, other Spills listings for Avis were indicated for 737 and 867 Albany-Shaker Road; these other listings are located greater than one-half mile from the project corridor and are not an environmental Based on the quantity of gasoline released and confirmed impact to concern. groundwater, this property has the potential to impact project alternative activities.
- **10. Dominion Transmission 148 Wolf Road:** This natural gas compressor and regulator facility is listed on the RCRA CESQG, FINDS, and MANIFEST databases. The location of this site is depicted on Figure 3A. PCB and benzene containing waste have been generated at this facility since 1999. Releases of regulated compounds to the environmental were not reported; however, based on the land use this property has the potential to impact project alternative activities.

- 11. Cerone Excavating - 70 and 200 Sunset Boulevard: This UST/HIST UST and SPILLS property is located west of the project corridor at the terminus of Sunset Boulevard. The location of this site is depicted on Figures 3A and 3B. A sheen on the groundwater was discovered during removal of a 2,000-gallon and a 1,000-gallon diesel UST on December 15, 1997 (9710528). Impacted soil was removed and groundwater testing revealed the presence of tetrachloroethene (3 parts per billion) below the regulatory standard (5 parts per billion). The spill was issued regulatory closure with a does not meet standards designation on April 26, 2000. A subsurface investigation at this property revealed the presence of gasoline constituents in groundwater on November 20, NYSDEC's review of the report indicated "minor" 2009 (Spill No. 0909368). concentrations requiring no further remediation. The spill was issued regulatory closure with a does not meet standards designation on December 9, 2009. Based on the presence of past soil and groundwater impacts, this SPILLS/HIST SPILLS listing is considered a potential environmental impact to the project alternative activities.
- 12. FedEx Truck 260 Wolf Road: This SPILLS/HIST SPILLS incident is located northeast of the Albany-Shaker Road and Old Wolf Road intersection. The location of this site is depicted on Figure 3B. A Federal Express truck was pulled over by police and checked for leakage of materials on July 30, 2008 (Spill No. 0804949). No release was found and the spill was issued regulatory closure with a meets standards designation on August 6, 2008. Based on the absence of a release, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.
- 13. Latham Construction (aka NiMo Transformer) 271 Wolf Road: This SPILLS/HIST SPILLS property is located at the east side of Old Wolf Road, south of the I-87 Southbound exit ramp, and west of I-87. A heating oil UST overfill resulted in a spill of approximately 20 gallons of product on January 25, 2001 (Spill No. 0011533). The release was remediated and the spill was issued regulatory closure with a meets

standards designation on January 26, 2001. Release of approximately one quart of transformer oil occurred on June 20, 2006 (Spill No. 0603057). The release was remediated by NiMo and the spill was issued regulatory closure June 20, 2006. Based on the limited impact and testing results, these SPILLS/HIST SPILLS listings are not considered a potential environmental impact to the project alternative activities. However, numerous drums in poor condition stored outside of this building were noted as described in Section 3.3.

3.2.2 Non-Adjoining Corridor Listings

Non-adjoining corridor listings discussed below are database listings within the AMSD recommended search distances but are not located along or in close proximity to one or more project alternatives where road and/or utility construction is likely to occur. Should project alternatives be altered or expanded, then the potential for these listed facilities to impact the project may be re-evaluated. It should be noted that due to the large number of LTANKS/HIST LTANKS and SPILLS/HIST SPILLS listings, facilities on these databases that are greater than one-quarter mile from project alternatives were considered to not be a potential impact to the project alternative activities (regulatory status, topographical relationship, and/or magnitude of the releases were also used as factors in this determination).

1. Bieniek (current Albany Park N Fly) – 264 Wolf Road: This former gasoline service station (1956-1987) property, located north of the Albany-Shaker Road and Wolf Road intersection, is listed on the LTANKS/HIST LTANKS and SPILLS/HIST SPILLS databases. Potential soil impact was discovered during removal of diesel fuel USTs at this property on September 28, 1988 (Spill No. 8806304). The release was remediated and issued regulatory closure with a meets standards designation on March 22, 1989. Impacted soil was encountered during installation of a test hole by a potential purchaser on November 15, 1988 (Spill No. 8806811). The spill was issued regulatory closure with a meets standards designation the same day. A leak from an automobile occurred on August 24, 1995 (Spill No. 9506442). The release was remediated by the fire department

and the spill was issued regulatory closure with a meets standards designation on August 28, 1995. Based on the distance from project alternative activities, this facility is not considered a potential environmental impact.

- 2. Federal Express Corporation (aka Atlantic Detroit Diesel) – 281 Old Wolf Road: This LTANKS/HIST LTANKS and SPILLS/HIST SPILLS property is located north of the Albany-Shaker Road and Old Wolf Road intersection near the I-87 Exit 4 Southbound exit ramp. A 330-gallon waste oil UST failed a tightness test on February 1, 1993 (Spill No. 9212441). The spill was issued regulatory closure with a meets standards designation on November 3, 1993. Gasoline-impacted soil was reported at the property on January 12, 1999 (Spill No. 9813073). This was associated with the December 1998 removal of a 10,000-gallon gasoline UST at this property. excavation was performed and subsequent soil and groundwater testing revealed "slight" exceedences for groundwater. The spill was issued regulatory closure with a does not meet standards designation on May 25, 2005. An employee of Atlantic Detroit Diesel reported the on-going discharge of waste oil, antifreeze, and transmission fluid to the oil water separator system at this property (Spill No. 0501750). The separator system did not reportedly function properly and the contents discharged to the storm water system. A NYSDEC inspection at the property revealed no issues and referred the matter to the Town of Colonie sewer department. The spill was issued regulatory closure with a meets standards designation on May 25, 2005. A routine NYSDEC inspection revealed an oil spill on the floor from an AST on March 1, 2006 (Spill No. 0513766). The spill was issued regulatory closure with a does not meet standards designation on June 2, 2006. Based on the distance from project alternative activities, this facility is not considered a potential environmental impact.
- 3. Waste Management Pier 1 146 Wolf Road: This SPILLS/HIST SPILLS facility is located near the southern portion of the project corridor. Rupture of a hydraulic line resulted in the release of 10 gallons of hydraulic fluid on March 6, 1995 (Spill No. 9415775). NYSDEC inspection of the cleanup was deemed satisfactory. The spill was

issued regulatory closure with a meets standards designation on April 7, 1995. Based on the limited amount released and remediated status, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.

- 4. 205 Wolf Road Accident 205 Wolf Road at Turf Inn: This SPILLS/HIST SPILLS listing is located east of the project corridor. A traffic accident resulted in the release of one gallon of antifreeze on July 26, 1995 (Spill No. 9505059). The spill was remediated and issued regulatory closure with a meets standards designation on December 5, 1988. Based on the limited amount released and remediated status, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.
- 5. Leatso's Farm 216 Wolf Road: This SPILLS/HIST SPILLS property is located on the west side of Wolf Road south of the I-87 Northbound Wolf Road exit ramp. Petroleum-impacted soil and groundwater were encountered during a walk-over in the former vicinity of oil ASTs on July 13, 2001 (Spill No. 0103945). A Phase II ESA investigation revealed soil and groundwater testing results were within NYSDEC standards. The spill was issued regulatory closure with a meets standards designation on November 20, 2001. Based on the limited impact and testing results, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.
- 6. Fleet Bank Wolf Road Vapors: This SPILLS/HIST SPILLS property is indicated as close to the southern portion of the project corridor; however, no address was provided. Employees at the building reported paint fumes on November 29, 1993 (Spill No. 9310607). The NYSDEC referred to the report to the Albany County Health Department and issued regulatory closure with a meets standards designation on December 7, 1993. Based on the distance from the project corridor and limited nature of this spill, it is not considered a potential impact to the project alternative activities.

- 7. Lazare Lincoln 144 Wolf Road: This LTANKS/HIST LTANKS and SPILLS/HIST SPILLS facility is located approximately 0.08 mile south of the project corridor. Impacted soil was encountered during removal of a gasoline UST on August 19, 1993 (Spill No. 9306177). Remediation was performed and groundwater impact was "minor". The spill was issued regulatory closure with a does not meet standards designation on December 5, 1997. Impacted soil was encountered during removal of gasoline, waste oil, and lube oil USTs on September 24, 1994 (Spill No. 9408681). Groundwater monitoring wells installed at this property revealed the presence of impacted groundwater. The spill was issued regulatory closure with a does not meet standards designation on October 1, 1994. Based on the distance from the project corridor and limited nature of this spill, it is not considered a potential impact to the project alternative activities.
- 8. NiMo Transformer 4 Computer Drive: This SPILLS/HIST SPILLS property is located approximately 0.125 mile south of the project corridor. A release of non-PCB oil was discovered around a transformer on November 22, 2006 (Spill No. 0609669). The spill was remediated and issued regulatory closure with a does not meet standards designation on April 25, 2007. Based on the distance from the project corridor and limited nature of this spill, it is not considered a potential impact to the project alternative activities.
- 9. NiMo Pump Station 125 Wolf Road: This SPILLS/HIST SPILLS facility is located greater than 0.25 mile south of the project corridor. An air release of mercapton occurred on June 2, 1988 (Spill No. 8801941). The spill was issued regulatory closure with a meets standards designation on June 7, 1988. Based on the distance from the project corridor and limited nature of this spill, it is not considered a potential impact to the project alternative activities. A second spill referenced within this spill case narrative was attributed to the Hess station at 156 Wolf Road on November 1, 1996 (Spill No. 9613389). The Hess station was discussed earlier in this section.

- 10. Denooyer Chevrolet 127 Wolf Road: This SPILLS/HIST SPILLS facility is located south of the project corridor. A spill of approximately 20 gallons of gasoline from an unknown source was reported on May 13, 2002 (Spill No. 0201594). The rain reportedly washed away the gasoline. The spill was issued regulatory closure with a meets standards designation on September 3, 2002. A release of gasoline associated with a leaking pump was reported October 18, 1994 (Spill No. 9409603). Remediation was performed and the spill was issued regulatory closure with a meets standards designation on August 10, 2005. Based on the distance from the project corridor and limited nature of these spills, they are not considered a potential impact to the project alternative activities.
- 11. Sherman (Sherwin) Williams Store 130 Wolf Road: This SPILLS property is located approximately 0.2 mile south of the project corridor. Soil contamination was encountered during removal of a 3,000-gallon fuel oil UST on February 6, 2002 (Spill No. 0110620). The spill was remediated and issued regulatory closure with a does not meet standards designation on June 27, 2002. Soil contamination was encountered during removal of a solvent and thinner spill containment concrete tank on February 7, 2002 (Spill No. 0110658). Impacted soil was excavated and disposed. The spill was issued regulatory closure with a meets standards designation on September 3, 2002. Based on the distance from the project corridor and limited nature of these spills, they are not considered a potential impact to the project alternative activities.

- 12. BFI Truck Computer Drive Parking Lot 15 Computer Drive: This SPILLS/HIST SPILLS property is located approximately 0.10 mile west of the project corridor. Failure of a commercial vehicle hydraulic hose resulted in the release of 15 gallons of hydraulic oil on March 14, 2006 (Spill No. 0514277). The spill was remediated and was issued regulatory closure with a does not meet standards designation on March 14, 2006. Based on the distance from the project corridor, limited quantity released, and surficial nature of this spill, it is not considered a potential impact to the project alternative activities.
- 13. Rymanowski Residence 5 Compass Court: This property is located approximately 0.19 mile west of the project corridor in a residential neighborhood. A 15-gallon waste oil drum was reported at this property on July 8, 1995 (Spill No. 9504237). The drum was disposed and the spill was issued regulatory closure with a meets standards designation on July 19, 1995. Based on the distance from the project corridor and limited nature of this spill, it is not considered a potential impact to the project alternative activities.
- 14. Colonie Library 629 Albany-Shaker Road: This property located approximately 0.09 mile east of the Albany-Shaker Road Wolf Road intersection is listed as a LTANKS/HIST LTANKS facility. Impacted soil was encountered during a 4,000-gallon No. 2 fuel oil UST on October 18, 1989 (Spill No. 8907090). Impacted soil was excavated and subsequent testing of soil revealed no detectable concentrations. The Spill was issued regulatory closure with a meets standards designation on May 4, 1990. Based on the remediated status and distance from the project corridor, this property is not a potential environmental concern. Based on the distance from the project corridor and limited nature of this spill, it is not considered a potential impact to the project alternative activities.

- 15. Colonie Athletic Club 636 Albany-Shaker Road: This SPILLS/HIST SPILLS property is located approximately 0.1 mile east of the Albany-Shaker Road and Wolf Road intersection. Discarded duct insulation suspected to contain asbestos was reported on October 1, 1993 (Spill No. 9308014). The spill was referred to NYSDEC Solid Waste and issued regulatory closure by the Spills unit on October 15, 1993. Based on the type of material spilled and remediated status, this SPILLS/HIST SPILLS is not a potential environmental impact.
- **Rushmore and Weber (aka Sunbelt Rentals) 272 Wolf Road:** This property, located approximately 0.09 mile northwest of the project corridor, is listed on the LTANKS, HIST LTANKS, UST, HIST UST, RCRA NonGen, SPILLS, and HIST SPILLS databases. Impacted soil was encountered during lube oil, diesel, and gasoline UST removals at this property on October 1, 1993 (Spill No. 9308022). The impact was remediated and issued regulatory closure with a meets standards designation on February 6, 1995. A leak of diesel fuel from a faulty valve was discovered on January 13, 2009 (Spill No. 0811298). The valve was repaired and the release remediated. The spill was issued regulatory closure with a does not meet standards designation on February 12, 2009. Based on the proximity to the project corridor this property is not a potential to impact project alternative activities.
- approximately 0.11 mile northwest of the project corridor. Three (3) 55-gallon drums were reported on this property on May 10, 1988 (Spills No. 8801260). The contents were determined to be kerosene and the contents were disposed. The spill was issued regulatory closure with a meets designation on May 13, 1988. Based on the absence of a release and regulatory resolution, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.
- **18. Ronald Durante/Smith Tran Terminal Drive:** This LTANKS/HIST LTANKS facility is located greater than 0.11 mile northwest west of the I-87 Exit 4 Southbound

exit ramp and Old Wolf Road. Impacted soil was encountered during diesel fuel UST removal at this property on October 17, 1988 (Spill No. 8806058). Groundwater was indicated as impacted. Remediation was performed and the spill was issued regulatory closure with a meets standards designation on October 17, 1988. Based on the proximity to the project corridor this property is not a potential to impact project alternative activities.

- 19. American Freightway 4 Terminal Drive: This SPILLS/HIST SPILLS facility is located greater than 0.11 mile northwest west of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road. A broken fuel nozzle caused a surficial spill of approximately 10 gallons of diesel fuel on February 20, 2001 (Spill No. 0012464 and 0012463). The spill (reported twice and issued two (2) spill numbers) was remediated and issued regulatory closure with a meets standards designation on April 13, 2001. Based on the limited quantity spilled, surficial nature of the release, and remediated status, this SPILLS/HIST SPILLS listings are not considered a potential environmental impact to the project alternative activities.
- 20. MLB Industries, Inc. 3 Northway Lane: This SPILLS/HIST SPILLS facility is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road. Impacted soil was encountered near an old tank excavation on October 22, 2001 (Spill No. 0107771). Three (3) gasoline USTs formerly filled with sand were removed along with 450 tons of impacted soil. Subsequent testing revealed the presence of "minor soil and groundwater contamination". The spill was issued regulatory closure with a does not meet standards designation on February 27, 2002. Based on the distance from the project corridor and "minor" soil and groundwater contamination identified, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.
- **21. MacFarland 4 Northway Lane:** This SPILLS/HIST SPILLS facility is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road. The

fire department reported leaking drums, poor housekeeping, ASTs, and USTs on June 3, 1991 (Spill No. 9200241). A subsequent inspection by NYSDEC in January 2008 revealed none of the previous issues. Residual contamination may exist on the property but NYSDEC was not concerned with residual contamination. Therefore, the spill was issued regulatory closure with a does not meet designation on January 14, 2008. Based on the distance from the project corridor and residual contamination identified, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.

- 22. Harper Property 5 Northway Lane: This LTANKS/HIST LTANKS facility is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road. Impacted soil was encountered during removal of a 1,000-gallon gasoline UST on June 29, 1989 (Spill No. 8904181). Extensive groundwater contamination was identified. Impacted soil was removed and disposed and the spill was issued regulatory closure with a meets standards designation on June 29, 1989. Based on the distance from the project corridor, this LTANKS/HIST LTANKS listing is not considered a potential environmental impact to the project alternative activities.
- 23. NiMo Backhoe Drum (aka MK Engine Systems) 6 Northway Lane: This SPILLS/HIST SPILLS facility is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road. A seal break on a test cell resulted in a spill of 15 gallons of waste oil on September 15, 1995 (Spill No. 9507376). The spill was remediated and issued a meets standards designation on September 21, 1995. A NiMo backhoe overturned a 55-gallon waste oil drum on January 21, 1997 (Spill No. 9612534). The spill was remediated and issued regulatory closure with a does not meet standards designation on January 21, 1997. Based on the distance from the project corridor and remediated status, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.

- 24. St. Johnsbury/Lyons Trucking/Sulzer Turbo/Turbo Systems – 7-9 Northway Lane: This SHWS, VAPOR REOPENED, LTANKS/HIST LTANKS, and SPILLS/HIST SPILLS facility is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road intersection. Releases from drums containing chlorinated solvents impacted soil and groundwater at this property (Site ID No. 401038). The source of contaminants was removed and residual groundwater contamination remained. NYSDEC requires that a vapor intrusion study be performed to further evaluate impacts. Gasoline impacted soil was encountered during UST removal on October 1, 1986 (Spill No. 8604254). A release of 10 gallons of gasoline was indicated and groundwater impact was confirmed. The release was remediated and the spill was issued regulatory closure with a meets standards designation on March 31, 1987. Dumping of a 55-gallon drum into a storm sewer was reported on May 11, 1988 (Spill No. 8801295). Remediation of the storm sewer and nearby wetland was performed. The spill was issued regulatory closure with a meets standards designation on December 10, 1988. Impacted soil was discovered beneath a 275-gallon waste oil AST during removal of USTs on April 6, 1992 (Spill No. 9200206). The impacted soil was removed and the spill was issued regulatory closure with a meets standards designation on October 7, 1992. Petroleum-impacted soil was encountered during performance of a site investigation for a prospective buyer on June 25, 1996 (Spill No. 9604075). Impacted soil was excavated, stockpiled, and later disposed. The spill was remediated and issued regulatory closure with a does not meet standards designation on January 5, 2001. Based on the distance from the project corridor, this SHWS, VAPOR REOPENED, LTANKS/HIST LTANKS, and SPILLS/HIST SPILLS facility is not considered a potential environmental impact to the project corridor activities.
- 25. Federal Express 8 Northway Lane: This SPILLS/HIST SPILLS property is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road intersection. Gasoline-impacted soil was discovered during UST removal on October 31, 1988 (Spill No. 8806827). Impacted soil was removed and disposed. Installation and testing of groundwater monitoring wells revealed no issues. The spill

was issued regulatory closure with a meets standards designation on November 23, 1988. Based on the distance from the project corridor, remedial status, and absence of groundwater impact, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.

- 26. Crown Enterprises 10 Northway Lane: This SPILLS/HIST SPILLS property is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road intersection. Gasoline-impacted soil was encountered during diesel fuel and gasoline UST removals on February 22, 1995 (Spill No. 9415293). Free product was detected on the groundwater surface. Subsequent testing showed "minor exceedences" of several compounds. Therefore, the spill was issued regulatory closure with a does not meet standards designation on June 6, 2001. Based on the distance from the project corridor and remedial status, this SPILLS/HIST SPILLS listing is not considered a potential environmental impact to the project alternative activities.
- 27. Blue Line Express (aka Birman) 16 Northway Lane: This SPILLS/HIST SPILLS property is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road intersection. A release of approximately 35 gallons of diesel fuel was reported on August 11, 1988 (Spill No. 8804166). Impacted soil was removed and disposed. The spill was issued regulatory closure with a meets standards designation on January 17, 1989. Evidence of an older spill was discovered during Spill No. 8804166 remediation on August 29, 1988 (Spill No. 8804758). The impacted soil was removed and the spill was issued regulatory closure with a meets standards designation on August 10, 1990. Based on the distance from the project corridor and remediated status of the spills, this SPILLS/HIST SPILLS facility is not considered a potential environmental impact to the project alternative activities.
- 28. NiMo 292 Wolf Road: This SPILLS/HIST SPILLS incident is located approximately 500 feet northwest of the project corridor. A traffic accident resulted in the collapse of a telephone pole and attached transformer on April 24, 1997 (Spill No. 9701052).

Transformer fluid was released. The spill was remediated and issued regulatory closure April 24, 1997. Based on the distance from the project corridor and surficial nature and limited quantity of the release, this SPILLS/HIST SPILLS incident is not considered a potential environmental impact to the project alternative activities.

29. Colonie Police Department (aka Latham Water District) – 312 Wolf Road: This HIST LTANKS, UST/HIST UST, and SPILLS/HIST SPILLS property is located greater than 0.125 mile north of the I-87 Exit 4 Southbound exit ramp and Old Wolf Road intersection. Impacted soil was encountered during the removal of a 1,000-gallon diesel fuel UST on April 5, 1990 (Spill No. 9000404). The impacted soil was excavated and disposed. The spill was issued regulatory closure with a meets standards designation on June 6, 1990. A small amount of gasoline-impacted soil was discovered during a UST removal on September 19, 1992 (Spill No. 9206986). The spill was remediated and issued regulatory closure with a meets standards designation on September 22, 1992. A release of gasoline occurred during a tank fill up on June 13, 1994 (Spill No. 9403492). The spill was remediated and issued regulatory closure with a meets standards designation on June 28, 1994. A malfunctioning gasoline pump caused the spill of 10 gallons of gasoline on December 16, 1996 (Spill No. 9611362). The release was remediated and the spill was issued regulatory closure on December 16, 1996. An overfill by a fueling truck resulted in the spill of 25-30 gallons of gasoline on October 23, 1999 (Spill No. 9908968). The spill was remediated and issued regulatory closure with a does not meet standards designation on October 28, 1999. A release from a transformer occurred on May 7, 2000 (Spill No. 0001530). The spill was remediated and issued regulatory closure on May 11, 2000. A crack in the hydraulic elevator piston resulted in the release of hydraulic oil to the elevator casing on January 31, 2001 (Spill No. 0011743). The spill was remediated and issued regulatory closure with a meets standards designation on October 15, 2001. Based on the distance from the project corridor, this HIST LTANKS, UST/HIST UST, and SPILLS/HIST SPILLS property is not considered a potential environmental impact to the project alternative activities.

30. NYSDOT - Rt 155 at I-87 Watervliet Shaker Road: This HIST LTANKS, UST/HIST UST, and SPILLS/HIST SPILLS property is located immediately east of the I-87 Exit 5 Northbound exit ramp. A tank test failure which resulted in Spill No. 8801229 was issued on May 9, 1988 and closed on March 22, 1989 meeting cleanup standards. A second tank failure which resulted in Spill No. 9106238 was issued on September 10, 1991 and closed on September 3, 1992 meeting cleanup standards. As a result of a third tank test failure Spill No. 9212301 was issued January 28, 1993 and impacted soil was discovered during the removal of on-site underground storage tanks. Subsequent remedial work was performed however Spill No. 9212301 remains open. Based on the distance from the project corridor, this HIST LTANKS, UST/HIST UST, and SPILLS/HIST SPILLS property is not considered a potential environmental impact to the project alternative activities.

3.2.3 Orphan Listings

The orphan listings consist of database sites that were not able to be mapped due to poor or inadequate address information. After a review of available information on the EDR web-portal it was determined that none of the orphan listings were determined to be within the respective AMSDs and/or search distances.

3.3 FIELD INSPECTION

SCE representatives performed project corridor reconnaissance on November 1-3, 2010, January 28, 2011, and on April 18, 2013. Observations during the project corridor visits are summarized in the table below. A discussion of each observed item as well as a conclusion of the potential environmental impact to the project corridor follows the table.

PROJECT CORRIDOR OBSERVATIONS SUMMARY

DESCRIPTION	OBSERVED	NOT OBSERVED	NOT APPLICABLE
Hazardous Substances and Petroleum Products in			
Connection with Identified Uses	$\sqrt{}$		
Storage Tanks	$\sqrt{}$		
Odors			
Pools of Liquid			
Drums			
Hazardous Substance and Petroleum Products Containers			
(Not Necessarily in Connection with Identified Uses)		$\sqrt{}$	
Unidentified Substance Containers			
Polychlorinated Biphenyls (PCBs)			
Heating/Cooling			$\sqrt{}$
Stains or Corrosion			
Drains and Sumps		$\sqrt{}$	
Pits, Ponds, or Lagoons		$\sqrt{}$	
Stained Soil or Pavement		$\sqrt{}$	
Stressed Vegetation			
Fill Material of unknown origin			
Solid Waste	√		
Waste Water		√	
Wells	√		
Septic Systems			

Hazardous Substances and Petroleum Products: Active gasoline services stations utilizing petroleum USTs are located at 156 Wolf Road and 656 Albany-Shaker Road.

Storage Tanks: Active gasoline services stations utilizing petroleum USTs are located at 156 Wolf Road and 656 Albany-Shaker Road. ASTs were observed in use on the west side of the Sunbelt Rental building (272 Wolf Road) and the northwest side of the Albany Park N Fly building (264 Wolf Road).

Drums: Approximately 36 drums were observed northwest of the Latham Construction building (271 Wolf Road). The contents were not determined. Many of drums were observed to be in poor condition with bulging and ruptured tops/bottoms. Spills on the ground surface were not evaluated due snow and frozen ground. SCE notified the NYSDEC Region 4 Division of Environmental Remediation of the drums. A total of three (3) 55-gallon metal drums were

observed on the SUNOCO property at 656 Albany-Shaker Road. These drums were observed from the NYSDOT right-of-way at the east side of I-87 Northbound. Staining or impacted vegetation was not observed around these drums and they appeared empty. SCE staff familiar with the area had also observed drums to be present in the past at the Hess station, located near a storage shed. Staining or impacted vegetation was not observed around these drums. Based on the absence of staining or evidence of releases, these drums do not appear to be a potential impact to the project corridor. However, any drums present at the time of construction activities should be disposed in accordance with applicable regulations.

Fill Material: Fill material of unknown origin was observed at 680 Albany-Shaker Road where numerous piles of soil have been staged. Fill material and miscellaneous construction and demolition (C&D) materials are also staged on land owned by New York State west of 158-170 Wolf Road. Fill material at this property varied from crushed asphalt, soil piles, stumps and gravel apparently from local NYSDOT projects. C&D materials are discussed below as solid waste.

Solid Waste: Solid waste observed throughout the project corridor consisted of discarded debris and trash. C&D materials were observed staged in the wooded property west of the Courtyard by Marriott property (160 Wolf Road). C&D materials consisted of asphalt, concrete debris, concrete culvert piping, metal piping, roofing, and miscellaneous items. Discarded asphalt roofing was observed east of the I-87 Northbound lane between Albany-Shaker Road and the exit ramp to Wolf Road. A discarded refrigerator was observed in the field area near I-87 Southbound and the rear of the 660 Albany-Shaker Road Desmond Albany Hotel property. Metal pipe sections were observed in the field area north of the 200 Sunset Boulevard property and east of I-87.

PCBs: Pole-mounted and pad-mounted transformers are located along Albany-Shaker Road and Wolf Road. PCB content of these transformers was not determined. Obvious leaks or stained soils were not observed, but close inspection of these transformers was not conducted.

Wells: Groundwater monitoring wells were observed on the SUNOCO property at 656 Albany-Shaker Road and Hess Station at 156 Wolf Road. These properties have had multiple SPILLS listed and represent a potential environmental impact to the project corridor activities as discussed previously in Section 3.2.1. SCE staff familiar with the area also noted that groundwater wells were at one time present in the parking lot west of the Desmond Albany Hotel and in the Entenmanns parking lot at 240-242 Wolf Road.

4.0 CONCLUSIONS AND RECOMMENDATIONS

SCE has performed a HW/CM Screening Assessment of the project corridor along I-87, Wolf Road, Albany-Shaker Road, and Old Wolf Road in the Town of Colonie, Albany County, New York. Limitations regarding this scope of work are described in Section 5.0 of this report. This HW/CM Screening has revealed the following potential areas of environmental concern (AOC) in connection with the alternatives proposed:

4.1 DIAMOND ALTERNATIVE

POTENTIAL AOC	ADDRESS	DESCRIPTION	POTENTIAL MEDIA IMPACTED	COMMENTS
The Desmond Albany Hotel	660-668 Albany- Shaker Road	Former fuel company, UST, documented releases	Soil, Groundwater	Construction activities at some locations on or along this property could contact impacted soil and/or groundwater
Hess Station	156 Wolf Road	Existing gasoline service station, USTs, documented releases	Soil, Groundwater	Construction activities at or adjoining this property could contact impacted soil and/or groundwater
Dominion Transmission	154 Wolf Road	Hazardous waste generator facility		Construction activities at this property could contact impacted media
Cerone Construction	200 Sunset Boulevard	Former USTs, documented releases, potential fill area	Soil, Groundwater	Construction activities at this property could contact impacted soil and/or groundwater
NYS Land	West of 158-170 Wolf Road	Fill area, C&D material staging		Construction activities at this property could contact fill and C&D material

Strip property acquisitions and expanded road rights-of-way are anticipated along portion of Wolf Road and Albany-Shaker Road. Acquisition of the Hess Mart gasoline station property at 156 Wolf Road and Cerone Construction at 200 Sunset Boulevard is proposed. Subsurface excavations for roadway and utility improvements are anticipated along Albany-Shaker Road west of Old Wolf Road, at the Wolf Road and Metro Park Road intersection and along the proposed I-87 highway and auxiliary lanes. The connector road from the Diamond Alternative will extend through wooded and agricultural land owned by the Albany County Airport

Authority and in close proximity to the Cerone Construction property at 200 Sunset Boulevard. The connector road between the Diamond Alternative and Wolf Road will extend through New York State land, Town of Colonie land, and the Hess Mart property at 156 Wolf Road. Screening for unregistered USTs using geophysical methods appears warranted at the AOCs where former or current UST use was indicated in the historical review. Subsurface investigation consisting of soil and groundwater sampling appears warranted at each AOC listed above prior to the construction phase of this project. The subsurface sampling results will be used to evaluate potential worker exposure to impacted media, and to determine if special material handling and disposal is required.

This alternative would include partial or full demolition of the existing Hess Mart gasoline service station structure at 156 Wolf Road and demolition of the Cerone Construction building at 200 Sunset Boulevard. Two (2) buildings located at the corner of the connector road and Albany-Shaker Road have already been demolished. Handling and disposal of C&D materials located on the New York State land may also be required. A site specific investigation would need to be performed to identify potential hazardous materials/hazardous substances associated with properties planned for acquisition and demolition. This investigation would include but not be limited to asbestos, PCBs, ASTs, USTs, septic systems and other discharges at the properties. This HW/CM screening revealed no AOCs associated with the I-87 bridges over Albany-Shaker Road (asbestos screening is the subject of a separate report).

4.2 FLYOVER ALTERNATIVE

POTENTIAL AOC	ADDRESS	DESCRIPTION	POTENTIAL MEDIA IMPACTED	COMMENTS
Entenmann's	242 Wolf Road	Former gasoline service station, UST facility	Soil, Groundwater	Construction activities at or adjoining this property could contact impacted soil and/or groundwater
SUNOCO	656 Albany-Shaker Road	Existing gasoline service station, UST facility	Soil, Groundwater	Construction activities at or adjoining this property could contact impacted soil and/or groundwater

POTENTIAL AOC	ADDRESS	DESCRIPTION	POTENTIAL MEDIA IMPACTED	COMMENTS
The Desmond Albany Hotel	660-668 Albany- Shaker Road	Former fuel company, UST, Spills listings	Soil, Groundwater	Construction activities at some locations along or on this property could contact impacted soil and/or
Avis Rental Car	674-676 Albany- Shaker Road	Former UST and fuel facility, Spills listings	Soil, Groundwater	groundwater Construction activities at or adjoining this property could contact impacted soil and/or groundwater
Fill Area	680 Albany-Shaker Road	Fill pile of unknown origin		Construction activities at this property could contact fill material
Latham Construction	271 Wolf Road	Spill Listings, former UST systems, outside drum storage	Soil, Groundwater	Construction activities at or adjoining this property could contact impacted soil and/or groundwater
Cerone Construction	200 Sunset Boulevard	Former USTs, documented releases, potential fill area	Soil, Groundwater	Construction activities at this property could contact impacted soil and/or groundwater

Strip property acquisitions and expanded road rights-of-way are anticipated along portion of Wolf Road and Albany-Shaker Road. Subsurface excavations for roadway and utility improvements are anticipated along Albany-Shaker Road west of Old Wolf Road and along the proposed I-87 auxiliary lanes. Screening for unregistered USTs using geophysical methods appears warranted at the AOCs where former or current UST use was indicated in the historical review. Subsurface investigation consisting of soil and groundwater sampling appears warranted at each AOC listed above prior to the construction phase of this project. The subsurface sampling results will be used to evaluate potential worker exposure to impacted media, and to determine if special material handling and disposal is required.

Two (2) buildings at the proposed intersection with ramps and Albany-Shaker Road have already been demolished. Site specific investigations would need to be performed to identify potential hazardous materials/hazardous substances associated with these properties. These investigations would include but not be limited to PCBs, ASTs, USTs, septic systems, and other discharges at these properties. This HW/CM screening revealed no AOCs associated with the I-87 bridges over Albany-Shaker Road (asbestos screening is the subject of a separate report).

5.0 LIMITATIONS

The purpose of an environmental assessment is to reasonably evaluate the potential for or actual impact of past practices on a given project corridor area. In performing an environmental assessment, it is understood that a balance must be struck between a reasonable inquiry into the environmental issues and an exhaustive analysis of each conceivable issue of potential concern. The following paragraphs discuss the assumptions and parameters under which such an assessment (which may include professional opinions) is conducted.

Historic data failure was encountered in this Phase I ESA. Historic data gaps with unconfirmed land use occurred in excess of the 5-year interval ASTM requirement. However, since land use at several specific commercial properties along the project alternatives have already been deemed a REC, this historic data failure is not expected to significantly impact the conclusions or recommendations of this report.

No investigation is thorough enough to absolutely rule out the presence of hazardous materials in a given project corridor area. If hazardous conditions have not been identified during the assessment, such a finding should not; therefore, be construed as a guarantee of the absence of such materials in the project corridor, but rather as the result of the services performed within the scope, limitations, and cost of the work performed.


Environmental conditions may exist in the project corridor that cannot be identified by visual observation. Where subsurface work was performed, professional opinions are based in part on interpretation of data from discrete sampling locations that may not represent actual conditions at unsampled locations.

Except where there have been expressed areas of concern, or where specific environmental contaminants have been previously reported by others, naturally occurring toxic substances, potential environmental contaminants inside buildings, or contaminant concentrations that are not of current environmental concern, may not be reflected in this document.

Where the scope of services is limited to interview and/or review of readily available reports and literature, any conclusions and/or recommendations are necessarily based largely on information supplied by others, the accuracy or sufficiency of which may not be independently reviewed.

Any opinions and/or recommendations presented apply to project corridor conditions existing at the time of this screening.

FIGURES

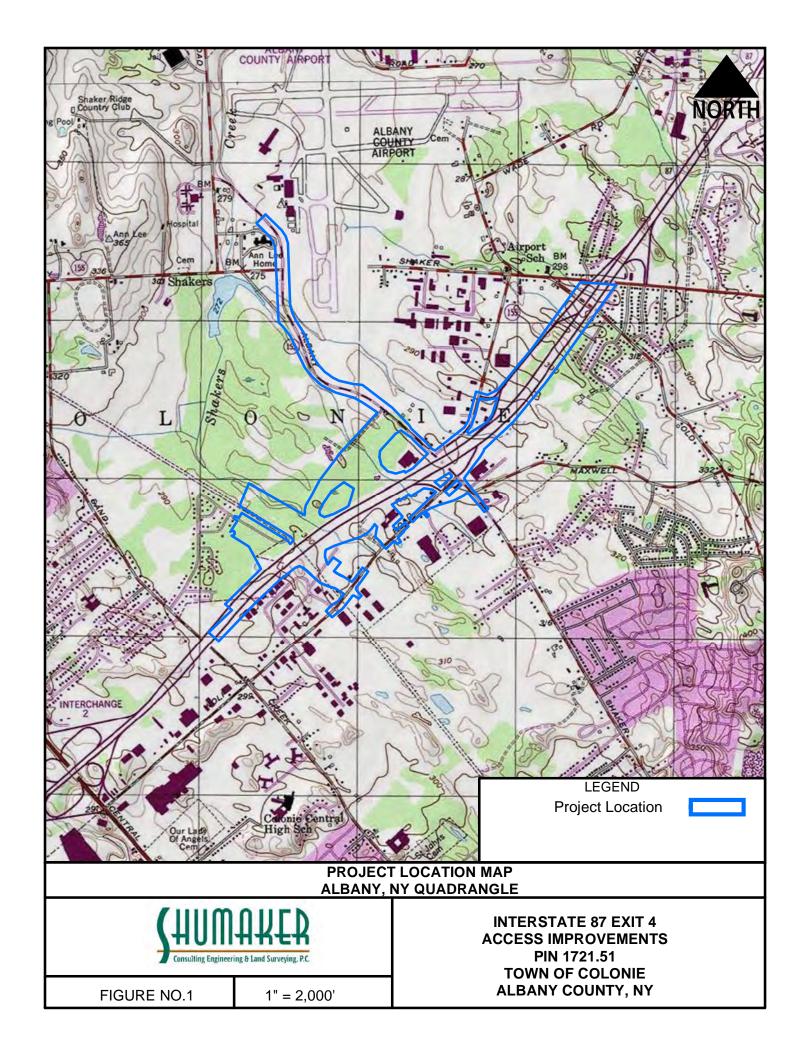



SITE SCHEMATIC DIAMOND ALTERNATIVE

INTERSTATE 87 EXIT 44
ACCESS IMPROVEMENTS
NYSBOT PIN: 1721.51






ACCESS IMPROVEMENTS
NYSDOT PIN: 1721.51



2B

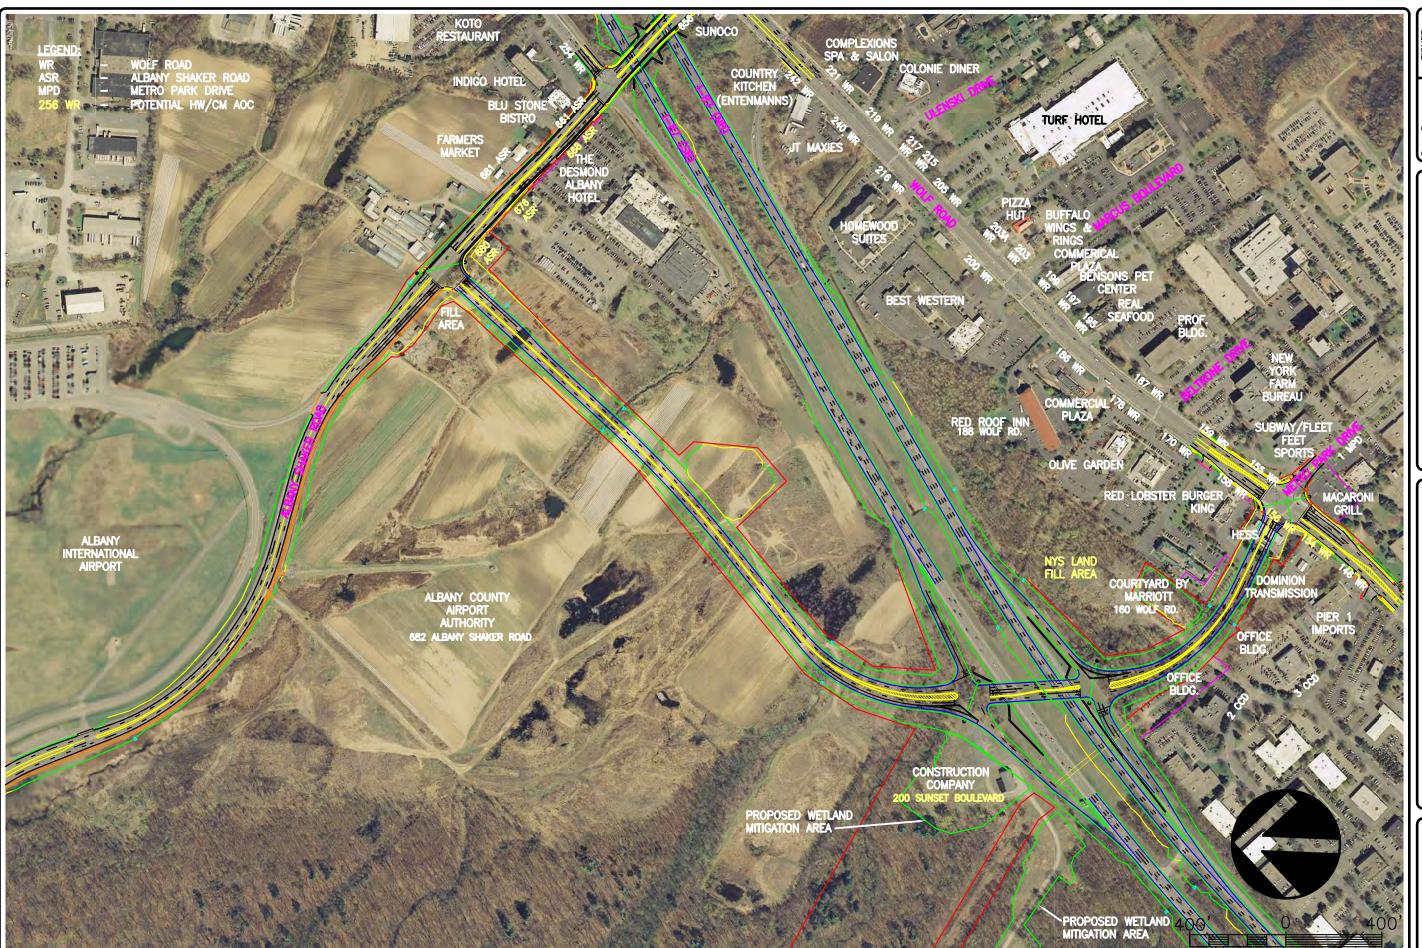


POTENTIAL HW/CM AREAS OF CONCERN (AOC) DIAMOND ALTERNATIVE

3A

INTERSTATE 87 EXIT 4 ACCESS IMPROVEMENTS NYSDOT PIN: 1721.51

Consulting Engineering & Lead Streeping Red.

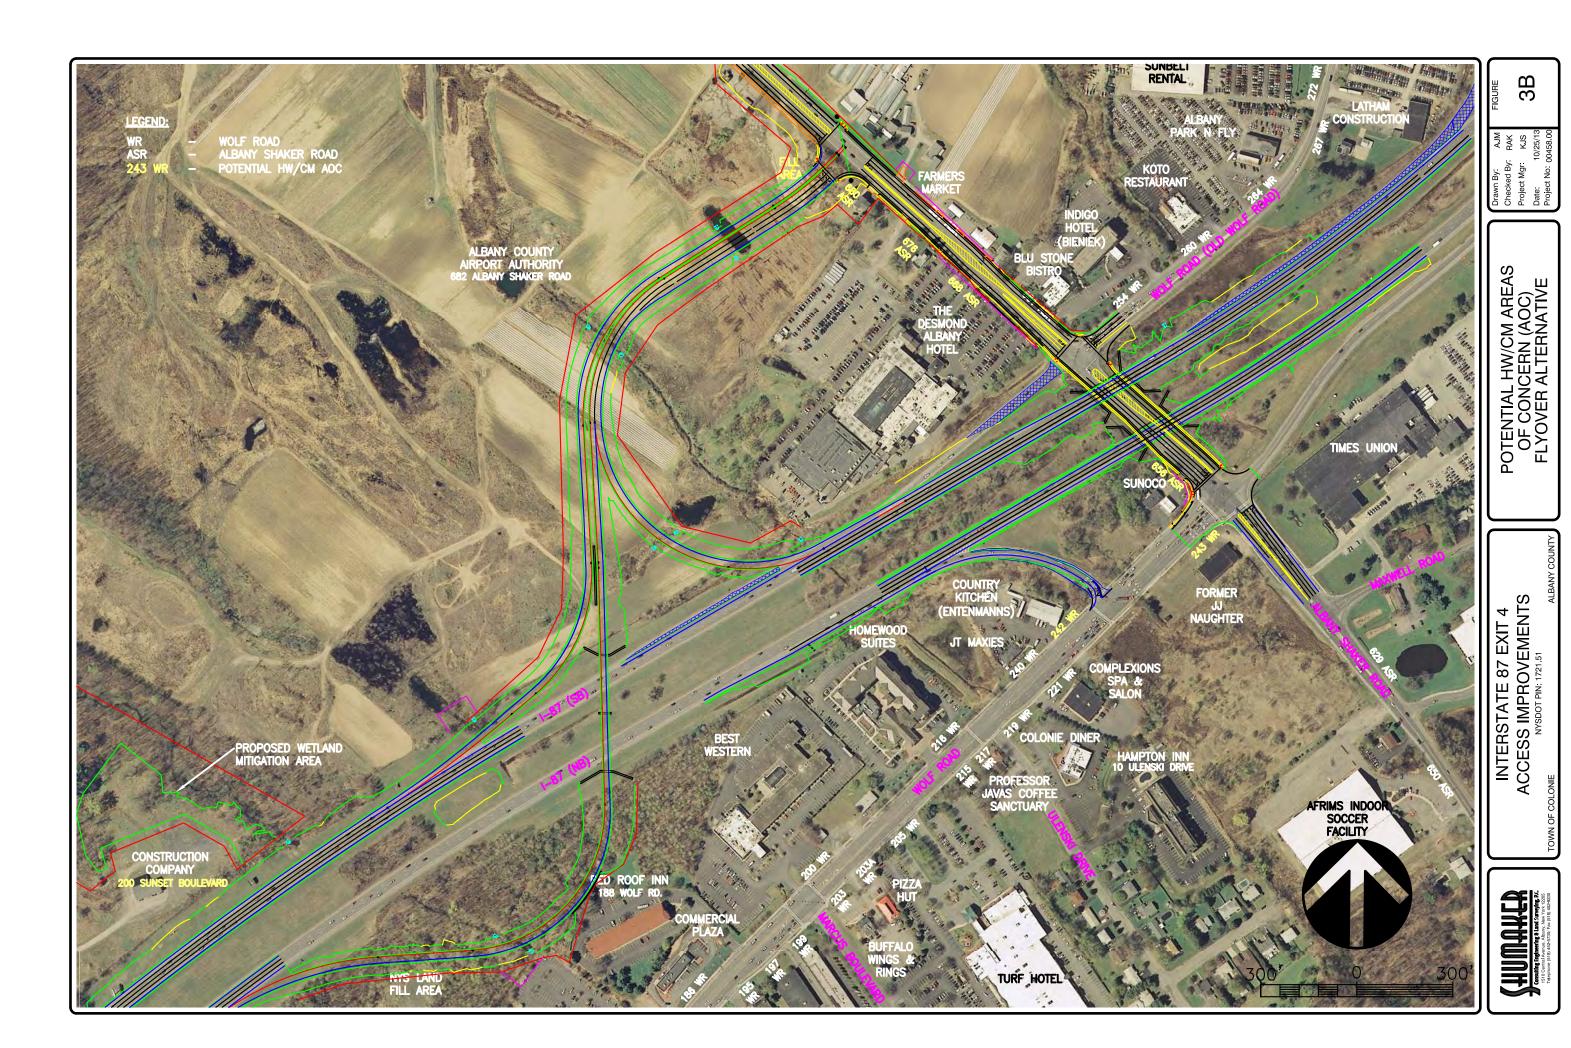


POTENTIAL HW/CM AREAS OF CONCERN (AOC) DIAMOND ALTERNATIVE


INTERSTATE 87 EXIT 4
ACCESS IMPROVEMENTS
NYSDOT PIN: 1721.51




APPENDIX A

HISTORICAL MAPS

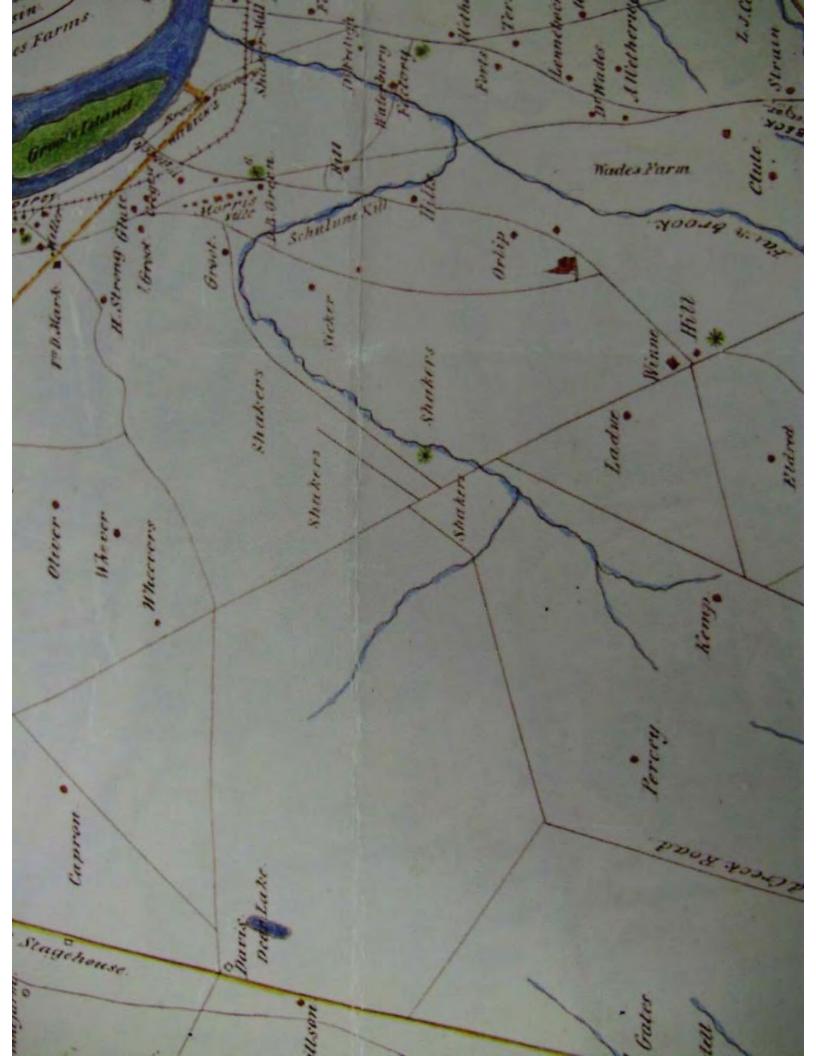


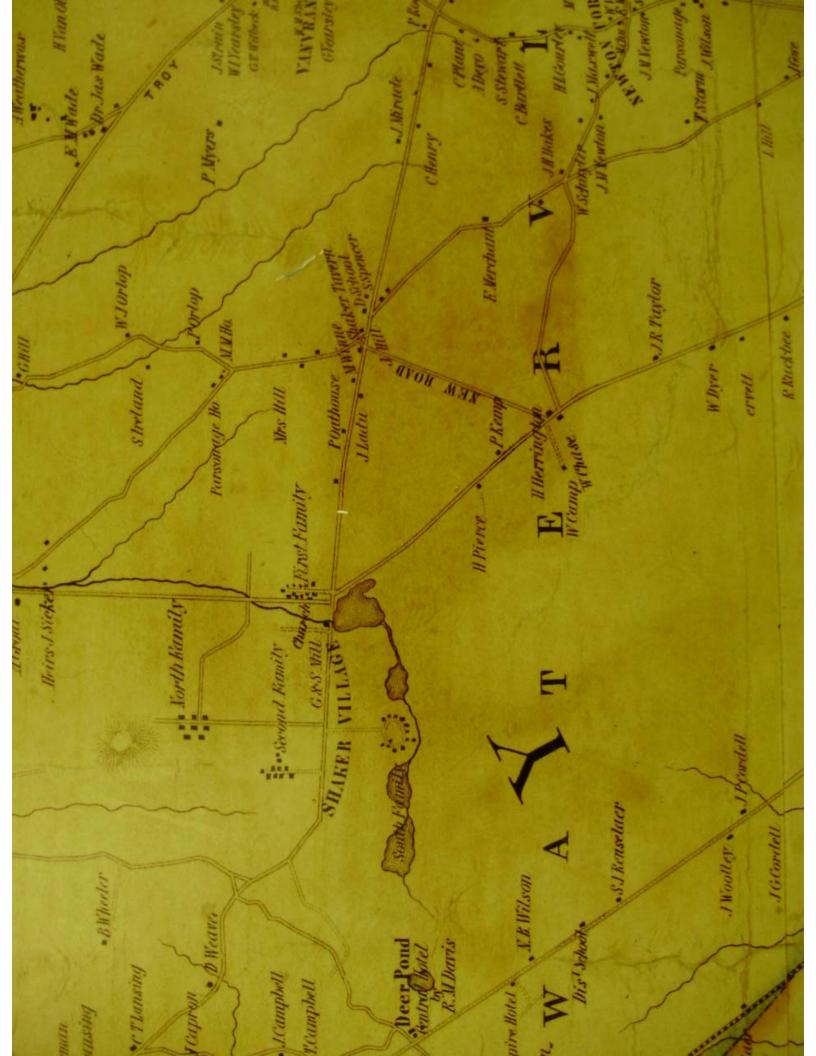

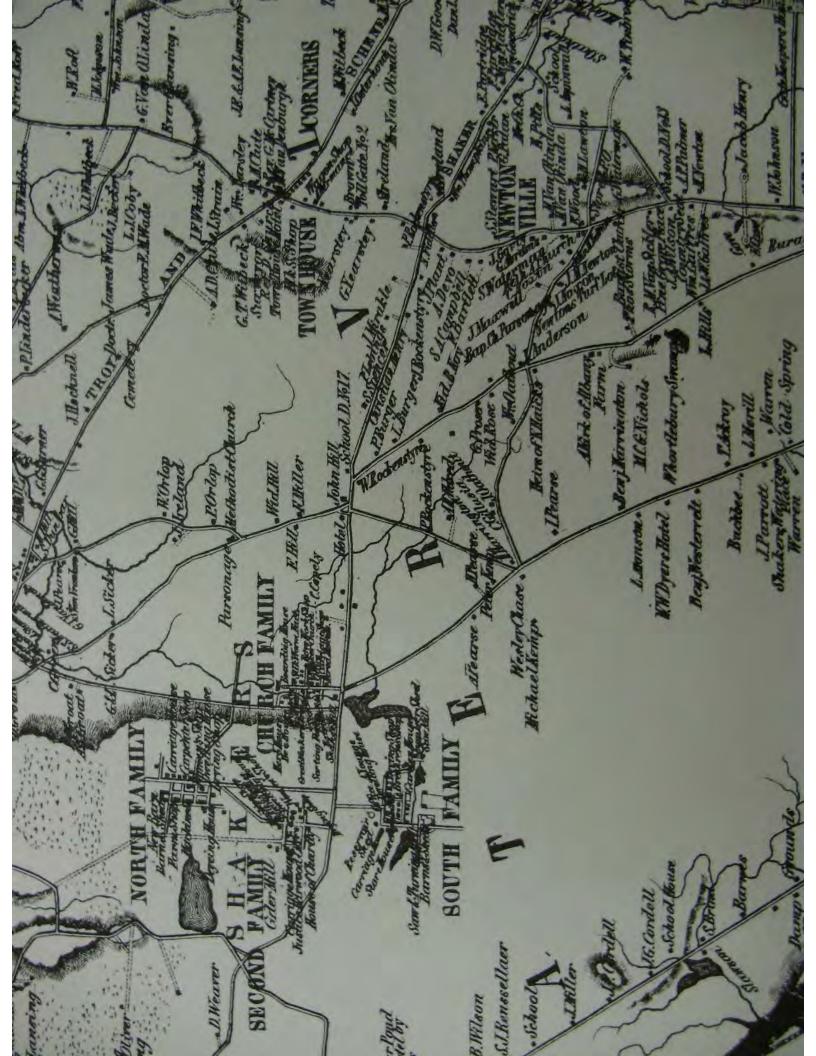

2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
enkes EFondo
J. Sweadland J. Sweadland Orlop Or
Service Condition of the Condition of th
36 25 36 3
SERSE BLE CHE STATE TO
Shakers Shakers KIreland J. W. Orlop Tamily Tamily Tames N. L. Barger N. L. Ames N. L. Ames Thues N. L. Ames Thues Wither Boy Relation ANIadh Shaker Bot ell JHIII Shaker Boy Cramer Frond N. L. Allanein N. L. Allanein Shaker Boy Cramer Allanein N. L. Allanein N.
2 4 H 2 K 2 B 2 C 3 E 2 B 3 C
Shakers KIroland And Hamily Cem Right of An Anthein Shaker Hot el Caller Shaker Hot el J. Cent. Shaker Hot el J. Cram. Withe ck. J. Cram. Wither Shaker Hot el J. Cram. See Harring ton Right of Miller St. Hamila ton Ri
The control of the co
まる。 一般を一番を一番を では、 では、 これ
8 60 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6 6
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
Shakers Kring Krin
Shakes Sh
3 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5 5
The state of the s
► 7 5 3 3 3 4 H
1
M. Young Willer States Willing States of Manual States of
A STATE
reting B.S.
H. Week, St. Co. Co. Co. Co. Co. Co. Co. Co. Co. Co
Sourchine Shares
1 2 3 2 2 2 2 1 1 1 1 1 1 1 1 1 1 1 1 1
3/2 3/2
2 6 12 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
"gh Manggan and Ma
2 2 2 2
2:4 3
2 2 2 3 3 .tady
Brown amp SH.No.24 S
Brown amp sing Crep Care Sering S. H.N. S. H.N



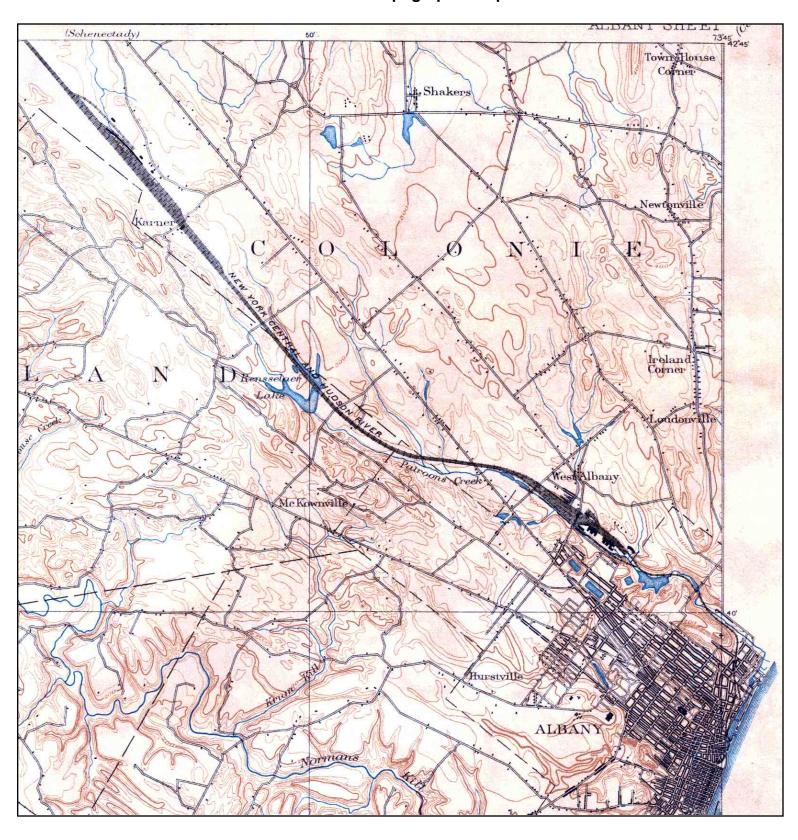



TARGET QUAD NAME: ALBANY


MAP YEAR: 1898

SERIES: 15 SCALE: 1:62500 SITE NAME: I-87 Exit 3 Airport

Connector

ADDRESS: Exit 3

Albany, NY 12205 LAT/LONG: 42.7268 / 73.7988 CLIENT: Shumaker Cons. Engineering

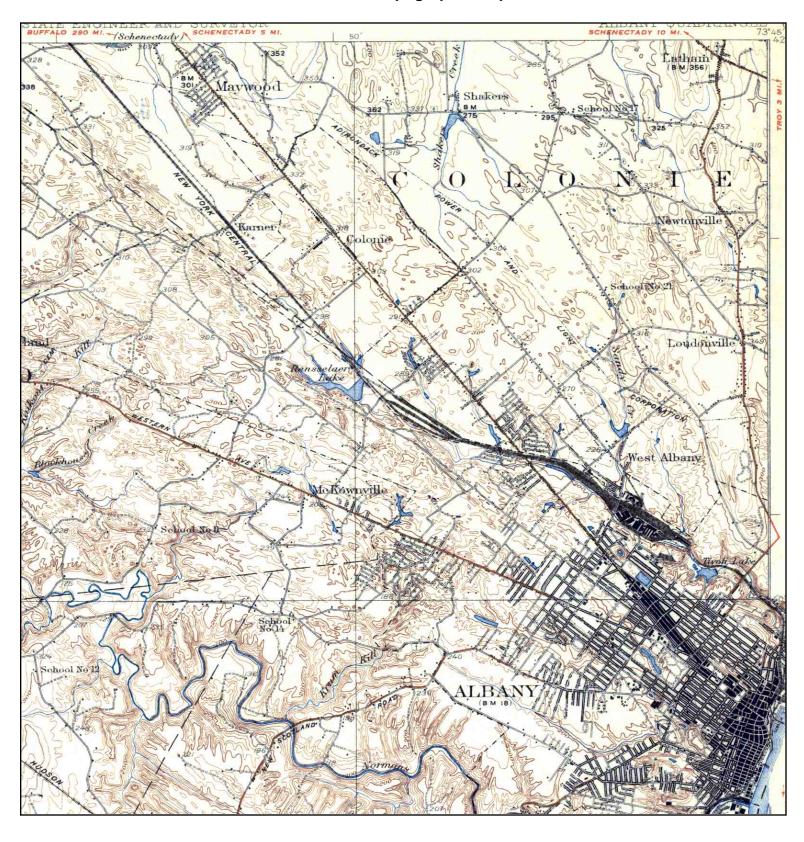

N

TARGET QUAD NAME: ALBANY


MAP YEAR: 1927


SERIES: 15 SCALE: 1:62500 SITE NAME: I-87 Exit 3 Airport

Connector

ADDRESS: Exit 3

Albany, NY 12205 LAT/LONG: 42.7268 / 73.7988 CLIENT: Shumaker Cons. Engineering

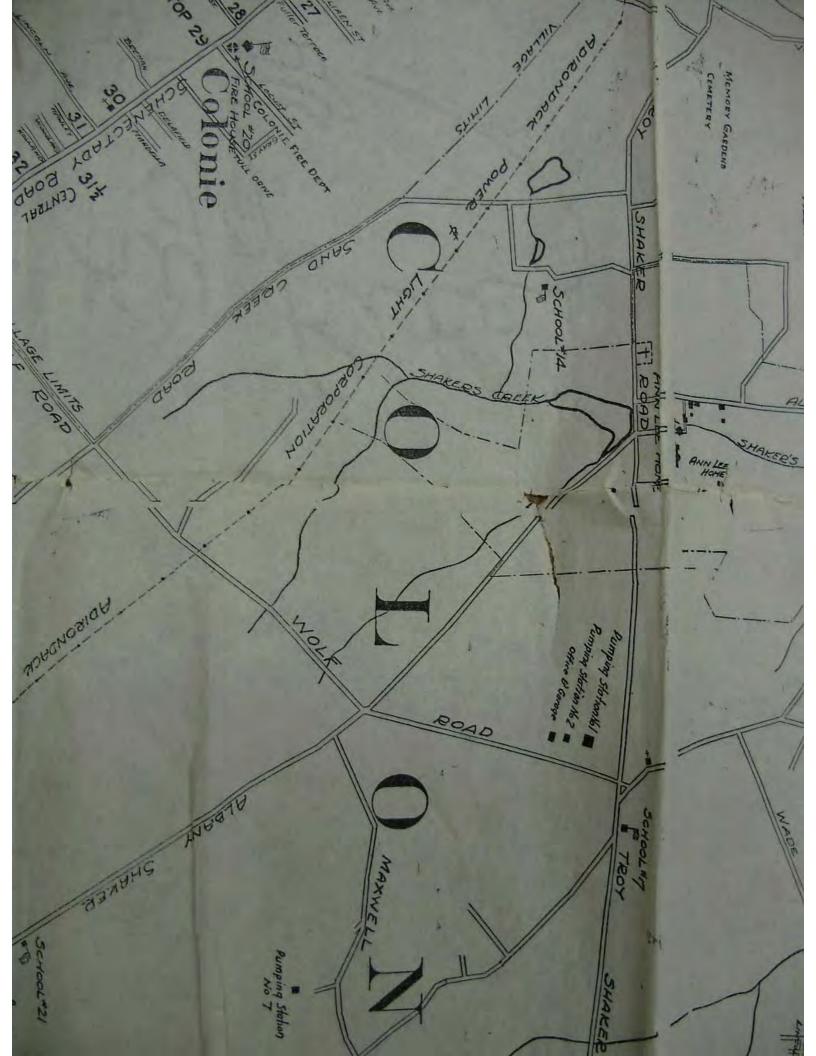

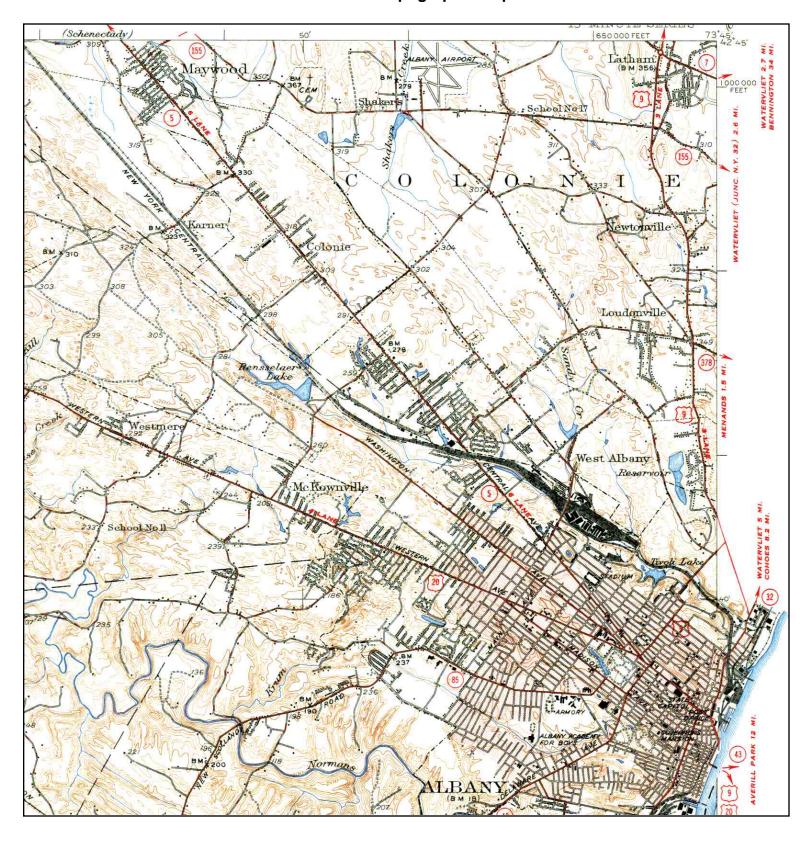

N

TARGET QUAD NAME: ALBANY


MAP YEAR: 1950

SERIES: 15 SCALE: 1:62500 SITE NAME: I-87 Exit 3 Airport

Connector

ADDRESS: Exit 3

Albany, NY 12205 LAT/LONG: 42.7268 / 73.7988 CLIENT: Shumaker Cons. Engineering

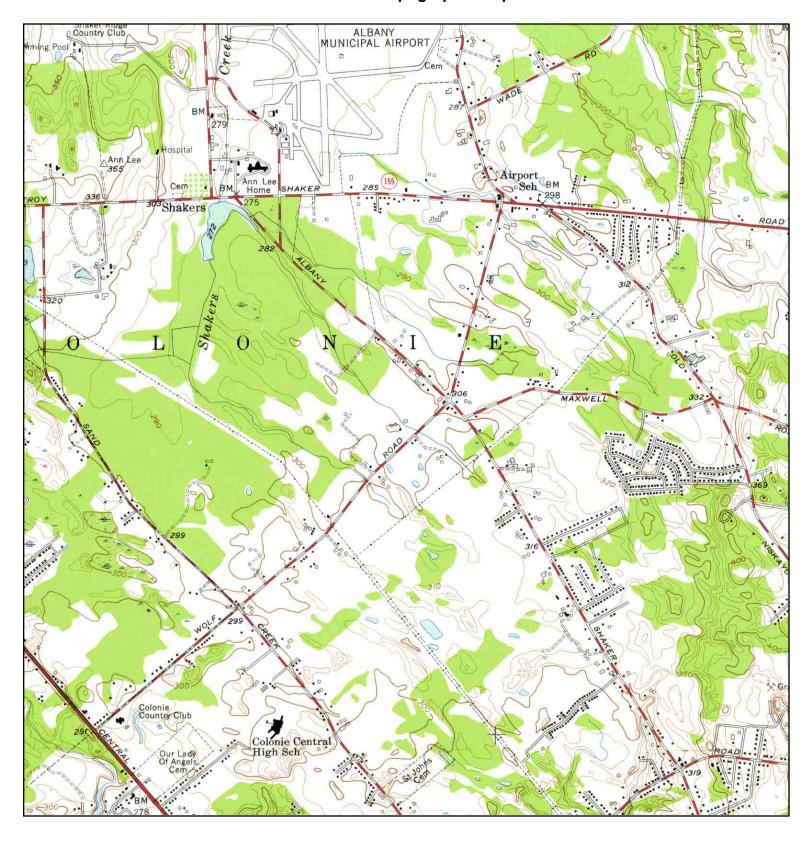

N

TARGET QUAD


NAME: ALBANY MAP YEAR: 1953

SERIES: 7.5 SCALE: 1:24000 SITE NAME: I-87 Exit 3 Airport

Connector

ADDRESS: Exit 3

Albany, NY 12205 LAT/LONG: 42.7268 / 73.7988 CLIENT: Shumaker Cons. Engineering

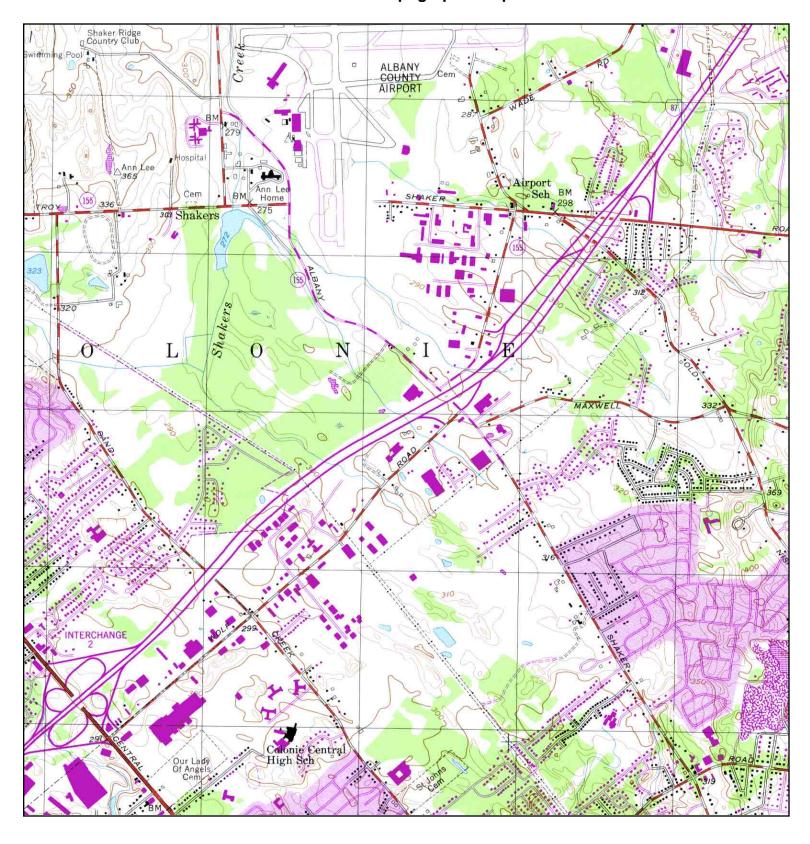

N

TARGET QUAD NAME: ALBANY MAP YEAR: 1980


PHOTOREVISED FROM:1953

SERIES: 7.5 SCALE: 1:24000 SITE NAME: I-87 Exit 3 Airport

Connector

ADDRESS: Exit 3

Albany, NY 12205 LAT/LONG: 42.7268 / 73.7988 CLIENT: Shumaker Cons. Engineering

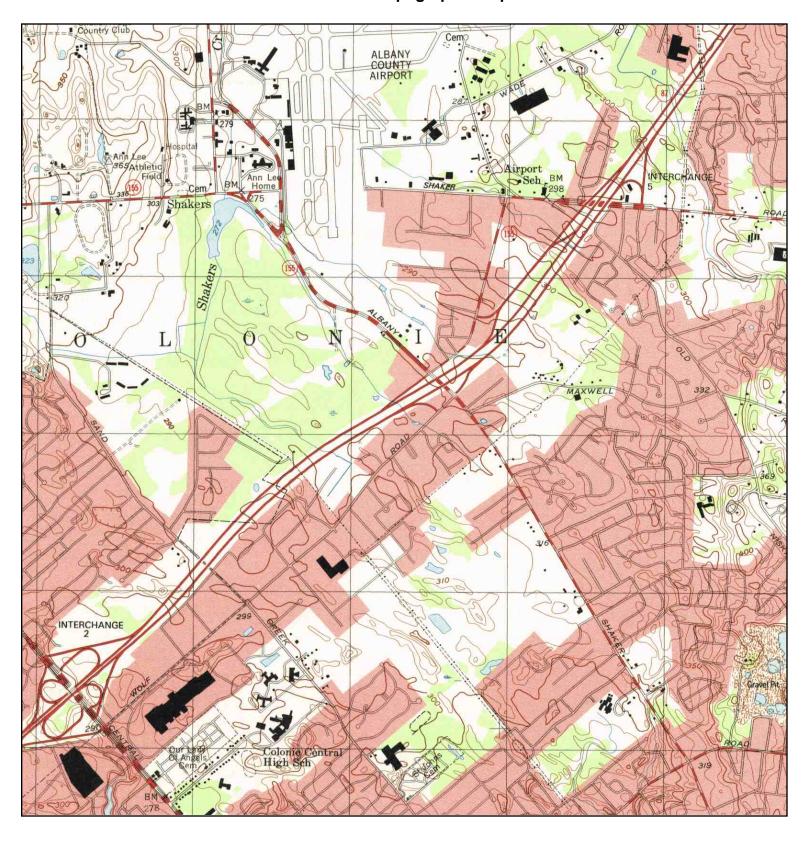

N TARGET QUAD NAME: ALBANY

MAP YEAR: 1994

SERIES: 7.5 SCALE: 1:24000 SITE NAME: I-87 Exit 3 Airport

Connector

ADDRESS: Exit 3

Albany, NY 12205 LAT/LONG: 42.7268 / 73.7988 CLIENT: Shumaker Cons. Engineering

Interstate 87 Exit 3 Airport Connector

Wolf Road and Albany Shaker Road Albany, NY 12211

Inquiry Number: 2896934.3

October 18, 2010

Certified Sanborn® Map Report



Certified Sanborn® Map Report

10/18/10

Site Name: Client Name:

Interstate 87 Exit 3 Airport Wolf Road and Albany Shaker Albany, NY 12211 Shumaker Cons. Engineering 1510 Central Avenue Suite 330 Albany, NY 12205

EDR Inquiry # 2896934.3 Contact: Jeff Mt. Pleasant



The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by Shumaker Cons. Engineering were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: Interstate 87 Exit 3 Airport Connector Address: Wolf Road and Albany Shaker Road

City, State, Zip: Albany, NY 12211

Cross Street:

P.O. # 00458.01

Project: I-87 Exit 3 Airport Connector

Certification # 9FD9-481B-9A5B



Sanborn® Library search results Certification # 9FD9-481B-9A5B

UNMAPPED PROPERTY

This report certifies that the complete holdings of the Sanborn Library, LLC collection have been searched based on client supplied target property information, and fire insurance maps covering the target property were not found.

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

Library of Congress

✓ University Publications of America

▼ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Shumaker Cons. Engineering (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.


Copyright 2010 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

APPENDIX B

AERIAL PHOTOGRAPHS



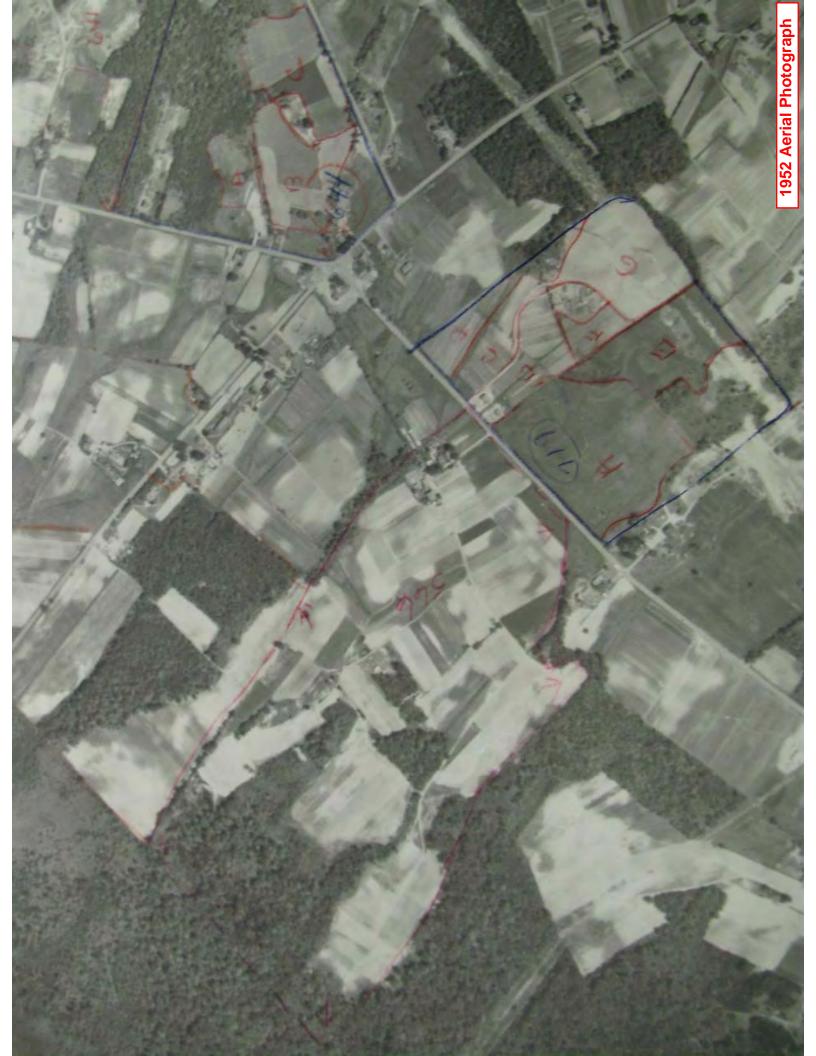











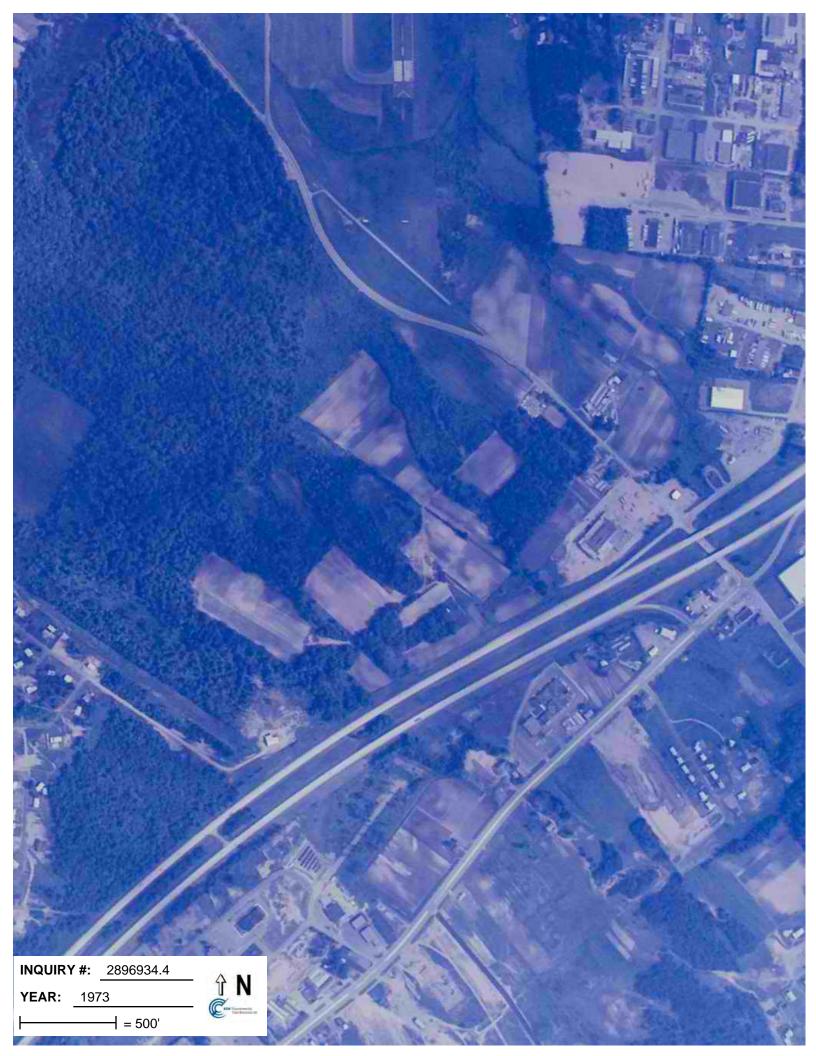


974 Aerial Photograph mericana






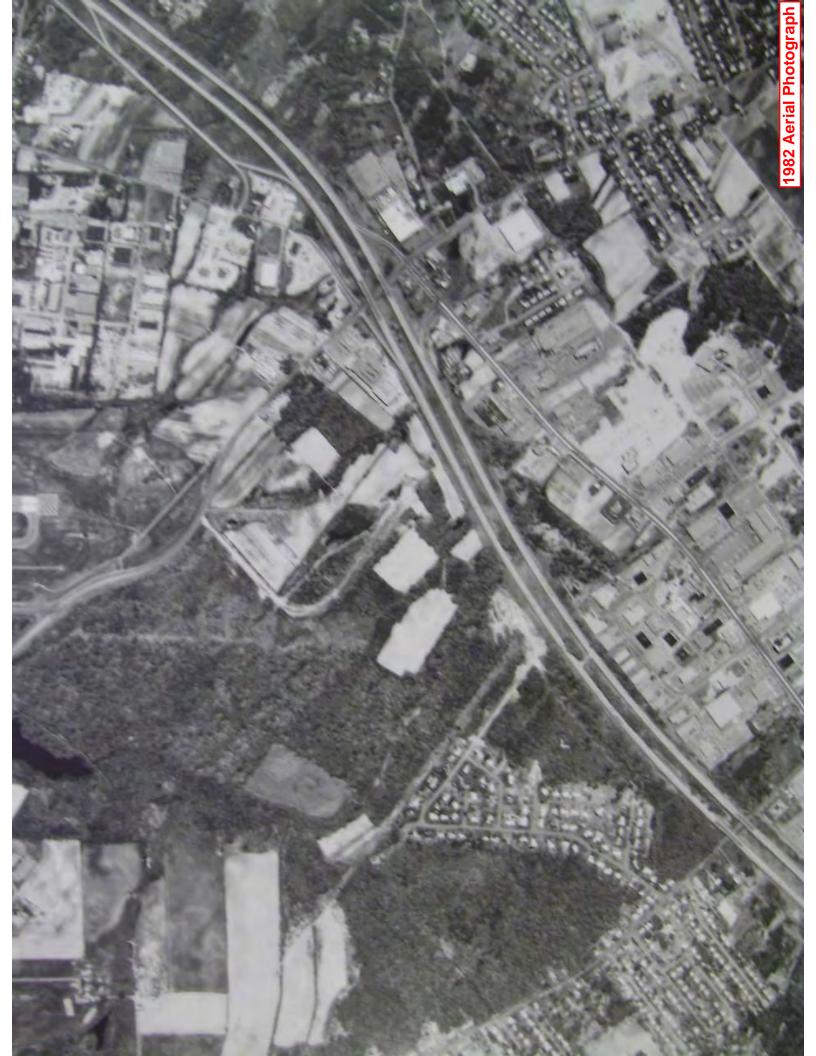




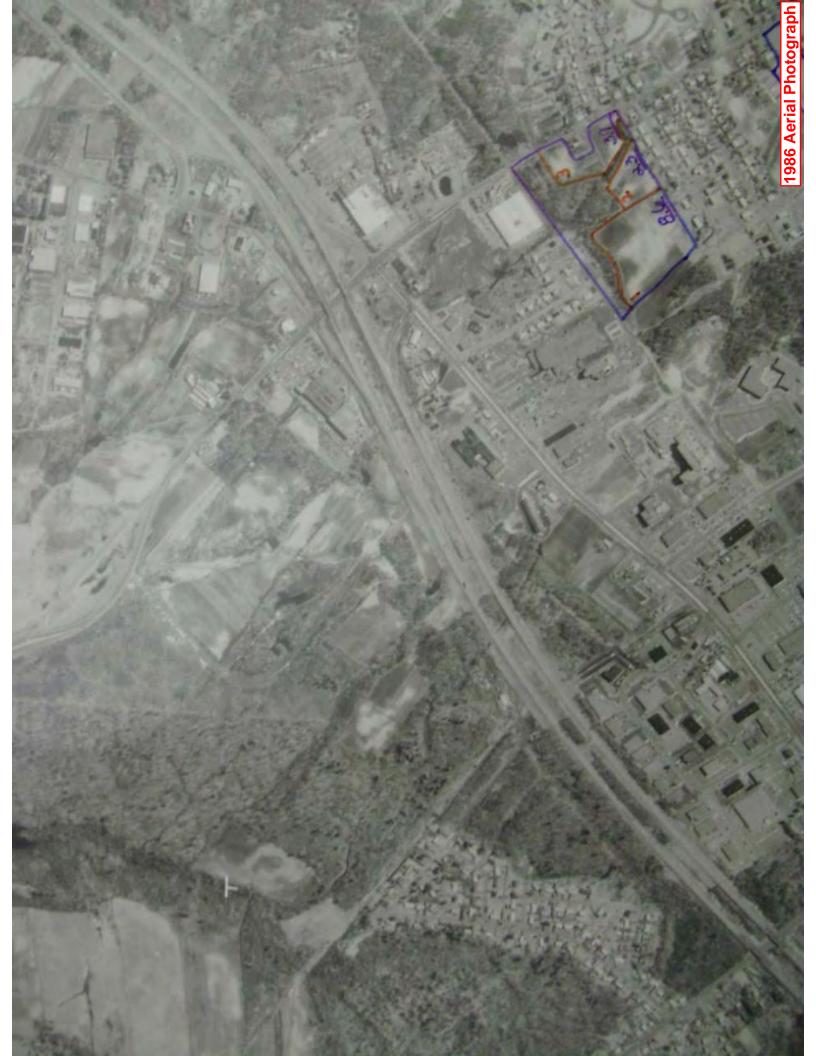




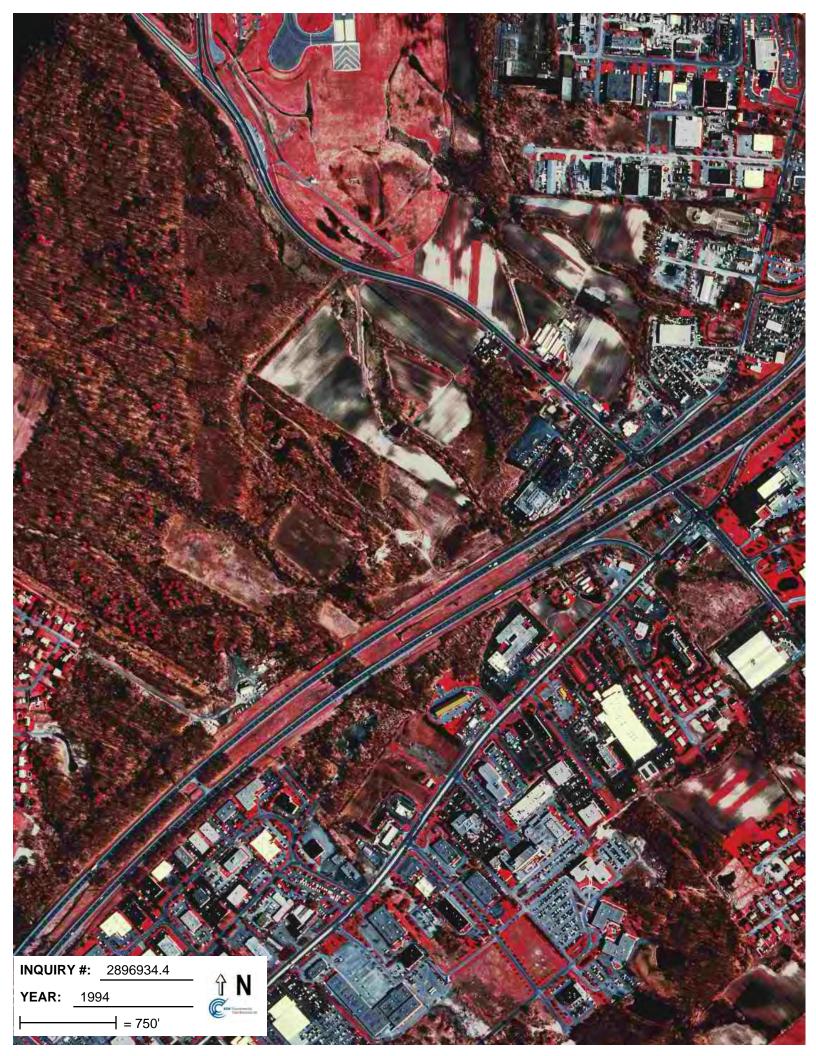



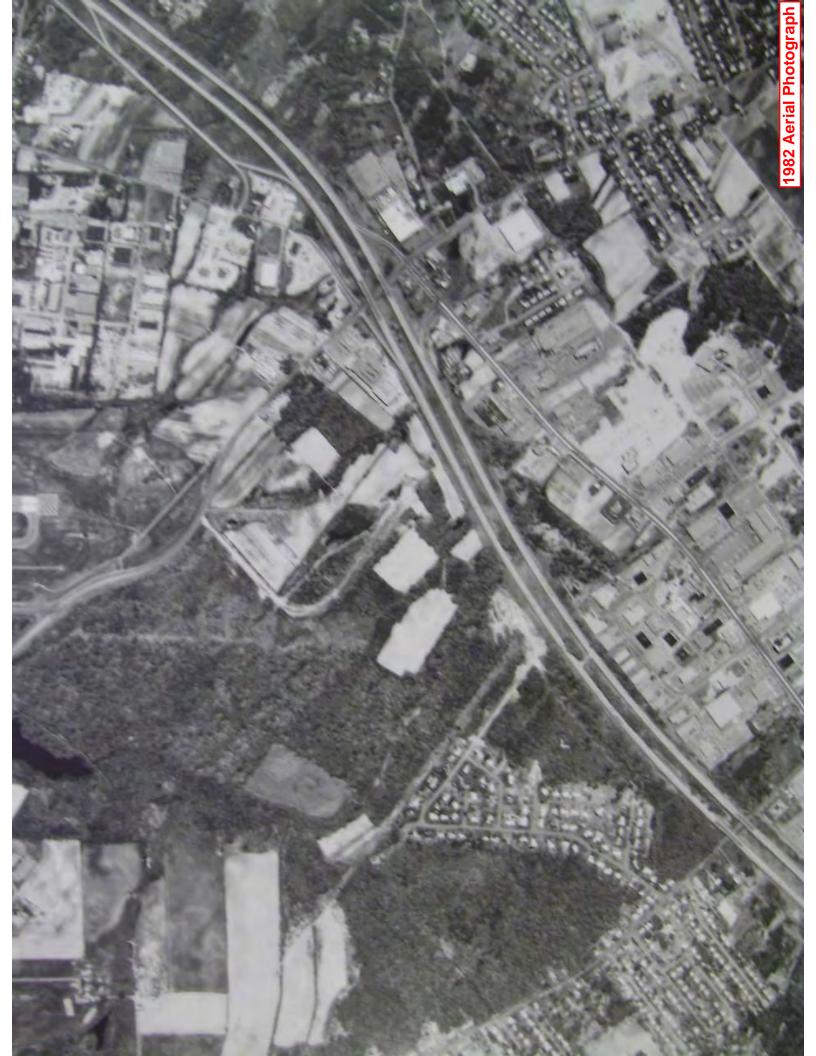

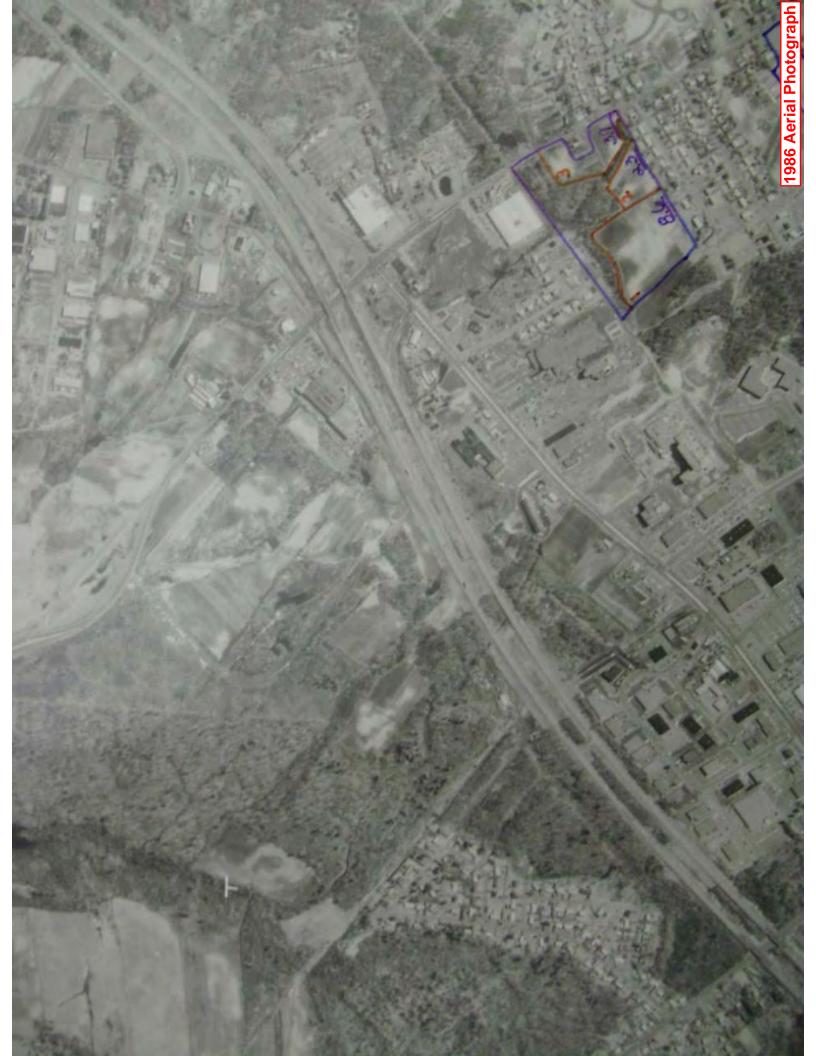








Overview


Map Layers
0 250 500
feet


2001 Aerial Photograph I-87 Exit 3 Airport Connector 12/14/2010 4:31PM

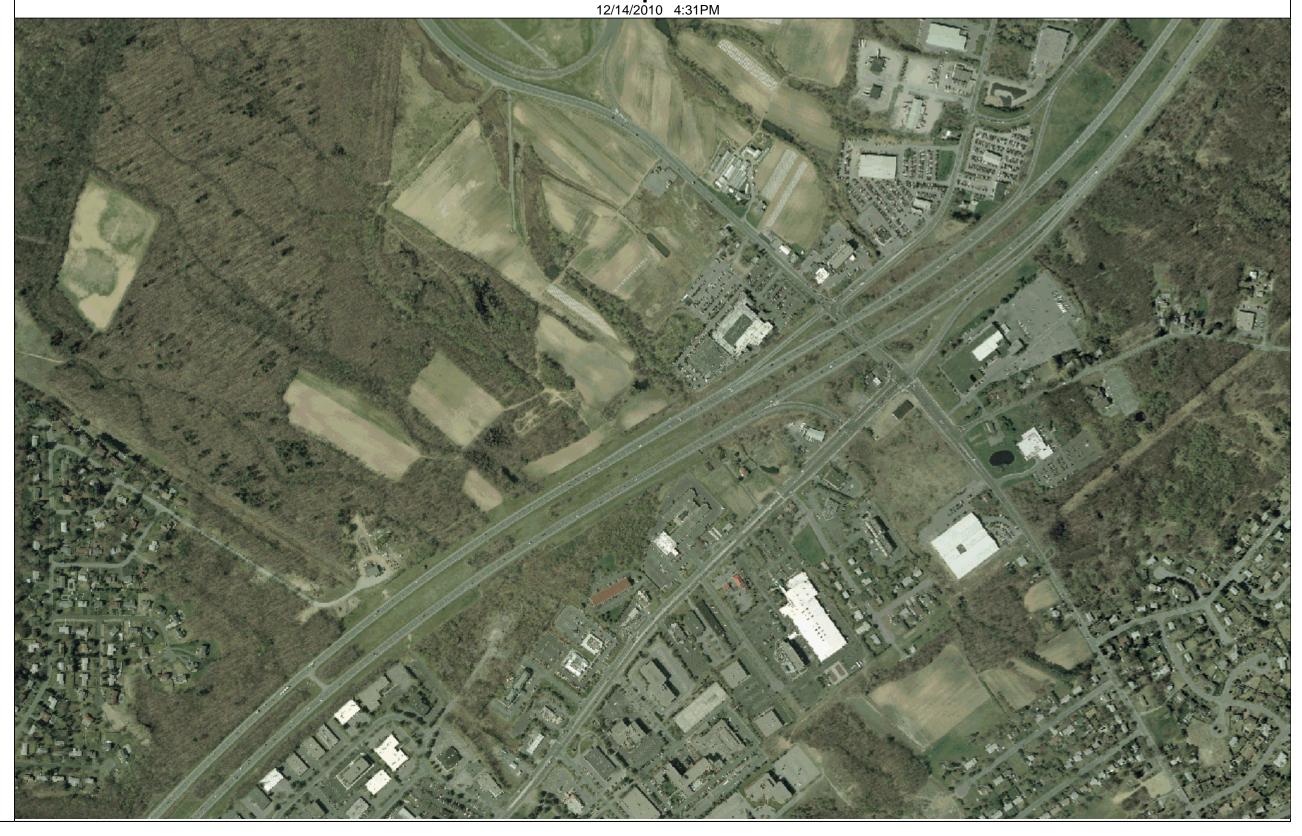

2004 Aerial Photograph I-87 Exit 3 Airport Connector 12/15/2010 8:39AM




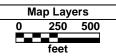

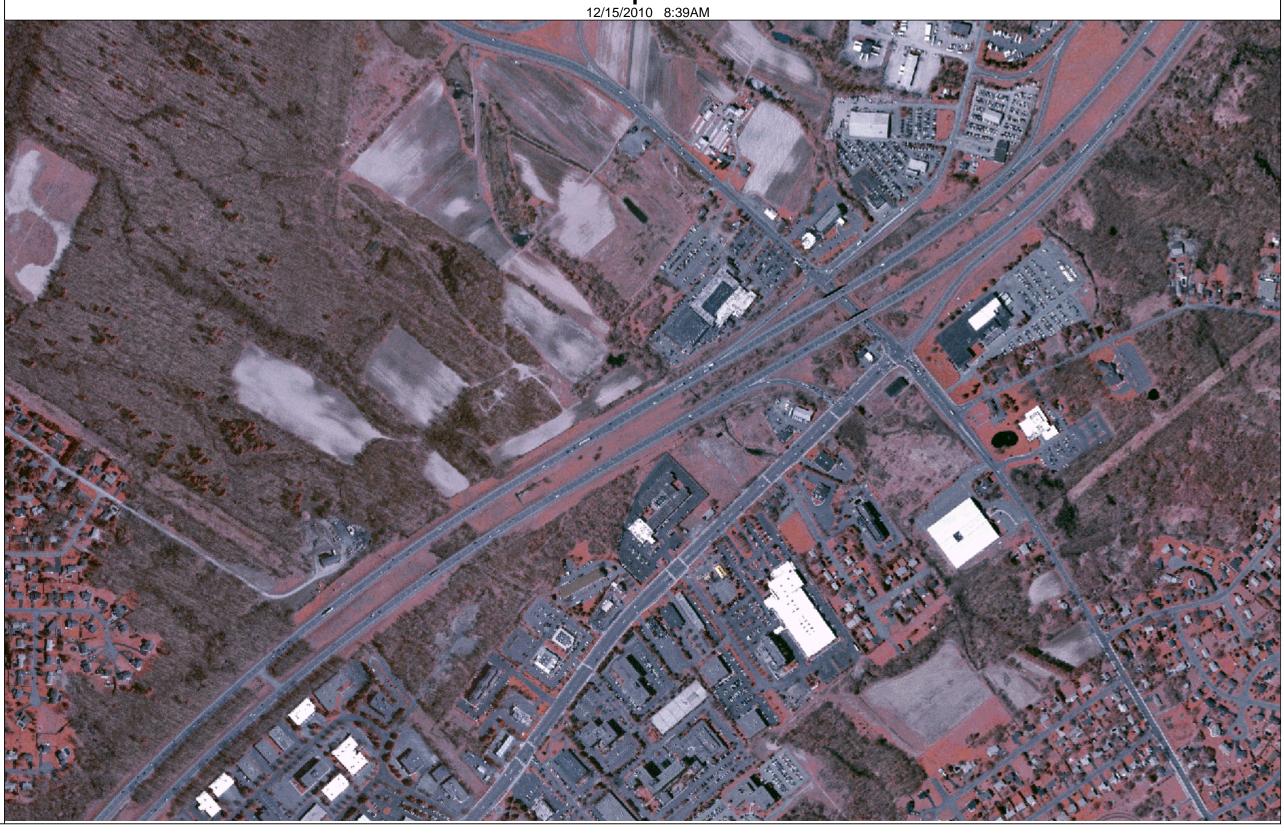



2007 Aerial Photograph -

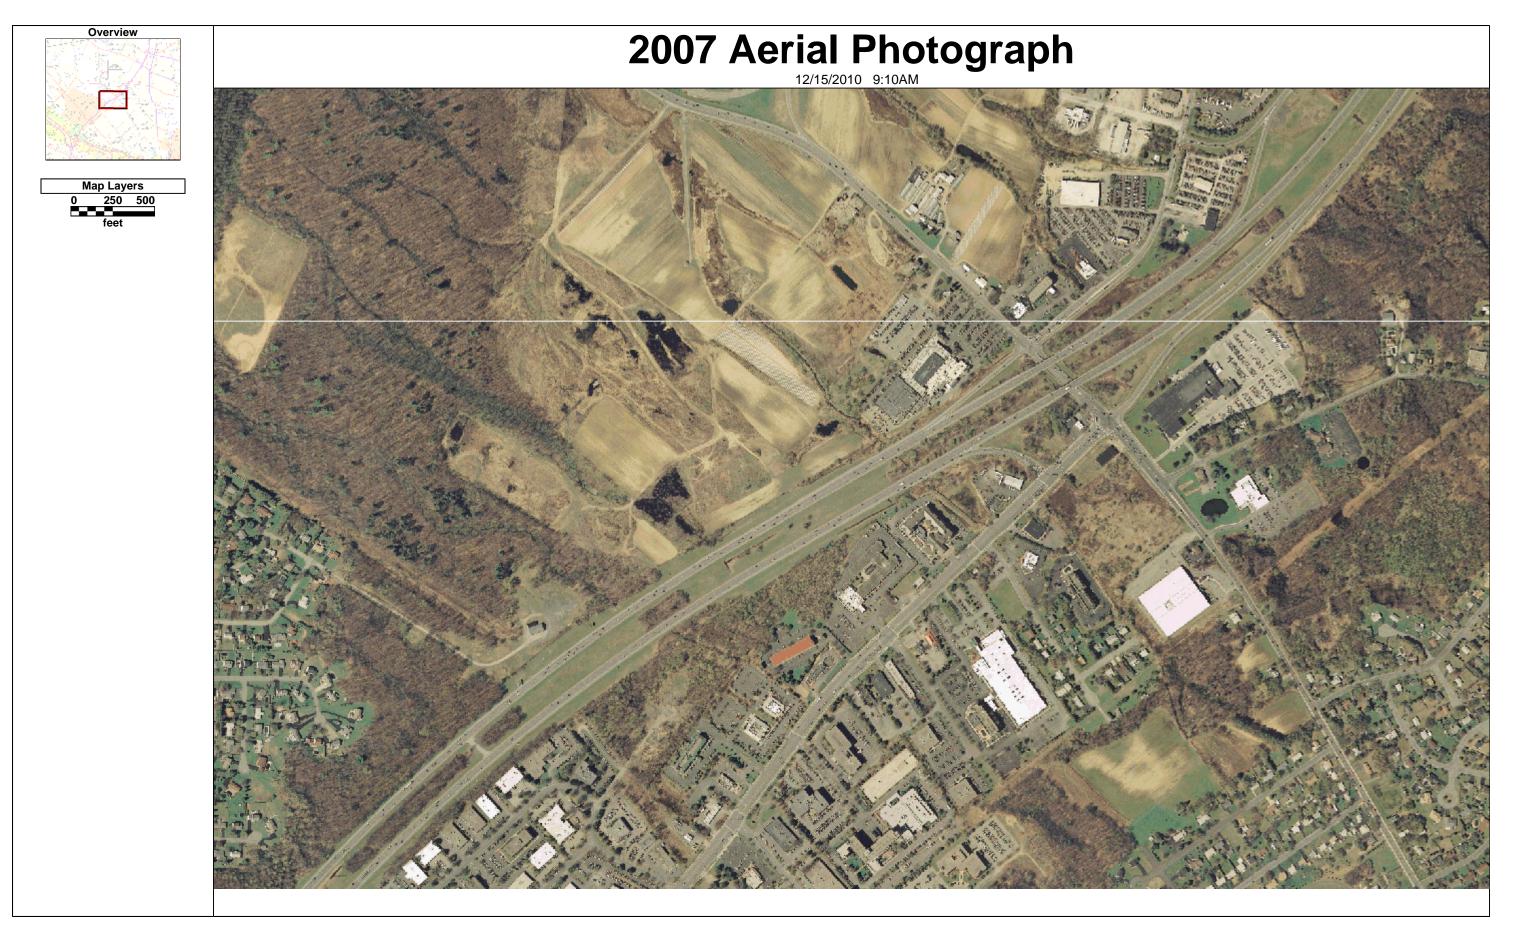

APPENDIX C

LOCAL GOVERNMENT AGENCY DOCUMENTATION



742 LISHAKILL ROAD SCHENECTADY, NEW YORK 12309 (518) 869-8602

TVO AT I

October 28, 1997

Town of Colonie Building Departments 10 www. Public Operation Center 7 347 old Niskayuna Road Latham, New York 992110-2286

Re: Underground fuel tanks Warehouse - 200 Sunset Boulevard

Gentlemen:

Enclosed are the following completed forms:

- commercial zoning verification
- 2. application for building & zoning permit
- 3. (3) site plans

Permit number with D.E.C. is #4-388203. An application has been submitted and approved with D.E.C., to close the tanks in place.

Trusting you will find this in order, we remain

Sincerely, JOHN CERONE, INC.

her Cerone &

John Cerone, Jr.

President

encs. 5

TOWN OF COLONIE

DEPARTMENT OF FIRE PREVENTION & INVESTIGATION

347 OLD NISKAYUNA ROAD LATHAM, NEW YORK 12110

OFFICE: 518-783-2712 FAX# 518-783-2873

Laurence J. Isabelle
Chief Fire Inspector/Investigator
Peter A. Lattanzio
Asst. Chief Fire Inspector/Investigator

MEMORANDUM

TO;

BLDG. DEPT. 5. Mapes

FROM:

Fire Prevention & Investigation

Date:

5/11/99

Subject:

Tank Removals at 200 Sunset Blvd.

Permit # 97-1331

The above project has been completed and can be removed from the active

file.

WEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION Petroleum Bulk Storage Program Facility Information Report

Site status : Under 1101 gal,

Owner : JOHN CERONE, INC.

70 SUMSET BLVD.

ALBANY, NY

Active Capacity : 0 gals. Total Active Tanks : 0

Reg Expires: 01/30/02

Town : COLCHIE Langitude :

County: ALBANY

Latitude :

SPDES#

COLONIE, NY 1230

70 SUKSET BLYD.

JOHN CERCHE,

PBS # : 4-38B203

CBS#

Site Type : Othe

Owner Type : Corporate/Commercial

Mail: JOHN CERONE, INC.

70 SUNSET BLVD.

ALBANY, NY

Phone : (518) 869-8602

Last Inspection:

Cert Printed : 01/27/97

Site Errors : Complete

Tank Errors : No Data Owner Error

(518) 785-0046 (518) 869-8602

CERONE INC

: JOHN

Operator

Emergency : JOHN CERONE INC

(518) 869-8602 Att :

Section Leak Overfil, Disp LastTest NextTest PipeExt Pi peint PipeType Piperoc Tankint TankExt TankType Product Stat Tank Loc TarkNo

BOTH TANKS REMOVED APPROX 12/16/97

SOME CONTAMINATED SOIL, STOCK PILED ON SITE DEC WILL RETURN IN SPRING TO SEE IF AN

FURTHER WILL BE REAUIRED,

1378 .oN

Site:

3 T TE APPR. V 40,40 ₽ • 1 FLOT & ESTIMATED REPRODUCTION COST UNIT PR. ADJUSTED Main Bldg. Depreciation and Obsolescence ť Normal 7001 PECAL DISTRICTS SCHOOL LAKINGT 17 ŝ C4 1) attorishmen ١ Main Bldg. Est. Reproduction Cost ě All Bidgs. Est. Depreciated Value · Shaken-L'ville Other Bldg. Depreciated Value Main Bldg. Depreciated Value Condition: Good 本統 MAIN STRUCTURE 0 DIMENSIONS Dept. APPRAISED VALUE 50 N Ï ť ij Add or Deduct % LOT SIZE Net Adjustment Adjustments Land Value 6 4A Front Total 3 t/b.combined & k/a 240 Wolf Rd (30.4-1-10.-2 schanz, 2442/85 8/1/91 for 92 Roll. Restausant * 2/69 To NYS to widen Wolf Rd 208x37 (.170 A)
Map 86 Parcel 96 Rate Sounce - 634 - Constitutionally Appearant - 16 X 29 Janget 4/1/16 .. To NYS Appro Map 86 Parcels 96 & 116 * 17 14 14 1A TOTAL OTHER STRUCTURES Hirely MISCELLANEOUS INFORMATION WATER INFORMATION 1815957 OTHER STRUCTURES 1971 COCOGE instilled over existing pate. > 018 REPULER ALGE * Application No. * INTO A SUNJET 13451 6811 Depreciation Construction Sq. Ft. Cost Dep. Value Est. Rep. S. T. 8 Size . 5 Manuland 212 OWNER'S STATEMENT OR TRANSFER FLOOR ROOF MATERIAL ROOF TYPE Electric 69 Schanz, Willard J & Martin Bus 1 No Chanles St. OCCUPIED FLOOR TOWN OF COLONIE American Oil Company Street Paved Price Paid \$ Alterations: Rents for \$ Additions: Sidewalks Baltimore. BASEMENT 1st FLOOR 2nd FLOOR Tenant Owner Sewer Date Purch. OUTSIDE WALLS WALL FACING STORE FRONT 240 WOLF ROAD Gas State 201 MAILING ADDRESS sq. ft. \$ sq. #. \$ * PAVING EXTRAS Refused Admittance FOUNDATION Listing Estimated: HEATING LOCATION OWNER'S Checked by OWNER. Appr. by: Plumb. Fix. No. Rooms Windows Excavation Partitions Lighting Tiling Floors Stoirs Area TYPE Hz. уре Type 즟

1.96 MAKER FORM NO. 25 1M From: Pellegrini, Susan

To: Jeffrey Mt. Pleasant;

Subject: RE: Environmental Investigation Information Request

Date: Wednesday, November 17, 2010 2:16:18 PM

Attachments: 20101117140329383.pdf

Mr. Mt. Pleasant:

The attached records are the only records Fire Services has relating to any of these sites as you requested. I have forwarded your request to the Building Department as well. I will let you know once I hear back from them.

Susan Pellegrini Paralegal Assistant Town Attorney's Office Memorial Town Hall PO Box 508 Newtonville, NY 12128 (518)783-2704

This message is being sent by or on behalf of an attorney; it is intended for the exclusive use of its intended recipient and may contain information that is privileged or confidential, or otherwise legally exempt from disclosure. If you are not the intended recipient, you are not authorized to read, print, retain, copy or disseminate this message, or any part of it. If you have received this message in error, please notify us immediately by e-mail; discard any paper copies and delete all electronic files of this message. If you are not sure as to whether you are the intended recipient, please reply to the above e-mail address.

From: Jeffrey Mt. Pleasant [mailto:jmtpleasant@shumakerengineering.com]

Sent: Tuesday, November 16, 2010 11:03 AM

To: foil@colonie.org

Subject: Environmental Investigation Information Request

To Whom It May Concern:

Please find our FOIL request for an environmental investigation being performed for the New York State Department of Transportation. Please do not hesitate to contact me should you have any questions regarding this request. Thank you for your assistance.

Jeffrey T. Mt. Pleasant

Environmental Scientist



"The Shumaker Difference"

1510 Central Ave, Suite 330 Albany NY 12205 Phone (518) 452-5730 Fax (518) 452-9230 jmtpleasant@shumakerengineering.com www.shumakerengineering.com



Before printing, please think about the environment

CONFIDENTIALITY STATEMENT

This message is intended only for the use of the individual or entity to which it is addressed and may contain information that is privileged, confidential and exempt from disclosure under applicable law. If the reader of this message is not the intended recipient or the employee or agent responsible for delivering the message to the intended recipient, YOU ARE HEREBY NOTIFIED that any dissemination, distribution or copying of this communication is strictly prohibited. If you are not the intended recipient of this message, please destroy any printed version and delete this email.

APPENDIX D

EDR ENVIRONMENTAL DATABASE REPORT

Interstate 87 Exit 3 Airport Connector

Wolf Road and Albany Shaker Road Albany, NY 12211

Inquiry Number: 2896934.2s

October 18, 2010

The EDR Radius Map™ Report with GeoCheck®

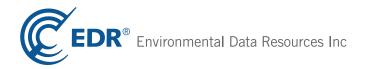


TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Overview Map	2
Detail Map.	3
Map Findings Summary	4
Map Findings	7
Orphan Summary	711
Government Records Searched/Data Currency Tracking.	GR-1
GEOCHECK ADDENDUM	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map.	A-5
Physical Setting Source Map.	A-16
Physical Setting Source Map Findings.	A-18
Physical Setting Source Records Searched	A-26

Thank you for your business.Please contact EDR at 1-800-352-0050 with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2010 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

WOLF ROAD AND ALBANY SHAKER ROAD ALBANY, NY 12211

COORDINATES

Latitude (North): 42.727700 - 42° 43' 39.7" Longitude (West): 73.803300 - 73° 48' 11.9"

Universal Tranverse Mercator: Zone 18 UTM X (Meters): 597974.0 UTM Y (Meters): 4731056.5

Elevation: 295 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 42073-F7 ALBANY, NY

Most Recent Revision: 1994

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from: 2006, 2008 Source: USDA

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list	
NPL	_ National Priority List

Proposed NPL Proposed National Priority List Sites

NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY..... Federal Facility Site Information listing

Federal CERCLIS NFRAP site List

CERC-NFRAP..... CERCLIS No Further Remedial Action Planned

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF...... RCRA - Treatment, Storage and Disposal

Federal institutional controls / engineering controls registries

US ENG CONTROLS...... Engineering Controls Sites List US INST CONTROL...... Sites with Institutional Controls

Federal ERNS list

ERNS..... Emergency Response Notification System

State and tribal landfill and/or solid waste disposal site lists

SWF/LF..... Facility Register

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

FEMA UST...... Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

RES DECL...... Restrictive Declarations Listing

State and tribal voluntary cleanup sites

VCP...... Voluntary Cleanup Agreements INDIAN VCP...... Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

ERP..... Environmental Restoration Program Listing

BROWNFIELDS..... Brownfields Site List

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

ODI..... Open Dump Inventory

DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations

SWTIRE...... Registered Waste Tire Storage & Facility List

SWRCY...... Registered Recycling Facility List

INDIAN ODI...... Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL...... National Clandestine Laboratory Register

Local Lists of Registered Storage Tanks

HIST AST..... Historical Petroleum Bulk Storage Database

Local Land Records

LIENS 2..... CERCLA Lien Information

LUCIS.....Land Use Control Information System

Records of Emergency Release Reports

HMIRS_____ Hazardous Materials Information Reporting System

Other Ascertainable Records

CONSENT..... Superfund (CERCLA) Consent Decrees

TRIS...... Toxic Chemical Release Inventory System

TSCA..... Toxic Substances Control Act

Act)/TSCA (Toxic Substances Control Act)

HIST FTTS..... FIFRA/TSCA Tracking System Administrative Case Listing

SSTS..... Section 7 Tracking Systems

ICIS..... Integrated Compliance Information System

PADS...... PCB Activity Database System MLTS..... Material Licensing Tracking System RADINFO...... Radiation Information Database

FINDS......Facility Index System/Facility Registry System RAATS______RCRA Administrative Action Tracking System HSWDS..... Hazardous Substance Waste Disposal Site Inventory NPDES...... State Pollutant Discharge Elimination System

AIRS..... Air Emissions Data

E DESIGNATION..... E DESIGNATION SITE LISTING

INDIAN RESERV..... Indian Reservations

SCRD DRYCLEANERS...... State Coalition for Remediation of Drycleaners Listing COAL ASH EPA..... Coal Combustion Residues Surface Impoundments List

PCB TRANSFORMER...... PCB Transformer Registration Database COAL ASH DOE..... Sleam-Electric Plan Operation Data FINANCIAL ASSURANCE.... Financial Assurance Information Listing

COAL ASH..... Coal Ash Disposal Site Listing

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants____ EDR Proprietary Manufactured Gas Plants

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in **bold italics** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-LQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA)

of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

A review of the RCRA-LQG list, as provided by EDR, and dated 02/17/2010 has revealed that there is 1 RCRA-LQG site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
ENGINE SYSTEMS CO	6 NORTHWAY LANE	NNW 1/8 - 1/4 (0.211 mi.)	R90	429

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 02/17/2010 has revealed that there is 1 RCRA-SQG site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CAPITAL NEWSPAPERS	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A1	7

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 02/17/2010 has revealed that there are 7 RCRA-CESQG sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HESS CORPORATION	156 WOLF RD	0 - 1/8 (0.000 mi.)	B2	25
DOMINION TRANSMISSION INCORPOR	148 WOLF ROAD	0 - 1/8 (0.000 mi.)	B25	102
LAZARE LINCOLN MERCURY	144 WOLF RD	SSW 0 - 1/8 (0.068 mi.)	L56	248
VEOLIA ES TECHNICAL SOLUTIONS	10 TERMINAL DR	NW 0 - 1/8 (0.084 mi.)	K65	285
SHERWIN WILLIAMS CO STORE 5101	WOLF RD	SSW 1/8 - 1/4 (0.159 mi.)	Q77	350
GENUINE PARTS CO	301 WOLF RD	N 1/8 - 1/4 (0.208 mi.)	R85	395
DENOOYER CHEVROLET	127 WOLF RD	SE 1/8 - 1/4 (0.236 mi.)	S112	538

State- and tribal - equivalent CERCLIS

SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the SHWS list, as provided by EDR, and dated 08/24/2010 has revealed that there is 1 SHWS

site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TURBOSYSTEMS INTL	7 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R100	481

VAPOR REOPENED: "Vapor intrusion" refers to the process by which volatile chemicals move from a subsurface source into the indoor air of overlying or adjacent buildings. The subsurface source can either be contaminated groundwater or contaminated soil which releases vapors into the pore spaces in the soil. Improvements in analytical techniques and knowledge gained from site investigations in New York and other states has led to an increased awareness of soil vapor as a medium of concern and of the potential for exposures from the soil vapor intrusion pathway. Based on this additional information, New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

A review of the VAPOR REOPENED list, as provided by EDR, and dated 08/13/2010 has revealed that there is 1 VAPOR REOPENED site within approximately 1 mile of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
TURBOSYSTEMS INTL	7 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R100	481

State and tribal leaking storage tank lists

LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the LTANKS list, as provided by EDR, and dated 08/24/2010 has revealed that there are 17 LTANKS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CAPITAL NEWSPAPERS Date Closed: 2/12/1992	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A1	7
BIENIEK WOLF RD Date Closed: 3/22/1989	264 WOLF RD	0 - 1/8 (0.000 mi.)	C21	81
AVIS 674 ALBANY SHAKER RD Date Closed: 11/15/1986	674 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	H32	143
HESS #32334 WOLF RD Date Closed: 7/1/2004 Date Closed: 5/22/2000	156 WOLF RD	0 - 1/8 (0.000 mi.)	B37	156
SUNOCO ALBANY SHAKER RD Date Closed: 12/2/1994	656 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A38	160
RUSHMORE & WEBER WOLF RD Date Closed: 2/6/1995	272 WOLF RD REAR OF BL	NW 0 - 1/8 (0.014 mi.)	48	204
COLONIE LIBRARY ALBANY SH Date Closed: 5/4/1990	629 ALBANY SHAKER RD	SE 0 - 1/8 (0.077 mi.)	N63	280
LAZARE LINCOLN WOLF RD Date Closed: 10/1/1994	144 WOLF RD	SSW 0 - 1/8 (0.106 mi.)	L73	337
FEDERAL EXPRESS CORP Date Closed: 11/3/1993	281 OLD WOLF RD	NNW 0 - 1/8 (0.109 mi.)	P74	340

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FIRESTONE WOLF RD Date Closed: 10/12/1994	83 WOLF RD	S 1/4 - 1/2 (0.372 mi.)	W139	648
AT&T 65 WOLF RD Date Closed: 9/11/1987	65 WOLF RD	SSW 1/4 - 1/2 (0.449 mi.)	AB158	689
AT&T WOLF RD Date Closed: 8/30/1995	65 WOLF RD	SSW 1/4 - 1/2 (0.449 mi.)	AB159	691
Lower Elevation	Address	Direction / Distance	Map ID	Page
ALBANY COUNTY JAIL SHAKER Date Closed: 5/17/1995	ALBANY SHAKER RD JAIL	0 - 1/8 (0.000 mi.)	20	76
CERONE EXCAVATING SUNSET Date Closed: 4/26/2000	70 SUNSET BLVD	NW 1/8 - 1/4 (0.238 mi.)	T118	588
VALLANO BROTHERS Date Closed: 11/21/1997	7 HEMLOCK ST	NNW 1/4 - 1/2 (0.395 mi.)	X150	672
FEDERAL EXPRESS RT 155 Date Closed: 11/3/1993	RT 155	NNE 1/4 - 1/2 (0.411 mi.)	153	678
ANN LEE HOME SHAKER RD Date Closed: 3/17/1994	WATERVLIET SHAKER RD	NNW 1/4 - 1/2 (0.455 mi.)	160	694

HIST LTANKS: A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database.

A review of the HIST LTANKS list, as provided by EDR, and dated 01/01/2002 has revealed that there are 29 HIST LTANKS sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CAPITAL NEWSPAPERS Date Closed: 02/12/92	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A1	7
BIENIEK WOLF RD Date Closed: 03/22/89	264 WOLF RD	0 - 1/8 (0.000 mi.)	C21	81
AVIS 674 ALBANY SHAKER RD Date Closed: 11/15/86	674 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	H32	143
AVIS ALBANY SHAKER RD Date Closed: 09/11/87	ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	G34	146
HESS #32334 WOLF RD Date Closed: 05/22/00	156 WOLF RD	0 - 1/8 (0.000 mi.)	B37	156
SUNOCO ALBANY SHAKER RD Date Closed: 12/02/94	656 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A38	160
CAPITAL NEWSPAPERS TU Date Closed: 03/17/92	ALBANY SHAKER RD @ MAX	KW0 - 1/8 (0.000 mi.)	41	188
RUSHMORE & WEBER WOLF RD Date Closed: 02/06/95	272 WOLF RD REAR OF BL	NW 0 - 1/8 (0.014 mi.)	48	204
COLONIE LIBRARY ALBANY SH Date Closed: 05/04/90	629 ALBANY SHAKER RD	SE 0 - 1/8 (0.077 mi.)	N63	280

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
LAZARE LINCOLN WOLF RD Date Closed: 10/01/94	144 WOLF RD	SSW 0 - 1/8 (0.106 mi.)	L73	337
FEDERAL EXPRESS CORP Date Closed: 11/03/93	281 OLD WOLF RD	NNW 0 - 1/8 (0.109 mi.)	P74	340
RONALD DURANTE/SMITH TRAN Date Closed: 10/17/88	TERMINAL DRIVE	NW 1/8 - 1/4 (0.152 mi.)	76	347
HARPER PROP NORTHWAY LN Date Closed: 06/29/89	5 NORTHWAY LN	N 1/8 - 1/4 (0.211 mi.)	R93	459
ST JOHNSBURY NORTHWAY LN Date Closed: 10/07/92	7-9 NORTHWAY LN	NNW 1/8 - 1/4 (0.212 mi.)	R95	464
CROWN ENTERPRISES INC Date Closed: 06/06/01	10 NORTHWAY LANE	NNW 1/8 - 1/4 (0.215 mi.)	R103	505
COLONIE PD WOLF RD Date Closed: 06/28/94	312 WOLF RD	N 1/8 - 1/4 (0.240 mi.)	R119	591
FIRESTONE WOLF RD Date Closed: 10/12/94	83 WOLF RD	S 1/4 - 1/2 (0.372 mi.)	W139	648
HESS WOLF RD Date Closed: 11/13/87	WOLF RD @ SAND CREEK	SSW 1/4 - 1/2 (0.390 mi.)	148	669
AT&T 65 WOLF RD Date Closed: 09/11/87	65 WOLF RD	SSW 1/4 - 1/2 (0.449 mi.)	AB158	689
AT&T WOLF RD	65 WOLF RD	SSW 1/4 - 1/2 (0.449 mi.)	AB159	691
Date Closed: 08/30/95				
Date Closed: 08/30/95 Lower Elevation	Address	Direction / Distance	Map ID	Page
	Address ALBANY SHAKER RD JAIL	Direction / Distance 0 - 1/8 (0.000 mi.)	<u>Map I</u> D <u>20</u>	<u>Page</u> 76
Lower Elevation ALBANY COUNTY JAIL SHAKER				
Lower Elevation ALBANY COUNTY JAIL SHAKER Date Closed: 05/17/95 CERONE EXCAVATING SUNSET	ALBANY SHAKER RD JAIL	0 - 1/8 (0.000 mi.)	20	76
Lower Elevation ALBANY COUNTY JAIL SHAKER Date Closed: 05/17/95 CERONE EXCAVATING SUNSET Date Closed: 04/26/00 PETER GRIMM	ALBANY SHAKER RD JAIL 70 SUNSET BLVD	0 - 1/8 (0.000 mi.) NW 1/8 - 1/4 (0.238 mi.)	20 T118	76 588
Lower Elevation ALBANY COUNTY JAIL SHAKER Date Closed: 05/17/95 CERONE EXCAVATING SUNSET Date Closed: 04/26/00 PETER GRIMM Date Closed: 03/22/89 LATHAM WATER DIST WOLF RD Date Closed: 06/06/90	ALBANY SHAKER RD JAIL 70 SUNSET BLVD ALBANY SHAKER RD	0 - 1/8 (0.000 mi.) NW 1/8 - 1/4 (0.238 mi.) NW 1/4 - 1/2 (0.296 mi.)	20 T118 124 125	76 588 606
Lower Elevation ALBANY COUNTY JAIL SHAKER Date Closed: 05/17/95 CERONE EXCAVATING SUNSET Date Closed: 04/26/00 PETER GRIMM Date Closed: 03/22/89 LATHAM WATER DIST WOLF RD Date Closed: 06/06/90 Date Closed: 09/22/92 DEC AIR LAB HEMLOCK ST	ALBANY SHAKER RD JAIL 70 SUNSET BLVD ALBANY SHAKER RD 312 WOLF RD	0 - 1/8 (0.000 mi.) NW 1/8 - 1/4 (0.238 mi.) NW 1/4 - 1/2 (0.296 mi.) N 1/4 - 1/2 (0.297 mi.)	20 T118 124 125	76 588 606 608
Lower Elevation ALBANY COUNTY JAIL SHAKER Date Closed: 05/17/95 CERONE EXCAVATING SUNSET Date Closed: 04/26/00 PETER GRIMM Date Closed: 03/22/89 LATHAM WATER DIST WOLF RD Date Closed: 06/06/90 Date Closed: 09/22/92 DEC AIR LAB HEMLOCK ST Date Closed: 01/13/93 LYONS TRKG NORTHWAY LN N	ALBANY SHAKER RD JAIL 70 SUNSET BLVD ALBANY SHAKER RD 312 WOLF RD 10 HEMLOCK ST	0 - 1/8 (0.000 mi.) NW 1/8 - 1/4 (0.238 mi.) NW 1/4 - 1/2 (0.296 mi.) N 1/4 - 1/2 (0.297 mi.) NNW 1/4 - 1/2 (0.357 mi.)	20 T118 124 125 X136	76 588 606 608
Lower Elevation ALBANY COUNTY JAIL SHAKER Date Closed: 05/17/95 CERONE EXCAVATING SUNSET Date Closed: 04/26/00 PETER GRIMM Date Closed: 03/22/89 LATHAM WATER DIST WOLF RD Date Closed: 06/06/90 Date Closed: 09/22/92 DEC AIR LAB HEMLOCK ST Date Closed: 01/13/93 LYONS TRKG NORTHWAY LN N Date Closed: 03/31/87 VALLANO BROTHERS	ALBANY SHAKER RD JAIL 70 SUNSET BLVD ALBANY SHAKER RD 312 WOLF RD 10 HEMLOCK ST 9 NORTHWAY LN N.	0 - 1/8 (0.000 mi.) NW 1/8 - 1/4 (0.238 mi.) NW 1/4 - 1/2 (0.296 mi.) N 1/4 - 1/2 (0.297 mi.) NNW 1/4 - 1/2 (0.357 mi.) NNE 1/4 - 1/2 (0.375 mi.)	20 T118 124 125 X136 Z145	76 588 606 608 641 664

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the UST list, as provided by EDR, and dated 06/17/2010 has revealed that there are 22 UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CAPITAL NEWSPAPERS, THE HEARST	645 ALBANY SHAKER ROAD	0 - 1/8 (0.000 mi.)	A7	45
ENTENMANN'S INC.	242 WOLF RD.	0 - 1/8 (0.000 mi.)	D15	63
HOLIDAY INN TURF	205 WOLF RD	0 - 1/8 (0.000 mi.)	E18	71
J J NAUGHTER INC	654 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A24	88
TOWN OF COLONIE PURE WATERS DE	108 WOLF ROAD	0 - 1/8 (0.000 mi.)	G28	120
DESMOND AMERICANA	660 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	G29	126
SUNOCO #0363-3021	656 ALBANY-SHAKER RD	0 - 1/8 (0.000 mi.)	A40	178
SUNBELT RENTALS INC.	272 WOLF ROAD	NW 0 - 1/8 (0.015 mi.)	J50	208
TRANSCON LINES	280 WOLF ROAD	NW 0 - 1/8 (0.066 mi.)	K53	235
LAZARE LINCOLN MERCURY, INC.	144 WOLF ROAD	SSW 0 - 1/8 (0.068 mi.)	L54	239
ALBANY MARRIOTT HOTEL	189 WOLF RD.	SW 0 - 1/8 (0.090 mi.)	O68	314
SHERWIN-WILLIAMS STORE #5101	130 WOLF RD	SSW 1/8 - 1/4 (0.159 mi.)	Q79	370
HESS STATION #32334	156 WOLF RD W/S	SSW 1/8 - 1/4 (0.173 mi.)	Q81	375
MLB INDUSTRIES INC	3 NORTHWAY LANE	N 1/8 - 1/4 (0.210 mi.)	R88	416
FEDERAL EXPRESS	8 NORTHWAY LANE	NNW 1/8 - 1/4 (0.213 mi.)	R96	467
SULZER TURBO/SYSTEMS INC	7 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R97	470
ST JOHNSBURY TRUCKING	7-9 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R99	478
ST JOHNSBURY TRUCKING CO.	7-9 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R101	498
CROWN ENTERPRISES INC	10 NORTHWAY LANE	NNW 1/8 - 1/4 (0.215 mi.)	R103	505
DENOOYER CHEVROLET	127 WOLF ROAD	SE 1/8 - 1/4 (0.236 mi.)	S114	573
TOWN OF COLONIE PUBLIC SAFETY	312 WOLF RD	N 1/8 - 1/4 (0.242 mi.)	R121	599
Lower Elevation	Address	Direction / Distance	Map ID	Page
JOHN CERONE, INC.	70 SUNSET BLVD.	NW 1/8 - 1/4 (0.237 mi.)	T115	579

AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the AST list, as provided by EDR, and dated 06/17/2010 has revealed that there are 4 AST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
SUNOCO #0363-3021	656 ALBANY-SHAKER RD	0 - 1/8 (0.000 mi.)	A40	178
SUNBELT RENTALS INC.	272 WOLF ROAD	NW 0 - 1/8 (0.015 mi.)	J50	208
VANTAGE EQUIPMENT, LLC	17 NORTHWAY LANE	NNW 1/8 - 1/4 (0.228 mi.)	109	524
DENOOYER CHEVROLET	127 WOLF ROAD	SE 1/8 - 1/4 (0.236 mi.)	S113	556

CBS: These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

A review of the CBS list, as provided by EDR, and dated 06/17/2010 has revealed that there is 1 CBS site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FEDERAL EXPRESS CORP	281 OLD WOLF RD	NNW 0 - 1/8 (0.109 mi.)	P74	340

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Registered Storage Tanks

HIST UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the HIST UST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 22 HIST UST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CAPITAL NEWSPAPERS, THE HEARST	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A3	35
ENTENMANN'S INC.	242 WOLF RD.	0 - 1/8 (0.000 mi.)	D15	63
HOLIDAY INN TURF	205 WOLF RD	0 - 1/8 (0.000 mi.)	E18	71
J J NAUGHTER INC	654 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A24	88
TOWN OF COLONIE PURE WATERS DE	108 WOLF ROAD	0 - 1/8 (0.000 mi.)	G28	120
DESMOND AMERICANA	660 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	G29	126
SUNOCO #0363-3021	656 ALBANY-SHAKER RD	0 - 1/8 (0.000 mi.)	A40	178
SUNBELT RENTALS INC.	272 WOLF ROAD	NW 0 - 1/8 (0.015 mi.)	J50	208
TRANSCON LINES	280 WOLF ROAD	NW 0 - 1/8 (0.066 mi.)	K53	235
LAZARE LINCOLN MERCURY, INC.	144 WOLF ROAD	SSW 0 - 1/8 (0.068 mi.)	L54	239
ALBANY MARRIOTT HOTEL	189 WOLF RD.	SW 0 - 1/8 (0.090 mi.)	O68	314
FEDERAL EXPRESS CORP	281 OLD WOLF RD	NNW 0 - 1/8 (0.109 mi.)	P74	340
HESS STATION #32334	156 WOLF RD W/S	SSW 1/8 - 1/4 (0.173 mi.)	Q81	375
MLB INDUSTRIES INC	3 NORTHWAY LANE	N 1/8 - 1/4 (0.210 mi.)	R88	416
FEDERAL EXPRESS	8 NORTHWAY LANE	NNW 1/8 - 1/4 (0.213 mi.)	R96	467
SULZER TURBO/SYSTEMS INC	7 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R97	470
ST JOHNSBURY TRUCKING	7-9 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R99	478
ST JOHNSBURY TRUCKING CO.	7-9 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R101	498
CROWN ENTERPRISES INC	10 NORTHWAY LANE	NNW 1/8 - 1/4 (0.215 mi.)	R103	505
DENOOYER CHEVROLET	127 WOLF ROAD	SE 1/8 - 1/4 (0.236 mi.)	S113	556
TOWN OF COLONIE PUBLIC SAFETY	312 WOLF RD	N 1/8 - 1/4 (0.242 mi.)	R121	599
Lower Elevation	Address	Direction / Distance	Map ID	Page
JOHN CERONE, INC.	70 SUNSET BLVD.	NW 1/8 - 1/4 (0.237 mi.)	T115	579

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 08/24/2010 has revealed that there are 87 NY Spills sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FLEET BANK WOLF RD VAPORS Date Closed: 12/7/1993	WOLF RD	0 - 1/8 (0.000 mi.)	B4	37
WASTE MGT PIER 1 WOLF RD Date Closed: 4/7/1995	WOLF RD	0 - 1/8 (0.000 mi.)	B5	40
CAPITAL NEWSPAPERS TU Date Closed: 3/8/1994	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A6	42
ATLANTIC WOLF RD NY TEL Date Closed: 8/6/1992	WOLF RD @ ALBANY SHAK	(ER0 - 1/8 (0.000 mi.)	C8	48
HESS 32334 WOLF RD Date Closed: 6/18/2007 Date Closed: 11/10/2008	156 WOLF RD	0 - 1/8 (0.000 mi.)	B9	51
HESS WOLF RD Date Closed: 12/1/2009	156 WOLF RD	0 - 1/8 (0.000 mi.)	B10	53
SUNOCO WOLF @ ALB SHAKER Date Closed: 3/20/2000	WOLF RD @ ALBANY SHAK	(ERO - 1/8 (0.000 mi.)	A11	54
TIMES UNION CAPITAL NEWS Date Closed: 5/14/2009 Date Closed: 2/9/1994	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A14	59
205 WOLF RD ACCIDENT Date Closed: 7/26/1995	205 WOLF RD @ TURF INN	0 - 1/8 (0.000 mi.)	E16	66
WOLF ROAD SPILL Date Closed: 12/5/1988	243 WOLF ROAD	0 - 1/8 (0.000 mi.)	D17	69
BUDGET CAR RENTAL WOLF RD Date Closed: 5/13/1988	WOLF RD	0 - 1/8 (0.000 mi.)	B22	83
ALBANY PARK & FLY WOLF RD Date Closed: 8/28/1995	264 WOLF RD	0 - 1/8 (0.000 mi.)	C23	86
NIMO PUMP STATION WOLF RD Date Closed: 6/7/1988 Date Closed: 2/19/1997	WOLF RD	0 - 1/8 (0.000 mi.)	F26	112
HESS #32334 WOLF RD Date Closed: 10/13/1993	WOLF RD	0 - 1/8 (0.000 mi.)	F27	117
DESMOND AMERICANA Date Closed: 4/13/2005 Date Closed: 2/17/1989	660 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	G29	126
WEST CENTRAL ENV 1-87 Date Closed: 3/22/1990	I-87 / ALBANY SHAKER	0 - 1/8 (0.000 mi.)	C31	140
AVIS ALBANY SHAKER RD Date Closed: 9/11/1987	ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	G34	146
FED EX TRUCK WOLF RD Date Closed: 8/6/2008	260 WOLF RD	0 - 1/8 (0.000 mi.)	35	149

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
A-PLUS ALBANY SHAKER RD Date Closed: 10/1/2003	656 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A36	151
SUNOCO #0363-3021 Date Closed: 6/4/2001	656 ALBANY-SHAKER RD	0 - 1/8 (0.000 mi.)	A40	178
NIMO TRANSFORMER WOLF RD Date Closed: 6/20/2006	271 WOLF RD POLE 89	NW 0 - 1/8 (0.004 mi.)	J44	192
ALBANY AIRPORT AMERICAN Date Closed: 11/5/2001 Date Closed: 10/5/1998 *Additional key fields are available in the N	ALBANY AIRPORT SHAKER	RNE 0 - 1/8 (0.009 mi.)	H45	194
LATHAM CONSTRUCTION Date Closed: 1/26/2001	271 WOLF RD	NW 0 - 1/8 (0.013 mi.)	J46	200
SUNBELT RENTALS WOLF RD Date Closed: 2/13/2009	272 WOLF RD	NW 0 - 1/8 (0.015 mi.)	J49	207
BFI TRUCK COMPUTER DR PK LOT Date Closed: 3/14/2006	15 COMPUTER DR W PK LOT	SE 0 - 1/8 (0.052 mi.)	52	234
LAZARE LINCOLN MERCURY Date Closed: 12/5/1997	144 WOLF RD	SSW 0 - 1/8 (0.068 mi.)	L56	248
LEATSO'S FARM WOLF RD Date Closed: 11/20/2001	216 WOLF RD	NE 0 - 1/8 (0.070 mi.)	57	267
FEDERAL EXPRESS WOLF RD Date Closed: 2/2/1999	281 OLD WOLFRD	NW 0 - 1/8 (0.075 mi.)	K60	273
AMERICAN FREIGHTWAY TERM Date Closed: 4/13/2001	4 TERMINAL DR	NW 0 - 1/8 (0.075 mi.)	K61	275
AMERICAN FREIGHTWAYS Date Closed: 4/13/2001	4 TERMINAL DR	NW 0 - 1/8 (0.075 mi.)	K62	278
SUNOCO ALBANY SHAKER RD Date Closed: 10/13/1994	650 ALBANY SHAKER RD	SE 0 - 1/8 (0.082 mi.)	N64	283
COMMERCIAL PROPERTY SUNSET BLV Date Closed: 12/9/2009	200 SUNSET BLVD	NW 0 - 1/8 (0.085 mi.)	67	313
NIMO WOLF RD Date Closed: 4/24/1997	292 WOLF RD	NNW 0 - 1/8 (0.101 mi.)	P72	335
NIMO TRANSFORMER Date Closed: 4/25/2007	4 COMPUTER DR	SE 1/8 - 1/4 (0.147 mi.)	75	346
RONALD DURANTE/SMITH TRAN Date Closed: 10/17/1988	TERMINAL DRIVE	NW 1/8 - 1/4 (0.152 mi.)	76	347
SHERMAN WILLIAMS STORE WOLF RD Date Closed: 6/27/2002 Date Closed: 9/3/2002	130 WOLF RD	SSW 1/8 - 1/4 (0.159 mi.)	Q78	367
COLONIE ATHLETIC CLUB Date Closed: 10/15/1993	636 ALBANY SHAKER RD	SE 1/8 - 1/4 (0.163 mi.)	80	372
RYMANOWSKI RES COMPASS ST Date Closed: 7/19/1995	5 COMPASS ST	NW 1/8 - 1/4 (0.199 mi.)	82	386
NIMO BACKHOE DRUM NWAY LN Date Closed: 1/21/1997	6 NORTHWAY LN @ MK SYS	? NNW 1/8 - 1/4 (0.210 mi.)	R87	414
MLB INDUSTRIES INC Date Closed: 2/27/2002	3 NORTHWAY LANE	N 1/8 - 1/4 (0.210 mi.)	R88	416

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
MK ENGINE SYSTEMS NWAY LN Date Closed: 9/21/1995	6 NORTHWAY LN	NNW 1/8 - 1/4 (0.211 mi.)	R91	455
HARPER PROP NORTHWAY LN Date Closed: 6/29/1989	5 NORTHWAY LN	N 1/8 - 1/4 (0.211 mi.)	R93	459
ST JOHNSBURY NORTHWAY LN Date Closed: 10/7/1992	7-9 NORTHWAY LN	NNW 1/8 - 1/4 (0.212 mi.)	R95	464
CROWN ENT NORTHWAY LN Date Closed: 6/6/2001	10 NORTHWAY LN	NNW 1/8 - 1/4 (0.215 mi.)	R105	514
BLUE LINE EXP NORTHWAY LN Date Closed: 1/17/1989	16 NORTHWAY LN	NNW 1/8 - 1/4 (0.220 mi.)	R107	519
BIRMAN NORTHWAY LN Date Closed: 8/10/1990	16 NORTHWAY LN	NNW 1/8 - 1/4 (0.224 mi.)	R108	522
DENOOYER CHEVY WOLF RD Date Closed: 9/3/2002 Date Closed: 8/10/2005	127 WOLF RD	SE 1/8 - 1/4 (0.236 mi.)	S111	531
COLONIE PD WOLF RD Date Closed: 10/15/2001 Date Closed: 6/28/1994 *Additional key fields are available in the M	312 WOLF RD	N 1/8 - 1/4 (0.240 mi.)	R119	591
COLONIE PUBLIC SAFETY BLDG WOL Date Closed: 10/28/1999	312 WOLF RD	N 1/8 - 1/4 (0.241 mi.)	R120	597
NIMO SAND CREEK TRANSFRMR Date Closed: 2/14/2001	479 SAND CREEK RD	SSW 1/4 - 1/2 (0.259 mi.)	U123	603
MUNK RES MARGARET DR Date Closed: 4/13/1999	3 MARGARET DR OIL IN SE	SE 1/4 - 1/2 (0.301 mi.)	126	613
HANNAFORD PLAZA WOLF RD Date Closed: 1/26/2000	98 WOLF RD	S 1/4 - 1/2 (0.309 mi.)	V127	615
EXAM MANAGEMENT COMPUTER DR Date Closed: 8/6/2008	14 COMPUTER DR E.	SSW 1/4 - 1/2 (0.328 mi.)	128	618
MEYERS GARAGE WOLF RD Date Closed: 10/17/1988	WOLF RD @ SAND CREEK R	DS 1/4 - 1/2 (0.335 mi.)	V129	619
MOBIL WOLF @ SAND CREEK Date Closed: 4/2/1998	88 WOLF RD @ SAND CREEK	(SSW 1/4 - 1/2 (0.341 mi.)	W130	622
MOBIL WOLF RD @ SAND CRK Date Closed: 1/30/1995	88 WOLF RD @ SAND CREEK	(SSW 1/4 - 1/2 (0.341 mi.)	W131	624
MOBIL WOLF RD Date Closed: 2/7/2001 Date Closed: 7/10/1986 *Additional key fields are available in the N	88 WOLF RD flap Findings section	S 1/4 - 1/2 (0.342 mi.)	V132	627
HESS #32413 WOLF RD Date Closed: 12/21/1998	89 WOLF RD	S 1/4 - 1/2 (0.342 mi.)	V133	634
AAMCO TRANSMISSION Date Closed: 7/2/1987	SAND CREEK RD / WOLF	S 1/4 - 1/2 (0.342 mi.)	V134	637
EXXON MOBIL WOLF RD Date Closed: 11/7/2008	88 WOLF ROAD	S 1/4 - 1/2 (0.356 mi.)	W135	640
PRIVATE RESIDENCE NIMO Date Closed: 6/21/2004	17 COMPUTER DRIVE EAST	SSW 1/4 - 1/2 (0.360 mi.)	Y137	644

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
HATHAWAY RES MARGARET RD Date Closed: 7/28/2000	21 MARGARET RD	ESE 1/4 - 1/2 (0.363 mi.)	138	645
EXXON MOBIL #11329 WOLF RD Date Closed: 8/21/2008	88 WOLF ROAD	S 1/4 - 1/2 (0.372 mi.)	W141	653
MOBIL OIL CORP SS K9M Date Closed: 7/3/2009 Date Closed: 1/14/2000	88 WOLF RD	S 1/4 - 1/2 (0.372 mi.)	W142	654
MOBIL MART WOLF RD Date Closed: 2/3/2005	88 WOLF RD	S 1/4 - 1/2 (0.372 mi.)	W143	660
NIMO TRANSFORMER POLE #4 Date Closed: 12/17/2002	25 COMPUTER DR E POLE #	S 1/4 - 1/2 (0.381 mi.)	Y146	666
CYTOLOGY SCREENING INC Date Closed: 5/31/2002	26 COMPUTER DR EAST	S 1/4 - 1/2 (0.383 mi.)	Y147	668
NIMO TRANSFORMER Date Closed: 2/1/2008	10 AVIATION DRIVE	SSW 1/4 - 1/2 (0.394 mi.)	Y149	670
NIMO TRANSFORMER Date Closed: 11/21/2007	2 AVIATION DR	SSW 1/4 - 1/2 (0.411 mi.)	152	677
NYNEX KENLYN DR SAND CRK Date Closed: 3/5/1991	KENLYN @ SAND CREEK	S 1/4 - 1/2 (0.438 mi.)	AA155	682
NAT GRID TRANSFORMER HAWTHORNE Date Closed: 6/1/2009	22 HAWTHORNE CT POLE #	ESE 1/4 - 1/2 (0.440 mi.)	156	685
SLICK ON SWIMMING POOL Date Closed: 9/12/1989	7 KENLYN DR	S 1/4 - 1/2 (0.441 mi.)	AA157	686
KELLY RES ROSEBUD LN Date Closed: 5/9/1988	5 ROSEBUD LANE	SE 1/4 - 1/2 (0.477 mi.)	162	702
HOUSE ASBESTOS SAND CREEK Date Closed: 7/6/2001	542 SAND CREEK RD	WNW 1/4 - 1/2 (0.495 mi.)	164	708
Lower Elevation	Address	Direction / Distance	Map ID	Page
ALBANY COUNTY JAIL SHAKER Date Closed: 9/24/1998	ALBANY SHAKER RD JAIL	0 - 1/8 (0.000 mi.)	20	76
ALBANY AIRPORT PK GARAGE Date Closed: 12/14/2004	ALBANY AIRPORT SHAKER R	R NNE 0 - 1/8 (0.001 mi.)	142	190
ALBANY AIRPORT Date Closed: 1/12/2005	ALBANY AIRPORT SHAKER R	R NNE 0 - 1/8 (0.001 mi.)	143	191
FEDERAL EXP NORTHWAY LN Date Closed: 11/23/1988	NORTHWAY LN	NNE 1/8 - 1/4 (0.212 mi.)	94	462
LATHAM WATER DIST WOLF RD Date Closed: 6/6/1990 Date Closed: 9/22/1992	312 WOLF RD	N 1/4 - 1/2 (0.297 mi.)	125	608
DEC AIR LAB HEMLOCK ST Date Closed: 1/13/1993	10 HEMLOCK ST	NNW 1/4 - 1/2 (0.357 mi.)	X136	641
BIG A AUTO PARTS HEMLOCK Date Closed: 10/21/1994	20 HEMLOCK ST	NNE 1/4 - 1/2 (0.372 mi.)	Z140	650
ST JOHNSBURY NORTHWAY LN Date Closed: 1/5/2001	9 NORTHWAY LN N.	NNE 1/4 - 1/2 (0.374 mi.)	Z144	661

Lower Elevation	Address	Direction / Distance	Map ID	Page
LYONS TRKG NORTHWAY LN N Date Closed: 3/31/1987	9 NORTHWAY LN N.	NNE 1/4 - 1/2 (0.375 mi.)	Z145	664
VELLANO BROS HEMLOCK ST Date Closed: 8/6/1992	7 HEMLOCK ST	NNW 1/4 - 1/2 (0.395 mi.)	X151	674
AVIS ALBANY SHAKER RD CONSOLIDATED FRIEGHT Date Closed: 11/10/2003 Date Closed: 2/23/1999	737 ALBANY SHAKER RD 845 WATERVLIET SHAKER R	NNW 1/4 - 1/2 (0.421 mi.) NE 1/4 - 1/2 (0.456 mi.)	154 161	681 698
MACFARLAND NORTHWAY LN Date Closed: 1/14/2008	4 NORTHWAY LN N.	NNE 1/4 - 1/2 (0.488 mi.)	163	704

NY Hist Spills: This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database.

A review of the NY Hist Spills list, as provided by EDR, and dated 01/01/2002 has revealed that there are 57 NY Hist Spills sites within approximately 0.5 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
FLEET BANK WOLF RD VAPORS	WOLF RD	0 - 1/8 (0.000 mi.)	B4	37
WASTE MGT PIER 1 WOLF RD	WOLF RD	0 - 1/8 (0.000 mi.)	B5	40
CAPITAL NEWSPAPERS TU	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A6	42
ATLANTIC WOLF RD NY TEL	WOLF RD @ ALBANY SHAK	ER0 - 1/8 (0.000 mi.)	C8	48
SUNOCO WOLF @ ALB SHAKER	WOLF RD @ ALBANY SHAK	ERO - 1/8 (0.000 mi.)	A11	54
TIMES UNION CAPITAL NEWS	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A14	59
205 WOLF RD ACCIDENT	205 WOLF RD @ TURF INN	0 - 1/8 (0.000 mi.)	E16	66
WOLF ROAD SPILL	243 WOLF ROAD	0 - 1/8 (0.000 mi.)	D17	69
BUDGET CAR RENTAL WOLF RD	WOLF RD	0 - 1/8 (0.000 mi.)	B22	83
ALBANY PARK & FLY WOLF RD	264 WOLF RD	0 - 1/8 (0.000 mi.)	C23	86
NIMO PUMP STATION WOLF RD	WOLF RD	0 - 1/8 (0.000 mi.)	F26	112
HESS #32334 WOLF RD	WOLF RD	0 - 1/8 (0.000 mi.)	F27	117
DESMOND AMERICANA	660 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	G29	126
WEST CENTRAL ENV 1-87	I-87 / ALBANY SHAKER	0 - 1/8 (0.000 mi.)	C31	140
A-PLUS ALBANY SHAKER RD	656 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A36	151
SUNOCO #0363-3021	656 ALBANY-SHAKER RD	0 - 1/8 (0.000 mi.)	A40	178
ALBANY AIRPORT AMERICAN	ALBANY AIRPORT SHAKER	RNE 0 - 1/8 (0.009 mi.)	H45	194
LATHAM CONSTRUCTION	271 WOLF RD	NW 0 - 1/8 (0.013 mi.)	J46	200
LAZARE LINCOLN MERCURY	144 WOLF RD	SSW 0 - 1/8 (0.068 mi.)	L56	248
LEATSO'S FARM WOLF RD	216 WOLF RD	NE 0 - 1/8 (0.070 mi.)	<i>57</i>	267
FEDERAL EXPRESS WOLF RD	281 OLD WOLF RD	NW 0 - 1/8 (0.075 mi.)	K60	273
AMERICAN FREIGHTWAY TERM	4 TERMINAL DR	NW 0 - 1/8 (0.075 mi.)	K61	275
AMERICAN FREIGHTWAYS	4 TERMINAL DR	NW 0 - 1/8 (0.075 mi.)	K62	278
SUNOCO ALBANY SHAKER RD	650 ALBANY SHAKER RD	SE 0 - 1/8 (0.082 mi.)	N64	283
NIMO WOLF RD	292 WOLF RD	NNW 0 - 1/8 (0.101 mi.)	P72	335
COLONIE ATHLETIC CLUB	636 ALBANY SHAKER RD	SE 1/8 - 1/4 (0.163 mi.)	80	372
RYMANOWSKI RES COMPASS ST	5 COMPASS ST	NW 1/8 - 1/4 (0.199 mi.)	82	386
NIMO BACKHOE DRUM NWAY LN	6 NORTHWAY LN @ MK SYS	S? NNW 1/8 - 1/4 (0.210 mi.)	R87	414
MLB INDUSTRIES INC	3 NORTHWAY LANE	N 1/8 - 1/4 (0.210 mi.)	R88	416
MK ENGINE SYSTEMS NWAY LN	6 NORTHWAY LN	NNW 1/8 - 1/4 (0.211 mi.)	R91	455

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
BLUE LINE EXP NORTHWAY LN	16 NORTHWAY LN	NNW 1/8 - 1/4 (0.220 mi.)	R107	519
BIRMAN NORTHWAY LN	16 NORTHWAY LN	NNW 1/8 - 1/4 (0.224 mi.)	R108	522
DENOOYER CHEVY WOLF RD	127 WOLF RD	SE 1/8 - 1/4 (0.236 mi.)	S111	531
COLONIE PD WOLF RD	312 WOLF RD	N 1/8 - 1/4 (0.240 mi.)	R119	591
COLONIE TOWN FACILITY	312 WOLF RD	N 1/8 - 1/4 (0.242 mi.)	R122	602
NIMO SAND CREEK TRANSFRMR	479 SAND CREEK RD	SSW 1/4 - 1/2 (0.259 mi.)	U123	603
MUNK RES MARGARET DR	3 MARGARET DR OIL IN SE	SE 1/4 - 1/2 (0.301 mi.)	126	613
HANNAFORD PLAZA WOLF RD	98 WOLF RD	S 1/4 - 1/2 (0.309 mi.)	V127	615
MEYERS GARAGE WOLF RD	WOLF RD @ SAND CREEK RI	DS 1/4 - 1/2 (0.335 mi.)	V129	619
MOBIL WOLF @ SAND CREEK	88 WOLF RD @ SAND CREEK	(SSW 1/4 - 1/2 (0.341 mi.)	W130	622
MOBIL WOLF RD @ SAND CRK	88 WOLF RD @ SAND CREEK	(SSW 1/4 - 1/2 (0.341 mi.)	W131	624
MOBIL WOLF RD	88 WOLF RD	S 1/4 - 1/2 (0.342 mi.)	V132	627
HESS #32413 WOLF RD	89 WOLF RD	S 1/4 - 1/2 (0.342 mi.)	V133	634
AAMCO TRANSMISSION	SAND CREEK RD / WOLF	S 1/4 - 1/2 (0.342 mi.)	V134	637
HATHAWAY RES MARGARET RD	21 MARGARET RD	ESE 1/4 - 1/2 (0.363 mi.)	138	645
MOBIL OIL CORP SS K9M	88 WOLF RD	S 1/4 - 1/2 (0.372 mi.)	W142	654
NYNEX KENLYN DR SAND CRK	KENLYN @ SAND CREEK	S 1/4 - 1/2 (0.438 mi.)	AA155	682
SLICK ON SWIMMING POOL	7 KENLYN DR	S 1/4 - 1/2 (0.441 mi.)	AA157	686
KELLY RES ROSEBUD LN	5 ROSEBUD LANE	SE 1/4 - 1/2 (0.477 mi.)	162	702
HOUSE ASBESTOS SAND CREEK	542 SAND CREEK RD	WNW 1/4 - 1/2 (0.495 mi.)	164	708
Lower Elevation	Address	Direction / Distance	Map ID	Page
ALBANY COUNTY JAIL SHAKER	ALBANY SHAKER RD JAIL	0 - 1/8 (0.000 mi.)	20	76
FEDERAL EXP NORTHWAY LN	NORTHWAY LN	NNE 1/8 - 1/4 (0.212 mi.)	94	462
BIG A AUTO PARTS HEMLOCK	20 HEMLOCK ST	NNE 1/4 - 1/2 (0.372 mi.)	Z140	650
ST JOHNSBURY NORTHWAYLN	9 NORTHWAY LN N.	NNE 1/4 - 1/2 (0.374 mi.)	Z144	661
VELLANO BROS HEMLOCK ST	7 HEMLOCK ST	NNW 1/4 - 1/2 (0.395 mi.)	X151	674
CONSOLIDATED FRIEGHT	845 WATERVLIET SHAKER R	NE 1/4 - 1/2 (0.456 mi.)	161	698
MACFARLAND NORTHWAYLN	4 NORTHWAY LN N.	NNE 1/4 - 1/2 (0.488 mi.)	163	704

Other Ascertainable Records

RCRA-NonGen: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA-NonGen list, as provided by EDR, and dated 02/17/2010 has revealed that there are 19 RCRA-NonGen sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
DESMOND AMERICANA	660 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	G29	126
SUNOCO SERVICE STATION	656 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A30	136
WOLF ROAD ONE HOUR CLEANERS	201 WOLF RD	0 - 1/8 (0.000 mi.)	E39	163
ALBANY PARK & FLY	264 WOLF RD	NW 0 - 1/8 (0.013 mi.)	J47	202
RUSHMORE WEBER	272 WOLF RD	NW 0 - 1/8 (0.015 mi.)	J51	219
CAPITALAND TIRE MART INC	284 WOLF RD	NW 0 - 1/8 (0.070 mi.)	K58	269
WESTERN UNION	17 COMPUTER DR	SSE 0 - 1/8 (0.073 mi.)	M59	271
ONYX ENVIRONMENTAL SERVICES	10 TERMINAL DR	NW 0 - 1/8 (0.084 mi.)	K66	312
A G F A DIV	189 WOLF RD	SW 0 - 1/8 (0.090 mi.)	O69	318
BLUE SHIELD	187 WOLF RD	SW 0 - 1/8 (0.093 mi.)	<i>O70</i>	319

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
GENERAL ELECTRIC - FORMER SHOP	14 VATRANO RD	S 0 - 1/8 (0.096 mi.)	M71	332
FEDERAL EXPRESS CORP	281 OLD WOLF RD	NNW 0 - 1/8 (0.109 mi.)	P74	340
TRANS-BORDERS FREIGHT SYSTEMS	3 NORTHWAY LN	N 1/8 - 1/4 (0.210 mi.)	R89	424
TURBOSYSTEMS INTL	7 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R100	481
GENERAL STEEL FABRICATORS	11 NORTHWAY LA	NNW 1/8 - 1/4 (0.215 mi.)	R102	504
CROWN ENTERPRISES INC	10 NORTHWAY LANE	NNW 1/8 - 1/4 (0.215 mi.)	R103	505
CROWN ENTERPRIZES	10 NORTHWAY LN	NNW 1/8 - 1/4 (0.215 mi.)	R106	516
NYSDOT BIN 1033131	I-87 OVER SAND CRK RD B	SSW 1/8 - 1/4 (0.237 mi.)	U116	583
NYSDOT BIN 1033132	I-87 OVER SAND CRK RD B	SSW 1/8 - 1/4 (0.237 mi.)	U117	586

MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the MANIFEST list, as provided by EDR, and dated 07/28/2010 has revealed that there are 20 MANIFEST sites within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
CAPITAL NEWSPAPERS	645 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A1	7
HESS CORPORATION	156 WOLF RD	0 - 1/8 (0.000 mi.)	B2	25
DOMINION TRANSMISSION INCORPOR	148 WOLF ROAD	0 - 1/8 (0.000 mi.)	B25	102
SUNOCO SERVICE STATION	656 ALBANY SHAKER RD	0 - 1/8 (0.000 mi.)	A30	136
WOLF ROAD ONE HOUR CLEANERS	201 WOLF RD	0 - 1/8 (0.000 mi.)	E39	163
ALBANY PARK & FLY	264 WOLF RD	NW 0 - 1/8 (0.013 mi.)	J47	202
RUSHMORE WEBER	272 WOLF RD	NW 0 - 1/8 (0.015 mi.)	J51	219
LAZARE LINCOLN MERCURY	144 WOLF RD	SSW 0 - 1/8 (0.068 mi.)	L56	248
VEOLIA ES TECHNICAL SOLUTIONS	10 TERMINAL DR	NW 0 - 1/8 (0.084 mi.)	K65	285
BLUE SHIELD	187 WOLF RD	SW 0 - 1/8 (0.093 mi.)	<i>070</i>	319
GENERAL ELECTRIC - FORMER SHOP	14 VATRANO RD	S 0 - 1/8 (0.096 mi.)	M71	332
SHERWIN WILLIAMS CO STORE 5101	WOLF RD	SSW 1/8 - 1/4 (0.159 mi.)	Q77	350
GENUINE PARTS CO	301 WOLF RD	N 1/8 - 1/4 (0.208 mi.)	R85	395
TRANS-BORDERS FREIGHT SYSTEMS	3 NORTHWAY LN	N 1/8 - 1/4 (0.210 mi.)	R89	424
ENGINE SYSTEMS CO	6 NORTHWAY LANE	NNW 1/8 - 1/4 (0.211 mi.)	R90	429
TURBOSYSTEMS INTL	7 NORTHWAY LANE	NNW 1/8 - 1/4 (0.214 mi.)	R100	481
CROWN ENTERPRIZES	10 NORTHWAY LN	NNW 1/8 - 1/4 (0.215 mi.)	R106	516
DENOOYER CHEVROLET	127 WOLF RD	SE 1/8 - 1/4 (0.236 mi.)	S112	538
NYSDOT BIN 1033131	I-87 OVER SAND CRK RD B	SSW 1/8 - 1/4 (0.237 mi.)	U116	583
NYSDOT BIN 1033132	I-87 OVER SAND CRK RD B	SSW 1/8 - 1/4 (0.237 mi.)	U117	586

DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the DRYCLEANERS list, as provided by EDR, and dated 03/23/2010 has revealed that there is 1 DRYCLEANERS site within approximately 0.25 miles of the target property.

Equal/Higher Elevation	Address	Direction / Distance	Map ID	Page
VALET CLEANERS	199 WOLF RD.	0 - 1/8 (0.000 mi.)	E33	146

Due to poor or inadequate address information, the following sites were not mapped:

Site Name Database(s)

NYSDEC MANIFEST SPANCRETE MANIFEST MANIFEST

NYSDOT - REGION 1 FINDS,MANIFEST,RCRA-NLR

NYNEX MANIFEST
NYS DMV 244B INSERTING MANIFEST
NYSDEC MANIFEST

NYS DEPT OF CIVIL SRVC FINDS,MANIFEST,RCRA-NLR

ALBANY COUNTY AIRPORT MANIFEST
CUMBERLAND FARMS 3141 MANIFEST

NIAGARA MOHAWK POWER CORP FINDS,RCRA-NLR,MANIFEST


CUMBERLAND FARMS INC MANIFEST NYNEX MANIFEST

SCHUYLER MEADOWS CLUB FINDS, MANIFEST, RCRA-NLR

COLONIE SANITARY LF
LATHAM MOTORS, INC.
UST NCFM
NYSDOT BIN 1004250
NYSDOT BIN 1072440
NYSDOT GRAPHIC ARTS
CERCLIS-NFRAP
UST NCFM
RCRA-LQG
RCRA-LQG
RCRA-LQG
RYSDOT GRAPHIC ARTS
FINDS,RCRA-NLR

CDTA BUS INTERSTATE @ CENTRAL SPILLS
DRUM RAILROAD @ INTERSTATE RR AVE SPILLS

OVERVIEW MAP - 2896934.2s

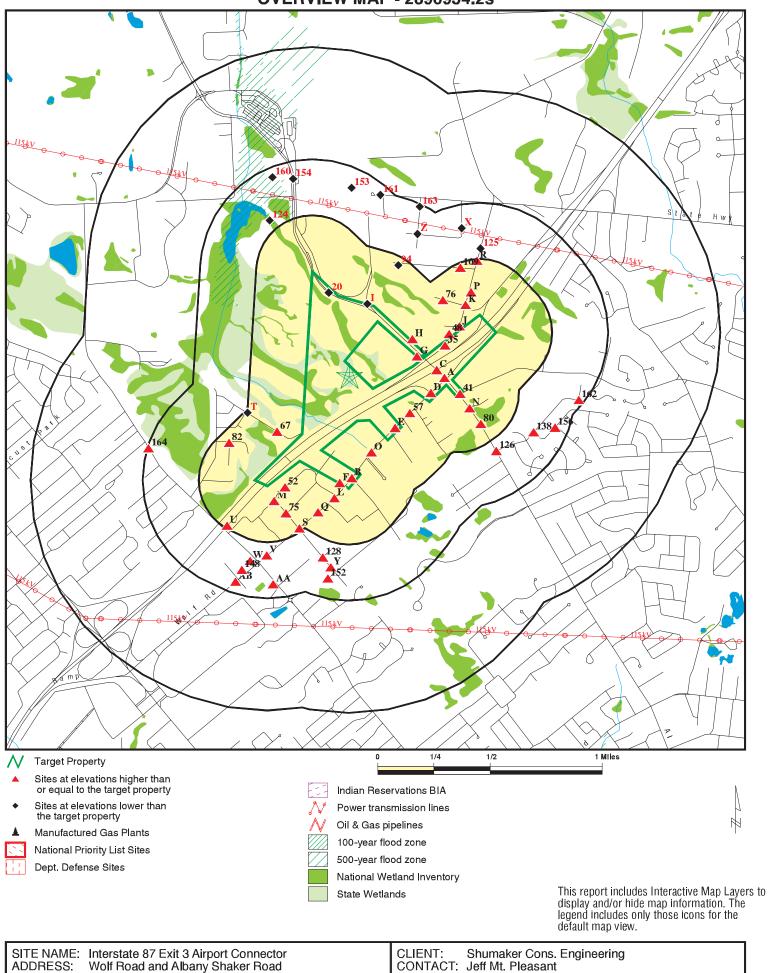


SITE NAME: Interstate 87 Exit 3 Airport Connector ADDRESS: Wolf Road and Albany Shaker Road

Albany NY 12211 LAT/LONG: 42.7277 / 73.8033 Jeff Mt. Pleasant

INQUIRY#: 2896934.2s

DATE: October 18, 2010 3:06 pm

DETAIL MAP - 2896934.2s

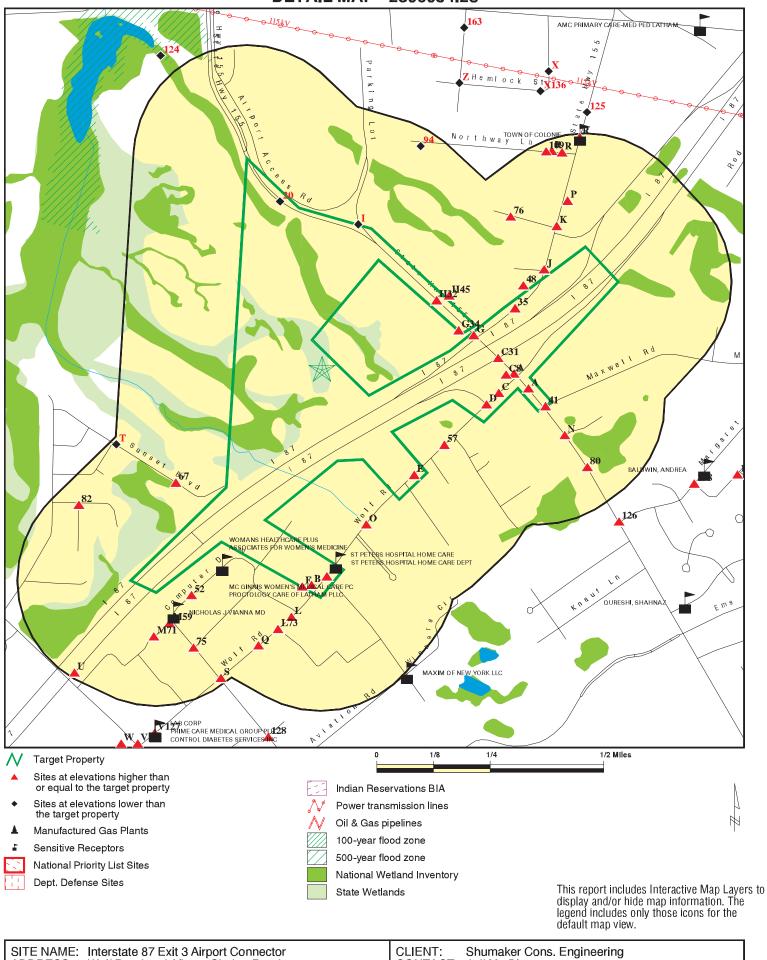

ADDRESS: Wolf Road and Albany Shaker Road

Albany NY 12211 LAT/LONG: 42.7277 / 73.8033 CLIENT: CONTACT:

Jeff Mt. Pleasant INQUIRY#: 2896934.2s

October 18, 2010 3:07 pm DATE:

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	>1	Total Plotted	
STANDARD ENVIRONMENTAL RECORDS									
Federal NPL site list									
NPL Proposed NPL NPL LIENS		1.000 1.000 TP	0 0 NR	0 0 NR	0 0 NR	0 0 NR	NR NR NR	0 0 0	
Federal Delisted NPL site list									
Delisted NPL		1.000	0	0	0	0	NR	0	
Federal CERCLIS list									
CERCLIS FEDERAL FACILITY		0.500 1.000	0 0	0 0	0 0	NR 0	NR NR	0 0	
Federal CERCLIS NFRAF	site List								
CERC-NFRAP		0.500	0	0	0	NR	NR	0	
Federal RCRA CORRACT	TS facilities lis	st							
CORRACTS		1.000	0	0	0	0	NR	0	
Federal RCRA non-CORRACTS TSD facilities list									
RCRA-TSDF		0.500	0	0	0	NR	NR	0	
Federal RCRA generator	s list								
RCRA-LQG RCRA-SQG RCRA-CESQG		0.250 0.250 0.250	0 1 4	1 0 3	NR NR NR	NR NR NR	NR NR NR	1 1 7	
Federal institutional con- engineering controls reg									
US ENG CONTROLS US INST CONTROL		0.500 0.500	0 0	0 0	0 0	NR NR	NR NR	0 0	
Federal ERNS list									
ERNS		TP	NR	NR	NR	NR	NR	0	
State- and tribal - equivalent CERCLIS									
SHWS VAPOR REOPENED		1.000 1.000	0 0	1 1	0 0	0 0	NR NR	1 1	
State and tribal landfill a solid waste disposal site									
SWF/LF		0.500	0	0	0	NR	NR	0	
State and tribal leaking storage tank lists									
LTANKS HIST LTANKS INDIAN LUST		0.500 0.500 0.500	10 12 0	1 6 0	6 11 0	NR NR NR	NR NR NR	17 29 0	
State and tribal registered storage tank lists									
UST		0.250	11	11	NR	NR	NR	22	

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
CBS UST MOSF UST AST CBS AST MOSF AST CBS MOSF INDIAN UST FEMA UST		0.250 0.500 0.250 0.250 0.500 0.250 0.500 0.250 0.250	0 0 2 0 0 1 0	0 0 2 0 0 0 0	NR 0 NR NR 0 NR 0 NR	NR NR NR NR NR NR NR	NR NR NR NR NR NR NR NR	0 0 4 0 0 1 0 0
State and tribal institutional control / engineering control registries								
ENG CONTROLS INST CONTROL RES DECL		0.500 0.500 0.125	0 0 0	0 0 NR	0 0 NR	NR NR NR	NR NR NR	0 0 0
State and tribal voluntary cleanup sites								
VCP INDIAN VCP		0.500 0.500	0 0	0 0	0 0	NR NR	NR NR	0 0
State and tribal Brownfields sites								
ERP BROWNFIELDS		0.500 0.500	0 0	0 0	0 0	NR NR	NR NR	0 0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS		0.500	0	0	0	NR	NR	0
Local Lists of Landfill / So Waste Disposal Sites	olid							
ODI DEBRIS REGION 9 SWTIRE SWRCY INDIAN ODI		0.500 0.500 0.500 0.500 0.500	0 0 0 0	0 0 0 0	0 0 0 0	NR NR NR NR NR	NR NR NR NR NR	0 0 0 0
Local Lists of Hazardous Contaminated Sites	waste/							
US CDL DEL SHWS US HIST CDL		TP 1.000 TP	NR 0 NR	NR 0 NR	NR 0 NR	NR 0 NR	NR NR NR	0 0 0
Local Lists of Registered Storage Tanks								
HIST UST HIST AST		0.250 TP	12 NR	10 NR	NR NR	NR NR	NR NR	22 0
Local Land Records								
LIENS 2 LUCIS		TP 0.500	NR 0	NR 0	NR 0	NR NR	NR NR	0 0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Records of Emergency Release Reports								
HMIRS NY Spills NY Hist Spills		TP 0.500 0.500	NR 36 26	NR 17 11	NR 34 20	NR NR NR	NR NR NR	0 87 57
Other Ascertainable Records								
RCRA-NonGen DOT OPS DOD FUDS CONSENT ROD UMTRA MINES TRIS TSCA FTTS HIST FTTS SSTS ICIS PADS MLTS RADINFO FINDS RAATS HSWDS MANIFEST DRYCLEANERS NPDES AIRS E DESIGNATION INDIAN RESERV SCRD DRYCLEANERS COAL ASH EPA PCB TRANSFORMER COAL ASH DOE FINANCIAL ASSURANCE COAL ASH		0.250 TP 1.000 1.000 1.000 1.000 0.500 0.250 TP	12 N 0 0 0 0 0 0 RR R R R R R R R R R R N 0 1 1 N N 0 0 0 0 R R R R R R R R N N 0 1 1 N N 0 0 0 0 N N N N N 0 0 0 0	7 NO O O O O O RR NR R R R R R R R NN O O O NR NR R NR NN NN NN O O O NN NR NN O O O NR NR NN O	NR O O O O O R R R R R R R R R R R R N O O O O	NR 0 0 0 0 R R R R R R R R R R R R R R R	N	19 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0
EDR PROPRIETARY RECORDS								
EDR Proprietary Records Manufactured Gas Plants	S	1.000	0	0	0	0	NR	0

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

Α1 **CAPITAL NEWSPAPERS** RCRA-SQG 1000264173 645 ALBANY SHAKER RD FINDS NYD986900413

< 1/8 ALBANY, NY 12211 1 ft.

Site 1 of 11 in cluster A

RCRA-SQG: Relative:

Higher Date form received by agency: 01/01/2007

Facility name: **CAPITAL NEWSPAPERS** Actual: Facility address: 645 ALBANY SHAKER RD 301 ft.

ALBANY, NY 12211 EPA ID: NYD986900413

Mailing address: PO BOX 15000 ALBANY, NY 12212

Contact: Not reported Contact address: PO BOX 15000

ALBANY, NY 12212

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region:

Facility is not located on Indian land. Additional information is not known. Land type:

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous

> waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of

LTANKS HIST LTANKS

MANIFEST

hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: **HEARST CORP** Owner/operator address: **NOT REQUIRED**

NOT REQUIRED, WY 99999

Owner/operator country:

Owner/operator telephone: (212) 555-1212 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

HEARST CORP Owner/operator name: Owner/operator address: **NOT REQUIRED**

NOT REQUIRED, WY 99999

Owner/operator country:

Owner/operator telephone: (212) 555-1212 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Unknown Transporter of hazardous waste: Treater, storer or disposer of HW: No Underground injection activity: No

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: CAPITAL NEWSPAPERS

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/14/1999

Facility name: CAPITAL NEWSPAPERS
Classification: Small Quantity Generator

Date form received by agency: 05/11/1990

Facility name: CAPITAL NEWSPAPERS
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: Not reported

Area of violation: Generators - Records/Reporting

Date violation determined: 04/01/1994
Date achieved compliance: 08/23/1994
Violation lead agency: State

Enforcement action: INITIAL 3008(A) COMPLIANCE

Enforcement action date: 07/29/1994
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: 1200
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Records/Reporting

Date violation determined: 04/01/1994
Date achieved compliance: 08/23/1994
Violation lead agency: State

Enforcement action: FINAL 3008(A) COMPLIANCE ORDER

Enforcement action date: 08/23/1994
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 600

Final penalty amount: 600 Paid penalty amount: 600

Evaluation Action Summary:

Evaluation date: 04/01/1994

Evaluation: NON-FINANCIAL RECORD REVIEW

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

Area of violation: Generators - Records/Reporting

Date achieved compliance: 08/23/1994 Evaluation lead agency: State

Evaluation date: 02/11/1993

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

State

FINDS:

Registry ID: 110004446724

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

LTANKS:

Site ID: 293214
Spill No: 9110717
Spill Date: 1/14/1992
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/12/1992 Facility Addr2: Not reported Cleanup Ceased: 2/5/1992 Cleanup Meets Standard: True SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Reported to Dept: 1/14/1992 CID: Not reported Water Affected: Not reported Spill Notifier: Responsible Party Last Inspection: 1/15/1992

Recommended Penalty: Penalty Not Recommended

UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1/16/1992
Spill Record Last Update: 4/14/2009
Spiller Name: Not reported

Spiller Company: CAPITAL NEWSPAPER TIMES UNION TU

Spiller Address: NEWS PLZ BOX 15000 Spiller City,St,Zip: COLONIE, NY 12212

Spiller County: 999

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

DEC Region: 4

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS (Continued)

1000264173

DER Facility ID: 237330

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN/TS" 10/08/92: 9/92 SAMPLE RESULTS STILL SHOW MINOR

RESIDUAL. SEE 9111828, 9312547, 9314320.

FOUND CONT. GW DURING TANK PULL, SAMPLES TAKEN, SOIL <5PPM HNU, WTC Remarks:

INSPECTED. RESULTS SHOW XYLENE @ 18PPB SLIGHTLY ABOVE GW STANDARD, NO

FURTHER ACTION @ THIS TIME, SAMPLES TO BE TAKEN AGAIN FALL '92

Material:

Site ID: 293214 Operable Unit ID: 960837 Operable Unit: 01 Material ID: 415804 Material Code: 8000 Material Name: Diesel Case No.: Not reported Petroleum Material FA: Quantity: Units: Gallons Recovered: No

Not reported Resource Affected:

Oxygenate: False

Tank Test:

Site ID: 293214 Spill Tank Test: 1539513 Tank Number: Not reported

Tank Size: 0 Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

HIST LTANKS:

Region of Spill: 4 Spill Number: 9110717

Spill Date: 01/14/1992 Spill Time: 14:30

Spill Cause: Tank Test Failure Resource Affectd: On Land Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 02/12/92 Cleanup Ceased: 02/05/92 Cleanup Meets Standard: True

CHRISTENSEN/TS Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported

Not reported Notifier Name:

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

Notifier Agency:
Notifier Phone:
Notifier Extension:
Reported to Department Date: 01/14/92
Reported to Department Time: 15:39
SWIS:
01
Spiller Contact:
Not reported
Not reported
Not reported

Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: CAPITAL NEWSPAPER TU NEWS

Spiller Address: NEWS PLZ BOX 15000

Spiller City, St, Zip: COLONIE 12212

Spiller Cleanup Date: //

Facility Contact: Not reported
Facility Phone: (518) 454-5614
Facility Extention: Not reported
Spill Notifier: Responsible Party

PBS Number: 4-054488 Last Inspection: 01/15/92

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/16/92
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 10/16/01 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported 19940728 Last Date:

DEC Remarks: 10/08/92: 9/92 SAMPLE RESULTS STILL SHOW MINOR RESIDUAL. SEE 9111828, 9312547,

9314320.

 ${\bf Spill\ Cause:} \qquad {\bf FOUND\ CONT.\ GW\ DURING\ TANK\ PULL,\ SAMPLES\ TAKEN,\ SOIL\ {\bf <5PPM\ HNU,\ WTC\ INSPECTED.}$

RESULTS SHOW XYLENE @ 18PPB SLIGHTLY ABOVE GW STANDARD, NO FURTHER ACTION @

THIS TIME, SAMPLES TO BE TAKEN AGAIN FALL 92

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

NY MANIFEST:

EPA ID: NYD986900413

Country: USA

Mailing Name: CAPITAL NEWSPAPERS
Mailing Contact: GEARY MORGAN/PLANT SUPER
Mailing Address: 645 ALBANY SHAKER RD

Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12211
Mailing Zip4: 1195
Mailing Country: USA

Mailing Phone: 518-434-0149

Document ID: ILA7363089

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 1478 Trans2 State ID: 1431 970808 Generator Ship Date: Trans1 Recv Date: 970808 Trans2 Recy Date: 970811 TSD Site Recv Date: 970813 Part A Recv Date: Not reported Part B Recv Date: 970910 Generator EPA ID:

 Generator EPA ID:
 NYD986900413

 Trans1 EPA ID:
 MAD039322250

 Trans2 EPA ID:
 OHD009865825

 TSDF ID:
 ILD000608471

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF1030359

Manifest Status: Not reported

Trans1 State ID: CT5000001495

Trans2 State ID: Not reported

Generator Ship Date: 05/23/2006

Trans1 Recv Date: 05/23/2006

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS (Continued)

1000264173

Trans2 Recv Date: Not reported 05/23/2006 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986900413 Trans1 EPA ID: CTJ32492 Trans2 EPA ID: Not reported TSDF ID: CT5000001495

Waste Code: D009 - MERCURY 0.2 MG/L TCLP

Quantity: 01000 Units: P - Pounds Number of Containers: 002

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 06

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Not reported Manifest Ref Num: Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CT5000001495 Trans2 State ID: Not reported 2008-03-12 Generator Ship Date: Trans1 Recv Date: 2008-03-13 Trans2 Recv Date: Not reported TSD Site Recv Date: 2008-03-13 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986900413 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: CT5000001495 Waste Code: Not reported 800.0 Quantity: Units: P - Pounds

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 80

Manifest Tracking Num: 100002371CTN

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H010

Document ID: ILA7319908

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 1478 Trans2 State ID: 1431 Generator Ship Date: 970224 Trans1 Recv Date: 970224 Trans2 Recv Date: 970228 TSD Site Recy Date: 970303 Part A Recv Date: Not reported Part B Recv Date: 970324

 Generator EPA ID:
 NYD986900413

 Trans1 EPA ID:
 MAD039322250

 Trans2 EPA ID:
 OHD009865825

 TSDF ID:
 ILD000608471

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00050

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100
Year: 97
Manifest Tracking Num: Not reported

Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MDC0860189 Manifest Status: Not reported Trans1 State ID: MAD039322250 Trans2 State ID: OHD009865825 Generator Ship Date: 11/02/1999 11/02/1999 Trans1 Recv Date: Trans2 Recv Date: 11/05/1999 TSD Site Recv Date: 11/05/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD986900413 Generator EPA ID: Trans1 EPA ID: MDD980555189

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

Trans2 EPA ID: Not reported TSDF ID: HWH160

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 99

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: ILA7785350 Manifest Status: Not reported Trans1 State ID: MAD039322250 Trans2 State ID: OHD009865825 Generator Ship Date: 03/09/1999 Trans1 Recv Date: 03/09/1999 03/10/1999 Trans2 Recv Date: TSD Site Recy Date: 03/12/1999 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD986900413 Generator EPA ID: Trans1 EPA ID: ILD000608471 Trans2 EPA ID: Not reported 1478

TSDF ID: 1478
Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 99

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

Mgmt Method Type Code: Not reported

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CT5000001495 Trans2 State ID: Not reported 2008-03-12 Generator Ship Date: Trans1 Recv Date: 2008-03-13 Trans2 Recv Date: Not reported 2008-03-13 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986900413 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: CT5000001495 Waste Code: Not reported Quantity: 0.008 P - Pounds Units:

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 100002371CTN

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H010

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: CT5000001495 Trans2 State ID: Not reported 2008-03-12 Generator Ship Date: Trans1 Recv Date: 2008-03-13 Trans2 Recv Date: Not reported TSD Site Recv Date: 2008-03-13 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986900413 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: CT5000001495 Waste Code: Not reported Quantity: 800.0 P - Pounds Units: Number of Containers: 2.0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS (Continued)

1000264173

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 100002371CTN

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H010

Document ID: MAH7328060 Manifest Status: Completed copy Trans1 State ID: 13274MA Trans2 State ID: MA37888 Generator Ship Date: 941230 Trans1 Recv Date: 941230 Trans2 Recv Date: 941230 TSD Site Recv Date: 941231 Part A Recy Date: Not reported Part B Recv Date: 950117 Generator EPA ID: NYD986900413

Trans1 EPA ID: MAD039322250 Trans2 EPA ID: MAD039322250 TSDF ID: MAD053452637

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAJ2971840

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 614195ME Map ID MAP FINDINGS Direction

Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS (Continued)

1000264173

Trans2 State ID: 614174ME 960201 Generator Ship Date: Trans1 Recv Date: 960201 Trans2 Recv Date: 960209 TSD Site Recv Date: 960210 Part A Recv Date: Not reported Part B Recv Date: 960228

Generator EPA ID: NYD986900413 Trans1 EPA ID: MAD039322250 Trans2 EPA ID: MAD039322250 TSDF ID: MAD053452637

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00150

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC4534672 Manifest Status: Completed copy ILP181891 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 971007 Trans1 Recv Date: 971007 Not reported Trans2 Recv Date: TSD Site Recv Date: 971007 Part A Recv Date: Not reported Part B Recv Date: 971023

Generator EPA ID: NYD986900413 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP

Quantity: 00190

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 010

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

ILA7694598 Document ID: Manifest Status: Not reported Trans1 State ID: MAD039322250 Trans2 State ID: OHD009865825 Generator Ship Date: 05/20/1998 Trans1 Recv Date: 05/20/1998 Trans2 Recv Date: 05/26/1998 TSD Site Recv Date: 06/04/1998 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD986900413 Trans1 EPA ID: ILD000608471 Trans2 EPA ID: Not reported TSDF ID: 1478

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00050

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: ILA7732666 Manifest Status: Not reported MAD039322250 Trans1 State ID: Trans2 State ID: OHD009865825 Generator Ship Date: 09/23/1998 Trans1 Recv Date: 09/23/1998 Trans2 Recy Date: 09/24/1998 09/30/1998 TSD Site Recy Date: Part A Recv Date: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

Part B Recv Date: Not reported NYD986900413 Generator EPA ID: Trans1 EPA ID: ILD000608471 Trans2 EPA ID: Not reported TSDF ID: 1478

D011 - SILVER 5.0 MG/L TCLP Waste Code:

00055 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

01.00 Specific Gravity: Year: 98

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: ILA7385726

Completed after the designated time period for a TSDF to get a copy to the DEC Manifest Status:

Trans1 State ID: 1478 Trans2 State ID: 1431 Generator Ship Date: 971120 Trans1 Recv Date: 971120 Trans2 Recv Date: 971121 TSD Site Recv Date: 971230 Part A Recv Date: Not reported Part B Recv Date: 980115 Generator EPA ID: NYD986900413 Trans1 EPA ID:

MAD039322250 Trans2 EPA ID: OHD009865825 TSDF ID: ILD000608471

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported

Direction Distance Elevation

on Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported

Document ID: 06

Manifest Status: CTF1030359 Trans1 State ID: NYD986900413 Trans2 State ID: Not reported CT5000001495 Generator Ship Date: Not reported Trans1 Recv Date: CT5000001495 Trans2 Recv Date: TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 2
Number of Containers: DF
Container Type: 1000
Handling Method: P
Specific Gravity: 1
Waste Code: R

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported Not reported Year: Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAF0107160

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 654975MA
Trans2 State ID: Not reported
Generator Ship Date: 901003
Trans1 Recv Date: 901003
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901003

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

 Part A Recv Date:
 901119

 Part B Recv Date:
 901105

 Generator EPA ID:
 NYD986900413

 Trans1 EPA ID:
 MAD039322250

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 MAD053452637

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAF2992410

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

654975MA Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 910731 Trans1 Recv Date: 910731 Trans2 Recv Date: Not reported TSD Site Recv Date: 910801 Not reported Part A Recv Date: Part B Recv Date: 910903 NYD986900413 Generator EPA ID: MAD039322250 Trans1 EPA ID:

 Trans2 EPA ID:
 MAD039322230

 TrspF ID:
 Not reported

 TSDF ID:
 MAD053452637

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100

Waste Code: Not reported Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 91

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS (Continued)

1000264173

EDR ID Number

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB4185675

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

OH044 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 930217 Trans1 Recv Date: 930217 Trans2 Recv Date: Not reported TSD Site Recv Date: 930218 Part A Recv Date: Not reported Part B Recv Date: 930319 Generator EPA ID: NYD986900413 Trans1 EPA ID: OHD053576294 Trans2 EPA ID: Not reported TSDF ID: OHD053576294

Waste Code: B002 - PETROLEUM OIL WITH 50 BUT < 500 PPM PCB

Quantity: 06709

Units: K - Kilograms (2.2 pounds)

Number of Containers: 003

Container Type: TP - Tanks, portable

Handling Method: L Landfill.
Specific Gravity: 100
Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAH7037500

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

 Trans1 State ID:
 13274MA

 Trans2 State ID:
 ME617020

 Generator Ship Date:
 950419

 Trans1 Recv Date:
 950419

 Trans2 Recv Date:
 950420

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS (Continued)

1000264173

TSD Site Recv Date: 950420 Part A Recv Date: Not reported Part B Recv Date: 950515 Generator EPA ID: NYD986900413 Trans1 EPA ID: MAD039322250 Trans2 EPA ID: MAD039322250 TSDF ID: MAD053452637

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Year: 95

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: ILA7265013

Completed after the designated time period for a TSDF to get a copy to the DEC Manifest Status:

Trans1 State ID: 1498 Trans2 State ID: 1513 Generator Ship Date: 960919 960919 Trans1 Recv Date: 960926 Trans2 Recv Date: 960930 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: 961121 Generator EPA ID: NYD986900413

Trans1 EPA ID: MAD039322250 Trans2 EPA ID: MOD095038998 TSDF ID: ILD000608471 Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00100

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported

MAP FINDINGS Map ID

Direction Distance

Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS (Continued)

1000264173

1004758569

NYD987009354

RCRA-CESQG

MANIFEST

FINDS

EDR ID Number

Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

HESS CORPORATION B2

156 WOLF RD

< 1/8 **ALBANY, NY 12205**

1 ft.

Site 1 of 10 in cluster B

RCRA-CESQG: Relative:

Higher

Date form received by agency: 01/01/2007

HESS CORPORATION Facility name:

Actual: Facility address: 156 WOLF RD 300 ft.

ALBANY, NY 12205 EPA ID: NYD987009354

Mailing address: **HESS PLAZA**

WOODBRIDGE, NJ 07095

Contact: JOHN GEITNER Contact address: **HESS PLAZA**

WOODBRIDGE, NJ 07095

Contact country: US

(732) 750-7105 Contact telephone: Contact email: Not reported

EPA Region: 02

Classification: Conditionally Exempt Small Quantity Generator

Handler: generates 100 kg or less of hazardous waste per calendar Description:

month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from

the cleanup of a spill, into or on any land or water, of acutely

hazardous waste

Owner/Operator Summary:

HESS CORPORATION Owner/operator name:

Owner/operator address: **HESS PLAZA**

WOODBRIDGE, NJ 07095

Owner/operator country: US

Owner/operator telephone: (732) 750-6000

Legal status: Private Owner/Operator Type: Owner Owner/Op start date: 08/01/2006 Owner/Op end date: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

HESS CORPORATION (Continued)

1004758569

EDR ID Number

Owner/operator name: **HESS CORPORATION**

Owner/operator address: Not reported Not reported

US

Owner/operator country: Owner/operator telephone: Not reported Legal status: Private Operator Owner/Operator Type: Owner/Op start date: 08/01/2006 Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: Nο

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 08/01/2006

Facility name: HESS CORPORATION

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/31/2006

HESS CORPORATION Facility name:

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 01/28/1998

HESS CORPORATION Facility name:

AMERADA HESS STATION 32334 Site name:

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 03/25/1994

HESS CORPORATION Facility name: HESS STATION #32334 Site name: Classification: Large Quantity Generator

Hazardous Waste Summary:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Direction Distance Elevation

tion Site Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

EDR ID Number

Waste code: D018
Waste name: BENZENE

Violation Status: No violations found

FINDS:

Registry ID: 110004492941

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

NY MANIFEST:

EPA ID: NYD987009354

Country: USA

Mailing Name: AMERADA HESS CORPORATION

Mailing Contact:

Mailing Address:

Mailing Address 2:

Mailing City:

DAVID LEE

ONE HESS PLAZA

Not reported

WOODBRIDGE

Mailing State: NJ
Mailing Zip: 07095
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 908-750-6000

Document ID: CTF0102673 Manifest Status: Completed copy Trans1 State ID: 23671SNY Trans2 State ID: Not reported Generator Ship Date: 931007 Trans1 Recv Date: 931007 Trans2 Recy Date: Not reported TSD Site Recv Date: 931008 Part A Recv Date: Not reported Part B Recv Date: 931026 NYD987009354

 Generator EPA ID:
 NYD987009354

 Trans1 EPA ID:
 NYD980761191

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD021816889

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 04000

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Distance Elevation Site

tion Site Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

EDR ID Number

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Not reported Discr Type Ind: Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF0183336 Completed copy Manifest Status: Trans1 State ID: CT99362 Trans2 State ID: Not reported Generator Ship Date: 921026 Trans1 Recv Date: 921026 Not reported Trans2 Recy Date: TSD Site Recv Date: 921026 Part A Recv Date: Not reported Part B Recv Date: 921110 Generator EPA ID: NYD987009354

 Trans1 EPA ID:
 CTD002593887

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD002593887

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00387

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: L Landfill.
Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not reporte

Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Not reported Mgmt Method Type Code:

Document ID: CTF0175292

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 11997A
Trans2 State ID: Not reported
Generator Ship Date: 920724

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS CORPORATION (Continued)

TSDF ID:

1004758569

Trans1 Recv Date: 920724 Trans2 Recv Date: Not reported TSD Site Recv Date: 920724 Part A Recv Date: Not reported Part B Recv Date: 920914 NYD987009354 Generator EPA ID: Trans1 EPA ID: CTD002593887 Trans2 EPA ID: Not reported

CTD002593887 Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00400

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF0286077 Completed copy Manifest Status:

Trans1 State ID: 7903A Trans2 State ID: Not reported Generator Ship Date: 930625 Trans1 Recv Date: 930625 Trans2 Recv Date: Not reported TSD Site Recv Date: 930625 Part A Recv Date: Not reported Part B Recv Date: 930713 Generator EPA ID: NYD987009354

Trans1 EPA ID: CTD002593887 Trans2 EPA ID: Not reported TSDF ID: CTD021816889

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00800

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported

Direction Distance Elevation

vation Site Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

EDR ID Number

Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: NJA1893691
Manifest Status: Completed copy

Trans1 State ID: 06815 Trans2 State ID: Not reported Generator Ship Date: 940510 Trans1 Recv Date: 940510 Trans2 Recy Date: Not reported TSD Site Recv Date: 940512 Part A Recv Date: 940601 940602 Part B Recv Date:

 Generator EPA ID:
 NYD987009354

 Trans1 EPA ID:
 PAD014146179

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002200046

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00100
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Not reported Mgmt Method Type Code:

Document ID: Not reported Manifest Status: Not reported NJ0000027193 Trans1 State ID: Trans2 State ID: Not reported 2010-01-22 Generator Ship Date: Trans1 Recv Date: 2010-01-22 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-01-22 Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYD987009354

Direction Distance Elevation

ce EDR ID Number ion Site Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

Trans1 EPA ID:

Trans2 EPA ID:

TSDF ID:

Waste Code:

Quantity:

Units:

Not reported

Not reported

NJD002200046

Not reported

So.0

P - Pounds

Number of Containers:

1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 10

Manifest Tracking Num: 001057075GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H141

Document ID: CTF0177215 Completed copy Manifest Status: Trans1 State ID: 11997A Trans2 State ID: Not reported Generator Ship Date: 920818 Trans1 Recv Date: 920818 Trans2 Recv Date: Not reported TSD Site Recv Date: 920820 Part A Recv Date: Not reported 920901 Part B Recv Date:

 Generator EPA ID:
 NYD987009354

 Trans1 EPA ID:
 CTD002593887

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD002593887

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00300

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

EDR ID Number

Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA5074197 Manifest Status: Not reported Trans1 State ID: S5811 Not reported Trans2 State ID: Generator Ship Date: 03/31/2004 Trans1 Recv Date: 03/31/2004 Trans2 Recv Date: Not reported 04/01/2004 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported NYD987009354 Generator EPA ID: Trans1 EPA ID: NJ0000027193 Trans2 EPA ID: Not reported TSDF ID: NJD002200

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 04

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1977061
Manifest Status: Completed copy

Trans1 State ID: 06815 Trans2 State ID: Not reported Generator Ship Date: 941005 Trans1 Recv Date: 941005 Trans2 Recv Date: Not reported 941006 TSD Site Recv Date: Part A Recv Date: 941028 Part B Recv Date: 941028

 Generator EPA ID:
 NYD987009354

 Trans1 EPA ID:
 PAD014146179

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002200046

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00020 Units: P - Pounds

Direction Distance Elevation

n Site Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

EDR ID Number

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Not reported Document ID: Manifest Status: Not reported Trans1 State ID: NJ0000027193 Trans2 State ID: Not reported Generator Ship Date: 2010-01-22 Trans1 Recv Date: 2010-01-22 Trans2 Recv Date: Not reported TSD Site Recy Date: 2010-01-22 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD987009354 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD002200046 Waste Code: Not reported Quantity: 50.0 P - Pounds Units:

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 2010

Manifest Tracking Num: 001057075GBF

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
H141

Document ID: CTF0274168

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Direction Distance Elevation

vation Site Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

EDR ID Number

Trans1 State ID: CT7461A Trans2 State ID: Not reported Generator Ship Date: 930827 Trans1 Recv Date: 930827 Trans2 Recv Date: Not reported 930828 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: 930927 Generator EPA ID: NYD987009354

 Generator EPA ID:
 NYD987009354

 Trans1 EPA ID:
 CTD021816889

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD021816889

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00450

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA2194936
Manifest Status: Completed copy

Trans1 State ID: 06815 Trans2 State ID: Not reported 950823 Generator Ship Date: Trans1 Recv Date: 950823 Not reported Trans2 Recv Date: TSD Site Recv Date: 950824 Part A Recv Date: 950915 Part B Recv Date: 950914

 Generator EPA ID:
 NYD987009354

 Trans1 EPA ID:
 PAD014146179

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002200046

Waste Code: D018 - BENZENE 0.5 MG/L TCLP

Quantity: 00800
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

HESS CORPORATION (Continued)

1004758569

Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

A3 CAPITAL NEWSPAPERS, THE HEARST CORP.

HIST UST U000382193 N/A

645 ALBANY SHAKER RD < 1/8 ALBANY, NY 12212

1 ft.

Site 2 of 11 in cluster A

Relative: Higher HIST UST:

PBS Number: 4-054488 SPDES Number: Not reported

Actual: 301 ft.

Emergency Contact: GEARY MORGAN
Emergency Telephone: (518) 454-5614
Operator: ROBERT S WILSON
Operator Telephone: (518) 454-5403

Owner Name: THE HEARST CORPORATION

Owner Address: 959 8TH AVENUE
Owner City,St,Zip: NEW YORK, NY 10019
Owner Telephone: (518) 454-5555
Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: CAPITAL NEWSPAPERS

Mailing Address: NEWS PLAZA
Mailing Address 2: BOX 15000
Mailing City,St,Zip: ALBANY, NY 12212
Mailing Contact: GEARY J. MORGAN
Mailing Telephone: (518) 454-5614
Owner Mark: First Owner

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is

greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

or not at the facility.

Facility Addr2: Not reported SWIS ID: 0126

Old PBS Number: Not reported MANUFACTURING Facility Type: Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 09/28/2001 **Expiration Date:** 12/02/2006 Renew Flag: False Renewal Date: Not reported Total Capacity: 12000

FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS, THE HEARST CORP. (Continued)

U000382193

EDR ID Number

Tank Screen:
Dead Letter:
CBS Number:
Town or City:
County Code:
No Missing Data
False
Not reported
COLONIE

County Code: 01 Town or City: 26 Region: 4

Tank ld:

Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19920101
Capacity (gals): 6000
Product Stored: DIESEL

Tank Type: Steel/carbon steel

Tank Internal: None Tank External: 12

Pipe Location: Underground
Pipe Type: GALVANIZED STEEL

Pipe Internal: None
Pipe External: Jacketed
Second Containment: Vault (w/access)
Leak Detection: Electronic

Overfill Prot: Float Vent Valve, Catch Basin

True

Dispenser: Suction
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: No Missing Data
Date Closed: Not reported
Test Method: Not reported
Deleted: False

Lat/long: 42|43|40 / 73|47|42

Tank Id:

Updated:

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19700701

Capacity (gals): 10000
Product Stored: UNLEADED GASOLINE

Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL

Pipe Internal: Not reported
Pipe External: Not reported

Second Containment: None
Leak Detection: None
Overfill Prot: Not reported
Dispenser: Suction
Date Tested: 09/01/1986
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing

Date Closed: 01/01/1992 Test Method: Petro-Tite

MAP FINDINGS Map ID

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS, THE HEARST CORP. (Continued)

U000382193

Deleted: False Updated: True

42|43|40 / 73|47|42 Lat/long:

Tank Id:

UNDERGROUND Tank Location: Tank Status: In Service Install Date: 19920101 Capacity (gals): 6000 **DIESEL** Product Stored:

Steel/carbon steel Tank Type:

Tank Internal: None Tank External:

Pipe Location: Underground **GALVANIZED STEEL** Pipe Type:

Pipe Internal: None Pipe External: Jacketed Second Containment: Vault (w/access) Leak Detection: Electronic

Overfill Prot: Float Vent Valve, Catch Basin

Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False

Updated: True

42|43|40 / 73|47|42 Lat/long:

FLEET BANK WOLF RD VAPORS B4

WOLF RD

< 1/8 COLONIE, NY

1 ft.

Site 2 of 10 in cluster B

Relative: Higher

Actual:

300 ft.

NY Spills:

Site ID: 246755 Facility Addr2: Not reported Facility ID: 9310607 Spill Number: 9310607 Facility Type: ER SWIS: 0126

MCCULLOUCH Investigator: Referred To: Not reported Spill Date: 11/29/1993 Reported to Dept: 12/1/1993 CID: Not reported Spill Cause: Other

Water Affected: Not reported Spill Source: Commercial/Industrial

Spill Notifier: Citizen Cleanup Ceased: 11/29/1993 Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False NY Spills

NY Hist Spills

S103561203

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FLEET BANK WOLF RD VAPORS (Continued)

S103561203

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 12/7/1993

Remediation Phase: 0

Date Entered In Computer: 12/7/1993 Spill Record Last Update: 3/30/1998 Spiller Name: Not reported

Spiller Company: PAINT FUMES ODOR

Spiller Address: Not reported ***UPDATE***, ZZ Spiller City, St, Zip:

Spiller Company: 999

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 368660 DEC Memo: Not reported

WORKERS COMPLAIN OF ODOR, NAUSEA, HEADACHES FROM PAINTING BLDG. [CALLD Remarks:

IN 3 DAYS AFTER PROBLEM OCCURRED.] REFD TO ACHD, NO DEC RESPONSE.

Material:

Site ID: Not reported Operable Unit ID: Not reported Operable Unit: Not reported Material ID: Not reported Material Code: Not reported Not reported Material Name: Case No.: Not reported Material FA: Not reported Quantity: Not reported Units: Not reported Not reported Recovered: Resource Affected: Not reported Oxygenate: Not reported

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

Spill Number: 9310607 **MCCULLOUCH** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FLEET BANK WOLF RD VAPORS (Continued)

S103561203

Notifier Phone: Not reported 11/29/1993 12:00 Spill Date/Time: Reported to Dept Date/Time: 12/01/93 17:03

SWIS: 01

Spiller Name: Not reported Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Other Reported to Dept: Air

Water Affected: Not reported

Spill Source: 01 Spill Notifier: Citizen PBS Number: Not reported Cleanup Ceased: 11/29/93 Cleanup Meets Std: True Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** / / Invstgn Complete: 11 False **UST Involvement:**

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 12/07/93 Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 12/07/93 Date Spill Entered In Computer Data File: Not reported

Update Date: 03/30/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Not reported Quantity Spilled: Not reported Unkonwn Quantity Spilled: Not reported Not reported Quantity Recovered: Not reported Unkonwn Quantity Recovered: Not reported Material: Not reported Not reported Class Type: Times Material Entry In File: Not reported CAS Number: Not reported Last Date: Not reported

DEC Remarks: 09/28/95: This is additional information about material spilled from the

translation of the old spill file: PAINT VAPORS?

WORKERS COMPLAIN OF ODOR, NAUSEA, HEADACHES FROM PAINTING BLDG. CALLD IN 3 Remark:

DAYS AFTER PROBLEM OCCURRED. REFD TO ACHD, NO DEC RESPONSE.

Direction Distance

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

B5 WASTE MGT PIER 1 WOLF RD NY Spills S102115984
WOLF RD NY Hist Spills N/A

< 1/8 COLONIE, NY 1 ft.

Site 3 of 10 in cluster B

Relative: Higher NY Spills:

Spill Date:

Actual: 300 ft.

Site ID: 246756 Facility Addr2: Not reported Facility ID: 9415775 Spill Number: 9415775 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported

Reported to Dept: 3/6/1995
CID: Not reported
Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party

Cleanup Ceased: 3/6/1995 Cleanup Meets Std: True Last Inspection: 3/6/1995

Recommended Penalty: Penalty Not Recommended

3/6/1995

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 4/7/1995
Remediation Phase: 0
Date Entered In Computer: 4/7/1995
Spill Record Last Update: 5/26/1995
Spiller Name: Not reported
Spiller Company: WASTE MGT
Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 202607

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN"

Remarks: HYD LINE BROKE. INSP SHOWED CLEAN-UP SATISFACTORY.

Material:

Site ID: 246756 Operable Unit ID: 1009211 Operable Unit: 01 Material ID: 370951 Material Code: 0016A NON PCB OIL Material Name: Case No.: Not reported Material FA: Petroleum Quantity: 10 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Direction Distance Elevation

ion Site Database(s) EPA ID Number

WASTE MGT PIER 1 WOLF RD (Continued)

S102115984

EDR ID Number

Site ID: 246756 Operable Unit ID: 1009211 Operable Unit: 01 Material ID: 370950 Material Code: 0010 Hydraulic Oil Material Name: Not reported Case No.: Petroleum Material FA: Quantity:

Units: Not reported

Recovered: No

Resource Affected: Not reported

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate: Not reported Gross Fail: Modified By: Not reported Not reported Last Modified: Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 9415775 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 03/06/1995 14:15 Spill Date/Time: Reported to Dept Date/Time: 03/06/95 15:25

SWIS: 01

Spiller Name: WASTE MGT
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure

Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 07

Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 03/06/95
Cleanup Meets Std: True
Last Inspection: 03/06/95

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: / /

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WASTE MGT PIER 1 WOLF RD (Continued)

S102115984

Enforcement Date: / / / / Invstgn Complete: **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

04/07/95 Spill Closed Dt:

Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 04/07/95 Date Spill Entered In Computer Data File: Not reported

Update Date: 05/26/95 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 10 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False

Material: NON PCB OIL Class Type: NON PCB OIL Times Material Entry In File: 2798 CAS Number: Not reported Last Date: 19940928 Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Not reported

Quantity Recovered: Unkonwn Quantity Recovered: False

HYDRAULIC OIL Material: HYDRAULIC OIL Class Type:

Times Material Entry In File: 1846 CAS Number: Not reported Last Date: 19940728

DEC Remarks: Not reported

HYD LINE BROKE. INSP SHOWED CLEAN-UP SATISFACTORY. Remark:

Α6 **CAPITAL NEWSPAPERS** TU 645 ALBANY SHAKER RD

ALBANY, NY

< 1/8 1 ft.

Site 3 of 11 in cluster A

NY Spills: Relative:

Site ID: 302507 Higher Facility Addr2: Not reported

Actual: Facility ID: 9314320 301 ft. Spill Number: 9314320 Facility Type: ER

S102158330

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS TU (Continued)

S102158330

EDR ID Number

SWIS: 0126 **TESPERBE** Investigator: Referred To: Not reported Spill Date: 3/8/1994 Reported to Dept: 3/8/1994 CID: Not reported Spill Cause: Equipment Failure Water Affected: Not reported Spill Source: Commercial Vehicle Spill Notifier: Responsible Party

Cleanup Ceased: 3/8/1994 Cleanup Meets Std: True Last Inspection: 3/8/1994

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 3/8/1994 Remediation Phase: 0

Date Entered In Computer: 3/8/1994
Spill Record Last Update: 10/16/2001
Spiller Name: Not reported

Spiller Company: CAPITAL NEWSPAPER TIMES UNION TU

Spiller Address: 645 ALBANY SHAKER RD

Spiller City,St,Zip: ALBANY, ZZ Spiller Company: 999 Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 244390

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"SPERBECK"

Remarks: DELIVERY TRUCK LEAKED, PAPER HIRED CH TO VAC PRODUCT, EXCAVATE CONT.

SOIL. TS @ SITE, SATISFACTORY. SEE 9110717,9111828,9312547.

Material:

302507 Site ID: Operable Unit ID: 992611 Operable Unit: 01 Material ID: 386118 Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: 30 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS TU (Continued)

S102158330

EDR ID Number

Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 9314320 **SPERBECK** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 03/08/1994 07:30 Reported to Dept Date/Time: 03/08/94 08:53

SWIS: 01

Spiller Name: CAPITAL NEWSPAPER TU NEWS

Spiller Contact: Not reported
Spiller Phone: Not reported

Spiller Address: 645 ALBANY SHAKER RD

Spiller City,St,Zip: ALBANY

Spill Cause: Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 07

Spill Notifier: Responsible Party

PBS Number: 4-054488
Cleanup Ceased: 03/08/94
Cleanup Meets Std: True
Last Inspection: 03/08/94

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/08/94

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/08/94
Date Spill Entered In Computer Data File: Not reported

Update Date: 10/16/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS TU (Continued)

S102158330

U004062218

N/A

UST

Quantity Spilled: 30 Unkonwn Quantity Spilled: False Gallons Units: Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported Last Date: 19940728

DEC Remarks: Not reported

DELIVERY TRUCK LEAKED, PAPER HIRED CH TO VAC PRODUCT, EXCAVATE CONT. SOIL. TS @ Remark:

SITE, SATISFACTORY. SEE 9110717,9111828,9312547.

Α7 CAPITAL NEWSPAPERS. THE HEARST CORP.

645 ALBANY SHAKER ROAD

< 1/8 ALBANY, NY 12212

1 ft.

Site 4 of 11 in cluster A

UST: Relative:

Facility Id: 4-054488 Higher Region: STATE

Actual: DEC Region: 301 ft. Site Status: Active Program Type: PBS

Expiration Date: 2011/12/02 UTM X: 598767 UTM Y: 4731161 Site ID: 35257

Tank Number:

48205 Tank ID: Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 1/1/1992 6000 Capacity Gallons: Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location:

Fiberglass coated steel Tank Type:

Date Test: Not reported Register: True **TMKOCH** Modified By: Last Modified: 6/19/2006

Equipment Records:

J02 - Dispenser - Suction

B01 - Tank External Protection - Painted/Asphalt Coating

D02 - Pipe Type - Galvanized Steel K01 - Spill Prevention - Catch Basin F05 - Pipe External Protection - Jacketed A00 - Tank Internal Protection - None

G04 - Tank Secondary Containment - Double-Walled (Underground)

101 - Overfill - Float Vent Valve

L01 - Piping Leak Detection - Interstitial - Electronic Monitoring

Direction Distance

Elevation Site Database(s) EPA ID Number

CAPITAL NEWSPAPERS, THE HEARST CORP. (Continued)

U004062218

EDR ID Number

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring B02 - Tank External Protection - Original Sacrificial Anode

C02 - Pipe Location - Underground/On-ground

Tank Number: 1-A Tank ID: 92314

Tank Status:

Closed - Removed
Tank Model:

Pipe Model:

Install Date:

Capacity Gallons:

Tightness Test Method:

Not reported

Not reported

10000

10000

110000

Not reported

10000

10000

10000

Not reported

10000

10000

Not reported

10000

Not reported

Next Test Date: Not reported
Date Tank Closed: 1/1/1992

Tank Location: 5

Tank Type: Steel/carbon steel

Date Test: 9/1/1986
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

B00 - Tank External Protection - None

100 - Overfill - None

F00 - Pipe External Protection - None A00 - Tank Internal Protection - None G00 - Tank Secondary Containment - None

D02 - Pipe Type - Galvanized Steel

J02 - Dispenser - Suction

H00 - Tank Leak Detection - None C00 - Pipe Location - No Piping

Tank Number: 2
Tank ID: 93661
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 1/1/1992
Capacity Gallons: 6000
Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Fiberglass coated steel

Date Test: Not reported Register: True Modified By: TMKOCH Last Modified: 6/19/2006

Equipment Records:

B02 - Tank External Protection - Original Sacrificial Anode

J02 - Dispenser - Suction

F05 - Pipe External Protection - Jacketed D02 - Pipe Type - Galvanized Steel A00 - Tank Internal Protection - None

L01 - Piping Leak Detection - Interstitial - Electronic Monitoring

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS, THE HEARST CORP. (Continued)

U004062218

K01 - Spill Prevention - Catch Basin

B01 - Tank External Protection - Painted/Asphalt Coating

101 - Overfill - Float Vent Valve

G04 - Tank Secondary Containment - Double-Walled (Underground) H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

C02 - Pipe Location - Underground/On-ground

Affiliation Records:

Site Id: 35257

Affiliation Type: **Emergency Contact**

THE HEARST CORPORATION Company Name:

Contact Type: Not reported Contact Name: **GERRY POTTER** Address1: Not reported Address2: Not reported Not reported City:

State: NN

Zip Code: Not reported Country Code: 999

(518) 454-5936 Phone: Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

35257 Site Id: Affiliation Type: Owner

THE HEARST CORPORATION Company Name: **DIRECTOR OF OPERATIONS** Contact Type:

Contact Name: **DAN COUTO** Address1: 959 8TH AVENUE Address2: Not reported **NEW YORK** City: State: NY 10019 Zip Code: Country Code:

Phone: (518) 454-5555 Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

Site Id: 35257 Affiliation Type: Mail Contact

CAPITAL NEWSPAPERS Company Name:

Contact Type: Not reported Contact Name: **GERRY POTTER** Address1: **NEWS PLAZA** Address2: **BOX 15000** City: **ALBANY** State: NYZip Code: 12212 Country Code: 001

Phone: (518) 454-5936 Phone Ext: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS, THE HEARST CORP. (Continued)

U004062218

Email: GPOTTER@TIMESUNION.COM

Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

35257 Site Id:

Affiliation Type: On-Site Operator

CAPITAL NEWSPAPERS, THE HEARST CORP. Company Name:

Contact Type: Not reported Contact Name: **DAN COUTO** Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 454-5401 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

ATLANTIC WOLF RD NY TEL **WOLF RD @ ALBANY SHAKER**

NY Spills S104496596 **NY Hist Spills** N/A

< 1/8 COLONIE, NY

1 ft.

C8

Site 1 of 4 in cluster C

NY Spills: Relative:

Higher Site ID: 237555 Facility Addr2: Not reported

Actual: Facility ID: 9204711 301 ft. Spill Number: 9204711 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST

Referred To: Not reported Spill Date: 7/24/1992 7/24/1992 Reported to Dept: CID: Not reported Spill Cause: Unknown Water Affected: Not reported Spill Source: Unknown Affected Persons Spill Notifier: Cleanup Ceased: 7/29/1992 Cleanup Meets Std: True

Recommended Penalty: Penalty Not Recommended

7/29/1992

UST Trust: False

Last Inspection:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 8/6/1992 Remediation Phase: 0 Date Entered In Computer: 8/6/1992 Spill Record Last Update: 2/1/2008 Spiller Name: Not reported Spiller Company: NO SOURCE ID'D

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ATLANTIC WOLF RD NY TEL (Continued)

S104496596

Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 301254

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9406278, 9406344, 9414525, 9914217; 8604528.

Remarks: NY TEL FOUND GAS IN MANHOLE, CALLED CLEAN HARBORS TO CLEAN. NO

DEFINITE SOURCE FOUND.

Material:

237555 Site ID: Operable Unit ID: 972224 Operable Unit: 01 Material ID: 557112 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Λ Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

237555 Site ID: Spill Tank Test: 1540286 Tank Number: Not reported

Tank Size: 0 Test Method: 00 Leak Rate:

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

NY Hist Spills:

Region of Spill: Spill Number: 9204711 **CHRISTENSEN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 07/24/1992 08:15 Reported to Dept Date/Time: 07/24/92 10:19

SWIS: 01

Spiller Name: NO SOURCE ID'D Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

ATLANTIC WOLF RD NY TEL (Continued)

S104496596

EDR ID Number

Spiller City, St, Zip:
Spill Cause:
Reported to Dept:
Water Affected:
Not reported
Not reported

Spill Source: 12

Spill Notifier: Affected Persons
PBS Number: 4-132284
Cleanup Ceased: 07/29/92
Cleanup Meets Std: True
Last Inspection: 07/29/92

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 08/06/92

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/06/92
Date Spill Entered In Computer Data File: Not reported

Update Date: 03/17/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported

Tank Size: 0

Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 9406278, 9406344, 9414525, 9914217; 8604528.

Remark: NY TEL FOUND GAS IN MANHOLE, CALLED CLEAN HARBORS TO CLEAN. NO DEFINITE SOURCE

FOUND.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

B9 HESS 32334 WOLF RD NY Spills S108638024 N/A

156 WOLF RD

< 1/8 COLONIE, NY 12205

1 ft.

Site 4 of 10 in cluster B

Relative: Higher

NY Spills: 382781 Site ID:

Facility Addr2: Not reported Actual: Facility ID: 0702953 300 ft. Spill Number: 0702953 Facility Type: ER

SWIS: 0126 Investigator: wtchrist Referred To: Not reported Spill Date: 6/11/2007 Reported to Dept: 6/11/2007 CID: 21

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Gasoline Station Spill Notifier: Responsible Party Cleanup Ceased: Not reported True

Cleanup Meets Std: Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/18/2007 Remediation Phase:

Date Entered In Computer: 6/12/2007 Spill Record Last Update: 6/18/2007 Spiller Name:

DAWN COUGHLIN Spiller Company: HESS 32334 Spiller Address: 156 WOLF RD COLONIE, NY 12205 Spiller City, St, Zip:

Spiller Company: 999

Contact Name: **DAWN COUGHLIN** Contact Phone: (732) 750-7068

DEC Region: 4 DER Facility ID:

DEC Memo: PBS 4-0702953; see 9110043 (Edocs), 9307535, 0310895. 06/18/07 -

Clean up by station personal. There was no impacts to GW or soils.

Tom Lane investigated spill. Closed wtc

DISPENSER HOSE BROKE. SPILL IS ONTO ASPHALT. UNKNOWN PUMP #. CLEAN UP Remarks:

IN PROGRESS BY STATION PERSONELL.

Material:

Site ID: 382781 Operable Unit ID: 1140164 Operable Unit: 01 Material ID: 2130212 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: 10 Units: Gallons Recovered: No

Direction Distance Elevation

Elevation Site Database(s) EPA ID Number

HESS 32334 WOLF RD (Continued)

S108638024

EDR ID Number

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 405956 Facility Addr2: Not reported Facility ID: 0808557 0808557 Spill Number: Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Not reported Referred To: 10/29/2008 Spill Date: Reported to Dept: 10/29/2008 CID: 21

Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/10/2008

Remediation Phase: 0

Date Entered In Computer: 10/29/2008
Spill Record Last Update: 11/12/2008
Spiller Name: MICHAEL MATRI

Spiller Company: HESS

Spiller Address: 156 WOLF ROAD Spiller City,St,Zip: COLONIE, NY 12205

Spiller Company: 999

Contact Name: MICHAEL MATRI Contact Phone: (732) 750-6432

DEC Region: 4
DER Facility ID: 332514

DEC Memo: 11/10/08 - No Dec response. Clean up by station personal. wtc

Remarks: SPILL CAUSED BY CUSTOMER ERROR ON PAVEMENT; ALL CLEANED.

Material:

 Site ID:
 405956

 Operable Unit ID:
 1162565

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS 32334 WOLF RD (Continued)

S108638024

Operable Unit: 01 2153831 Material ID: Material Code: 0009 Material Name: Gasoline Case No.: Not reported Petroleum Material FA: Quantity: 5 Units: Gallons Recovered:

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

> Click this hyperlink while viewing on your computer to access SPILL CAUSED BY CUSTOMER ERROR ON PAVEMENT; ALL CLEANED.

B10 **HESS WOLF RD NY Spills** S110045173

< 1/8 **ALBANY COLONIE, NY**

156 WOLF RD

1 ft.

Site 5 of 10 in cluster B

NY Spills: Relative: Higher

Site ID: 421871

Facility Addr2: HESS GAS STATION 156 WOLF RD Facility ID: 0909194

Actual: 300 ft.

Spill Number: 0909194 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Spill Date: 11/16/2009 Reported to Dept: 11/16/2009 CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Passenger Vehicle Spill Notifier: Fire Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS WOLF RD (Continued)

S110045173

Spill Closed Dt: 12/1/2009

Remediation Phase: 0

Date Entered In Computer: 11/16/2009 Spill Record Last Update: 12/1/2009 Spiller Name: DANIEL FARRELL

Spiller Company: UNK CUSTOMER @ HESS

156 WOLF RD Spiller Address: Spiller City,St,Zip: ALBANY, NY

Spiller Company:

Contact Name: DANIEL FARRELL Contact Phone: Not reported

DEC Region: DER Facility ID: 370818

DEC Memo: 12/01/09 - Minor spill cleaned up on concrete. Closed wtc Remarks: FD reporting that fuel line on customer vehicle broke, spilling 11

gallons onto the pavement at gas station. Speedi dry has been applied

for cleanup.

Material:

Site ID: 421871 Operable Unit ID: 1177745 Operable Unit: 01 Material ID: 2170565 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 11 Units: Gallons Recovered: Not reported Resource Affected: Not reported False Oxygenate:

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

SUNOCO WOLF @ ALB SHAKER A11 **WOLF RD @ ALBANY SHAKER**

ALBANY, NY < 1/8

1 ft.

Site 5 of 11 in cluster A

NY Spills: Relative:

Site ID: 237556 Higher Facility Addr2: Not reported

Actual: Facility ID: 9914217 301 ft. Spill Number: 9914217 Facility Type: ER

S104510900

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) **EPA ID Number**

SUNOCO WOLF @ ALB SHAKER (Continued)

S104510900

EDR ID Number

SWIS: 0126 Investigator: **TESPERBE** Referred To: Not reported Spill Date: 3/16/2000 Reported to Dept: 3/16/2000 CID: 365

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: **Gasoline Station** Spill Notifier: Affected Persons Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 3/20/2000

Remediation Phase:

Date Entered In Computer: 3/16/2000 Spill Record Last Update: 2/1/2008 Spiller Name: Not reported Spiller Company: SUNOCO

Spiller Address: WOLF & ALBANY SHAKER RD

Spiller City,St,Zip: ALBANY, NY -

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 301254

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"SPERBECK" 9204711, 9406278, 9406344, 9414525; 8604528 (NAUGHTERS)

3/20/00 - No DEC response

Remarks: the automatic shut off on pump #3 was not working & spilled gasoline

> down the side of callers truck - also the break away on the hose was leaking - 10 minutes later northeast petroleum was there fixing it

Material:

Site ID: 237556 Operable Unit ID: 1092406 Operable Unit: 01 Material ID: 292503 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum

Quantity: Units: Gallons Recovered: Yes Resource Affected:

Not reported

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO WOLF @ ALB SHAKER (Continued)

S104510900

EDR ID Number

Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 9914217 Spill Number: Investigator: **SPERBECK** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 03/16/2000 13:45 Reported to Dept Date/Time: 03/16/00 14:16

SWIS: 01
Spiller Name: SUNOCO
Spiller Contact: Not reported
Spiller Phone: () -

Spiller Phone: () -

Spiller Address: WOLF & ALBANY SHAKER RD

Spiller City, St, Zip: ALBANY, NY Spill Cause: Equipment Failure
Reported to Dept: On Land

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 05

Spill Notifier: Affected Persons
PBS Number: 4-066524
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: True

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/20/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/16/00
Date Spill Entered In Computer Data File: Not reported

Update Date: 03/20/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

SUNOCO WOLF @ ALB SHAKER (Continued)

S104510900

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 9204711, 9406278, 9406344, 9414525; 8604528 NAUGHTERS) 3/20/00 - No DEC

response

Remark: the automatic shut off on pump 3 was not working spilled gasoline down the

side of callers truck - also the break away on the hose was leaking - 10

minutes later northeast petroleum was there fixing it

B12 AMERADA HESS STATION MANIFEST S109785760
156 WOLF ROAD N/A

< 1/8 ALBANY, NY 12205

1 ft.

Site 6 of 10 in cluster B

Relative: CT MANIFEST:

Higher

Waste:

Actual: Manifest No: CTF0175292

300 ft. Waste Occurence: 1

UNNA: 1993 Hazard Class: 3

US Dot Description: WASTE FLAMMABLE LIQUID

No of Containers: 001
Container Type: TT
Quantity: 400
Weight/Volume: G
Additional Description: Y
Handling Code: S02
Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0175292
Waste Occurence: 1
EPA Waste Code: D001

Recycled Waste?: F
Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Detail:

 Year:
 1992

 Manifest ID:
 CTF0175292

 TSDF EPA ID:
 CTD002593887

TSDF Name: BRIDGEPORT UNITED RECYCLE (FORMERLY HITCHCOCK GAS)

TSDF Address: 50 CROSS STREET
TSDF City,St,Zip: BRIDGEPORT, CT 06608

TSDF Country: USA

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

AMERADA HESS STATION (Continued)

S109785760

TSDF Telephone: Not reported Transport Date: 7/24/1992 Transporter EPA ID: CTD002593887

Transporter Name: BRIDGEPORT UNITED RECYCLE (FORMERLY HITCHCOCK GAS)

Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported

Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported

EPA ID: NYD987009354
Generator Phone: 9087506000
Generator Mailing Addr: 156 WOLFE ROAD

Generator Mailing Town: COLONIE Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: **USA** Special Handling: Yes Discrepancies: No Date Shipped: 7/24/1992 Date Received: 7/24/1992 Last modified date: 4/27/2004 Last modified by: IG

Not reported

HESS OIL CORP. MANIFEST S109785761
156 WOLF ROAD N/A

156 WOLF ROAD < 1/8 ALBANY, NY 12205

1 ft.

B13

Site 7 of 10 in cluster B

Comments:

Relative: CT MANIFEST: Higher Waste:

Actual: Manifest No: CTF0102673
300 ft. Waste Occurence: 1
UNNA: 1203

Hazard Class: FLAMMABLE

US Dot Description: WASTE GASOLINE MIXTURE

No of Containers: 001
Container Type: TT
Quantity: 4000
Weight/Volume: G
Additional Description: Y
Handling Code: S02
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0102673

Waste Occurence: 1
EPA Waste Code: D001
Recycled Waste?: F

Date Record Was Last Modified: 4/27/2004

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS OIL CORP. (Continued)

S109785761

DEO Who Last Modified Record: IG

Detail:

Year: 1993

Manifest ID: CTF0102673 TSDF EPA ID: CTD021816889

TSDF Name: UNITED INDUSTRIAL SERVICE DBA ADVANCED LIQUID RECY

TSDF Address: 136 GRACEY AVENUE TSDF City,St,Zip: MERIDEN, CT 06450

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 10/7/1993 Transporter EPA ID: NYD980761191

ENVIRONMENTAL PRODUCTS AND SERVICES, INC. Transporter Name:

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Not reported Trans 2 Address:

Trans 2 City, St, Zip: CT Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: NYD987009354 Generator Phone: Not reported

156 WOLF RD. ALBANY Generator Mailing Addr:

Generator Mailing Town: Not reported

Generator Mailing State: NY

Generator Mailing Zip: Not reported Generator Mailing Country: USA Special Handling: Yes Discrepancies: No Date Shipped: 10/7/1993 Date Received: 10/8/1993 Last modified date: 4/27/2004 IG

Last modified by:

Comments: Not reported

TIMES UNION CAPITAL NEWS

645 ALBANY SHAKER RD COLONIE, NY

< 1/8 1 ft.

A14

Site 6 of 11 in cluster A

NY Spills: Relative:

Higher Site ID: 412415

Facility Addr2: TIMES UNION 645 ALBANY SHAKER RD

Actual: Facility ID: 0900474 301 ft. Spill Number: 0900474 Facility Type: ER

SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Spill Date: 4/13/2009 Reported to Dept: 4/13/2009 CID: 21

S102115276

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

TIMES UNION CAPITAL NEWS (Continued)

S102115276

EDR ID Number

Spill Cause:
Water Affected:
Spill Source:
Unknown
Spill Notifier:
Cleanup Ceased:
Cleanup Meets Std:
Last Inspection:
Unknown
Fire Department
Not reported
False
Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. (Minimal

Occurrence)

Spill Closed Dt: 5/14/2009
Remediation Phase: 0
Date Entered In Computer: 4/13/2009
Spill Record Last Update: 5/14/2009
Spiller Name: Not reported

Spiller Company: UNKNOWN @ TIMES UNION TU

Spiller Address: Not reported Spiller City,St,Zip: NY Spiller Company: 999

Contact Name: BEN STEVENS
Contact Phone: (518) 376-1012

DEC Region:

DER Facility ID: 361633

DEC Memo: 05/14/09 - Liquid ID as water with a small amount of blue dye in it.

Closed wtc

Remarks: UNK POTENTIALLY HAZARDOUS BLUE LIQUID MATERIAL CONTAINED IN A PLASTIC

JUG IN THE PARKING LOT, SIMILAR PRODUCT WAS FOUND AT THE SCHENECTADY

GAZETTE EARLIER TODAY.

Material:

 Site ID:
 412415

 Operable Unit ID:
 1168885

 Operable Unit:
 01

 Material ID:
 2160516

 Material Code:
 0063A

Material Name: UNKNOWN HAZARDOUS MATERIAL

False

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Resource Affected:

Not reported

Gallons

Not reported

Not reported

Not reported

Tank Test:

Oxygenate:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

TIMES UNION CAPITAL NEWS (Continued)

S102115276

EDR ID Number

Site ID: 302506 Not reported Facility Addr2: Facility ID: 9312547 Spill Number: 9312547 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Spill Date: 1/25/1994 Reported to Dept: 1/25/1994 CID: 21

Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party

Cleanup Ceased: 1/25/1994
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

LIGHT TO THE RESERVE THE PROPERTY OF THE CONTINIENT

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/9/1994
Remediation Phase: 0
Date Entered In Computer: 2/9/1994
Spill Record Last Update: 4/14/2009
Spiller Name: Not reported

Spiller Company: VENDOR @ TIMES UNION CAPITAL NEWSPAPERS TU

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 999

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 281816

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN"

Remarks: HOSE POPPED OFF, CONTAINED ON PAVING, USED SORBENT BOOM, CH EN ROUTE.

NO DEC RESPONSE. SEE 9110717,9111828,9314320.

Material:

 Site ID:
 302506

 Operable Unit ID:
 994546

 Operable Unit:
 01

 Material ID:
 387972

 Material Code:
 0582A

 Material Name:
 INK

Case No.: Not reported
Material FA: Other
Quantity: 40
Units: Gallons
Recovered: No
Resource Affected: Not reported

Oxygenate: Not repo

Tank Test:

Site ID: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

TIMES UNION CAPITAL NEWS (Continued)

S102115276

EDR ID Number

Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Not reported Modified By: Last Modified: Not reported Test Method: Not reported

Click this hyperlink while viewing on your computer to access NO DEC RESPONSE. SEE 9110717,9111828,9314320.

NY Hist Spills:

Region of Spill: Spill Number: 9312547 Investigator: **CHRISTENSEN** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 01/25/1994 12:00 Spill Date/Time: Reported to Dept Date/Time: 01/25/94 12:17

SWIS: 01

Spiller Name: VENDOR @ TU NEWS

Spiller Contact:

Spiller Phone:

Spiller Address:

Spiller City,St,Zip:

Spill Cause:

Not reported

Not reported

Not reported

Equipment Failure

Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 07

Spill Notifier: Responsible Party PBS Number: 4-054488

Cleanup Ceased: 01/25/94
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 02/09/94

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 02/09/94
Date Spill Entered In Computer Data File: Not reported

Update Date: 10/16/01 Is Updated: False

Tank:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TIMES UNION CAPITAL NEWS (Continued)

S102115276

PBS Number: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material

Quantity Spilled: Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: False

PRINTERS INK Material:

Class Type: PRINTERS INK

Times Material Entry In File: 2

CAS Number: Not reported Last Date: Not reported

DEC Remarks: Not reported

HOSE POPPED OFF, CONTAINED ON PAVING, USED SORBENT BOOM, CH EN ROUTE. NO DEC Remark:

RESPONSE. SEE 9110717,9111828,9314320.

D15 ENTENMANN'S INC. UST U001845748 242 WOLF RD. **HIST UST** N/A

< 1/8 COLONIE, NY 12205

1 ft.

Site 1 of 2 in cluster D

UST: Relative:

Facility Id: 4-442933 Higher Region: STATE

Actual: DEC Region: 298 ft. Site Status: Unregulated

Program Type: **PBS** Expiration Date: N/A UTM X: 598643 4731249 UTM Y: Site ID: 36924

Tank Number: 001 Tank ID: 93193

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Not reported Pipe Model: Install Date: 12/1/1980 10000 Capacity Gallons: Tightness Test Method: NN Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location:

Steel/carbon steel Tank Type: Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None

Direction
Distance

Elevation Site Database(s) EPA ID Number

ENTENMANN'S INC. (Continued)

U001845748

EDR ID Number

J02 - Dispenser - Suction

F00 - Pipe External Protection - None D01 - Pipe Type - Steel/Carbon Steel/Iron

C00 - Pipe Location - No Piping A00 - Tank Internal Protection - None

100 - Overfill - None

G00 - Tank Secondary Containment - None B00 - Tank External Protection - None

Affiliation Records:

Site Id: 36924

Affiliation Type: Mail Contact

Company Name: ENTENMANNS INC.

Contact Type: Not reported

Contact Name:

Address1:

Address2:

Not reported

1724 FIFTH AVE.

Not reported

Not reported

BAY SHORE

State: NY
Zip Code: 11706
Country Code: 001

Phone: (516) 273-6000
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 36924

Affiliation Type: On-Site Operator Company Name: ENTENMANNS INC.

Contact Type: Not reported
Contact Name: RON STROUSE
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported

Country Code: 001

Phone: (518) 459-7683
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 36924

Affiliation Type: Emergency Contact
Company Name: ENTENMANNS INC.
Contact Type: Not reported
Contact Name: RON STROUSE
Address1: Not reported
Address2: Not reported
City: Not reported

State: NN

Zip Code: Not reported

Country Code: 001

Direction Distance

Elevation Site Database(s) EPA ID Number

ENTENMANN'S INC. (Continued)

U001845748

EDR ID Number

Phone: (518) 459-7683
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 36924 Affiliation Type: Owner

Company Name: ENTENMANNS INC.

Contact Type: Not reported
Contact Name: Not reported
Address1: 1724 FIFTH AVE.
Address2: Not reported
City: BAY SHORE

State: NY
Zip Code: 11706
Country Code: 001

Phone: (516) 273-6000
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-442933 SPDES Number: Not reported **Emergency Contact: RON STROUSE** Emergency Telephone: (518) 273-6000 Operator: **RON STROUSE** Operator Telephone: (518) 459-7683 Owner Name: ENTENMANN'S INC. 1724 FIFTH AVE. Owner Address: BAY SHORE, NY 11706 Owner City,St,Zip:

Owner Telephone: (516) 273-6000
Owner Type: Not reported
Owner Subtype: Not reported
Mailing Name: ENTENMANN'S

Mailing Name: ENTENMANN'S INC.
Mailing Address: 1724 FIFTH AVE.
Mailing Address 2: Not reported

Mailing City,St,Zip: BAY SHORE, NY 11706

Mailing Contact: Not reported
Mailing Telephone: (516) 273-6000
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126 Old PBS Number: Not reported Facility Type: Not reported Inspected Date: Not reported Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Certification Flag: False 06/28/1988 Certification Date:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENTENMANN'S INC. (Continued)

U001845748

Expiration Date: 06/28/1993 Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: Minor Data Missing Owner Screen: Minor Data Missing Tank Screen: Minor Data Missing Dead Letter: False

CBS Number: Not reported COLONIE Town or City: County Code: 01 Town or City: 26 Region:

Tank Id: 001

Tank Location: **UNDERGROUND**

Tank Status: Closed Before April 1, 1991

Install Date: 19801201 10000 Capacity (gals): Product Stored: DIESEL

Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported Pipe Type: STEEL/IRON Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

205 WOLF RD ACCIDENT 205 WOLF RD @ TURF INN

< 1/8 COLONIE, NY

1 ft.

E16

Site 1 of 5 in cluster E

NY Spills: Relative:

194351 Site ID: Higher Facility Addr2: Not reported

Actual: Facility ID: 9505059 298 ft. Spill Number: 9505059

Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 7/26/1995 Spill Date: Reported to Dept: 7/26/1995

S102116238

N/A

NY Spills

NY Hist Spills

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

205 WOLF RD ACCIDENT (Continued)

S102116238

CID: Not reported Spill Cause: Traffic Accident Water Affected: Not reported Spill Source: Passenger Vehicle Spill Notifier: Police Department

Cleanup Ceased: 7/26/1995 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Known release with minimal potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 7/26/1995

Remediation Phase:

Date Entered In Computer: 7/26/1995 8/22/1995 Spill Record Last Update: Spiller Name: Not reported Spiller Company: CAR Spiller Address: Not reported

Spiller City, St, Zip: NY Spiller Company: 999

Contact Name: Not reported Contact Phone: Not reported DEC Region: 4

DER Facility ID: 161958

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN"

Remarks: USED SPEEDIDRY ON ANTIFREEZE FROM ACCIDENT.

Material:

194351 Site ID: Operable Unit ID: 1015978 Operable Unit: 01 366587 Material ID: Material Code: 0043A Material Name: **ANTIFREEZE** Case No.: Not reported Material FA: Other Quantity: Gallons Units: Recovered: No Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

205 WOLF RD ACCIDENT (Continued)

S102116238

EDR ID Number

NY Hist Spills:

Region of Spill:

Spill Number: 9505059 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 07/26/1995 09:45 Spill Date/Time: 07/26/95 09:45 Reported to Dept Date/Time:

SWIS: 01 Spiller Name: CAR Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Traffic Accident Reported to Dept: On Land Water Affected: Not reported

Spill Source: 06

Spill Notifier: Police Department
PBS Number: Not reported
Cleanup Ceased: 07/26/95
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 07/26/95

Corrective Action Plan Submitted: / /

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/26/95
Date Spill Entered In Computer Data File: Not reported

Update Date: 08/22/95 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material

Quantity Spilled: 1
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: ANTIFREEZE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

205 WOLF RD ACCIDENT (Continued)

S102116238

ANTIFREEZE Class Type:

Times Material Entry In File: 0

CAS Number: Not reported Last Date: Not reported

DEC Remarks: Not reported

USED SPEEDIDRY ON ANTIFREEZE FROM ACCIDENT. Remark:

D17 **WOLF ROAD SPILL NY Spills** S104496386 243 WOLF ROAD **NY Hist Spills** N/A

COLONIE, NY < 1/8

1 ft.

Site 2 of 2 in cluster D

Relative: Higher

Actual:

298 ft.

NY Spills:

Site ID: 123221 Facility Addr2: Not reported Facility ID: 8807293 Spill Number: 8807293 Facility Type: ER SWIS: 0126

MCDONALD Investigator: Referred To: Not reported 11/8/1988 Spill Date: Reported to Dept: 11/22/1988

CID: 21

Equipment Failure Spill Cause: Water Affected: Not reported Spill Source: Commercial Vehicle

Spill Notifier: Citizen Cleanup Ceased: 12/5/1988 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/5/1988

Remediation Phase: Date Entered In Computer: 12/5/1988 Spill Record Last Update: 6/3/2008 Spiller Name: Not reported Spiller Company: UNKNOWN Spiller Address: Not reported

Spiller City, St, Zip: NY Spiller Company: 999

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4 DER Facility ID: 106816 DEC Memo: Not reported

COLONIE POLICE, SHAKER ROAD FIRE DEPT. ON SCENE. FD FLUSHED INTO Remarks:

SEWER. NO DEC ACTION.

Material:

Site ID: 123221 Operable Unit ID: 923971 Operable Unit: 01 455639 Material ID:

Distance Elevation

Site Database(s) EPA ID Number

WOLF ROAD SPILL (Continued)

Material Code: 0008
Material Name: Diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 25
Units: Gallons
Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 8807293 Investigator: **MCDONALD** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 11/08/1988 12:00 Spill Date/Time:

Reported to Dept Date/Time: 11/22/88 13:33

SWIS: 01

Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Equipment Failure

Reported to Dept: In Sewer Water Affected: Not reported

Spill Source: 07
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 12/05/88
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False
Spill Class: Not reported

S104496386

EDR ID Number

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

WOLF ROAD SPILL (Continued)

S104496386

Spill Closed Dt: 12/05/88

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 12/05/88

Date Spill Entered In Computer Data File: Not reported

Update Date: 04/09/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 25 Unkonwn Quantity Spilled: False Gallons Units: Quantity Recovered: O Unkonwn Quantity Recovered: False DIESEL Material: Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported Last Date: 19940728

DEC Remarks: Not reported

Remark: COLONIE POLICE, SHAKER ROAD FIRE DEPT. ON SCENE. FD FLUSHED INTO SEWER. NO DEC

ACTION.

E18 HOLIDAY INN TURF UST U000383790 205 WOLF RD HIST UST N/A

< 1/8 COLONIE, NY 12205 1 ft.

Site 2 of 5 in cluster E

Relative: UST:

 Higher
 Facility Id:
 4-485748

 Region:
 STATE

 Actual:
 DEC Region:
 4

 298 ft.
 Site Status:
 Unregulate

 Site Status:
 Unregulated

 Program Type:
 PBS

 Expiration Date:
 N/A

 UTM X:
 598291

 UTM Y:
 4730893

 Site ID:
 37276

Tank Number: 1 Tank ID: 92463

Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/1/1974
Capacity Gallons: 8000
Tightness Test Method: 01

Next Test Date: Not reported Date Tank Closed: 7/1/1996

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HOLIDAY INN TURF (Continued)

U000383790

Tank Location: 5

Steel/carbon steel Tank Type: Date Test: 6/1/1990 Register: True **TRANSLAT** Modified By: Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None

100 - Overfill - None

F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None

D10 - Pipe Type - Copper J02 - Dispenser - Suction

C02 - Pipe Location - Underground/On-ground

A00 - Tank Internal Protection - None B00 - Tank External Protection - None

Affiliation Records:

37276 Site Id: Affiliation Type: Owner

TURF HOUSE INC. Company Name:

Contact Type: Not reported Contact Name: Not reported 205 WOLF RD Address1: Address2: Not reported COLONIE City: State: NY Zip Code: 12205 Country Code: 001

Phone: (518) 458-7250 Phone Ext: Not reported Email: Not reported Fax Number: Not reported TRANSLAT Modified By: Date Last Modified: 3/4/2004

Site Id: 37276

Affiliation Type: **Emergency Contact** TURF HOUSE INC. Company Name: Contact Type: Not reported

Contact Name: MICHAEL HOFFMAN

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001 (518) 475-9621 Phone: Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 37276 Affiliation Type: Mail Contact

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HOLIDAY INN TURF (Continued)

U000383790

Company Name: TURF HOUSE INC. Contact Type: Not reported Contact Name: MICHAEL HOFFMAN Address1: 205 WOLF RD Address2: Not reported COLONIE City: State: NY Zip Code: 12205 Country Code: 001

Phone: (518) 458-7250 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 37276

On-Site Operator Affiliation Type: Company Name: HOLIDAY INN TURF Contact Type: Not reported

Contact Name: TURF HOUSE INC. Address1: Not reported Address2: Not reported City: Not reported State: NN Zip Code: Not reported

Country Code: 001

Phone: (518) 458-7250 Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

HIST UST:

4-485748 PBS Number: SPDES Number: Not reported

MICHAEL HOFFMAN **Emergency Contact:** Emergency Telephone: (518) 475-9621 TURF HOUSE INC. Operator: (518) 458-7250 Operator Telephone: Owner Name: TURF HOUSE INC. Owner Address: 205 WOLF RD COLONIE, NY 12205 Owner City, St, Zip: Owner Telephone: (518) 458-7250 Owner Type: Corporate/Commercial

Owner Subtype: Not reported Mailing Name: TURF HOUSE INC. Mailing Address: 205 WOLF RD Mailing Address 2: Not reported

Mailing City, St, Zip: COLONIE, NY 12205 Mailing Contact: MICHAEL HOFFMAN Mailing Telephone: (518) 458-7250 First Owner Owner Mark:

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported

Direction

Elevation Site Database(s) EPA ID Number

HOLIDAY INN TURF (Continued)

U000383790

EDR ID Number

SWIS ID: 0126 Old PBS Number: Not reported Facility Type: OTHER Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Not reported Federal ID: False Certification Flag: Certification Date: 08/20/1990 **Expiration Date:** 08/02/1995 Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data

Tank Screen:

Dead Letter:

CBS Number:

Town or City:

County Code:

Town or City:

Region:

0

False

COLONIE

01

1

26

Region:

4

Tank Id:

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19741001

Capacity (gals): 8000

Product Stored: NOS 1,2, OR 4 FUEL OIL

Tank Type: Steel/carbon steel

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: FIBERGLASS COATED STEEL

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Date Tested: 06/01/1990 Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 07/01/1996 Test Method: Petro-Tite Deleted: False Updated: True Lat/long: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

E19 **HOLIDAY INN TURF** MANIFEST S109721214 205 WOLF ROAD N/A

< 1/8 **ALBANY, CT 12205** 1 ft.

Site 3 of 5 in cluster E

Relative:

CT MANIFEST:

Higher

Waste:

Manifest No: CTF0044338 Actual: Waste Occurence: 298 ft.

UNNA: 2762

Hazard Class: **COMBUSTIBL**

US Dot Description: WASTE CHLORDANE LIQUD

No of Containers: 001 Container Type: DM Quantity: 117 Weight/Volume: Р

Additional Description: Not reported Handling Code: S01 Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0044338

Waste Occurence: U036 EPA Waste Code: Recycled Waste?: Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Detail:

1990 Year:

Manifest ID: CTF0044338 TSDF EPA ID: CTD000604488

TSDF Name: CONNECTICUT TREATMENT CORPORATION

TSDF Address: 51 BRODERICK RD TSDF City,St,Zip: BRISTOL, CT 06010

TSDF Country: USA

TSDF Telephone: Not reported 7/30/1990 Transport Date: Transporter EPA ID: NYD088658646

Transporter Name: D & J TRANSPORTATION SPECIALISTS, INC.,

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Not reported Trans 2 Name: Trans 2 Address: Not reported

Trans 2 City, St, Zip: СТ Trans 2 Country: USA Trans 2 Phone: Not reported

EPA ID: CT\$000027600 Generator Phone: 5184587250 Generator Mailing Addr: 205 WOLF ROAD

Generator Mailing Town: **ALBANY** Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: **USA**

Direction Distance

Elevation Site Database(s) EPA ID Number

HOLIDAY INN TURF (Continued)

S109721214

S101508702

N/A

LTANKS

EDR ID Number

Special Handling: Yes
Discrepancies: No
Date Shipped: 7/30/1990
Date Received: 7/30/1990
Last modified date: 4/27/2004
Last modified by: IG

Comments: Not reported

ALDANY COUNTY IAIL OLIAVED

20 ALBANY COUNTY JAIL SHAKER ALBANY SHAKER RD JAIL

HIST LTANKS NY Spills NY Hist Spills

< 1/8 COLONIE, NY 1 ft.

LTANKS:

Relative: Lower

 Site ID:
 88896

 Spill No:
 9501952

 Spill Date:
 5/17/1995

 Spill Cause:
 Tank Failure

Actual: 280 ft.

Spill Source: Institutional, Educational, Gov., Other

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 5/17/1995 Not reported Facility Addr2: Cleanup Ceased: 5/17/1995 Cleanup Meets Standard: True SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Reported to Dept: 5/17/1995

CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 5/17/1995
Spill Record Last Update: 5/10/2002
Spiller Name: Not reported

Spiller Company: ALB CO CORRECTIONAL FAC

Spiller Address: ALBANY SHAKER RD

Spiller City, St, Zip: COLONIE, ZZ

Spiller County: 001

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

DEC Region: 4
DER Facility ID: 81260

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9201471, 9409464, 9501952, 9506673, 9510275, 9512193,

9604973.

Remarks: 3 5GAL CONTAINERS LEAKED GAS TO GARAGE DRAIN, FD FLUSHED.

9201471,9409464.

Material:

Site ID: 88896

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY COUNTY JAIL SHAKER (Continued)

S101508702

Operable Unit ID: 1016391 Operable Unit: 01 Material ID: 367025 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Petroleum Material FA: Quantity: 15 Units: Gallons Recovered: No Resource Affected: Not reported

False

Tank Test:

Oxygenate:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Not reported Test Method:

HIST LTANKS:

Region of Spill: Spill Number: 9501952 Spill Date: 05/17/1995 Spill Time: 02:51 Spill Cause: Tank Failure Resource Affectd: In Sewer Water Affected: Not reported

Spill Source: Other Non Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 05/17/95 Cleanup Ceased: 05/17/95 Cleanup Meets Standard: True

Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 05/17/95 Reported to Department Time: 02:51 SWIS:

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: ALB CO CORRECTIONAL FAC

Direction Distance

Elevation Site Database(s) EPA ID Number

ALBANY COUNTY JAIL SHAKER (Continued)

S101508702

EDR ID Number

Spiller Address: ALBANY SHAKER RD

Spiller City,St,Zip: COLONIE
Spiller Cleanup Date: //

Facility Contact: Not reported
Facility Phone: (518) 869-2622
Facility Extention: Not reported
Spill Notifier: Responsible Party

PBS Number: 4-600362 Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Pate Spill Entered In Computer Date File: 05/17.

Date Spill Entered In Computer Data File: 05/17/95
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/24/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 15 Unkonwn Quantity Spilled: False Gallons Quantity Recovered: Unkonwn Quantity Recovered: False **GASOLINE** Material: **GASOLINE** Class Type: Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: 9201471, 9409464, 9501952, 9506673, 9510275, 9512193, 9604973.

Spill Cause: 3 5GAL CONTAINERS LEAKED GAS TO GARAGE DRAIN, FD FLUSHED. 9201471,9409464.

NY Spills:

Site ID: 88898 Facility Addr2: Not reported Facility ID: 9510275 Spill Number: 9510275 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 11/16/1995 Reported to Dept: 11/16/1995 CID: 216 Spill Cause: Unknown Water Affected: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ALBANY COUNTY JAIL SHAKER (Continued)

S101508702

EDR ID Number

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier:

Cleanup Ceased:

Cleanup Meets Std:

Local Agency

Not reported

True

Last Inspection:

Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/24/1998

Remediation Phase: 0

Date Entered In Computer: 11/16/1995
Spill Record Last Update: 5/10/2002
Spiller Name: PETE SNYDER
Spiller Company: ALBANY COUNTY JAIL
Spiller Address: ALBANY SHAKER RD JAIL

Spiller City,St,Zip: ALBANY, ZZ

Spiller Company: 001

Contact Name: PETE SNYDER
Contact Phone: (518) 869-2664

DEC Region: 4

DER Facility ID: 81260

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 11/17/95-MINOR SHEEN, SHALE UNDER TANKS, CONT. SOIL ON

POLY, TO GO TO ALF, EPS. SEE 9201471, 9409464, 9501952, 9506673,

9510275, 9512193, 9604973.

Remarks: CALLER IS REMOVEING TANKS AND IT APPEARS THAT THE TANK DID LEAK AT ONE

TIME THEY CAN SEE A FILM ON THE WATER WHERE THEY ARE DIGGING THEY DID

TAKE HMU READING AND IT SHOWS 60 PARTS PER MILLON

Material:

Site ID: 88898 Operable Unit ID: 1020813 Operable Unit: 01 Material ID: 361202 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

ALBANY COUNTY JAIL SHAKER (Continued)

S101508702

EDR ID Number

NY Hist Spills:

Region of Spill: Spill Number: 9510275 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 11/16/1995 09:45 Spill Date/Time:

Reported to Dept Date/Time: SWIS:

Spiller Name: ALBANY COUNTY JAIL
Spiller Contact: PETE SNYDER
Spiller Phone: (518) 869-2664
Spiller Contact: PETE SNYDER

Spiller Contact: PETE SNYDER Spiller Phone: (518) 869-2664

Spiller Address: ALBANY SHAKER RD JAIL

01

11/16/95 09:58

Spiller City,St,Zip: ALBANY
Spill Cause: Unknown
Reported to Dept: Groundwater
Water Affected: Not reported

Spill Source: 02

Spill Notifier: Local Agency
PBS Number: 4-600362
Cleanup Ceased: //
Cleanup Meets Std: True
Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 09/24/9

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 11/16/95
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/24/99 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0

Direction Distance

Elevation Site Database(s) EPA ID Number

ALBANY COUNTY JAIL SHAKER (Continued)

S101508702

EDR ID Number

Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: 11/17/95-MINOR SHEEN, SHALE UNDER TANKS, CONT. SOIL ON POLY, TO GO TO ALF, EPS.

SEE 9201471, 9409464, 9501952, 9506673, 9510275, 9512193, 9604973.

Remark: CALLER IS REMOVEING TANKS AND IT APPEARS THAT THE TANK DID LEAK AT ONE TIME

THEY CAN SEE A FILM ON THE WATER WHERE THEY ARE DIGGING THEY DID TAKE HMU

READING AND IT SHOWS 60 PARTS PER MILLON

C21 BIENIEK WOLF RD LTANKS \$103478456

264 WOLF RD HIST LTANKS N/A

< 1/8 COLONIE, NY

1 ft.

Site 2 of 4 in cluster C

Relative: LTANKS:

 Higher
 Site ID:
 226559

 Spill No:
 8806304

 Actual:
 Spill Date:
 9/28/1988

 300 ft.
 Spill Cause:
 Tank Failur

Spill Cause: Tank Failure
Spill Source: Gasoline Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 3/22/1989
Facility Addr2: Not reported
Cleanup Ceased: 3/22/1989
Cleanup Meets Standard: True
SWIS: 0126
Investigator: MCDONALD
Referred To: Not reported

Reported to Dept: 9/28/1988
CID: 21
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True Remediation Phase: 0

Date Entered In Computer: 10/27/1988
Spill Record Last Update: 10/4/2004
Spiller Name: Not reported
Spiller Company: BIENIEK
Spiller Address: 264 WOLF RD
Spiller City,St,Zip: COLONIE, NY

Spiller County: 001

DER Facility ID:

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 4

DEC Memo: See EDOCs for additional information. SEE FOLDER; 8801295, 8806304,

8806827, 8806811; (AND 8604254, 9200206, 9604075?).

Remarks: MCDONALD ON SCENE - LARGE AMT CONTAMINATION FOUND WHILE REMOVING

DIESEL TANKS.

266772

Direction Distance

Elevation Site Database(s) EPA ID Number

BIENIEK WOLF RD (Continued)

S103478456

EDR ID Number

Material:

226559 Site ID: 923143 Operable Unit ID: Operable Unit: 01 Material ID: 454650 8000 Material Code: Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons No Recovered: Not reported Resource Affected:

False

Tank Test:

Oxygenate:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

HIST LTANKS:

Region of Spill:

Spill Number: 8806304
Spill Date: 09/28/1988
Spill Time: 09:00
Spill Cause: Tank Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Gas Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/22/89
Cleanup Ceased: 03/22/89
Cleanup Meets Standard: True
Investigator: MCDONALD
Caller Name: Not reported

Caller Agency: Not reported Caller Phone: Not reported Not reported Caller Extension: Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 09/28/88 Reported to Department Time: 10:00 SWIS: 01

Spiller Contact: Not reported Spiller Phone: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

BIENIEK WOLF RD (Continued)

S103478456

EDR ID Number

Spiller Extention: Not reported Spiller Name: **BIENIEK** Spiller Address: 264 WOLF RD Spiller City, St, Zip: COLONIE, NY

Spiller Cleanup Date: / /

Facility Contact: Not reported Not reported Facility Phone: Facility Extention: Not reported Spill Notifier: Other PBS Number: Not reported

Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: / / **UST Involvement:** True

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 11 Date Spill Entered In Computer Data File: 10/27/88 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 04/26/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported 19940728 Last Date:

DEC Remarks: SEE FOLDER; 8801295, 8806304, 8806827, 8806811; AND 8604254, 9200206,

9604075?).

Spill Cause: MCDONALD ON SCENE - LARGE AMT CONTAMINATION FOUND WHILE REMOVING DIESEL TANKS.

B22 BUDGET CAR RENTAL WOLF RD

S103034954 **NY Spills NY Hist Spills** N/A

COLONIE, NY < 1/8 1 ft.

WOLF RD

Site 8 of 10 in cluster B

NY Spills: Relative:

Site ID: 246750 Higher Facility Addr2: Not reported

Actual: Facility ID: 8801260 300 ft. Spill Number: 8801260 Facility Type: ER

Direction Distance

Elevation Site Database(s) EPA ID Number

BUDGET CAR RENTAL WOLF RD (Continued)

S103034954

EDR ID Number

SWIS: 0126 Investigator: tesperbe Referred To: Not reported Spill Date: 5/10/1988 Reported to Dept: 5/10/1988 CID: Not reported Spill Cause: Abandoned Drums Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Other

Cleanup Ceased: 5/13/1988
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 5/13/1988

Remediation Phase: 0

Date Entered In Computer: 5/31/1988
Spill Record Last Update: 6/2/2008
Spiller Name: Not reported

Spiller Company: BUDGET CAR RENTAL

Spiller Address: WOLF RD
Spiller City,St,Zip: COLONIE, ZZ
Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 202607

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"SPERBECK" 09/28/95: This is additional information about material

spilled from the translation of the old spill file: 3 DRUMS'.

Remarks: SPERBECK AT SITE OBSERVED DRUMS IN FIELD BEHIND BUDGET RENTAL. 2 DRUMS

CONTAINING UNKNOWN PRODUCT WILL BE OVERPACKED AND SAMPLED.

Material:

 Site ID:
 246750

 Operable Unit ID:
 916735

 Operable Unit:
 01

 Material ID:
 460409

 Material Code:
 0012

Material Name: Kerosene (#1 Fuel Oil)

Case No.: Not reported Material FA: Petroleum Quantity: 165
Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

BUDGET CAR RENTAL WOLF RD (Continued)

S103034954

EDR ID Number

Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 8801260 **SPERBECK** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Spill Date/Time: 05/10/1988 08:00 05/10/88 09:00 Reported to Dept Date/Time:

SWIS: 01

Spiller Name: BUDGET CAR RENTAL

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: WOLF RD
Spiller City,St,Zip: COLONIE

Spill Cause: Abandoned Drums

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 01
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 05/13/88
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 05/13/88
Corrective Action Plan Submitted:

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 05/31/88
Date Spill Entered In Computer Data File: Not reported

Update Date: 03/30/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BUDGET CAR RENTAL WOLF RD (Continued)

S103034954

Quantity Spilled: 165 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False KEROSENE Material: KEROSENE Class Type: Times Material Entry In File: 2052 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 09/28/95: This is additional information about material spilled from the

translation of the old spill file: 3 DRUMS.

SPERBECK AT SITE OBSERVED DRUMS IN FIELD BEHIND BUDGET RENTAL. 2 DRUMS Remark:

CONTAINING UNKNOWN PRODUCT WILL BE OVERPACKED AND SAMPLED.

C23 **ALBANY PARK & FLY WOLF RD** 264 WOLF RD

NY Spills S102116312 **NY Hist Spills** N/A

COLONIE, NY < 1/8

1 ft.

Site 3 of 4 in cluster C

NY Spills: Relative:

Higher

226560 Site ID: Facility Addr2: Not reported

Actual: 300 ft.

Facility ID: 9506442 Spill Number: 9506442 Facility Type: ER SWIS: 0126 Investigator: **PNBENTIE** Referred To: Not reported Spill Date: 8/24/1995 8/24/1995 Reported to Dept:

CID: 21

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Passenger Vehicle Spill Notifier: Affected Persons Cleanup Ceased: 8/24/1995 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

8/28/1995 Spill Closed Dt:

Remediation Phase:

Date Entered In Computer: Not reported Spill Record Last Update: 12/2/2003 Spiller Name: Not reported Spiller Company: **UNKNOWN CAR** Spiller Address: Not reported

Spiller City,St,Zip: NY Spiller Company: 999

Contact Name: Not reported Contact Phone: Not reported DEC Region: 4

DER Facility ID: 266772

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY PARK & FLY WOLF RD (Continued)

S102116312

"BENTIEN"

CAR GAS TANK LEAKED @ PARKING LOT, FD @ SITE. Remarks:

Material:

Site ID: 226560 Operable Unit ID: 1021217 Operable Unit: 01 Material ID: 364408 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units:

Not reported

Recovered: No

Resource Affected: Not reported False Oxygenate:

Tank Test:

Not reported Site ID: Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

Spill Number: 9506442 Investigator: **BENTIEN** Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 08/24/1995 17:29 Reported to Dept Date/Time: 08/24/95 17:29

SWIS:

UNKNOWN CAR Spiller Name: Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City,St,Zip: Not reported Spill Cause: Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 06

Spill Notifier: Affected Persons PBS Number: Not reported Cleanup Ceased: 08/24/95 Cleanup Meets Std: True

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY PARK & FLY WOLF RD (Continued)

S102116312

Last Inspection:

Penalty Not Recommended Recommended Penalty:

Spiller Cleanup Dt: Enforcement Date: Invstgn Complete: / / **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 08/28/95 Corrective Action Plan Submitted:

Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 08/28/95 Date Spill Entered In Computer Data File: Not reported

Update Date: Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate Failed Tank: Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Not reported

Quantity Recovered: Unkonwn Quantity Recovered: True **GASOLINE** Material: Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: Not reported

CAR GAS TANK LEAKED @ PARKING LOT, FD @ SITE. Remark:

A24 J J NAUGHTER INC

654 ALBANY SHAKER RD < 1/8 LOUDONVILLE, NY 12211

Site 7 of 11 in cluster A

1 ft.

Site ID:

Relative: Higher

UST:

Facility Id: 4-088196 STATE Region: DEC Region: 4

Actual: 301 ft.

Site Status: Unregulated Program Type: **PBS Expiration Date:** N/A UTM X: 598665 UTM Y: 4731265

Tank Number:

Tank ID: 87003

Tank Status: Closed Prior to Micro Conversion, 03/91

35633

U000382451

N/A

UST

HIST UST

Direction Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

U000382451

EDR ID Number

Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/1/1969
Capacity Gallons: 4000
Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

J01 - Dispenser - Submersible D02 - Pipe Type - Galvanized Steel

100 - Overfill - None

C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
H00 - Tank Leak Detection - None

B00 - Tank External Protection - None

Tank Number: 1A Tank ID: 87011

Tank Status:

Closed - Removed
Tank Model:

Not reported

Pipe Model:

Install Date:

Capacity Gallons:

Tightness Test Method:

NN

Closed - Removed

Not reported

Not reported

4/1/1988

6000

NN

Next Test Date: Not reported
Date Tank Closed: 9/1/1996
Tank Leasting

Tank Location:

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

A00 - Tank Internal Protection - None F00 - Pipe External Protection - None J01 - Dispenser - Submersible D02 - Pipe Type - Galvanized Steel

100 - Overfill - None

H05 - Tank Leak Detection - In-Tank System (ATG) C02 - Pipe Location - Underground/On-ground

G04 - Tank Secondary Containment - Double-Walled (Underground)

B00 - Tank External Protection - None

Tank Number: 2 Tank ID: 87004

Tank Status: Closed Prior to Micro Conversion, 03/91

Direction Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

U000382451

EDR ID Number

Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/1/1969
Capacity Gallons: 4000
Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None C00 - Pipe Location - No Piping D02 - Pipe Type - Galvanized Steel H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None J01 - Dispenser - Submersible

100 - Overfill - None

B00 - Tank External Protection - None G00 - Tank Secondary Containment - None

Tank Number: 2A Tank ID: 87012

Tank Status:

Closed - Removed
Tank Model:

Not reported

Not reported
Install Date:

Capacity Gallons:

Tightness Test Method:

Not reported

Next Test Date: Not reported Date Tank Closed: 9/1/1996

Tank Location:

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

C02 - Pipe Location - Underground/On-ground

D02 - Pipe Type - Galvanized Steel J01 - Dispenser - Submersible F00 - Pipe External Protection - None

H05 - Tank Leak Detection - In-Tank System (ATG)

100 - Overfill - None

A00 - Tank Internal Protection - None B00 - Tank External Protection - None

G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 3
Tank ID: 87005

Tank Status: Closed Prior to Micro Conversion, 03/91

Direction Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

U000382451

EDR ID Number

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1969 Capacity Gallons: 4000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None J01 - Dispenser - Submersible

100 - Overfill - None

C00 - Pipe Location - No Piping
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None

Tank Number: 3A Tank ID: 87013

Tank Status:

Closed - Removed
Tank Model:

Not reported

Not reported
Install Date:

Capacity Gallons:

Tightness Test Method:

Not reported

Next Test Date: Not reported Date Tank Closed: 9/1/1996

Tank Location:

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

C02 - Pipe Location - Underground/On-ground

H05 - Tank Leak Detection - In-Tank System (ATG)

100 - Overfill - None

A00 - Tank Internal Protection - None D02 - Pipe Type - Galvanized Steel J01 - Dispenser - Submersible F00 - Pipe External Protection - None

G04 - Tank Secondary Containment - Double-Walled (Underground)

B00 - Tank External Protection - None

Tank Number: 4
Tank ID: 87006

Tank Status: Closed Prior to Micro Conversion, 03/91

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

J J NAUGHTER INC (Continued)

U000382451

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1969 Capacity Gallons: 4000 Tightness Test Method: NN

Next Test Date: Not reported Not reported Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None

C00 - Pipe Location - No Piping D02 - Pipe Type - Galvanized Steel J01 - Dispenser - Submersible H00 - Tank Leak Detection - None

100 - Overfill - None

A00 - Tank Internal Protection - None F00 - Pipe External Protection - None B00 - Tank External Protection - None

Tank Number: 4A Tank ID: 87014

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 4/1/1988 Capacity Gallons: 6000 Tightness Test Method: NN

Next Test Date: Not reported 9/1/1996 Date Tank Closed:

Tank Location:

Steel/carbon steel Tank Type: Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

D02 - Pipe Type - Galvanized Steel A00 - Tank Internal Protection - None F00 - Pipe External Protection - None

J01 - Dispenser - Submersible

C02 - Pipe Location - Underground/On-ground

100 - Overfill - None

H05 - Tank Leak Detection - In-Tank System (ATG)

B00 - Tank External Protection - None

G04 - Tank Secondary Containment - Double-Walled (Underground)

Tank Number: 5 Tank ID: 87007

Tank Status: Closed Prior to Micro Conversion, 03/91

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

J J NAUGHTER INC (Continued)

U000382451

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1969 Capacity Gallons: 3000 Tightness Test Method: NN

Next Test Date: Not reported Not reported Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None H00 - Tank Leak Detection - None G00 - Tank Secondary Containment - None A00 - Tank Internal Protection - None D02 - Pipe Type - Galvanized Steel C00 - Pipe Location - No Piping J01 - Dispenser - Submersible

100 - Overfill - None

B00 - Tank External Protection - None

Tank Number: 6 Tank ID: 87008

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Not reported Pipe Model: Install Date: 12/1/1969 Capacity Gallons: 3000 Tightness Test Method: NN

Next Test Date: Not reported Not reported Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None F00 - Pipe External Protection - None A00 - Tank Internal Protection - None D02 - Pipe Type - Galvanized Steel C00 - Pipe Location - No Piping J01 - Dispenser - Submersible

100 - Overfill - None

H00 - Tank Leak Detection - None B00 - Tank External Protection - None

Tank Number: Tank ID: 87009

Tank Status: Closed Prior to Micro Conversion, 03/91

Direction Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

U000382451

EDR ID Number

Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/1/1969
Capacity Gallons: 3000
Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
J01 - Dispenser - Submersible
D02 - Pipe Type - Galvanized Steel
A00 - Tank Internal Protection - None

100 - Overfill - None

B00 - Tank External Protection - None G00 - Tank Secondary Containment - None

Tank Number: 8
Tank ID: 87010

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/1/1969
Capacity Gallons: 2000
Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

J02 - Dispenser - Suction

A00 - Tank Internal Protection - None F00 - Pipe External Protection - None

100 - Overfill - None

C00 - Pipe Location - No Piping D02 - Pipe Type - Galvanized Steel H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None B00 - Tank External Protection - None

Affiliation Records:

Site Id: 35633

Affiliation Type: On-Site Operator Company Name: J J NAUGHTER INC

Direction Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

U000382451

EDR ID Number

Contact Type: Not reported
Contact Name: J J NAUGHTER INC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN

Zip Code: Not reported Country Code: 001

Phone: (518) 458-7994
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 35633

Affiliation Type: Emergency Contact Company Name: J J NAUGHTER INC

Contact Type: Not reported
Contact Name: RICHARD HOEFER

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 458-7959
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 35633 Affiliation Type: Owner

Company Name: J J NAUGHTER INC
Contact Type: Not reported
Contact Name: Not reported

Address1: 654 ALBANY SHAKER RD

Address2: Not reported City: LOUDONVILLE

State: NY
Zip Code: 12211
Country Code: 001

Phone: (518) 458-7994
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 35633

Affiliation Type: Mail Contact

Company Name: J J NAUGHTER INC

Contact Type: Not reported

Contact Name: Not reported

Address1: 654 ALBANY SHAKER RD

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

J J NAUGHTER INC (Continued)

U000382451

Address2: Not reported LOUDONVILLE City:

NY State: Zip Code: 12211 Country Code: 001

(518) 458-7994 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** 3/4/2004 Date Last Modified:

HIST UST:

PBS Number: 4-088196 SPDES Number: Not reported RICHARD HOEFER **Emergency Contact:** Emergency Telephone: (518) 458-7959 Operator: J J NAUGHTER INC Operator Telephone: (518) 458-7994 Owner Name: J J NAUGHTER INC 654 ALBANY SHAKER RD Owner Address: Owner City, St, Zip: LOUDONVILLE, NY 12211

Owner Telephone: (518) 458-7994 Corporate/Commercial Owner Type:

Owner Subtype: Not reported

Mailing Name: J J NAUGHTER INC Mailing Address: 654 ALBANY SHAKER RD

Mailing Address 2: Not reported

LOUDONVILLE, NY 12211 Mailing City, St, Zip:

Mailing Contact: Not reported Mailing Telephone: (518) 458-7994 Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126 Old PBS Number: Not reported

Facility Type: **RETAIL GASOLINE SALES**

Inspected Date: Not reported Not reported Inspector: Inspection Result: Not reported Federal ID: Not reported Certification Flag: False 04/29/1992 Certification Date: **Expiration Date:** 03/24/1997 Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 True FAMT:

Facility Screen: No Missing Data Owner Screen: No Missing Data

Tank Screen: Dead Letter: False CBS Number: Not reported COLONIE Town or City: County Code: 01 Town or City: 26

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

J J NAUGHTER INC (Continued)

U000382451

Region:

Tank Id:

Tank Location: **UNDERGROUND**

Tank Status: Closed Before April 1, 1991

4

19691201 Install Date: Capacity (gals): 4000

Product Stored: **UNLEADED GASOLINE** Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Not reported Pipe Location:

GALVANIZED STEEL Pipe Type:

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

Tank Id: 1A

Tank Location: **UNDERGROUND** Tank Status: Closed-Removed Install Date: 19880401 Capacity (gals): 6000

UNLEADED GASOLINE Product Stored: Steel/carbon steel Tank Type:

Tank Internal: None

Tank External: None Underground Pipe Location: **GALVÄNIZED STEEL** Pipe Type:

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access) In-tank System Leak Detection:

Overfill Prot: None Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: 09/01/1996 Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Tank Id: 2

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

J J NAUGHTER INC (Continued)

Tank Location: UNDERGROUND Closed Before April 1, 1991 Tank Status:

19691201 Install Date: 4000 Capacity (gals):

UNLEADED GASOLINE Product Stored: Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported

Pipe Type: **GALVANIZED STEEL**

Not reported Pipe Internal: Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported Deleted: False

Updated: False Lat/long: Not reported

Tank Id: 2A

Tank Location: **UNDERGROUND** Tank Status: Closed-Removed 19880401 Install Date:

6000 Capacity (gals):

Product Stored: **UNLEADED GASOLINE** Tank Type: Steel/carbon steel

Tank Internal: None Tank External: None Underground Pipe Location: GALVANIZED STEEL Pipe Type:

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access) Leak Detection: In-tank System

Overfill Prot: None Dispenser: Submersible Not reported Date Tested: Not reported Next Test Date: No Missing Data Missing Data for Tank: Date Closed: 09/01/1996 Test Method: Not reported Deleted: False Updated: True

Lat/long: Not reported

Tank Id:

UNDERGROUND Tank Location:

Tank Status: Closed Before April 1, 1991

Install Date: 19691201 U000382451

Direction
Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

Capacity (gals): 4000
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL

Not reported Pipe Internal: Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Submersible Dispenser: Date Tested: Not reported Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False

Tank Id: 3A

Lat/long:

Tank Location: UNDERGROUND Tank Status: Closed-Removed Install Date: 19880401

Capacity (gals): 6000

Product Stored: UNLEADED GASOLINE Tank Type: Steel/carbon steel

Not reported

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access)
Leak Detection: In-tank System

Overfill Prot: None Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data 09/01/1996 Date Closed: Test Method: Not reported False Deleted: Updated: True Lat/long: Not reported

Tank Id:

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19691201
Capacity (gals): 4000
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel

U000382451

EDR ID Number

Direction Distance Elevation

ion Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

Tank Internal:

Tank External:

U000382451

EDR ID Number

Not reported Pipe Location: Pipe Type: GALVANIZED STEEL Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Submersible Not reported Date Tested: Not reported Next Test Date: Minor Data Missing Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False

Not reported Not reported

Not reported

Tank Id: 4A

Lat/long:

Tank Location: UNDERGROUND Tank Status: UNDERGROUND

Install Date: 19880401 Capacity (gals): 6000

Product Stored: UNLEADED GASOLINE

Tank Type: Steel/carbon steel

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access)
Leak Detection: In-tank System

Overfill Prot: None Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 09/01/1996 Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Tank ld: 5

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19691201 Capacity (gals): 3000

Product Stored: LEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

Pipe Type:

GALVANIZED STEEL

Not reported Pipe Internal: Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported False Deleted: Updated: False Lat/long: Not reported

Tank ld: 6

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19691201 Capacity (gals): 3000

Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported

Pipe Type: GALVANIZED STEEL

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Submersible Not reported Date Tested: Not reported Next Test Date: Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported False Deleted: Updated: False

Tank ld: 7

Lat/long:

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Not reported

Install Date: 19691201 Capacity (gals): 3000

Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported

Pipe Location: Not reported
Pipe Type: GALVANIZED STEEL

Pipe Internal: Not reported Pipe External: Not reported

EDR ID Number

U000382451

Direction Distance

Elevation Site Database(s) EPA ID Number

J J NAUGHTER INC (Continued)

U000382451

EDR ID Number

Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

Tank ld: 8

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19691201
Capacity (gals): 2000
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported

Pipe Type: GALVANIZED STEEL

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Suction Dispenser: Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Not reported Date Closed: Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

B25 DOMINION TRANSMISSION INCORPORATED ALBANY M&R

RCRA-CESQG 1000153868 FINDS NYD982541211 MANIFEST

< 1/8 ALBANY, NY 12205

1 ft.

Site 9 of 10 in cluster B

148 WOLF ROAD

Relative: RCRA-CESQG:

Higher Date form received by agency: 01/01/2007

Facility name: C N G TRANSMISSION CORP - ALBANY M&R STA Facility address: 148 WOLF RD

Actual: 300 ft.

ALBANY, NY 12205

EPA ID: NYD982541211
Mailing address: BURDECK ST

SCHENECTADY, NY 12306

Contact: OLIVE DIMON Contact address: BURDECK ST

SCHENECTADY, NY 12306

Contact country: US

Direction Distance Elevation

ation Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

Contact telephone: (814) 628-6065 Contact email: Not reported

EPA Region: 02

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar

month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from

the cleanup of a spill, into or on any land or water, of acutely

hazardous waste

Owner/Operator Summary:

Owner/operator name: C N G TRANSMISSION CORP

Owner/operator address: 445 W MAIN ST

CLARKSBURG, WV 26301

Owner/operator country: US

Owner/operator telephone: (304) 623-8000

Legal status: Private

Owner/Operator Type: Operator
Owner/Op start date: 02/28/2000
Owner/Op end date: Not reported

Owner/operator name: C N G TRANSMISSION CORP

Owner/operator address: 445 W MAIN ST

CLARKSBURG, WV 26301

Owner/operator country: US

Owner/operator telephone: (304) 623-8000

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 02/28/2000
Owner/Op end date: Not reported

Owner/operator name: DOMINION RESOURCES INC

Owner/operator address: 120 TREDEGAR ST

RICHMOND, VA 23219

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown

Direction Distance

Elevation Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Used oil transporter:

Date form received by agency: 01/01/2006

Facility name: C N G TRANSMISSION CORP - ALBANY M&R STA Classification: Conditionally Exempt Small Quantity Generator

No

Date form received by agency: 06/12/2000

Facility name: C N G TRANSMISSION CORP - ALBANY M&R STA

Classification: Large Quantity Generator

Date form received by agency: 07/14/1999

Facility name: C N G TRANSMISSION CORP - ALBANY M&R STA

Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004424971

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD982541211

Country: USA

Mailing Name: CNG TRANSMISSION CORP Mailing Contact: CNG TRANSMISSION CORP

Mailing Address: 445 W MAIN ST
Mailing Address 2: Not reported
Mailing City: CLARKSBURG

Mailing State: WV
Mailing Zip: 26301
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 304-623-8000

Document ID: NYG1796022

Direction Distance

Elevation Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

Manifest Status: Not reported NYD980761191 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 11/14/2001 Trans1 Recv Date: 11/14/2001 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/16/2001 Part A Recy Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982541211 NYD049836679 Trans1 EPA ID: Not reported Trans2 EPA ID: TSDF ID: PR5398NY

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00200

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 01

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG2796489 Manifest Status: Not reported Trans1 State ID: VTR000500090 VTR000500090 Trans2 State ID: Generator Ship Date: 10/28/2003 Trans1 Recv Date: 10/28/2003 Trans2 Recv Date: 10/30/2003 TSD Site Recv Date: 10/30/2003 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD982541211 Generator EPA ID: Trans1 EPA ID: NYD049836679 Trans2 EPA ID: Not reported TSDF ID: 72C52VT

Waste Code: D018 - BENZENE 0.5 MG/L TCLP

Quantity: 00100

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 03

Direction Distance Elevation

on Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported Manifest Status: Not reported PAD980707442 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2008-11-12 Trans1 Recv Date: 2008-11-12 Trans2 Recv Date: Not reported TSD Site Recv Date: 2008-11-13 Not reported Part A Recv Date: Part B Recv Date: Not reported NYD982541211 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported 204.0 Quantity:

Units: K - Kilograms (2.2 pounds)

Number of Containers: 2.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 003740821JJK

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: NYB7579467

Manifest Status: Completed copy
Trans1 State ID: K66761ME

Trans2 State ID: Not reported
Generator Ship Date: 970213

Trans1 Recv Date: 970213

Trans2 Recv Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

TSD Site Recv Date: 970214
Part A Recv Date: 970305
Part B Recv Date: 970305
Generator EPA ID: NYD982541211
Trans1 EPA ID: OH0000000539
Trans2 EPA ID: Not reported
TSDF ID: NYD049836679

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00227

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYG0236727 Document ID: Manifest Status: Completed copy Trans1 State ID: P5W89COH Trans2 State ID: Not reported Generator Ship Date: 971106 971106 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 971107 Part A Recv Date: 971203 Part B Recv Date: 971124 Generator EPA ID: NYD982541211 Trans1 EPA ID: OH000000539 Trans2 EPA ID: Not reported NYD049836679 TSDF ID:

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00050

Units: K - Kilograms (2.2 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 100
Year: 97

Manifest Tracking Num:
Import Ind:
Export Ind:
Discr Quantity Ind:
Discr Type Ind:
Not reported

Direction Distance Elevation

nce EDR ID Number tition Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

Discr Partial Reject Ind:
Discr Full Reject Ind:
Mot reported
Not reported
Manifest Ref Num:
Not reported
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Mgmt Method Type Code:
Not reported

Document ID: NYG1798695 Manifest Status: Not reported OH000000539 Trans1 State ID: Not reported Trans2 State ID: 11/08/2000 Generator Ship Date: Trans1 Recv Date: 11/08/2000 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/09/2000 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982541211 Trans1 EPA ID: NYD049836679 Trans2 EPA ID: Not reported TSDF ID: PUN9076OH

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00300

Units: K - Kilograms (2.2 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 01.00
Year: 00

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG4006053 Manifest Status: Not reported Trans1 State ID: 78C50VT Trans2 State ID: Not reported Generator Ship Date: 11/02/2004 Trans1 Recy Date: 11/02/2004 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/04/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982541211 VTR000500090 Trans1 EPA ID: Trans2 EPA ID: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

TSDF ID: NYD049836

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00100

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method:

Specific Gravity:

Year:

Manifest Tracking Num:

Not reported

Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB7579827

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: Not reported Trans2 State ID: Not reported Generator Ship Date: 960723 Trans1 Recv Date: 960723 Trans2 Recv Date: Not reported TSD Site Recv Date: 960727 Part A Recv Date: 960821 Part B Recv Date: 960909 Generator EPA ID: NYD982541211 Trans1 EPA ID: MOD095038998 Trans2 EPA ID: Not reported TSDF ID: KSD981506025

Waste Code: B003 - PETROLEUM OIL WITH 500 PPM OR > PCB

Quantity: 00727

Units: K - Kilograms (2.2 pounds)

Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100

Waste Code: Not reported Quantity: 00181

Units: K - Kilograms (2.2 pounds)
Number of Containers: 001
Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00200

Units: K - Kilograms (2.2 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Direction Distance

Elevation Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG3261303 Manifest Status: Not reported Trans1 State ID: OH000000539 Trans2 State ID: Not reported Generator Ship Date: 11/21/2002 Trans1 Recv Date: 11/21/2002 Trans2 Recv Date: Not reported TSD Site Recv Date: 11/21/2002 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982541211 Trans1 EPA ID: NYD049836679 Trans2 EPA ID: Not reported TSDF ID: TLM4144OH

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00050

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method:
Specific Gravity:
Year:

Manifest Tracking Num:

L Landfill.
01.00
02
Not reporte

Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported

Manifest Status: Not reported

Trans1 State ID: NJD080631369

Trans2 State ID: NJD054126164

Generator Ship Date: 12/5/2007

Direction Distance

Elevation Site Database(s) EPA ID Number

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

EDR ID Number

Trans1 Recv Date: 12/5/2007 Trans2 Recv Date: 12/6/2007 TSD Site Recv Date: 12/7/2007 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982541211 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: Not reported

Quantity: 98

Units: K - Kilograms (2.2 pounds)

Number of Containers: 2

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 1
Year: 07

Manifest Tracking Num: 000250581VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H132

Document ID: NYG4006854 Manifest Status: Not reported Trans1 State ID: VTR000500090 Not reported Trans2 State ID: Generator Ship Date: 12/06/2005 Trans1 Recv Date: 12/06/2005 Trans2 Recv Date: Not reported 12/09/2005 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD982541211 Trans1 EPA ID: 78C50VT Trans2 EPA ID: Not reported TSDF ID: NYD049836679

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00150

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method:
Specific Gravity:
O1.00
Year:
Not reported
Manifest Tracking Num:
Import Ind:
Not reported
Export Ind:
Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DOMINION TRANSMISSION INCORPORATED ALBANY M&R (Continued)

1000153868

Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

NYG4006854 Document ID: Manifest Status: Not reported VTR000500090 Trans1 State ID: Trans2 State ID: Not reported 12/06/2005 Generator Ship Date: Trans1 Recv Date: 12/06/2005 Trans2 Recy Date: Not reported TSD Site Recv Date: 12/09/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD982541211 Generator EPA ID: Trans1 EPA ID: 78C50VT Trans2 EPA ID: Not reported TSDF ID: NYD049836679

B007 - OTHER MISCELLANEOUS PCB WASTES Waste Code:

L Landfill.

Quantity: 00150

K - Kilograms (2.2 pounds) Units:

Number of Containers:

Handling Method:

Container Type: DM - Metal drums, barrels

Specific Gravity: 01.00 Year: 2005 Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

F26 NIMO PUMP STATION WOLF RD

WOLF RD

< 1/8 COLONIE, NY

1 ft.

Site 1 of 2 in cluster F

NY Spills: Relative: Site ID:

246751 Higher Facility Addr2: Not reported Actual: Facility ID: 8801941 299 ft.

Spill Number: 8801941 Facility Type: ER SWIS: 0126

S102113311

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

NIMO PUMP STATION WOLF RD (Continued)

S102113311

EDR ID Number

Investigator: PNBENTIE
Referred To: Not reported
Spill Date: 6/2/1988
Reported to Dept: 6/2/1988
CID: Not reported
Spill Cause: Unknown
Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Affected Persons

Cleanup Ceased: 6/3/1988
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 6/7/1988 Remediation Phase: 0

Date Entered In Computer: 6/7/1988
Spill Record Last Update: 11/18/1996
Spiller Name: Not reported

Spiller Company: NIAGARA MOHAWK NIMO

Spiller Address: Not reported Spiller City, St, Zip: ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 202607

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BENTIEN" 06/07/88: MERCAPTON ODORANT RELEASE, NOT NATURAL GAS, NO

CLEAN UP ACTION TAKEN DISPERSED IN AIR.

Remarks: STRONG GAS ODOR AT 125 WOLF RD, JOHN ALLEN 471-3518 NIMO ODORIZING

STATION, RELEASE OF ODORANT, NOT NATURAL GAS

Material:

 Site ID:
 246751

 Operable Unit ID:
 917381

 Operable Unit:
 01

 Material ID:
 461069

 Material Code:
 1233A

Material Name: MERCAPTONPHANOL

Case No.:

Mot reported

Material FA:

Other

Quantity:

Units:

Pounds

Recovered:

No

Resource Affected:

Not reported

Not reported

Oxygenate:

False

Tank Test:

Site ID: Not reported
Spill Tank Test: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO PUMP STATION WOLF RD (Continued)

S102113311

Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 246757 Facility Addr2: Not reported Facility ID: 9613389 Spill Number: 9613389 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 11/1/1996 Spill Date: 2/12/1997 Reported to Dept: CID: 252

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Gasoline Station

Spill Notifier: DEC Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/19/1997 Remediation Phase: Date Entered In Computer: 2/12/1997 Spill Record Last Update: 6/14/2007 Spiller Name: **UNKNOWN** Spiller Company: UNKNOWN

Spiller Address: UNKNOWN Spiller City, St, Zip: UNKNOWN, ZZ

Spiller Company:

Contact Name: GREG GORDON [???] (518) 423-4032 Contact Phone:

DEC Region: 4 DER Facility ID:

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

> "CHRISTENSEN" PROBABLY #32334 @ 156 WOLF; MATT LEFT CONTACT & PHONE BLANK - HAVE NO IDEA WHERE GREG GORDON CAME FROM. 2/18/97 - CHECKED BOTH WOLF ROAD STATIONS BUT FOUND NOTHING WRONG. 156 WOLF - 9110043,

0310895

HESS STATION ON WOLF RD NEAR AIRPORT-PUMP HAS BEEN LEAKING SINCE Remarks:

NOVEMBER-PUMP AND GROUND STAINED WITH DIESEL

Material:

Site ID: 246757 Operable Unit ID: 1040974 Operable Unit: 01 Material ID: 338499 Material Code: 8000 Material Name: Diesel Case No.: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO PUMP STATION WOLF RD (Continued)

S102113311

Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

> Click this hyperlink while viewing on your computer to access NOVEMBER-PUMP AND GROUND STAINED WITH DIESEL

NY Hist Spills:

Region of Spill: Spill Number: 9613389 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 11/01/1996 12:00 Spill Date/Time: Reported to Dept Date/Time: 02/12/97 16:03

SWIS:

UNKNOWN Spiller Name: Spiller Contact: **UNKNOWN** Spiller Phone: (000) 000-0000

Spiller Contact: GREG GORDON [???]

Spiller Phone: (518) 423-4032 Spiller Address: UNKNOWN Spiller City, St, Zip: UNKNOWN Spill Cause: **Equipment Failure** Reported to Dept: On Land

Water Affected: Not reported Spill Source: 05 Spill Notifier: DEC PBS Number: 4-163775 Cleanup Ceased: Cleanup Meets Std: False Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: 11 **Enforcement Date:** 11 Invstgn Complete:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO PUMP STATION WOLF RD (Continued)

S102113311

UST Involvement: True

Known release with minimal potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 02/12/97 Date Spill Entered In Computer Data File: Not reported

Update Date: 02/11/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate Failed Tank: Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: True Material: DIESEL

Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported 19940728 Last Date:

DEC Remarks: PROBABLY 32334 @ 156 WOLF; MATT LEFT CONTACT PHONE BLANK - HAVE NO IDEA

WHERE GREG GORDON CAME FROM. 2/18/97 - CHECKED BOTH WOLF ROAD STATIONS BUT

FOUND NOTHING WRONG.

HESS STATION ON WOLF RD NEAR AIRPORT-PUMP HAS BEEN LEAKING SINCE NOVEMBER-PUMP Remark:

AND GROUND STAINED WITH DIESEL

Region of Spill: 8801941 Spill Number: **BENTIEN** Investigator: Not reported Caller Name: Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 06/02/1988 10:00 Reported to Dept Date/Time: 06/02/88 11:48

SWIS: 01

Spiller Name: NIAGARA MOHAWK NIMO

Spiller Contact: Not reported Spiller Phone: (518) 471-3518 Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Unknown Reported to Dept: Air

Water Affected: Not reported

Spill Source: 01

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

NIMO PUMP STATION WOLF RD (Continued)

S102113311

Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: 06/03/88
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 06/07/88

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 06/07/88
Date Spill Entered In Computer Data File: Not reported

Update Date: 11/18/96
Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material

Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Pounds
Quantity Recovered: 0
Unkonwn Quantity Recovered: True

Material: MERCAPTONPHANOL Class Type: MERCAPTONPHANOL

Times Material Entry In File: 1

CAS Number: Not reported Last Date: Not reported

DEC Remarks: 06/07/88: MERCAPTON ODORANT RELEASE, NOT NATURAL GAS, NO CLEAN UP ACTION TAKEN

DISPERSED IN AIR.

Remark: STRONG GAS ODOR AT 125 WOLF RD, JOHN ALLEN 471-3518 NIMO ODORIZING STATION,

RELEASE OF ODORANT, NOT NATURAL GAS

F27 HESS #32334 WOLF RD NY Spills

WOLF RD < 1/8 COLONIE. NY

1 ft.

Site 2 of 2 in cluster F

Relative: NY Spills:

 Higher
 Site ID:
 246754

 Facility Addr2:
 Not reported

 Actual:
 Facility ID:
 9307535

 299 ft.
 Spill Number:
 9307535

Spill Number: 9307535 Facility Type: ER SWIS: 0126 S103035077

N/A

NY Hist Spills

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS #32334 WOLF RD (Continued)

S103035077

Investigator: HOY Referred To:

Not reported Spill Date: 9/21/1993 Reported to Dept: 9/21/1993 CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: **Gasoline Station** Spill Notifier: Responsible Party

Cleanup Ceased: 9/21/1993 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/13/1993

Remediation Phase:

Date Entered In Computer: 10/13/1993 Spill Record Last Update: 6/14/2007 Spiller Name: Not reported Spiller Company: HESS #32334 Spiller Address: WOLF RD Spiller City, St, Zip: COLONIE, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 332363

PBS 4-163775; SEE 9110043 (Edocs), 9307535, 9613389, 0310895, 0702953. DEC Memo:

Not reported

Remarks: SPILLED FROM HOSE DURING DISCONNECT, USED SORBENTS.

Material:

246754 Site ID: Operable Unit ID: 988613 Operable Unit: 01 393795 Material ID: Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum

Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

HESS #32334 WOLF RD (Continued)

S103035077

EDR ID Number

Last Modified: Not reported Not reported Test Method:

NY Hist Spills:

Region of Spill:

Spill Number: 9307535 Investigator: HOY

Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 09/21/1993 18:00 Reported to Dept Date/Time: 09/21/93 18:29

SWIS: 01

Spiller Name: HESS #32334 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: WOLF RD COLONIE Spiller City, St, Zip: Spill Cause: **Equipment Failure**

Reported to Dept: On Land

Water Affected: Not reported Spill Source: 05

Spill Notifier:

Responsible Party PBS Number: Not reported Cleanup Ceased: 09/21/93 Cleanup Meets Std: True Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** // Invstgn Complete: // **UST Involvement:** True

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

10/13/93 Spill Closed Dt:

. Corrective Action Plan Submitted: // Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 10/13/93 Date Spill Entered In Computer Data File: Not reported

Update Date: 03/30/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS #32334 WOLF RD (Continued)

S103035077

Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: Not reported

Remark: SPILLED FROM HOSE DURING DISCONNECT, USED SORBENTS.

TOWN OF COLONIE PURE WATERS DEPT. G28

UST U001323601 108 WOLF ROAD **HIST UST** N/A

LATHAM, NY 12110 < 1/8

1 ft.

Site 1 of 3 in cluster G

UST: Relative:

4-600124 Higher Facility Id: Region: STATE

Actual: DEC Region:

300 ft. Site Status: Unregulated

Program Type: **PBS Expiration Date:** N/A UTM X: 597602 UTM Y: 4730159 Site ID: 37459

Tank Number: 13 Tank ID: 94209

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1976 2000 Capacity Gallons: Tightness Test Method: Next Test Date: Not reported 12/1/1993 Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel

Date Test: 9/1/1987 Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

A00 - Tank Internal Protection - None

J02 - Dispenser - Suction

C02 - Pipe Location - Underground/On-ground

B01 - Tank External Protection - Painted/Asphalt Coating

F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None D01 - Pipe Type - Steel/Carbon Steel/Iron

H00 - Tank Leak Detection - None

100 - Overfill - None

Tank Number: 14

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TOWN OF COLONIE PURE WATERS DEPT. (Continued)

U001323601

Tank ID: 94210

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1976 2000 Capacity Gallons: Tightness Test Method: 01

Next Test Date: Not reported Date Tank Closed: 12/1/1993

Tank Location:

Tank Type: Steel/carbon steel

Date Test: 9/1/1987 Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

J02 - Dispenser - Suction

B01 - Tank External Protection - Painted/Asphalt Coating

A00 - Tank Internal Protection - None F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None D01 - Pipe Type - Steel/Carbon Steel/Iron H00 - Tank Leak Detection - None

C02 - Pipe Location - Underground/On-ground

100 - Overfill - None

Tank Number: Tank ID: 94207

Tank Status: Tank Converted to Non-Regulated Use Tank Model:

Not reported Pipe Model: Not reported Install Date: Not reported Capacity Gallons: 1000 Tightness Test Method: NNNext Test Date: Not reported Date Tank Closed: 8/1/1996 Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron A00 - Tank Internal Protection - None

J02 - Dispenser - Suction 100 - Overfill - None

B01 - Tank External Protection - Painted/Asphalt Coating

F00 - Pipe External Protection - None

C02 - Pipe Location - Underground/On-ground

H00 - Tank Leak Detection - None

5

G00 - Tank Secondary Containment - None

Tank Number:

Direction Distance

Elevation Site Database(s) EPA ID Number

TOWN OF COLONIE PURE WATERS DEPT. (Continued)

U001323601

EDR ID Number

Tank ID: 94208

Tank Status: Tank Converted to Non-Regulated Use

Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported Capacity Gallons: 1000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: 8/1/1996 Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron A00 - Tank Internal Protection - None

J02 - Dispenser - Suction I00 - Overfill - None

H00 - Tank Leak Detection - None

B01 - Tank External Protection - Painted/Asphalt Coating

G00 - Tank Secondary Containment - None C02 - Pipe Location - Underground/On-ground

F00 - Pipe External Protection - None

Affiliation Records:

Site Id: 37459

Affiliation Type: Emergency Contact
Company Name: TOWN OF COLONIE

Contact Type: Not reported

Contact Name: DEPT. OF FIRE PREV.

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999

Phone: (518) 783-2811
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: ELMOORE
Date Last Modified: 2/24/2006

Site Id: 37459 Affiliation Type: Owner

Company Name: TOWN OF COLONIE

Contact Type: Not reported Contact Name: Not reported

Address1: MEMORIAL TOWN HALL

Address2: Not reported City: NEWTONVILLE

State: NY
Zip Code: 12128
Country Code: 001

Direction Distance

Elevation Site Database(s) EPA ID Number

TOWN OF COLONIE PURE WATERS DEPT. (Continued)

U001323601

EDR ID Number

Phone: (518) 783-2712
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: ELMOORE
Date Last Modified: 2/24/2006

Site Id: 37459
Affiliation Type: Mail Contact
Company Name: TOWN OF COLONIE
Contact Type: Not reported

Contact Name: VINCENT A. MARINI
Address1: MEMORIAL TOWN HALL

Address2: P.O. BOX 508
City: P.O. BOX 508
NEWTONVILLE

State: NY
Zip Code: 12128
Country Code: 001

Phone: (518) 783-2726
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37459

Affiliation Type: On-Site Operator

Company Name: TOWN OF COLONIE PURE WATERS DEPT.

Contact Type: Not reported
Contact Name: TOWN OF COLONIE

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 783-2712
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

HIST UST:

Owner City,St,Zip:

PBS Number: 4-600124 SPDES Number: Not reported

Emergency Contact: DEPT. OF FIRE PREV.
Emergency Telephone: (518) 783-2811
Operator: TOWN OF COLONIE
Operator Telephone: (518) 783-2712
Owner Name: TOWN OF COLONIE
Owner Address: MEMORIAL TOWN HALL

NEWTONVILLE, NY 12128

Owner Telephone: (518) 783-5712
Owner Type: Local Government
Owner Subtype: Not reported

Mailing Name: TOWN OF COLONIE

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TOWN OF COLONIE PURE WATERS DEPT. (Continued)

U001323601

EDR ID Number

Mailing Address: MEMORIAL TOWN HALL

Mailing Address 2: P.O. BOX 508

Mailing City, St, Zip: NEWTONVILLE, NY 12128 Mailing Contact: VINCENT A. MARINI Mailing Telephone: (518) 783-2726 Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126 Old PBS Number: Not reported OTHER Facility Type: Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False 07/13/1994 Certification Date: **Expiration Date:** 11/17/1997 Renew Flag: False Renewal Date: Not reported Total Capacity: 0

FAMT: True

Facility Screen: No Missing Data Owner Screen: No Missing Data

Tank Screen: 0 Dead Letter: False CBS Number: Not reported COLONIE Town or City:

County Code: 01 Town or City: 26 Region: 4

Tank Id: 13

UNDERGROUND Tank Location: Closed-Removed Tank Status: 19761201 Install Date: Capacity (gals): 2000

LEADED GASOLINE Product Stored: Tank Type: Steel/carbon steel

Tank Internal: None

Painted/Asphalt Coating Tank External:

Pipe Location: Underground Pipe Type: STEEL/IRON Pipe Internal: None

Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Suction Dispenser: Date Tested: 09/01/1987 Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: 12/01/1993 Test Method: Petro-Tite Deleted: False Updated: True

Direction Distance Elevation

tion Site Database(s) EPA ID Number

TOWN OF COLONIE PURE WATERS DEPT. (Continued)

U001323601

EDR ID Number

Lat/long: Not reported

Tank Id: 14

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19761201
Capacity (gals): 2000

Product Stored: UNLEADED GASOLINE Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Painted/Asphalt Coating

Pipe Location: Underground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Date Tested: 09/01/1987 Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 12/01/1993 Petro-Tite Test Method: Deleted: False Updated: True Lat/long: Not reported

Tank ld: 4

Tank Location: UNDERGROUND

Tank Status: Tank Converted To Non-Regulated Use

Install Date: Not reported Capacity (gals): 1000

Product Stored: NOS 1,2, OR 4 FUEL OIL Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Painted/Asphalt Coating

Pipe Location: Underground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 08/01/1996 Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TOWN OF COLONIE PURE WATERS DEPT. (Continued)

U001323601

Tank Id:

UNDERGROUND Tank Location:

Tank Status: Tank Converted To Non-Regulated Use

Install Date: Not reported

Capacity (gals): 1000

NOS 1,2, OR 4 FUEL OIL Product Stored: Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Painted/Asphalt Coating

Pipe Location: Underground STEEL/IRON Pipe Type:

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Suction Dispenser: Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 08/01/1996 Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

G29 **DESMOND AMERICANA** RCRA-NonGen 1000301242 660 ALBANY SHAKER RD FINDS NYD982728982

< 1/8 **ALBANY, NY 12211**

HIST UST Site 2 of 3 in cluster G **NY Spills NY Hist Spills**

Relative:

1 ft.

RCRA-NonGen: Higher

Date form received by agency: 01/01/2007

Actual: **DESMOND AMERICANA** Facility name: 300 ft. Facility address: 660 ALBANY SHAKER RD ALBANY, NY 122111084

NYD982728982 EPA ID: ALBANY SHAKER RD Mailing address:

ALBANY, NY 12211

Contact: Not reported

Contact address: ALBANY SHAKER RD

ALBANY, NY 12211

US Contact country:

Contact telephone: Not reported Not reported Contact email:

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: UNKNOWN Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

US Owner/operator country:

UST

Direction Distance Elevation

ance EDR ID Number ation Site Database(s) EPA ID Number

DESMOND AMERICANA (Continued)

1000301242

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: UNKNOWN
Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Unknown Transporter of hazardous waste: Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No

Off-site waste receiver: Commercial status unknown

No

Historical Generators:

Used oil transporter:

Date form received by agency: 01/01/2006

Facility name: DESMOND AMERICANA
Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: DESMOND AMERICANA
Classification: Not a generator, verified

Date form received by agency: 04/17/1989

Facility name: DESMOND AMERICANA
Classification: Large Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 10/08/1993

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported
Not reported
State

Direction Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

DESMOND AMERICANA (Continued)

1000301242

FINDS:

Registry ID: 110004429208

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

UST:

Facility Id: 4-600451 Region: STATE

DEC Region:

Site Status: Unregulated **PBS** Program Type: **Expiration Date:** N/A UTM X: 598510 UTM Y: 4731397 Site ID: 37785

Tank Number: 1

Tank ID: 96461

Tank Status: Closed - In Place Tank Model: Not reported Pipe Model: Not reported Install Date: 1/1/1982 Capacity Gallons: 6500 Tightness Test Method: NN

Next Test Date: Not reported 10/1/1996 Date Tank Closed:

Tank Location:

Tank Type: Equivalent technology

Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

J02 - Dispenser - Suction

B04 - Tank External Protection - Fiberglass

D10 - Pipe Type - Copper

A00 - Tank Internal Protection - None H00 - Tank Leak Detection - None

100 - Overfill - None

C02 - Pipe Location - Underground/On-ground G00 - Tank Secondary Containment - None F00 - Pipe External Protection - None

Affiliation Records:

Site Id: 37785 Affiliation Type: Mail Contact Company Name: THE DESMOND

Direction Distance

Elevation Site Database(s) EPA ID Number

DESMOND AMERICANA (Continued)

1000301242

EDR ID Number

Contact Type: Not reported

Contact Name: GARY D. SMITH GENERAL MAN Address1: G60 ALBANY-SHAKER RD

 Address2:
 Not reported

 City:
 ALBANY

 State:
 NY

 Zip Code:
 12211

 Country Code:
 001

Phone: (518) 869-8100
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37785

Affiliation Type: On-Site Operator Company Name: THE DESMOND Contact Type: Not reported THE DESMOND Contact Name: Address1: Not reported Not reported Address2: City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 869-8100
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37785 Affiliation Type: Owner

Company Name: FIRST COLONIE COMPANY

Contact Type: Not reported Contact Name: Not reported

Address1: 660 ALBANY-SHAKER RD

 Address2:
 Not reported

 City:
 ALBANY

 State:
 NY

 Zip Code:
 12211

 Country Code:
 001

Phone: (518) 869-8100
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37785

Affiliation Type: Emergency Contact

Company Name: FIRST COLONIE COMPANY

Contact Type: Not reported

Contact Name: GARY SMITH, GEN. MANAGER

Address1: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DESMOND AMERICANA (Continued)

1000301242

EDR ID Number

Address2: Not reported City: Not reported

State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 869-8100
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-600451 SPDES Number: Not reported

Emergency Contact: GARY SMITH, GEN. MANAGER

Emergency Telephone: (518) 869-8100 Operator: THE DESMOND Operator Telephone: (518) 869-8100

Owner Name: FIRST COLONIE COMPANY
Owner Address: 660 ALBANY-SHAKER RD
Owner City,St,Zip: ALBANY, NY 12211
Owner Telephone: (518) 869-8100
Owner Type: Corporate/Commercial

Owner Subtype: Not reported Mailing Name: THE DESMOND

Mailing Address: 660 ALBANY-SHAKER RD

Mailing Address 2: Not reported
Mailing City, St, Zip: ALBANY, NY 12211

Mailing Contact: GARY D. SMITH GENERAL MAN

Mailing Telephone: (518) 869-8100 Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126 Old PBS Number: Not reported Facility Type: **OTHER** Not reported Inspected Date: Not reported Inspector: Inspection Result: Not reported Federal ID: Not reported Certification Flag: False 10/15/1996 Certification Date: **Expiration Date:** 10/15/2001 Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data

Tank Screen:

Dead Letter:

CBS Number:

Town or City:

County Code:

Town or City:

26

Direction Distance

Elevation Site Database(s) EPA ID Number

DESMOND AMERICANA (Continued)

1000301242

EDR ID Number

Region: 4

Tank Id:

Tank Location: UNDERGROUND
Tank Status: Closed-In Place
Install Date: 19820101
Capacity (gals): 6500

Product Stored: NOS 1,2, OR 4 FUEL OIL
Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: Fiberglass
Pipe Location: Underground

Pipe Type: FIBERGLASS COATED STEEL

Pipe Internal: Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: 10/01/1996 Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

NY Spills:

Site ID: 339156 Facility Addr2: Not reported Facility ID: 0413281 Spill Number: 0413281 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported 3/21/2005 Spill Date: 3/21/2005 Reported to Dept:

CID: 21
Spill Cause: Housekeeping
Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. DEC Response. Willing Responsible Party.

Corrective action taken.

Spill Closed Dt: 4/13/2005

Remediation Phase: 0

Date Entered In Computer: 3/21/2005 Spill Record Last Update: 9/2/2005 Spiller Name: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DESMOND AMERICANA (Continued)

1000301242

DESMOND HOTEL Spiller Company:

Spiller Address: COLONIE Spiller City, St, Zip: COLONIE, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 285773

DEC Memo: 04/13/05 - No DEC response. wtc 06/15/05 - ECO checked site and

everything was ok. They were getting a lot of calls after they fired

one of their painters. wtc 8808977

THIS STARTED BACK IN 2001 AND HAS BEEN CONTINUING RIGHT UP UNTILL Remarks:

> JANUARY OF THIS YEAR. THE CALLER STATES THAT THIS COMPANY WOULD PUT LACKER THINNER, MINERAL SPIRITS, APOXY PAINTS, ETC. WAS DISPOSED INTO

A FARMERS FIELD.

Material:

Site ID: Not reported Operable Unit ID: Not reported Operable Unit: Not reported Material ID: Not reported Not reported Material Code: Material Name: Not reported Case No.: Not reported Material FA: Not reported Not reported Quantity: Units: Not reported Recovered: Not reported Resource Affected: Not reported Oxygenate: Not reported

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

99777 Site ID: Facility Addr2: Not reported Facility ID: 8808977 Spill Number: 8808977 Facility Type: ER SWIS: 0126 **AJKOKOCK** Investigator: Referred To: Not reported 2/17/1989 Spill Date:

2/17/1989 Reported to Dept: CID: 21

Spill Cause: Human Error Water Affected: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DESMOND AMERICANA (Continued)

1000301242

EDR ID Number

Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: 2/17/1989
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates a file or hazard. DEC Response. Willing

Responsible Party. Corrective action taken.

Spill Closed Dt: 2/17/1989

Remediation Phase: 0
Date Entered In Computer: 2/17/1989
Spill Record Last Update: 9/2/2005
Spiller Name: Not reported

Spiller Company: DESMOND AMERICANA
Spiller Address: DESMOND AMERICANA
660 ALBANY SHAKER ROAD

Spiller City, St, Zip: COLONIE, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported DEC Region: 4

DER Facility ID: 88637

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"KOKOCKI" 02/21/89: CLEAN HARBORS HIRED BY HOTEL TO PUMP MATERIAL FROM SUMP RATHER THAN RISK RUNNING IT THROUGH SEWER SYSTEM. TANKER ARRIVED 1400 HRS. 6,000 G REMOVED FROM SUMP.READING AT SOURCE 1 PPM.

0413281

Remarks: FUMES EMANATING FROM LAUNDRY ROOM, SPREADING THROUGH HOTEL. THINK

HYDROFLUORIC ACID AND ANOTHER CHEMICAL MIXED. SHAKER ROAD FD ON SCENE.

ONE PERSON HOSPITALIZED. CLEAN HARBORS PUMPED OUT CESSPOOL.

Material:

 Site ID:
 99777

 Operable Unit ID:
 925285

 Operable Unit:
 01

 Material ID:
 453731

 Material Code:
 0066A

Material Name: UNKNOWN PETROLEUM

Case No.: Not reported Material FA: Petroleum Quantity: 0

Units: Pounds
Recovered: No
Resource Affected: Not reported

 Oxygenate:
 False

 Site ID:
 99777

 Operable Unit ID:
 925285

 Operable Unit:
 01

 Material ID:
 453732

 Material Code:
 0063A

Material Name: UNKNOWN HAZARDOUS MATERIAL

Case No.: Not reported
Material FA: Hazardous Material

Quantity: 0
Units: Gallons
Recovered: No

Resource Affected: Not reported Oxygenate: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DESMOND AMERICANA (Continued)

1000301242

Site ID: 99777 Operable Unit ID: 925285 Operable Unit: 01 Material ID: 453734 Material Code: 0177B

Material Name: HYDROGEN FLUORIDE

07664393 Case No.:

Material FA: Hazardous Material

Quantity: Units: Pounds Recovered: No Not reported Resource Affected:

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Not reported Last Modified: Test Method: Not reported

> Click this hyperlink while viewing on your computer to access ONE PERSON HOSPITALIZED. CLEAN HARBORS PUMPED OUT CESSPOOL.

NY Hist Spills:

Region of Spill: 4 Spill Number: 8808977 KOKOCKI Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Not reported Notifier Name: Not reported Notifier Agency: Notifier Phone: Not reported Spill Date/Time: 02/17/1989 09:39 Reported to Dept Date/Time: 02/17/89 09:55

SWIS: 01

Spiller Name: **DESMOND AMERICANA**

Spiller Contact: Not reported Spiller Phone: Not reported

660 ALBANY SHAKER ROAD Spiller Address:

COLONIE, NY Spiller City, St, Zip: Spill Cause: Human Error Reported to Dept: Air Water Affected: Not reported

Spill Source:

Spill Notifier: Fire Department PBS Number: 4-600451 Cleanup Ceased: 02/17/89 Cleanup Meets Std: True

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DESMOND AMERICANA (Continued)

1000301242

Last Inspection:

Penalty Not Recommended Recommended Penalty:

Spiller Cleanup Dt: Enforcement Date: Invstgn Complete: / / **UST Involvement:** False

Spill Class: Known release that creates a file or hazard. DEC Response. Willing

Responsible Party. Corrective action taken.

Spill Closed Dt: 02/17/89 Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 02/17/89 Date Spill Entered In Computer Data File: Not reported

Update Date: 02/24/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate Failed Tank: Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Pounds Quantity Recovered: Unkonwn Quantity Recovered: False

UNKNOWN PETROLEUM Material: Class Type: UNKNOWN PETROLEUM

Times Material Entry In File: 16414 CAS Number: Not reported Last Date: 19940929

Material Class Type: Nonpetroleum/Nonhazardous

Quantity Spilled: Unkonwn Quantity Spilled: True Units: **Pounds** Quantity Recovered: 0 Unkonwn Quantity Recovered: False

HYDROGEN FLUORIDE Material: Class Type: HYDROGEN FLUORIDE

Times Material Entry In File: 0

CAS Number: 07664393 Last Date: Not reported

Material: HYDROFLUORIC ACID HYDROFLUORIC ACID Class Type:

Times Material Entry In File: 17 07664393 CAS Number: Last Date: Not reported

Material Class Type: Nonpetroleum/Nonhazardous

Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DESMOND AMERICANA (Continued)

1000301242

MANIFEST

Material: UNKNOWN HAZARDOUS MATERIAL UNKNOWN HAZARDOUS MATERIAL Class Type:

Times Material Entry In File: 2093 CAS Number: Not reported Last Date: 19940728

02/21/89: CLEAN HARBORS HIRED BY HOTEL TO PUMP MATERIAL FROM SUMP RATHER THAN DEC Remarks:

RISK RUNNING IT THROUGH SEWER SYSTEM. TANKER ARRIVED 1400 HRS. 6,000 G REMOVED

FROM SUMP.READING AT SOURCE 1 PPM.

FUMES EMANATING FROM LAUNDRY ROOM, SPREADING THROUGH HOTEL. THINK HYDROFLUORIC Remark:

ACID AND ANOTHER CHEMICAL MIXED. SHAKER ROAD FD ON SCENE. ONE PERSON

HOSPITALIZED. CLEAN HARBORS PUMPED OUT CESSPOOL.

A30 SUNOCO SERVICE STATION RCRA-NonGen 1004757354 656 ALBANY SHAKER RD **FINDS** NYD986929891

< 1/8 **ALBANY, NY 12211** 1 ft.

Site 8 of 11 in cluster A

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

Facility name: SUNOCO SERVICE STATION Actual: Facility address: 656 ALBANY SHAKER RD

301 ft. ALBANY, NY 12211 EPA ID: NYD986929891

Mailing address: MARKET ST 20-10 PC

PHILADELPHIA. NY 191031699

SUSAN HICKEY Contact: Contact address: MARKET ST 20-10 PC

PHILADELPHIA, NY 191031699

Contact country: US

Contact telephone: (610) 941-9054 Contact email: Not reported EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

SUN COMPANY INC R & M Owner/operator name:

Owner/operator address: 1801 MARKET ST

PHILADELPHIA, PA 19103

Owner/operator country: US

Owner/operator telephone: (610) 941-9054 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported

Owner/Op end date: Not reported

SUN COMPANY INC R & M Owner/operator name:

Owner/operator address: 1801 MARKET ST

PHILADELPHIA, PA 19103

Owner/operator country: US

Owner/operator telephone: (610) 941-9054 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO SERVICE STATION (Continued)

1004757354

EDR ID Number

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: Nο User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: SUNOCO SERVICE STATION Classification: Not a generator, verified

Date form received by agency: 09/08/1998

Facility name: SUNOCO SERVICE STATION

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 04/19/1995

Facility name: SUNOCO SERVICE STATION Classification: Not a generator, verified

Violation Status: No violations found

FINDS:

Registry ID: 110004455606

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986929891

Country: USA

Mailing Name: SUN CO INC
Mailing Contact: BRUCE KRUCKEL
Mailing Address: TEN-11 PENN CTR
Mailing Address 2: Not reported
Mailing City: PHILADELPHIA

Mailing State: PA

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO SERVICE STATION (Continued)

1004757354

Mailing Zip: 19103 Mailing Zip4: Not reported Mailing Country: USA Mailing Phone: 800-466-2052

Document ID: LAA3335060

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: PM1002NY Trans2 State ID: 24269SNY 950829 Generator Ship Date: Trans1 Recv Date: 950829 950905 Trans2 Recv Date: TSD Site Recv Date: 950927 Part A Recv Date: 950913 Part B Recv Date: 951023

NYD986929891 Generator EPA ID: Trans1 EPA ID: NYD980761191 Trans2 EPA ID: NYD980761191 TSDF ID: LAD981057706

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Waste Code: Not reported 00165 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 95 Year: Manifest Tracking Num: Not reported

Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB7947891 Manifest Status: Completed copy Trans1 State ID: PR1941NY Trans2 State ID: Not reported Generator Ship Date: 951018 Trans1 Recy Date: 951018 Trans2 Recy Date: Not reported TSD Site Recv Date: 951018

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO SERVICE STATION (Continued)

1004757354

Part A Recv Date: 951026 951030 Part B Recv Date: Generator EPA ID: NYD986929891 Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID: NYD095577342

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00472

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Not reported Manifest Ref Num: Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYB7947999 Document ID: Manifest Status: Completed copy Trans1 State ID: Not reported Trans2 State ID: Not reported Generator Ship Date: 960207 Trans1 Recv Date: 960207 Not reported Trans2 Recv Date: 960207 TSD Site Recv Date: 960215 Part A Recv Date: Part B Recv Date: 960216

NYD986929891 Generator EPA ID: Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID: NYD095577342

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00479

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO SERVICE STATION (Continued)

1004757354

Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

NYB6835266 Document ID: Manifest Status: Completed copy Trans1 State ID: PR1941NY Trans2 State ID: Not reported 950615 Generator Ship Date: 950615 Trans1 Recv Date: Trans2 Recv Date: 950616 TSD Site Recv Date: 950616 Part A Recv Date: 950623 Part B Recv Date: 950630

NYD986929891 Generator EPA ID: Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID: NYD095577342

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00730

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

WEST CENTRAL ENV I-87 C31 I-87 / ALBANY SHAKER RAMP

S102114193 **NY Spills NY Hist Spills** N/A

< 1/8 COLONIE, NY 1 ft.

Site 4 of 4 in cluster C

NY Spills: Relative:

Site ID: 314833 Higher

Facility Addr2: Not reported Actual: 8912174 Facility ID: 300 ft. Spill Number: 8912174

Facility Type: ER SWIS: 0126 **PNBENTIE** Investigator: Referred To: Not reported 3/22/1990 Spill Date:

Direction Distance

Elevation Site Database(s) EPA ID Number

WEST CENTRAL ENV I-87 (Continued)

S102114193

EDR ID Number

Reported to Dept: 3/22/1990
CID: Not reported
Spill Cause: Traffic Accident
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Police Department

Cleanup Ceased: 3/22/1990
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. (Highly

Improbable)

Spill Closed Dt: 3/22/1990 Remediation Phase: 0

Date Entered In Computer: 4/11/1990
Spill Record Last Update: 1/9/2009
Spiller Name: Not reported

Spiller Company: WEST CENTRAL TRUCK

Spiller Address: P.O. BOX 83

Spiller City,St,Zip: RENSSELAER, NY 12144

Spiller Company: 001

Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 4

DER Facility ID: 253826

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BENTIEN" 09/28/95: This is additional information about material

spilled from the translation of the old spill file:

GLYCOL&WATER@271PPM. 9604621, 9701678, 0005154, 0110425

Remarks: PD & FD ON SCENE TRYING TO CONTAIN. DANA (W.CENTRAL) REPORTS CLEANUP

COMPLETE.

Material:

 Site ID:
 314833

 Operable Unit ID:
 937895

 Operable Unit:
 01

 Material ID:
 441649

 Material Code:
 0060A

Material Name: WASTEWATER
Case No.: Not reported
Material FA: Other
Quantity: 0
Units: Gallons
Recovered: No

Resource Affected: Not reported Oxygenate: False Site ID: 314833 Operable Unit ID: 937895 Operable Unit: 01 441648 Material ID: Material Code: 0043A ANTIFREEZE Material Name: Not reported Case No.: Material FA: Other 0

Quantity: 0
Units: Gallons
Recovered: No

Direction Distance

Elevation Site Database(s) EPA ID Number

WEST CENTRAL ENV I-87 (Continued)

S102114193

EDR ID Number

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 8912174 **BENTIEN** Investigator: Not reported Caller Name: Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 03/22/1990 15:55 Reported to Dept Date/Time: 03/22/90 16:02

SWIS: 01

Spiller Name: WEST CENTRAL TRUCK

Spiller Contact: Not reported
Spiller Phone: (518) 272-6891
Spiller Address: P.O. BOX 83

Spiller City, St, Zip: RENSSELAER, NY 12144

Spill Cause: Traffic Accident
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 07

Spill Notifier: Police Department
PBS Number: Not reported
Cleanup Ceased: 03/22/90
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Closed Dt:

Spill Class: Known release that creates potential for fire or hazard. (Highly

Improbable) 03/22/90

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 04/11/90
Date Spill Entered In Computer Data File: Not reported

Update Date: 07/31/00

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WEST CENTRAL ENV I-87 (Continued)

S102114193

Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate Failed Tank: Gross Leak Rate: Not reported

Material:

Material Class Type: Hazardous Material

Quantity Spilled: 0 Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: False

ANTIFREEZE Material: Class Type: **ANTIFREEZE**

Times Material Entry In File:

CAS Number: Not reported Not reported Last Date: Material Class Type: Hazardous Material

Quantity Spilled:

Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: False

Material: WASTEWATER Class Type: WASTEWATER

Times Material Entry In File: 86

CAS Number: Not reported Last Date: Not reported

DEC Remarks: 09/28/95: This is additional information about material spilled from the

translation of the old spill file: GLYCOL WATER@271PPM. 0005154

PD FD ON SCENE TRYING TO CONTAIN. DANA W.CENTRAL) REPORTS CLEANUP COMPLETE. Remark:

AVIS 674 ALBANY SHAKER RD

674 ALBANY SHAKER RD

< 1/8 COLONIE, NY

1 ft.

H32

Site 1 of 2 in cluster H

LTANKS: Relative:

Higher Actual: Site ID: 313275 Spill No: 8603326 Spill Date: 8/19/1986

299 ft. Spill Cause: Tank Test Failure Commercial/Industrial Spill Source:

> Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/15/1986 Not reported Facility Addr2: Cleanup Ceased: 11/15/1986 Cleanup Meets Standard: True SWIS: 0126 WEBLAIN Investigator: Referred To: Not reported Reported to Dept: 8/19/1986

LTANKS

HIST LTANKS

S100163327

N/A

Direction
Distance

Elevation Site Database(s) EPA ID Number

AVIS 674 ALBANY SHAKER RD (Continued)

S100163327

EDR ID Number

CID: 21

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 8/22/1986
Spill Record Last Update: 2/24/1999
Spiller Name: Not reported
Spiller Company: AVIS RENTAL CAR

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller County: 001

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

DEC Region: 4

DER Facility ID: 252600

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BLAIN" / /: TANK & SOIL REMOVED. SEE 8605116; (9706183?).

Remarks: UNLEADED REG.-(3) 4K MANIFOLDED-(-.2608 GAL/HR) EXCAVATE & ISOLATE &

RETEST-LARGE AMOUNT SPILLED & RECOVERED

Material:

Site ID: 313275 Operable Unit ID: 900215 Operable Unit: 01 Material ID: 476153 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 313275
Spill Tank Test: 1530143
Tank Number: Not reported

Tank Size: 0
Test Method: 00
Leak Rate: 0

Gross Fail: Not reported Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 4

 Spill Number:
 8603326

 Spill Date:
 08/19/1986

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AVIS 674 ALBANY SHAKER RD (Continued)

S100163327

Spill Time: 15:00

Tank Test Failure Spill Cause: Resource Affectd: Groundwater Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/15/86 Cleanup Ceased: 11/15/86 Cleanup Meets Standard: True **BLAIN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 08/19/86 Reported to Department Time: 15:24 SWIS: 01

Not reported Spiller Contact: Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: AVIS RENTAL CAR Spiller Address: Not reported Spiller City, St, Zip: Not reported

Spiller Cleanup Date:

Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Notifier: Tank Tester PBS Number: Not reported

Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: 11 **UST Involvement:** True

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: Date Spill Entered In Computer Data File:

08/22/86 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/24/99 Is Updated: False

Tank:

PBS Number: Not reported Not reported Tank Number: Tank Size: 0

Test Method: Not reported

Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AVIS 674 ALBANY SHAKER RD (Continued)

S100163327

Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: / / : TANK SOIL REMOVED. SEE 8605116; 9706183?).

UNLEADED REG.- 3) 4K MANIFOLDED- -. 2608 GAL/HR) EXCAVATE ISOLATE RETEST-LARGE Spill Cause:

AMOUNT SPILLED RECOVERED

E33 **VALET CLEANERS DRYCLEANERS** S110248227

199 WOLF RD. N/A

ALBANY, NY 12205 < 1/8

1 ft.

Site 4 of 5 in cluster E

DRYCLEANERS: Relative:

Facility ID: 4-0126-00404 Higher

Region:

Actual: Registration Effective Date: 7/27/2000 00:00:00

299 ft. 06JAN4 Inspection Date:

Drop Shop: Not reported

Shutdown:

Alternate Solvent: Not reported

NOT A DRY CLEANER **Current Business:**

G34 HIST LTANKS S100163493 **AVIS ALBANY SHAKER RD ALBANY SHAKER RD NY Spills** N/A

< 1/8 COLONIE, NY

1 ft.

Site 3 of 3 in cluster G

HIST LTANKS: Relative:

Region of Spill: Higher Spill Number: 8605116

Actual: Spill Date: 11/11/1986 300 ft. Spill Time: 10:00 Spill Cause: Tank Failure

Resource Affectd: Groundwater Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 09/11/87 Cleanup Ceased: 09/11/87 Cleanup Meets Standard: True **BLAIN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

AVIS ALBANY SHAKER RD (Continued)

S100163493

EDR ID Number

Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 11/11/86
Reported to Department Time: 10:29
SWIS: 01

Spiller Contact:

Spiller Phone:

Spiller Extention:

Spiller Name:

Spiller Address:

Spiller City,St,Zip:

Not reported

AVIS CAR RENTAL

ALBANY SHAKER RD

ALBANY, NY 12205

Spiller Cleanup Date: //

Facility Contact:

Facility Phone:

Facility Phone:

Facility Extention:

Spill Notifier:

PBS Number:

Last Inspection:

Not reported

Responsible Party

Not reported

12/12/87

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/24/86
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/24/99
Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum 1200 Quantity Spilled: Unkonwn Quantity Spilled: False Gallons Quantity Recovered: 800 Unkonwn Quantity Recovered: False Material: **GASOLINE GASOLINE** Class Type: Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: //: TAKING TANK OUT OF GROUND-EXCAVATING CLEANING UP. LANDSPREAD SOIL.

WILL AERATE SPRING OF 87. SEE 8603326, 9706183? 867 ALBANY SHAKER Rd

REGISTERED UNDER 4-020044.

Spill Cause: REMOVING TANK DISCOVERED LOTS OF CONTAMINATED SOIL.

NY Spills:

Site ID: 112495 Facility Addr2: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

AVIS ALBANY SHAKER RD (Continued)

S100163493

Facility ID: 8605116 Spill Number: 8605116 Facility Type: ER SWIS: 0126 Investigator: weblain Referred To: Not reported 11/11/1986 Spill Date: 11/11/1986 Reported to Dept: CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Responsible Party

Cleanup Ceased: 9/11/1987 Cleanup Meets Std: True Last Inspection: 12/12/1987

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/11/1987
Remediation Phase: 0
Date Entered In Computer: 11/24/1986
Spill Record Last Update: 1/31/2008
Spiller Name: Not reported
Spiller Company: AVIS CAR RENTAL
Spiller Address: ALBANY SHAKER RD
Spiller City, St, Zip: ALBANY, NY 12205

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 327191

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BLAIN" / /: TAKING TANK OUT OF GROUND-EXCAVATING & CLEANING UP. LANDSPREAD SOIL. WILL AERATE SPRING OF '87. SEE 8603326, 9706183? 867

ALBANY SHAKER Rd REGISTERED UNDER 4-020044.

Remarks: REMOVING TANK DISCOVERED LOTS OF CONTAMINATED SOIL.

Material:

112495 Site ID: Operable Unit ID: 902328 Operable Unit: 01 Material ID: 474321 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum 1200 Quantity: Gallons Units: Recovered: 800

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AVIS ALBANY SHAKER RD (Continued)

S100163493

Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Not reported Last Modified: Test Method: Not reported

FED EX TRUCK WOLF RD **NY Spills** S109206695 35 N/A

260 WOLF RD < 1/8 LATHAM, NY 12110 1 ft.

NY Spills:

Relative: Higher

Site ID: 401946

Facility Addr2: ON ROADWAY 260 WOLF ROAD

0804949 Facility ID: Actual: Spill Number: 0804949 299 ft. Facility Type: ER SWIS: 0126 WTCHRIST Investigator:

Referred To: Not reported Spill Date: 7/30/2008 Reported to Dept: 7/30/2008

CID: 21

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial Vehicle Spill Notifier: Fire Department Cleanup Ceased: Not reported Cleanup Meets Std: False

Last Inspection: Not reported Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release that creates potential for fire or hazard. (Minimal

Occurrence) Spill Closed Dt: 8/6/2008

Remediation Phase:

Date Entered In Computer: 7/30/2008 Spill Record Last Update: 8/6/2008 Spiller Name: **BEN STEVENS** Spiller Company: ON ROADWAY Spiller Address: 260 WOLF ROAD Spiller City, St, Zip: LATHAM, NY 12110

Spiller Company: 999

Contact Name: **BEN STEVENS** Contact Phone: (518) 376-1012 CELL

DEC Region: 4 DER Facility ID: 351152

Hazmat scare snarls Old Wolf Road By:Tom Caprood, The DEC Memo:

Record07/31/2008 COLONIE - A section of Old Wolf Road and Northway Exit 4 south were closed for more than 2 hours Wednesday after police believed a variety of chemicals being transported in a FedEx truck may have started to leak from their containers. No leaks were discovered by hazmat crews who combed both the area around the

vehicle's exterior as well as its cargo hold for several hours

Map ID MAP FINDINGS
Direction

Elevation Site

Database(s)

EDR ID Number EPA ID Number

FED EX TRUCK WOLF RD (Continued)

Distance

S109206695

throughout the morning. The driver of the truck, whose identity was not immediately available, was stopped around 9:45 a.m. during a routine seatbelt checkpoint when he alerted officers that some of his cargo may have started to leak, and was transported to Albany Medical Center after complaining of a slight irritation to his throat. The truck was carrying a total of 22,000 pounds of various chemicals in boxes and barrels, among other mixed cargo, according to town officials. "The biggest issue that we have here is the unknown," said First Deputy Town Fire Coordinator Gerald Paris Jr. as crews prepared to enter the vehicle. "We know that a chemical's properties change when they start mixing with other substances, which could make the situation more volatile, so we want to make sure that the situation gets secured before we send people in." Police blocked off Old Wolf Road and redirected traffic on both of its ends, from the intersection with Albany-Shaker Road to its intersection with Route 155. Paris and Town Supervisor Paula Mahan were on the scene throughout the morning, along with a number of emergency personnel from the town, the city of Albany, the West Albany Fire Department, and the Watervliet Arsenal Fire Department to shut down the road, as well as the Northway exit ramp, before crews were able to safely approach the vehicle. Employees of local businesses along the road, including the Koto Japanese restaurant, were evacuated for safety purposes before crews began making their sweeps of the area. Hazmat units from the West Albany Fire Department made several trips back and forth to the vehicle as they tested the air for known chemicals before entering the truck around 11:50 a.m. and ultimately turning the vehicle back over to FedEx shortly after noon. Mahan was proud to note that, even though no actual chemical spill was found, all of the emergency personnel performed exactly how they had been trained. "All of the staff from the various departments came together exactly the way that they should have," said Mahan. "We hope that these types on incidents never happen, but when they do, we're trained to handle them." Paris was unable to disclose exactly what kind of chemicals were being transported in the truck or where they were being delivered, but did note that the FedEx vehicle was an acceptable means of transport for the substances and that, as far as emergency personnel were initially aware, all of the cargo inside matched what was listed on the truck's bill of lading. The road was re-opened to traffic shortly after emergency crews cleared the area and the truck was returned to their nearby Latham delivery terminal. Information on the driver's condition was not immediately available. Driver release from hospital. Checked out OK. There was no leak or any release of chemicals from the trailer. Closed wtc

Remarks:

CASno: LEAKING FROM TRUCK AND FIRE DEPT. ON SCENES: PLACARD WITH HAZMAT : MONIA SOLUTION 5758LBS HYDRO PEROXIDE- 8027 LBS HYDRO CHLORIDE ACID 726 LBS SULFURIC ACID 1400 LBS

Material:

Site ID: 401946 Operable Unit ID: 1158719 Operable Unit: 01 Material ID: 2149808 Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons

TC2896934.2s Page 150

Direction Distance

Elevation Site Database(s) **EPA ID Number**

FED EX TRUCK WOLF RD (Continued)

S109206695

EDR ID Number

Recovered: No Resource Affected: Not reported Oxygenate: False Site ID: 401946 Operable Unit ID: 1158719 Operable Unit: 01 Material ID: 2149810 Material Code: 0063A

Material Name: UNKNOWN HAZARDOUS MATERIAL

Not reported

False

Case No.: Not reported Hazardous Material Material FA:

Quantity: 0 Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False Site ID: 401946 Operable Unit ID: 1158719 Operable Unit: 01 2149809 Material ID: Material Code: 0015 Material Name: Motor Oil Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Tank Test:

Resource Affected:

Oxygenate:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

A36 A-PLUS ALBANY SHAKER RD

656 ALBANY SHAKER RD

< 1/8 ALBANY, NY

1 ft.

Site 9 of 11 in cluster A

Relative: Higher

NY Spills:

Site ID: 230318 Facility Addr2: Not reported Actual: Facility ID: 9414525 301 ft. Spill Number: 9414525

Facility Type: ER SWIS: 0126 Investigator: **JEYUCHNI** S103482138

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

A-PLUS ALBANY SHAKER RD (Continued)

S103482138

EDR ID Number

Referred To: Not reported
Spill Date: 2/2/1995
Reported to Dept: 2/3/1995
CID: 21
Spill Cause: Human Error

Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Gasoline Station

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Recommended Penalty: Penalty Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Unable/unwilling Responsible Party. Corrective action taken. (ISR)

Spill Closed Dt: 10/1/2003

Remediation Phase: 0

Date Entered In Computer: 3/21/1995
Spill Record Last Update: 10/4/2004
Spiller Name: WILLIAM MORSE

Spiller Company: SUN OIL
Spiller Address: Not reported
Spiller City,St,Zip: ZZ

Spiller City, St, Zip: 22 Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 266809

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"YUCHNIEWICZ "SEE FILE; 9204711, 9406278, 9406344, 9414525, 9914217, 0102375; 8604528. MD TO TK 8/98. 01/29/99 THE SITE IS A SUNOCO

GASOLINE RETAIL FACILITY WITH AN A-PLUS MINI-MARKET. IN FEBRUARY
1995, MATRIX ENVIRONMENTAL TECHNOLOGIES INC. PERFORMED A FACILITY
UPGRADE PRE-PROFILING INVESTIGATION. THE INVESTIGATION INCLUDED TWO
SOIL BORINGS AND THE INSTALLATION OF MONITORING WELL MW1. ELEVATED
BTEX LEVELS WERE DETECTED IN SOIL AND GROUNDWATER SAMPLES COLLECTED.

A SUBSEQUENT SITE WIDE INVESTIGATION WAS PERFORMED BY MATRIX IN MARCH

1995 AND INCLUDED THE INSTALLATION OF MW2, MW3, MW4 AND MW5 TO DELINEATE THE PETROLEUM IMPACT ACROSS THE SITE. THREE ADDITIONAL MONITORING WELLS WERE INSTALLED IN APRIL 1995 TO FURTHER DEFINE

IMPACT DOWNGRADIENT OF THE SITE ALONG ALBANY-SHAKER ROAD MW7 AND MW8 AND AT AN UPGRADIENT LOCATION AT THE SITE MW6. THE STATION UNDERWENT A FACILITY UPGRADE DURING JUNE 1995. DURING THE UPGRADE FREE PHASE GASOLINE WAS ENCOUNTERED AT THE WATERTABLE WHILE EXCAVATING AT THE WESTERN SIDE OF THE UST FIELD. SEVEN HUNDRED GALLONS OF PRODUCT WERE REMOVED INITIALLY BY VACUUM TRUCK. GROUNDWATER WAS TREATED THROUGH AN AIR STRIPPING TOWER AND ACTIVATED CARBON. THIS SYSTEM WAS REPLACED BY A SOIL VENT/AIR SPARGE SYSTEM INSTALLED IN JULY OF 1996. THE SPARGE SYSTEM IS OPERATIONAL WITH VES TREAMENT THROUGH A MATRIX BIO-FILTER. IN DECEMBER 1996, 5 ADDITIONAL GROUNDWATER MONITORING WELLS MW10. MW11, MW12, MW13, AND MW14 WERE INSTALLED ALONG THE SOUTHERN PORTION OF THE PROPERTY. A SUPLEMENTAL RAP WAS DEVELOPED IN SEPTEMBER 1997 TO INCLUDE ADDITIONAL 3 SPARGE POINTS AND 2 VENT ZONES ALONG WITH THE SOUTHERN PORTION OF THE PROPERTY. THE REMEDIAL SYSTEM UPGRADE WAS COMPLETED IN NOVEMBER 1997 ALONG WITH THE INSTALLATION OF MONITORING WELLS MW15 AND MW16. WEEKLY SITE CHECKS INCLUDE SYSTEM CHECKS. QUARTERLY SYSTEM DISCHARGE SAMPLING AND QUARTERLY GROUNDWATER

Map ID MAP FINDINGS
Direction

Distance Elevation

Site Database(s) EPA ID Number

A-PLUS ALBANY SHAKER RD (Continued)

S103482138

EDR ID Number

SAMPLING AND GUAGING. BTEX RANGED FROM 14 PPB. AT MW6 TO 23500 PPB. AT MW13. MTBE RANGED FROM NON-DETECT AT MW1 TO 1600 AT MW 5. ESTIMATED GASOLINE RECOVERY VIA VES THIS QUARTER IS APPROXIMATELY 11 GALLONS. INFLUENT/EFFLUENT LEVELS WERE 140 PPB./ND. 05/21/1999 THE DEPARTMENT RECEIVED QUARTERLY REPORT DATED 3-1-99. THE REPORT WAS PREPARED BY MATRIX. BTEX CONCENTRATIONS 13,950 PPB. AT MW-13, 15,690 PPB. AT MW-14, 8,320 PPB. AT MW-15. THESE WELLS ARE LOCATED ON THE DOWN GRADIENT EDGE OF THE SUBURFACE PLUME MIGRATING FROM THE SUNOCO SITE. THIS IS CO-MINGLING WITH THE PLUME ORIGINATING FROM THE NAUGHTER SITE ACROSS WOLF RD. SIMILARLY MTBE WAS DETECTED IN THESE WELLS. 07/12/1999 THE DEPARTMENT RECEIVED REPORT DATED JUNE 99. TOTAL BTEX IN THREE WELLS CONTINUE TO STAND OUT FROM THE OTHERS. MW-2 HAS 5210 PPB., MW-13 HAS 18600 PPB. AND MW-15 HAS 12520 PPB. MW-2 IS LOCATED NEXT TO THE UST FIELD, WHILE MW-13 AND MW-15 ARE BOUNDARY WELLS. THE BOUNDARY WELLS APPEAR TO BE AFFECTED BY THE DISSOLVED PETROLEUM PLUME EMANATING FROM THE NAUGHTER'S SITE ACCROSS WOLF ROAD. VAPOR EXTRACTION AIR-SPARGING CONTINUE ON SITE, 02/29/2000 THE DEPARTMENT RECEIVED REPORT DATED DECEMBER 99. TOTAL BTEX AT MW-2 IS 10500 PPB, MW-13 IS 17070 PPB. AND MW-15 2950 PPB. MONITORING WELL MW-2 SEEMS TO BE IMPACTED BY FREASHER GASOLINE BASED ON THE HIGHER PERCENTAGE OF BENZENE AS RELATED TO TOTAL BTEX CONSTIUENTS. THE PERIMETER WELLS STILL REMAIN THE HIGHEST IMPACTED. THE GASOLINE SINGNATURE AT THESE WELLS WOULD INDICATE THE PRODUCT IMPACTING THEM IS AN OLDER SOURCE. THIS WOULD SURPORT THE IMPACT FROM OFF SITE. THE MONITORING WELLS WERE SAMPLED ON 12/2/99. 07/14/2000 THE DEPARTMENT RECEIVED REPORT DATED JUNE 2000. ON MAY 2, 2000 BIO-FILTER WAS REPLACED WITH GRANULATED CARBON. SAMPLING WAS CONDUCTED ON JUNE 2, 2000. VES INTO FILTER WAS 4 PPM ON PID METER. NO PRODUCT RECOVERY FOR THE QUARTER. BETX IN MW-13 WAS 4977 PPB. MW-16 AT 586 PPB. 10/23/2000 THE DEPARTMENT RECEIVED REPORT DATED SEPTEMBER 2000. THERE WAS AN APPEARENT INCREASE ACROSS THE SITE OF BETX LEVELS. CONCENTRATIONS INCREASED FROM TWO FOLD TO TEN FOLD OVER LAST SAMPLING RESULTS. MW-13 WAS 8400 PPB. AND MW-16 WAS 3240 PPB. VES IS OPERATIONAL. 9/1/01 PROJECT TURNED OVER TO JAMES YUCHNIEWICZ 9/10/01 SPOKE WITH PRECISION ENVIRON. CONCERNING THE POSSIBLITY THAT NAUGHTER'S MOBILE MAY BE HELD RESPONSIBLE FOR THE GROUNDWATER CONTAMINATION BENEATH THE SOUTH-WEST CORNER OF THE SUNOCO SITE. JY 10/2003 GROUNDWATER LEVELS IN MONITORING WELLS HAVE REACHED ACCEPTABLE LEVELS AT THIS TIME, MAX AMOUNT IS 4,000 TOTAL VOCS IN ON WELL. AS SUCH, SPILL WILL BE CLOSED DOES NOT MEET STANDARDS AS SOON AS ISR IS SENT OUT.

Remarks: HIGH PID READING IN SOIL.

Material:

Site ID: 230318 Operable Unit ID: 1012092 Operable Unit: 01 Material ID: 373257 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False
Site ID: 230318
Operable Unit ID: 1012092

Direction Distance

Elevation Site Database(s) EPA ID Number

A-PLUS ALBANY SHAKER RD (Continued)

S103482138

EDR ID Number

 Operable Unit:
 01

 Material ID:
 2096760

 Material Code:
 1213A

Material Name: MTBE (METHYL-TERT-BUTYL ETHER)

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Resource Affected:

Oxygenate:

01634044

Hazardous Material

Not reported

Not reported

Not reported

Not reported

False

Tank Test:

Site ID: 230318
Spill Tank Test: 1543593
Tank Number: Not reported

Tank Size: 0
Test Method: 00
Leak Rate: 0

Gross Fail: Not reported
Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

NY Hist Spills:

Region of Spill: Spill Number: 9414525 YUCHNIEWICZ Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Spill Date/Time: 02/02/1995 12:00

02/03/95 11:07

SWIS: 01 Spiller Name: SUN OIL

Reported to Dept Date/Time:

Spiller Contact: WILLIAM MORSE
Spiller Phone: (908) 981-0139
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Human Error
Reported to Dept: Groundwater
Water Affected: Not reported

Spill Source: 05
Spill Notifier: Other
PBS Number: 4-066524
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Recommended

Spiller Cleanup Dt: // Enforcement Date: // Invstgn Complete: // Map ID MAP FINDINGS Direction

Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

A-PLUS ALBANY SHAKER RD (Continued)

S103482138

UST Involvement: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Unable/unwilling Responsible Party. Corrective action taken. (ISR)

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 03/21/95 Date Spill Entered In Computer Data File: Not reported

Update Date: 12/19/01 Is Updated: True

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: True Material: **GASOLINE** Class Type: GASOLINE

Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

SEE FILE; 9204711, 9406278, 9406344, 9414525, 9914217, 0102375; 8604528. MD **DEC Remarks:**

> TO TK 8/98. 01/29/99 THE SITE IS A SUNOCO GASOLINE RETAIL FACILITY WITH AN A-PLUS MINI-MARKET. IN FEBRUARY 1995, MATRIX ENVIRONMENTAL TECHNOLOGIES INC. PERFORMED A FACILITY UPGRADE PRE-PROFILING INVESTIGATION. THE INVESTIGATION INCLUDED TWO SOIL BORINGS AND THE INSTALLATION OF MONITORING WELL MW1. ELEVATED BTEX LEVELS WERE DETECTED IN SOIL AND GROUNDWATER SAMPLES COLLECTED. A SUBSEQUENT SITE WIDE INVESTIGATION WAS PERFORMED BY MATRIX IN MARCH 1995 AND INCLUDED THE INSTALLATION OF MW2, MW3, MW4 AND MW5 TO DELINEATE THE PETROLEUM IMPACT ACROSS THE SITE. THREE ADDITIONAL MONITORING WELLS WERE INSTALLED IN APRIL 1995 TO FURTHER DEFINE IMPACT DOWNGRADIENTOF THE SITE ALONG ALBANY-SHAKER ROAD MW7 AND MW8 AND AT AN UPGRADIENT LOCATION AT THE SITE MW6. THE STATION UNDERWENT A FACILITY UPGRADE DURING JUNE 1995. DURING THE UPGRADE FREE PHASE GASOLINE WAS ENCOUNTERED AT THE WATERTABLE WHILE EXCAVATING ATTHE WESTERN SIDE OF THE UST FIELD. SEVEN HUNDRED GALLONS OF PRODUCT WERE REMOVED INITIALLY BY VACUUM TRUCK. GROUNDWATER WAS TREATED THROUGH AN AIR STRIPPING TOWER AND ACTIVATED CARBON. THIS SYSTEM WAS REPLACED BY A SOIL VENT/AIR SPARGE SYSTEM INSTALLED IN JULY OF 1996. THE SPARGE SYSTEM IS OPERATIONAL WITH VES TREAMENT THROUGH A MATRIX BIO-FILTER. IN DECEMBER 1996, 5 ADDITIONAL GROUNDWATER MONITORING WELLS MW10, MW11, MW12, MW13, AND MW14 WERE INSTALLED ALONG THE SOUTHERN PORTION OF THE PROPERTY. A SUPLEMENTAL RAP WAS DEVELOPED IN SEPTEMBER 1997 TO INCLUDE ADDITIONAL 3 SPARGE POINTS AND 2 VENT ZONES ALONG WITH THE SOUTHERN PORTION OF THE PROPERTY. THE REMEDIAL SYSTEM UPGRADE WAS COMPLETED IN NOVEMBER 1997 ALONG WITH THE INSTALLATIONOF MONITORING WELLS MW15 AND MW16. WEEKLY SITE CHECKS INCLUDE SYSTEM CHECKS. QUARTERLY SYSTEM DISCHARGE SAMPLING AND QUARTERLY GROUNDWATER SAMPLING AND GUAGING. BTEX RANGED FROM 14 PPB. AT MW6 TO 23500 PPB, AT MW13. MTBE RANGED FROM NON-DETECT AT MW1 TO 1600 AT MW 5. ESTIMATED GASOLINE RECOVERY VIA VES THIS QUARTER IS APPROXIMATELY 11 GALLONS.

Direction Distance Elevation

evation Site Database(s) EPA ID Number

A-PLUS ALBANY SHAKER RD (Continued)

S103482138

EDR ID Number

INFLUENT/EFFLUENT LEVELS WERE 140 PPB./ND. 05/21/1999 THE DEPARTMENT RECEIVED QUARTERLY REPORT DATED 3-1-99. THE REPORT WAS PREPARED BY MATRIX. BTEX CONCENTRATIONS 13,950 PPB. AT MW-13, 15,690 PPB. AT MW-14, 8,320 PPB. AT MW-15. THESE WELLS ARE LOCATED ON THE DOWN GRADIENT EDGE OF THE SUBURFACE PLUME MIGRATING FROM THE SUNOCO SITE. THIS IS CO-MINGLING WITH THE PLUME ORIGINATING FROMTHE NAUGHTER SITE ACROSS WOLF RD. SIMILARLY MTBE WAS DETECTED 07/12/1999 THE DEPARTMENT RECEIVED REPORT DATED JUNE 99. IN THESE WELLS. TOTAL BTEX IN THREE WELLS CONTINUE TO STAND OUT FROM THE OTHERS. MW-2 HAS 5210 PPB., MW-13 HAS 18600 PPB.AND MW-15 HAS 12520 PPB. MW-2 IS LOCATED NEXT TO THE UST FIELD, WHILE MW-13 AND MW-15 ARE BOUNDARY WELLS. THE BOUNDARY WELLS APPEAR TO BE AFFECTED BY THE DISSOLVED PETROLEUM PLUME EMANATING FROM THE NAUGHTER S SITE ACCROSS WOLF ROAD. VAPOR EXTRACTION AIR-SPARGING CONTINUE ON SITE. 02/29/2000 THE DEPARTMENT RECEIVED REPORT DATED DECEMBER 99. TOTAL BTEX AT MW-2 IS 10500 PPB, MW-13 IS 17070 PPB. AND MW-15 2950 PPB. MONITORING WELL MW-2 SEEMS TO BE IMPACTED BY FREASHER GASOLINE BASED ON THE HIGHER PERCENTAGE OF BENZENE AS RELATED TO TOTAL BTEX CONSTIUENTS. THE PERIMETER WELLS STILL REMAIN THE HIGHEST IMPACTED. THE GASOLINE SINGNATURE AT THESE WELLS WOULD INDICATE THE PRODUCT IMPACTING THEM IS AN OLDER SOURCE. THIS WOULD SURPORT THE IMPACT FROM OFF SITE. THE MONITORING WELLS WERE SAMPLED ON 12/2/99. 07/14/2000 THE DEPARTMENT RECEIVED REPORT DATED JUNE 2000. ON MAY 2, 2000 BIO-FILTER WAS REPLACED WITH GRANULATED CARBON. SAMPLING WAS CONDUCTED ON JUNE 2, 2000. VES INTO FILTER WAS 4 PPM ON PID METER. NO PRODUCT RECOVERY FOR THE QUARTER. BETX IN MW-13 WAS 4977 PPB. MW-16 AT 586 PPB. 10/23/2000 THE DEPARTMENT RECEIVED REPORT DATED SEPTEMBER 2000. THERE WAS AN APPEARENT INCREASE ACROSS THE SITE OF BETX LEVELS.CONCENTRATIONS INCREASED FROM TWO FOLD TO TEN FOLD OVER LAST SAMPLING RESULTS. MW-13 WAS 8400 PPB. AND MW-16 WAS 3240 PPB. VES IS OPERATIONAL. 9/1/01 PROJECT TURNED OVER TO JAMES YUCHNIEWICZ 9/10/01 SPOKE WITH PRECISION ENVIRON. CONCERNING THE POSSIBLITY THAT NAUGHTER S MOBILE MAY BE HELD RESPONSIBLE FOR THE GROUNDWATER CONTAMINATION BENEATH THE SOUTH-WEST CORNER OF THE SUNOCO SITE. JY

Remark: HIGH PID READING IN SOIL.

HESS #32334 WOLF RD LTANKS \$104275926

< 1/8 COLONIE, NY 1 ft.

Site 10 of 10 in cluster B

Relative: Higher

300 ft.

B37

LTANKS:

156 WOLF RD

Actual:

 Site ID:
 289982

 Spill No:
 0310895

 Spill Date:
 12/22/2003

 Spill Cause:
 Tank Overfill

 Spill Source:
 Gasoline Station

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 7/1/2004 Facility Addr2: Not reported Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 0126 Investigator: **KDGOERTZ** Referred To: Not reported Reported to Dept: 12/22/2003

CID: 21

Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported

HIST LTANKS

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS #32334 WOLF RD (Continued)

S104275926

EDR ID Number

Recommended Penalty: Penalty Not Recommended

UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 12/22/2003

Date Entered In Computer: 12/22/2003
Spill Record Last Update: 6/14/2007
Spiller Name: DAVID LEE

Spiller Company: CUSTOMER @ AMERADA HESS

Spiller Address: 156 WOLF RD Spiller City,St,Zip: COLONIE, NY 12205

Spiller County: 001
Spiller Contact: DAVID LEE
Spiller Phone: (518) 436-6585
Spiller Extention: Not reported

DEC Region: 4
DER Facility ID: 266788

DEC Memo: PBS 4-163775; SEE 9110043 (Edocs), 9307535, 9613389, 0310895,

0702953. 2/20/04: Bill C. stopped at the site at the request of an ECO. Drums of waste were still staged on the site. KG telephoned David Lee and he told me the drums were waste generated by this spill. He will get back to me when the drums will be disposed of. (KG) 7/1/04: Received disposal manifest. No further action is

warranted. (KG)

Remarks: caller states customer overfilled tank w/ approximately 5 to 10

gallons spilling onto the ground. All was recovered. approximately 1/2 gallon went into a catch basin and was picked up by environmental

services.

Material:

Site ID: 289982 875970 Operable Unit ID: Operable Unit: 01 Material ID: 499736 Material Code: 8000 Diesel Material Name: Not reported Case No.: Petroleum Material FA: Quantity: Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 289983

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS #32334 WOLF RD (Continued)

S104275926

Spill No: 9110043 Spill Date: 12/20/1991 Spill Cause: Tank Test Failure Spill Source: Gasoline Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 5/22/2000 Facility Addr2: Not reported Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 0126 Investigator: **KDGOERTZ** Referred To: Not reported Reported to Dept: 12/20/1991 CID:

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True Remediation Phase: Date Entered In Computer: 1/7/1992 Spill Record Last Update: 6/14/2007

Spiller Name: **DAWN JOHNSON** Spiller Company: AMERADA HESS Spiller Address: ONE HESS PLAZA

Spiller City,St,Zip: WOODBRIDGE, NJ 07096-

Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: **DER Facility ID:**

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

> "GOERTZ" PBS 4-163775; SEE 9110043 (Edocs), 9307535, 9613389, 0310895, 0702953. See EDOCs for additional information. THIS SITE WAS HEAVILLY CONTAMINATED AT ONE POINT. P7T AND VES SYSTEMS WERE INSTALLED TO REMEDIATE. HOWEVER, IT WAS THE SITE REBUILD WHICH DID THE BULK OF THE CLEANUP. DURING TANK RPLACEMENT, LARGE AMOUNTS OF CONTAMINATED SOIL AND GROUNDWATER WERE REMOVED WHICH SIGNIFICANTLY REDUCE THE CONTAMINATION CONCENTRATIONS. NO FURTHER WORK IS NEEDED AS

THE LATEST SAMPLING DATA MET STANDARDS. (KG) UGT FAILED PETROTITE @ -.0135GPH. SEE FOLDER.

Remarks:

Material:

Site ID: 289983 Operable Unit ID: 963715 Operable Unit: 01 Material ID: 418617 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS #32334 WOLF RD (Continued)

S104275926

Oxygenate:

Tank Test:

Site ID: 289983 Spill Tank Test: 1539452 Not reported Tank Number:

Tank Size: 01 Test Method: Leak Rate: -0.14 Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004

Petro-Tite/Petro Comp Test Method:

False

HIST LTANKS:

Region of Spill:

Spill Number: 9110043 Spill Date: 12/20/1991 Spill Time: 15:30

Spill Cause: Tank Test Failure Resource Affectd: Groundwater Water Affected: Not reported Spill Source: Gas Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 05/22/00 Cleanup Ceased: / / Cleanup Meets Standard: True Investigator: **GOERTZ** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 12/20/91 Reported to Department Time: 15:49 SWIS:

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: AMERADA HESS Spiller Address: ONE HESS PLAZA

Spiller City, St, Zip: WOODBRIDGE, NJ 07096-

Spiller Cleanup Date:

Facility Contact: **DAWN JOHNSON** Facility Phone: (908) 750-7068 Facility Extention: Not reported Spill Notifier: Tank Tester PBS Number: 4-163775 Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date:

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

HESS #32334 WOLF RD (Continued)

S104275926

Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 01/07/92

Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 05/22/00 Is Updated: False

Tank:

PBS Number: 4-600278
Tank Number: Not reported

Tank Size: 0

Test Method: Petro-Tite
Leak Rate Failed Tank: -0.14
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE

Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: SEE 9307535. THIS SITE WAS HEAVILLY CONTAMINATED AT ONE POINT. P7T AND VES

SYSTEMS WERE INSTALLED TO REMEDIATE. HOWEVER, IT WAS THE SITE REBUILD WHICH DID THE BULK OF THE CLEANUP. DURING TANK RPLACEMENT, LARGE AMOUNTS OF

CONTAMINATED SOIL AND GROUNDWATER WERE REMOVED WHICH SIGNIFICANTLY REDUCE THE CONTAMINATION CONCENTRATIONS. NO FURTHER WORK IS NEEDED AS THE LATEST SAMPLING

DATA MET STANDARDS. KG)

Spill Cause: UGT FAILED PETROTITE @ -.0135GPH. SEE FOLDER.

A38 SUNOCO ALBANY SHAKER RD

656 ALBANY SHAKER RD

< 1/8 ALBANY, NY

1 ft.

Site 10 of 11 in cluster A

Relative: LTANKS:

Higher Site ID: 230317

 Spill No:
 9406344

 Actual:
 Spill Date:
 8/9/1994

 301 ft.
 Spill Cause:
 Tank Test I

Spill Cause: Tank Test Failure
Spill Source: Gasoline Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/2/1994
Facility Addr2: Not reported
Cleanup Ceased: 8/10/1994
Cleanup Meets Standard: True
SWIS: 0126
Investigator: WTCHRIST
Referred To: Not reported

LTANKS

HIST LTANKS

S101174444

N/A

Direction Distance

Elevation Site Database(s) **EPA ID Number**

SUNOCO ALBANY SHAKER RD (Continued)

S101174444

EDR ID Number

Reported to Dept: 8/9/1994 Not reported CID: Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True Remediation Phase: Date Entered In Computer: 9/9/1994 Spill Record Last Update: 4/9/2008 Spiller Name: Not reported Spiller Company: SUNOCO

Spiller Address: 656 ALBANY SHAKER RD

Spiller City, St, Zip: ALBANY, ZZ

Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Not reported Spiller Extention: DEC Region:

DER Facility ID: 284342

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9204711, 9406278, 9406344, 9414525, 9914217, 0102375;

False

LINE TEST FAILURE, REPAIRED, CONT. SOIL, CONTINUING INVESTIGATION. Remarks:

SEE 9406278, 9414525. HEAVY CONTAMINATION.

Material:

Site ID: 230317 Operable Unit ID: 1000487 Operable Unit: 01 Material ID: 379390 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Petroleum Material FA: Quantity: Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate:

Tank Test:

Site ID: 230317 Spill Tank Test: 1543029 Tank Number: Not reported

Tank Size: 0 Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills 10/1/2004 Last Modified: Test Method: Unknown

HIST LTANKS:

Region of Spill: 4

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO ALBANY SHAKER RD (Continued)

S101174444

EDR ID Number

 Spill Number:
 9406344

 Spill Date:
 08/09/1994

 Spill Time:
 12:00

Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Gas Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/02/94
Cleanup Ceased: 08/10/94
Cleanup Meets Standard: True

CHRISTENSEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 08/09/94 Reported to Department Time: 19:51 SWIS: Spiller Contact: Not reported Spiller Phone: Not reported

Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: SUNOCO

Spiller Address: 656 ALBANY SHAKER RD

Spiller City,St,Zip: ALBANY
Spiller Cleanup Date: / /

Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 4-066524

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 09/09/94
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 06/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: 0

Test Method: Not reported

Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO ALBANY SHAKER RD (Continued)

S101174444

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: True Material: **GASOLINE** Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported

9204711, 9406278, 9406344, 9414525, 9914217, 0102375; 8604528. **DEC Remarks:**

LINE TEST FAILURE, REPAIRED, CONT. SOIL, CONTINUING INVESTIGATION. SEE Spill Cause:

9406278, 9414525. HEAVY CONTAMINATION.

19940929

WOLF ROAD ONE HOUR CLEANERS E39 201 WOLF RD

RCRA-NonGen 1000227346 **FINDS** NYD981076599 **MANIFEST**

ALBANY, NY 12205 < 1/8

1 ft.

Site 5 of 5 in cluster E

Last Date:

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

WOLF ROAD ONE HOUR CLEANERS Facility name:

Actual: Facility address: 201 WOLF RD 299 ft.

ALBANY, NY 12205 EPA ID: NYD981076599

Mailing address: WOLF RD

ALBANY, NY 12205

Not reported Contact: Contact address: WOLF RD

ALBANY, NY 12205

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: Not reported Owner/operator address: **NOT REQUIRED**

NOT REQUIRED, WY 99999

Owner/operator country: US Owner/operator telephone: (212) 555-1212 Legal status: Private Operator Owner/Operator Type:

Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: Not reported Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 Legal status: Private

Direction Distance

Elevation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: Nο On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: WOLF ROAD ONE HOUR CLEANERS

Classification: Not a generator, verified

Date form received by agency: 07/14/1999

Facility name: WOLF ROAD ONE HOUR CLEANERS

Classification: Small Quantity Generator

Date form received by agency: 04/16/1985

Facility name: WOLF ROAD ONE HOUR CLEANERS

Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General

Date violation determined: 08/13/1990
Date achieved compliance: 08/13/1990
Violation lead agency: State
Enforcement action: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported

Enf. disposition status.

Enf. disp. status date:

Enforcement lead agency:

Proposed penalty amount:

Final penalty amount:

Not reported

Regulation violated: Not reported

Area of violation: Generators - General

Date violation determined: 09/21/1989
Date achieved compliance: 09/21/1989
Violation lead agency: State

Direction Distance Elevation

on Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

Enforcement action: Not reported Not reported Enforcement action date: Enf. disposition status: Not reported Enf. disp. status date: Not reported Enforcement lead agency: Not reported Proposed penalty amount: Not reported Not reported Final penalty amount: Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 08/13/1990

Evaluation: NON-FINANCIAL RECORD REVIEW

Area of violation: Generators - General

Date achieved compliance: 08/13/1990 Evaluation lead agency: State

Evaluation date: 09/21/1989

Evaluation: NON-FINANCIAL RECORD REVIEW

Area of violation: Generators - General

Date achieved compliance: 09/21/1989 Evaluation lead agency: State

FINDS:

Registry ID: 110004394478

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD981076599

Country: USA

Mailing Name: WOLF ROAD ONE HOUR CLEANERS
Mailing Contact: WOLF ROAD ONE HOUR CLEANERS

Mailing Address:

Mailing Address 2:

Mot reported

Mailing City:

Mailing State:

My

Mailing Zip:

Mailing Zip:

Mailing Zip4:

Mot reported

Ny

Mot reported

Ny

Mot reported

Not reported

Mot reported

Mot reported

Mot reported

Mot reported

Mot reported

Mailing Phone: 518-459-1147

Document ID: NYA3850863
Manifest Status: Completed copy

Trans1 State ID: IL009
Trans2 State ID: Not reported
Generator Ship Date: 861202
Trans1 Recv Date: 861202
Trans2 Recv Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

TSD Site Recv Date: 861202
Part A Recv Date: 861216
Part B Recv Date: 861204
Generator EPA ID: NYD981076599
Trans1 EPA ID: ILD000805911
Trans2 EPA ID: Not reported
TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00280
Units: P - Pounds
Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 86

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6706462

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NY-AC1985 Trans2 State ID: Not reported Generator Ship Date: 870706 870706 Trans1 Recv Date: Not reported Trans2 Recv Date: TSD Site Recv Date: 870706 Part A Recv Date: 870818 Part B Recv Date: 870709 Generator EPA ID: NYD981076599 Trans1 EPA ID: ILD000805911

 Trans1 EPA ID:
 ILD000805911

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00280
Units: P - Pounds
Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6967067

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NY-AC1985 Trans2 State ID: Not reported Generator Ship Date: 871202 Trans1 Recv Date: 871202 Trans2 Recv Date: Not reported TSD Site Recv Date: 871202 Part A Recv Date: 880127 Part B Recv Date: 871209

Generator EPA ID: NYD981076599 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00280 Units: P - Pounds

Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 87 Year:

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6484995

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NY-AC1985 Trans2 State ID: Not reported Generator Ship Date: 870218 Trans1 Recy Date: 870218 Trans2 Recv Date: Not reported TSD Site Recv Date: 870218 870409 Part A Recv Date: Part B Recv Date: 870224

Generator EPA ID: NYD981076599 ILD000805911 Trans1 EPA ID: Trans2 EPA ID: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00810
Units: P - Pounds
Number of Containers: 007

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9068927

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: **NYAC1985** Trans2 State ID: Not reported Generator Ship Date: 881013 Trans1 Recv Date: 881013 Trans2 Recv Date: Not reported TSD Site Recv Date: 881013 Part A Recy Date: 881205 Part B Recv Date: 881020 Generator EPA ID: NYD981076599 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00280
Units: P - Pounds
Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Waste Code: Not reported Quantity: 00195 Units: P - Pounds

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 88

Manifest Tracking Num:
Import Ind:
Export Ind:
Discr Quantity Ind:
Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9283296

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

NYAC1985 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 890207 Trans1 Recv Date: 890207 Trans2 Recv Date: Not reported TSD Site Recy Date: 890207 Part A Recv Date: 890328 Part B Recv Date: 890210

Generator EPA ID: NYD981076599 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00350 P - Pounds Units: Number of Containers: 005

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 89 Manifest Tracking Num: Not reported

Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9342652

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYAC1985 Trans2 State ID: Not reported Generator Ship Date: 890228 890228 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 890228 Part A Recv Date: 890504 Part B Recv Date: 890306

NYD981076599 Generator EPA ID: Trans1 EPA ID: ILD051060408

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

Trans2 EPA ID: Not reported TSDF ID: NYD000708206

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

Quantity: 00280 Units: P - Pounds Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC1647123 Manifest Status: Completed copy Trans1 State ID: **NYAC1985** Trans2 State ID: Not reported 920601 Generator Ship Date: Trans1 Recv Date: 920601 Trans2 Recv Date: Not reported TSD Site Recy Date: 920601 Part A Recv Date: Not reported Part B Recv Date: 920615 NYD981076599 Generator EPA ID: ILD051060408 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD986872869

F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV Waste Code:

Quantity: 00140 Units: P - Pounds Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

Mgmt Method Type Code: Not reported

Document ID: NYC1683922 Manifest Status: Completed copy Trans1 State ID: **NYAC1985** Trans2 State ID: Not reported Generator Ship Date: 920622 Trans1 Recv Date: 920622 Trans2 Recv Date: Not reported 920622 TSD Site Recv Date: Part A Recv Date: Not reported 920630 Part B Recv Date: Generator EPA ID: NYD981076599 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140 Units: P - Pounds

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92 Manifest Tracking Num: Not

Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code:

Document ID: NYC1804623 Manifest Status: Completed copy Trans1 State ID: NYAC1985 Trans2 State ID: Not reported Generator Ship Date: 920820 Trans1 Recv Date: 920820 Trans2 Recv Date: Not reported TSD Site Recv Date: 920820 Part A Recv Date: Not reported Part B Recv Date: 920827 Generator EPA ID: NYD981076599 ILD051060408 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Direction Distance

Elevation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC3108745 Manifest Status: Completed copy Trans1 State ID: NYAC1985 Trans2 State ID: Not reported Generator Ship Date: 940627 Trans1 Recv Date: 940627 Trans2 Recv Date: Not reported TSD Site Recv Date: 940627 Part A Recy Date: Not reported Part B Recv Date: 940713 NYD981076599 Generator EPA ID: ILD984908202 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC2943191
Manifest Status: Completed copy
Trans1 State ID: NYAC1985

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

Trans2 State ID: Not reported 940405 Generator Ship Date: Trans1 Recv Date: 940405 Trans2 Recv Date: Not reported TSD Site Recv Date: 940405 Part A Recv Date: Not reported Part B Recv Date: 940414 Generator EPA ID: NYD981076599 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC2701495 Manifest Status: Completed copy NYAC1985 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 931208 Trans1 Recv Date: 931208 Trans2 Recv Date: Not reported TSD Site Recv Date: 931208 Part A Recv Date: Not reported Part B Recv Date: 931220

 Generator EPA ID:
 NYD981076599

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYC3679604 Document ID: Manifest Status: Completed copy Trans1 State ID: **NYJR8766** Trans2 State ID: Not reported Generator Ship Date: 950918 Trans1 Recv Date: 950918 Trans2 Recv Date: Not reported TSD Site Recv Date: 950918 Part A Recv Date: Not reported Part B Recv Date: 950928 Generator EPA ID: NYD981076599

 Generator EPA ID:
 NYD981076599

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported **Export Ind:** Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC3721094 Manifest Status: Completed copy **NYJR8766** Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 951011 Trans1 Recv Date: 951011 Trans2 Recy Date: Not reported 951011 TSD Site Recy Date: Part A Recv Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

Part B Recv Date: 951023

 Generator EPA ID:
 NYD981076599

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00140
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC4657533 Manifest Status: Completed copy Trans1 State ID: NYAC1985 Not reported Trans2 State ID: Generator Ship Date: 970403 Trans1 Recv Date: 970403 Trans2 Recv Date: Not reported TSD Site Recv Date: 970403 Part A Recv Date: 970411 970415 Part B Recv Date: Generator EPA ID: NYD981076599 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00195 Units: P - Pounds

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

EDR ID Number

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6628252

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYAC1985 Trans2 State ID: Not reported 870423 Generator Ship Date: Trans1 Recv Date: 870423 Trans2 Recv Date: Not reported TSD Site Recv Date: 870423 Part A Recv Date: 870615 870427 Part B Recv Date: NYD981076599 Generator EPA ID:

Trans1 EPA ID: ILD000805911 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00280 Units: P - Pounds Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6770823

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NY-AC1985 Not reported Trans2 State ID: Generator Ship Date: 870819 870819 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 870819 871009 Part A Recv Date: Part B Recv Date: 870825 NYD981076599 Generator EPA ID: Trans1 EPA ID: ILD000805911

Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

Quantity: 00280 P - Pounds Units: Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 87

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA8908672

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NY-AC1985 Trans2 State ID: Not reported Generator Ship Date: 880623 Trans1 Recy Date: 880623 Trans2 Recv Date: Not reported TSD Site Recv Date: 880623 Part A Recv Date: 880817 Part B Recv Date: 880628 Generator EPA ID: NYD981076599

Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

00280 Quantity: Units: P - Pounds Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 88

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

WOLF ROAD ONE HOUR CLEANERS (Continued)

1000227346

Document ID: NYA9500951

Completed after the designated time period for a TSDF to get a copy to the DEC Manifest Status:

Trans1 State ID: NYAC1985 Trans2 State ID: Not reported Generator Ship Date: 890523 Trans1 Recv Date: 890523 Trans2 Recv Date: Not reported TSD Site Recy Date: 890523 Part A Recv Date: 890712 Part B Recv Date: 890526 NYD981076599 Generator EPA ID: Trans1 EPA ID: ILD051060408

Trans2 EPA ID: Not reported TSDF ID: NYD000708206 Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

00280 Quantity: P - Pounds Units: 004 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

A40 SUNOCO #0363-3021

Site ID:

656 ALBANY-SHAKER RD ALBANY, NY 12211

< 1/8 1 ft.

Site 11 of 11 in cluster A

U003031102 UST **HIST UST** N/A

AST NY Spills NY Hist Spills

UST: Relative:

Facility Id: 4-066524 Higher STATE Region:

Actual: DEC Region: 4 301 ft. Site Status: Active Program Type: **PBS Expiration Date:** 2011/12/18 UTM X: 598660 UTM Y: 4731270

> Tank Number: Tank ID: 86063 Tank Status: In Service

35367

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO #0363-3021 (Continued)

U003031102

EDR ID Number

Tank Model: 103
Pipe Model: D
Install Date: 6/15/1983
Capacity Gallons: 12000
Tightness Test Method: 21
Next Test Date: 5/2/2010
Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Equivalent technology

 Date Test:
 5/2/2005

 Register:
 True

 Modified By:
 TESPERBE

 Last Modified:
 9/28/2005

Equipment Records:

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

L07 - Piping Leak Detection - Pressurized Piping Leak Detector

B04 - Tank External Protection - Fiberglass

J01 - Dispenser - Submersible

F04 - Pipe External Protection - Fiberglass C02 - Pipe Location - Underground/On-ground

A00 - Tank Internal Protection - None I03 - Overfill - Automatic Shut-Off

L08 - Piping Leak Detection - Tank Top Sump

E04 - Piping Secondary Containment - Double-Walled (Underground)

H99 - Tank Leak Detection - Other

G00 - Tank Secondary Containment - None

K01 - Spill Prevention - Catch Basin

Tank Number: 2 Tank ID: 86064 Tank Status: In Service Tank Model: 103 Pipe Model: D Install Date: 6/1/1983 12000 Capacity Gallons: Tightness Test Method: 21 Next Test Date: 5/2/2010

Tank Location: 5

Tank Type: Equivalent technology

 Date Test:
 5/2/2005

 Register:
 True

 Modified By:
 TESPERBE

 Last Modified:
 9/28/2005

Equipment Records:

Date Tank Closed:

L07 - Piping Leak Detection - Pressurized Piping Leak Detector

B04 - Tank External Protection - Fiberglass

Not reported

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

C02 - Pipe Location - Underground/On-ground

H99 - Tank Leak Detection - Other

L08 - Piping Leak Detection - Tank Top Sump G00 - Tank Secondary Containment - None

J01 - Dispenser - Submersible

103 - Overfill - Automatic Shut-Off

F04 - Pipe External Protection - Fiberglass

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO #0363-3021 (Continued)

U003031102

K01 - Spill Prevention - Catch Basin

E04 - Piping Secondary Containment - Double-Walled (Underground)

A00 - Tank Internal Protection - None

Tank Number: Tank ID: 86065 Tank Status: In Service Tank Model: 103 Pipe Model: D 6/1/1983 Install Date: 12000 Capacity Gallons: Tightness Test Method: 21 Next Test Date: 5/2/2010 Date Tank Closed: Not reported

Tank Location:

Equivalent technology Tank Type:

Date Test: 5/2/2005 Register: True Modified By: **TESPERBE** Last Modified: 9/28/2005

Equipment Records:

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

L04 - Piping Leak Detection - Groundwater Well

C02 - Pipe Location - Underground/On-ground

E04 - Piping Secondary Containment - Double-Walled (Underground)

B04 - Tank External Protection - Fiberglass

H99 - Tank Leak Detection - Other

F04 - Pipe External Protection - Fiberglass A00 - Tank Internal Protection - None G00 - Tank Secondary Containment - None

K01 - Spill Prevention - Catch Basin

J01 - Dispenser - Submersible

L08 - Piping Leak Detection - Tank Top Sump

103 - Overfill - Automatic Shut-Off

Affiliation Records:

35367 Site Id: Affiliation Type: Owner

Company Name: SUNOCO, INC. (R&M)

Contact Type: **COMPLIANCE COORDINATOR**

Contact Name: KATHLEEN MCCANEY

Address1: 1735 MARKET ST 12TH FLOOR

Address2: Not reported **PHILADELPHIA** City:

State: PΑ Zip Code: 19103 Country Code: 001

Phone: (215) 246-8513 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: aeskalsk Date Last Modified: 10/14/2008

Site Id: 35367

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO #0363-3021 (Continued)

U003031102

Affiliation Type: Mail Contact

SUNOCO, INC. (R&M) Company Name:

Contact Type: COMPLIANCE COORDINATOR

Contact Name: KATHLEEN MCCANEY

Address1: 1735 MARKET ST 12TH FLOOR

Address2: Not reported **PHILADELPHIA** City:

State: PΑ Zip Code: 19103 Country Code: 001

(215) 246-8513 Phone: Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: aeskalsk Date Last Modified: 10/14/2008

Site Id: 35367

Affiliation Type: On-Site Operator SUNOCO #0363-3021 Company Name:

Contact Type: Not reported DUNCO, INC Contact Name: Address1: Not reported Address2: Not reported City: Not reported State: NY Zip Code: Not reported

Country Code:

(518) 459-4882 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **RJSCHOWE** Date Last Modified: 2/17/2006

Site Id: 35367

Affiliation Type: **Emergency Contact** SUNOCO, INC. (R&M) Company Name:

Not reported Contact Type: SUN HELPLINE Contact Name: Address1: Not reported Address2: Not reported City: Not reported

State: NN

Zip Code: Not reported

Country Code: 999

Phone: (800) 786-9494 Phone Ext: Not reported Email: Not reported Fax Number: Not reported **NRLOMBAR** Modified By: Date Last Modified: 5/6/2010

HIST UST:

PBS Number: 4-066524 SPDES Number: Not reported **ROLAND DAVIS Emergency Contact:**

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO #0363-3021 (Continued)

U003031102

EDR ID Number

Emergency Telephone: (800) 786-9494

Operator: NORRIS ENTERPRISES INC

Operator Telephone: (518) 459-4882 Owner Name: SUN COMPANY INC

Owner Address: 1801 MARKET STREET-20/10 PC
Owner City,St,Zip: PHILADELPHIA, PA 19103

Owner Telephone: (215) 246-8513 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: SUN COMPANY INC Mailing Address: 1801 MARKET STREET

Mailing Address 2: 20TH FLOOR

Mailing City,St,Zip: PHILADELPHIA, PA 19103
Mailing Contact: UST COORDINATOR
Mailing Telephone: (215) 246-8513
Owner Mark: First Owner

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is

greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

or not at the facility.

Facility Addr2: Not reported

SWIS ID: 0126

Old PBS Number: Not reported

Facility Type: RETAIL GASOLINE SALES

Inspected Date: Not reported Inspector: Not reported Not reported Inspection Result: Federal ID: Not reported Certification Flag: False 10/26/2001 Certification Date: 12/18/2006 **Expiration Date:** Renew Flag: False Renewal Date: Not reported **Total Capacity:** 36000 FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data

Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26
Region: 4

Tank ld:

Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19830601
Capacity (gals): 12000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None Tank External: None

Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal: None
Pipe External: Jacketed

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO #0363-3021 (Continued)

U003031102

EDR ID Number

Second Containment: None

Leak Detection: In-tank System

Overfill Prot: Float Vent Valve, Catch Basin

Dispenser: Submersible Date Tested: 06/01/1995 Not reported Next Test Date: Missing Data for Tank: No Missing Data Date Closed: Not reported Test Method: USTest 2000 Deleted: False Updated: True Lat/long: Not reported

Tank ld: 2

Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19830601
Capacity (gals): 12000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: None

Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal: None
Pipe External: Jacketed
Second Containment: None

Leak Detection: In-tank System

Overfill Prot: Float Vent Valve, Catch Basin

Submersible Dispenser: Date Tested: 06/01/1995 Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: Not reported Test Method: USTest 2000 Deleted: False Updated: True Lat/long: Not reported

Tank ld:

Tank Location: UNDERGROUND Tank Status: In Service Install Date: 19830601

Capacity (gals): 12000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal:NonePipe External:JacketedSecond Containment:None

Leak Detection: In-tank System

Overfill Prot: Float Vent Valve, Catch Basin

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNOCO #0363-3021 (Continued)

U003031102

EDR ID Number

Dispenser: Submersible 06/01/1995 Date Tested: Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: Not reported Test Method: USTest 2000 Deleted: False Updated: True Lat/long: Not reported

AST:

 Region:
 STATE

 DEC Region:
 4

 Site Status:
 Active

 Facility Id:
 4-054488

 Program Type:
 PBS

 UTM X:
 598767

 UTM Y:
 4731161

 Expiration Date:
 2011/12/02

Tank Number: 3
Tank Id: 209740
Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 6/10/1998
Capacity Gallons: 275
Tightness Test Method: NN

Date Test:
Not reported
Next Test Date:
Not reported
Date Tank Closed:
Privation 7/1/2009
Register:
Modified By:
Last Modified:
Not reported
True
True
tesperbe
tesperbe
5/14/2010

Equipment Records:

L00 - Piping Leak Detection - None 104 - Overfill - Product Level Gauge (A/G)

J02 - Dispenser - Suction

D01 - Pipe Type - Steel/Carbon Steel/Iron A00 - Tank Internal Protection - None F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None

K00 - Spill Prevention - None

B00 - Tank External Protection - None C01 - Pipe Location - Aboveground H00 - Tank Leak Detection - None

Affiliation Records:

Site Id: 35257

Affiliation Type: Emergency Contact

Company Name: THE HEARST CORPORATION

Contact Type: Not reported
Contact Name: GERRY POTTER
Address1: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNOCO #0363-3021 (Continued)

U003031102

Address2: Not reported Not reported City:

State: NN

Zip Code: Not reported Country Code: 999

Phone: (518) 454-5936 Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

35257 Site Id: Affiliation Type: Owner

THE HEARST CORPORATION Company Name: Contact Type: **DIRECTOR OF OPERATIONS**

Contact Name: **DAN COUTO** Address1: 959 8TH AVENUE Address2: Not reported **NEW YORK** City: State: NYZip Code: 10019 Country Code: 001

Phone: (518) 454-5555 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

Site Id: 35257 Affiliation Type: Mail Contact

Company Name: **CAPITAL NEWSPAPERS**

Contact Type: Not reported Contact Name: **GERRY POTTER** Address1: **NEWS PLAZA** Address2: **BOX 15000** City: **ALBANY** State: NY Zip Code: 12212 Country Code: 001

Phone: (518) 454-5936 Phone Ext: Not reported

GPOTTER@TIMESUNION.COM Email:

Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

Site Id: 35257

Affiliation Type: On-Site Operator

Company Name: CAPITAL NEWSPAPERS, THE HEARST CORP.

Contact Type: Not reported DAN COUTO Contact Name: Address1: Not reported Address2: Not reported City: Not reported

State: NN

Direction Distance

Elevation Site Database(s) **EPA ID Number**

SUNOCO #0363-3021 (Continued)

U003031102

EDR ID Number

Zip Code: Not reported

Country Code: 001

(518) 454-5401 Phone: Phone Ext: Not reported Email: Not reported Not reported Fax Number: Modified By: tesperbe Date Last Modified: 5/14/2010

NY Spills:

Site ID: 230316 Facility Addr2: Not reported Facility ID: 0102375 Spill Number: 0102375 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Spill Date: 6/1/2001 6/1/2001 Reported to Dept: CID: 21 Spill Cause: Other Water Affected: Not reported Spill Source: **Gasoline Station** Spill Notifier: Responsible Party Cleanup Ceased: Not reported

Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/4/2001 Remediation Phase: 0 Date Entered In Computer: 6/1/2001 Spill Record Last Update: 6/7/2001

Spiller Name: **DONNA CONSTANTINE** Spiller Company: SUNOCO A PLUS

Spiller Address: 656 ALBANY SHAKER ROAD

Spiller City, St, Zip: COLONIE, NY 12205-

Spiller Company:

Contact Name: DONNA CONSTANTINE

Contact Phone: (518) 459-4882

DEC Region: **DER Facility ID:** 266809

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN" 06/04/2001 - No DEC response. wtc 9406344, 9414525

Remarks: DRIVERS FINGER GOT CAUGHT IN THE PUMP CAUSING GAS TO SPILL ONTO THE

GROUND APPEARS ACTUALLY 2 GALLONS WAS SPILLED.FIRE DEPT IS ON THE

SCENE AND WILL CONTAIN.

Material:

230316 Site ID: Operable Unit ID: 839139 Operable Unit: 01 Material ID: 534489 Material Code: 0009

Direction
Distance
Elevation

vation Site Database(s) EPA ID Number

SUNOCO #0363-3021 (Continued)

U003031102

EDR ID Number

Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: 0

Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 0102375 **CHRISTENSEN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 06/01/2001 20:45 Reported to Dept Date/Time: 06/01/01 20:45

SWIS: 01

Spiller Name: SUNOCO A PLUS
Spiller Contact: DONNA CONSTANTINE

Spiller Phone: (518) 459-4882

Spiller Contact: DONNA CONSTANTINE

Spiller Phone: (518) 459-4882

Spiller Address: 656 ALBANY SHAKER ROAD

Spiller City, St, Zip: COLONIE, NY 12205-

Spill Cause: Other
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 05

Spill Notifier: Responsible Party

PBS Number: 4-066542
Cleanup Ceased: / /
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: False

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

SUNOCO #0363-3021 (Continued)

U003031102

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 06/04/01

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 06/01/01
Date Spill Entered In Computer Data File: Not reported

Update Date: 06/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Units: Quantity Recovered: Unkonwn Quantity Recovered: True Material: GASOLINE **GASOLINE** Class Type: Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 06/04/2001 - No DEC response. wtc 9406344, 9414525

Remark: DRIVERS FINGER GOT CAUGHT IN THE PUMP CAUSING GAS TO SPILL ONTO THE GROUND

APPEARS ACTUALLY 2 GALLONS WAS SPILLED.FIRE DEPT IS ON THE SCENE AND WILL

CONTAIN.

41 CAPITAL NEWSPAPERS TU ALBANY SHAKER RD @ MAXWEL HIST LTANKS S102675765

N/A

< 1/8 COLONIE, NY

0.000 mi. 2 ft.

Relative: Higher HIST LTANKS:

Region of Spill: 4
Spill Number: 9111828

 Actual:
 Spill Date:
 02/18/1992

 300 ft.
 Spill Time:
 07:30

 Spill Cause:
 Tank Overfill

 Resource Affectd:
 On Land

 Weter Affected:
 Net reported

Resource Affectd:
Water Affected:
Spill Source:
On Land
Not reported
Other Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/17/92 Cleanup Ceased: 02/18/92 Cleanup Meets Standard: True

Investigator: CHRISTENSEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITAL NEWSPAPERS TU (Continued)

S102675765

Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 02/18/92 Reported to Department Time: 09:10 SWIS:

Spiller Contact: Not reported Spiller Phone: Not reported Not reported Spiller Extention:

ANDERSON EQ?? Spiller Name: **TU NEWS**

Spiller Address: Not reported Spiller City, St, Zip: Not reported

Spiller Cleanup Date:

Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Notifier: Other 4-054488 PBS Number: Last Inspection: 02/18/92

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: / / **UST Involvement:** True

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: Date Spill Entered In Computer Data File: 02/18/92 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 10/16/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 5 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: Not reported

CALLER TO REPLACE CONT. STONE . FOUND DEFECTIVE GASKET WHILE FILLING TANK, Spill Cause:

CLEANING. SEE 9110717,9312547,9314320.

Direction Distance

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

I42 ALBANY AIRPORT PK GARAGE NY Spills S106736143
NNE ALBANY AIRPORT SHAKER RD N/A

ALBANY AIRPORT SHAKER RD COLONIE, NY 12110

< 1/8 0.001 mi.

6 ft. Site 1 of 2 in cluster I

Relative: Lower

ve: NY Spills:
Site ID: 335097

Facility Addr2: 737 ALBANY SHAKER RD Facility ID: 0410195

Actual: Facility ID: Spill Number:

Spill Number: 0410195
Facility Type: ER
SWIS: 0126
Investigator: WTCHRIST
Referred To: Not reported
Spill Date: 12/13/2004
Reported to Dept: 12/13/2004

CID: 77

Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Passenger Vehicle
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/14/2004

Remediation Phase: 0

Date Entered In Computer: 12/14/2004 Spill Record Last Update: 5/21/2010 Spiller Name: Not reported

Spiller Company: UNKNOWN ALBANY INTERNATIONAL AIRPORT

Spiller Address: Not reported

Spiller City,St,Zip: NY Spiller Company: 999

Contact Name: WILLIAM PARKS
Contact Phone: (518) 242-2332

DEC Region: 4
DER Facility ID: 270316

DEC Memo: 12-14-2004 - No DEC response. wtc PBS 4-600099, 600808; see 0409117,

etc.

Remarks: LESS THAN 10 GALS OF GASOLINE SPILLED ONTO ASPHALT IN PARKING GARAGE.

OPERATOR OF VEHICLE RAN OVER CURB CAUSING DAMAGE TO GAS TANK. CLEAN-UP $\,$

USING PULP.

Material:

Site ID: 335097 Operable Unit ID: 1097205 Operable Unit: 01 Material ID: 577159 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: 10 Units: Gallons Recovered: 10

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

ALBANY AIRPORT PK GARAGE (Continued)

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

I43 ALBANY AIRPORT NY Spills S106736231
NNE ALBANY AIRPORT SHAKER RD N/A

< 1/8 COLONIE ALBANY, NY 12205

0.001 mi.

6 ft. Site 2 of 2 in cluster I

Relative: NY Spills:

Lower Site ID: 335375

Facility Addr2: ALBANY INTERNATIONAL AIRPORT
Actual: Facility ID: 0410321

292 ft. Spill Number: 0410321 Facility Type: ER

Facility Type: ER
SWIS: 0126
Investigator: WTCHRIST
Referred To: Not reported
Spill Date: 12/16/2004
Reported to Dept: 12/16/2004
CID: 408

Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party

Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/12/2005

Remediation Phase: 0
Date Entered In Computer: 12/20/2004
Spill Record Last Update: 5/21/2010

Spiller Name: MICHAEL JAHN
Spiller Company: ALBANY INTERNATIONAL AIRPORT
Spiller Address: 737 ALBANY SHAKER ROAD

Spiller City, St, Zip: ALBANY, NY

Spiller Company: 999

Contact Name: MICHAEL JAHN Contact Phone: (518) 869-0253

DEC Region: 4

S106736143

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY AIRPORT (Continued)

S106736231

DER Facility ID: 270589

01-12-2005 - No DEC response. PBS 4-600099 & 4-600808; see 0410195, DEC Memo:

0412864, etc.

HAS BEEN CLEANED UP. Remarks:

Material:

335375 Site ID: Operable Unit ID: 1097444 Operable Unit: 01 Material ID: 577429 Material Code: 0011 Material Name: Jet Fuel Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: 3

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

J44 NIMO TRANSFORMER WOLF RD

NW **271 WOLF RD POLE 89** < 1/8 COLONIE, NY 12205

0.004 mi.

20 ft. Site 1 of 6 in cluster J

Relative: Higher

Actual:

296 ft.

NY Spills: Site ID:

> Facility Addr2: Not reported Facility ID: 0603057 Spill Number: 0603057 Facility Type: ER SWIS: 0126 WTCHRIST

365676

Investigator: Referred To: Not reported Spill Date: 6/20/2006 Reported to Dept: 6/20/2006 CID: 73

Spill Cause: **Equipment Failure** Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Responsible Party Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

NY Spills

S108057593

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO TRANSFORMER WOLF RD (Continued)

S108057593

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

6/20/2006 Spill Closed Dt:

Remediation Phase:

Date Entered In Computer: 6/20/2006 Spill Record Last Update: 4/9/2010 Spiller Name: Not reported

Spiller Company: NATIONAL GRID (NIMO) Spiller Address: 2512 WESTERN TRNP Spiller City, St, Zip: ALTAMONT, NY 12009

Spiller Company: 001

Contact Name: **TERRY OBRIEN** Contact Phone: (518) 356-6471

DEC Region: DER Facility ID: 315795 DEC Memo: Not reported

POLE MOUNTED TRANSFORMER LEAKED 1 QUART ONTO SOIL. CLEAN UP TO BEGIN Remarks:

SHORTLY.

Material:

Site ID: 365676 Operable Unit ID: 1123677 Operable Unit: 01 Material ID: 2113151 Material Code: 0020A

Material Name: TRANSFORMER OIL

Case No.: Not reported Material FA: Petroleum 0 Quantity: Units: Gallons Recovered: No Not reported

Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Distance Elevation Site EDR ID Number Database(s) EPA ID Number

H45 ALBANY AIRPORT AMERICAN NY Spills S103485031
NE ALBANY AIRPORT SHAKER RD NY Hist Spills N/A

< 1/8 COLONIE, NY

0.009 mi.

46 ft. Site 2 of 2 in cluster H

Spill Date:

Relative: Higher NY Spills: Site ID: 193753

Actual: 298 ft.

Facility Addr2:

Facility Addr2:

Not reported
9905628

Spill Number:

9905628

Facility Type:

ER

SWIS:

0126

Investigator:

Referred To:

Not reported

Reported to Dept: 8/10/1999 CID: 322

Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Moote Std: False

Cleanup Meets Std: False
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

8/10/1999

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 8/10/1999 Remediation Phase: 0

Date Entered In Computer: 8/10/1999 Spill Record Last Update: 12/6/2005

Spiller Name: AMERICAN AIRLINES A-3
Spiller Company: ALBANY AIRPORT AMERICAN A
Spiller Address: 737 ALBANY SHAKER ROAD

Spiller City, St, Zip: COLONIE, NY -

Spiller Company: 001

Contact Name: MIKE RUTH
Contact Phone: (518) 869-0253

DEC Region: 4
DER Facility ID: 267544

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"STAFF" No DEC response.

Remarks: DURING FUELING THE CENTER TANK VALVE PERMATURLY [SP] SHUT DOWN - SPILL

HAS BEEN CLEANED UP

Material:

Site ID: 193753 Operable Unit ID: 1084165 Operable Unit: 01 Material ID: 301918 Material Code: 0011 Material Name: Jet Fuel Case No.: Not reported Material FA: Petroleum Quantity: 12 Units: Gallons Recovered:

Resource Affected: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY AIRPORT AMERICAN (Continued)

S103485031

Tank Test:

Oxygenate:

Last Modified:

Test Method:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported

False

Not reported

Not reported

Site ID: 193747 Facility Addr2: Not reported Facility ID: 9808274 Spill Number: 9808274 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 10/5/1998 Spill Date: 10/5/1998 Reported to Dept:

CID: 323 **Equipment Failure** Spill Cause: Water Affected: Not reported Spill Source: Commercial Vehicle Spill Notifier: Fire Department Cleanup Ceased: Not reported Cleanup Meets Std: False

Recommended Penalty: Penalty Not Recommended

Not reported

UST Trust:

Last Inspection:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/5/1998

Remediation Phase: Date Entered In Computer: 10/5/1998 Spill Record Last Update: 11/5/1998 Spiller Name: **CAMILLE SOTO**

Spiller Company: ALBANY AIRPORT AMERICAN A ALBANY INTERNATIONAL Spiller Address:

Spiller City, St, Zip: COLONIE, NY -

Spiller Company: 001

DON BRUNDAGE Contact Name: (518) 242-2332 Contact Phone:

DEC Region: 4 DER Facility ID: 267544

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN'

FMC 6260 DE-ICING VEH HAD A BROKEN LINE. SOME PRODUCT WENT INTO A Remarks:

SEWER MANHOLE LOCATED AT AMERICAN AIRLINES.

Material:

Site ID: 193747

Direction Distance

Elevation Site Database(s) **EPA ID Number**

ALBANY AIRPORT AMERICAN (Continued)

S103485031

EDR ID Number

Operable Unit ID: 1069474 Operable Unit: 01 Material ID: 315792 Material Code: 0010 Material Name: Hydraulic Oil Not reported Case No.: Petroleum Material FA: Quantity:

Units: Gallons Recovered: No Resource Affected: Not reported False

Tank Test:

Oxygenate:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

> Click this hyperlink while viewing on your computer to access SEWER MANHOLE LOCATED AT AMERICAN AIRLINES.

NY Hist Spills:

Region of Spill:

Spill Number: 0107659 **CHRISTENSEN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 10/26/2001 06:00 Reported to Dept Date/Time: 10/26/01 10:41

SWIS:

Spiller Name: AMERICAN AIRLINES AIRPORT

Spiller Contact: **BRUCE CAMPBELL** Spiller Phone: (817) 931-5423 Spiller Contact: JIM BRADY Spiller Phone: (518) 434-0209

Spiller Address: 4333 AMON CARTER BLVD Spiller City, St, Zip: FORT WORTH, TX 76155-Spill Cause: **Equipment Failure**

Reported to Dept: On Land Water Affected: Not reported

Spill Source:

Spill Notifier: Responsible Party PBS Number: Not reported

Cleanup Ceased:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY AIRPORT AMERICAN (Continued)

S103485031

Cleanup Meets Std: True Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** Invstgn Complete: // UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / 10/26/01 Date Spill Entered In Computer Data File: Date Spill Entered In Computer Data File: Not reported

Update Date: 11/27/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 2 Unkonwn Quantity Recovered: False Material: JET FUEL Class Type: JET FUEL Times Material Entry In File: 1264 CAS Number: Not reported 19940728 Last Date:

DEC Remarks: PBS 4-435511 SIGNATURE) 4-600099 AIRPORT); CBS 4-000227; SEE 0106857,

0108584, Etc. 11/05/2001 - No DEC response. Clean up done by RP. wtc

CALLER STATES DUE TO A BAD VALVE ON THE RIGHT WING ON THE PLANE - ALL HAS BEEN Remark:

CLEANED UP

Region of Spill: Spill Number: 9808274 **CHRISTENSEN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 10/05/1998 16:00 Spill Date/Time: Reported to Dept Date/Time: 10/05/98 16:19

SWIS:

Spiller Name: ALBANY AIRPORT AMERICAN A

Spiller Contact: **CAMILLE SOTO** Spiller Phone: (518) 242-4277 Spiller Contact: DON BRUNDAGE

Direction Distance

Elevation Site Database(s) EPA ID Number

ALBANY AIRPORT AMERICAN (Continued)

S103485031

EDR ID Number

Spiller Phone: (518) 242-2332

Spiller Address: ALBANY INTERNATIONAL

Spiller City,St,Zip: COLONIE, NY - Spill Cause: Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 07

Spill Notifier: Fire Department PBS Number: Not reported

Cleanup Ceased: //
Cleanup Meets Std: False
Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/05/98

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/05/98
Date Spill Entered In Computer Data File: Not reported

Update Date: 11/05/98
Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 4
Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Material: HYDRAULIC OIL Class Type: HYDRAULIC OIL

Times Material Entry In File: 1846
CAS Number: Not reported
Last Date: 19940728

DEC Remarks: Not reported

Remark: FMC 6260 DE-ICING VEH HAD A BROKEN LINE. SOME PRODUCT WENT INTO A SEWER MANHOLE

LOCATED AT AMERICAN AIRLINES.

Region of Spill:

Spill Number: 9905628
Investigator: STAFF
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ALBANY AIRPORT AMERICAN (Continued)

S103485031

EDR ID Number

Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 08/10/1999 08:30
Reported to Dept Date/Time: 08/10/99 10:14

SWIS: 01

Spiller Name: ALBANY AIRPORT AMERICAN A
Spiller Contact: AMERICAN AIRLINES A-3

Spiller Phone: () Spiller Contact: MIKE RUTH
Spiller Phone: (518) 869-0253

Spiller Address: 737 ALBANY SHAKER ROAD

Spiller City,St,Zip: COLONIE, NY - Spill Cause: Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 07

Spill Notifier: Affected Persons
PBS Number: Not reported

Cleanup Ceased: //
Cleanup Meets Std: False
Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 08/10/99

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 08/10/99
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/27/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 12 Unkonwn Quantity Spilled: False Gallons Quantity Recovered: 12 Unkonwn Quantity Recovered: False Material: JET FUEL Class Type: JET FUEL Times Material Entry In File: 1264 CAS Number: Not reported Last Date: 19940728

DEC Remarks: No DEC response.

Remark: DURING FUELING THE CENTER TANK VALVE PERMATURLY SP SHUT DOWN - SPILL HAS

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY AIRPORT AMERICAN (Continued)

S103485031

BEEN CLEANED UP

J46 **LATHAM CONSTRUCTION NY Spills** S104952349 NW **271 WOLF RD NY Hist Spills** N/A

LATHAM, NY < 1/8 0.013 mi.

Site 2 of 6 in cluster J 69 ft.

NY Spills: Relative:

Site ID: 302332 Higher Facility Addr2: Not reported Actual: Facility ID: 0011533 295 ft. Spill Number: 0011533 Facility Type: ER SWIS: 0126

Investigator: WTCHRIST Referred To: Not reported Spill Date: 1/25/2001 1/25/2001 Reported to Dept: 21 CID:

Spill Cause: Human Error Water Affected: Not reported Spill Source: Tank Truck Spill Notifier: Responsible Party Cleanup Ceased: Not reported

Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/26/2001 Remediation Phase: 0 Date Entered In Computer: 1/25/2001 Spill Record Last Update: 4/9/2010 Spiller Name: TOM JONES Spiller Company: KING FUELS Spiller Address: PO BOX 838 Spiller City, St, Zip: TROY, NY 12180-

Spiller Company:

Contact Name: JACK HOFFMAN Contact Phone: (518) 869-0907

DEC Region: **DER Facility ID:** 244268

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN" IS THIS A PBS FACILITY? SHOULD IT BE?

Remarks: tank was overfilled due to the driver getting incorrect information

from the employees on the scene there - he was informed that the tank

would hold more than it actually did

Material:

302332 Site ID: Operable Unit ID: 833020 Operable Unit: 01 Material ID: 541842 Material Code: 0001 #2 Fuel Oil Material Name: Not reported Case No.:

Direction Distance Elevation

on Site Database(s) EPA ID Number

LATHAM CONSTRUCTION (Continued)

S104952349

EDR ID Number

Material FA: Petroleum
Quantity: 20
Units: Gallons
Recovered: 20
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 0011533 CHRISTENSEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 01/25/2001 09:30 Reported to Dept Date/Time: 01/25/01 10:14

SWIS: 01

Spiller Name: KING FUELS Spiller Contact: **TOM JONES** Spiller Phone: (518) 274-4200 Spiller Contact: JACK HOFFMAN Spiller Phone: (518) 869-0907 Spiller Address: PO BOX 838 Spiller City, St, Zip: TROY, NY 12180-Spill Cause: Human Error Reported to Dept: On Land Water Affected: Not reported

Spill Source: 08

Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LATHAM CONSTRUCTION (Continued)

S104952349

Spill Closed Dt: 01/26/01 Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 01/25/01 Date Spill Entered In Computer Data File: Not reported

Update Date: 01/29/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 20 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 20 Unkonwn Quantity Recovered: False #2 FUEL OIL Material: Class Type: #2 FUEL OIL Times Material Entry In File: 24464 CAS Number: Not reported Last Date: 19941207

DEC Remarks: IS THIS A PBS FACILITY? SHOULD IT BE?

Remark: tank was overfilled due to the driver getting incorrect information from the

employees on the scene there - he was informed that the tank would hold more

than it actually did

J47 **ALBANY PARK & FLY** RCRA-NonGen 1000153870 NW 264 WOLF RD **FINDS** NYD982796930 < 1/8 LATHAM, NY 12110 **MANIFEST**

0.013 mi.

Site 3 of 6 in cluster J 69 ft.

Relative:

RCRA-NonGen:

Date form received by agency: 01/01/2007 Higher

Facility name: ALBANY PARK & FLY Facility address: 264 WOLF RD

Actual: 295 ft.

LATHAM, NY 121104805

EPA ID: NYD982796930

Mailing address: WOLF RD

LATHAM, NY 12110

Contact: Not reported WOLF RD Contact address:

LATHAM, NY 12110

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Direction Distance Elevation

vation Site Database(s) EPA ID Number

ALBANY PARK & FLY (Continued)

1000153870

EDR ID Number

Owner/operator name: WERTHEIM PHIL Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: WERTHEIM PHIL Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Unknown Furnace exemption: Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No No Used oil Specification marketer: Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: ALBANY PARK & FLY Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: ALBANY PARK & FLY Classification: Not a generator, verified

Date form received by agency: 11/03/1989

Facility name: ALBANY PARK & FLY Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004435503

Direction Distance

Elevation Site Database(s) **EPA ID Number**

ALBANY PARK & FLY (Continued)

1000153870

EDR ID Number

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD982796930

Country: USA

Mailing Name: ALBANY PARK & FLY Mailing Contact: ALBANY PARK & FLY Mailing Address: 271 WOLF RD Mailing Address 2: Not reported Mailing City: LATHAM Mailing State: NY Mailing Zip: 12110 Mailing Zip4: 4807 Mailing Country: USA

Mailing Phone: 518-869-8200

NY MANIFEST:

No Manifest Records Available

RUSHMORE & WEBER WOLF RD 48 NW 272 WOLF RD REAR OF BLDG

S103939493 **LTANKS HIST LTANKS** N/A

< 1/8 COLONIE, NY

0.014 mi. 75 ft.

LTANKS: Relative:

72309 Site ID: Higher 9308022 Spill No: Actual: Spill Date: 10/1/1993 296 ft. Spill Cause: Tank Failure

Spill Source: Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/6/1995 Facility Addr2: Not reported Cleanup Ceased: 5/20/1994 Cleanup Meets Standard: True SWIS: 0126 Investigator: WTCHRIST Not reported Referred To: Reported to Dept: 10/1/1993 CID: Not reported Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True Remediation Phase: 0

Date Entered In Computer: 10/15/1993 Spill Record Last Update: 4/26/1999

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RUSHMORE & WEBER WOLF RD (Continued)

S103939493

Spiller Name: Not reported

POSS FORMER OWNER Spiller Company:

Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: DER Facility ID: 68272

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN/TS" SEE FOLDER.

FOUND CONT. SOIL @ TANK PULL @ FORMER RUSHMORE & WEBER, PEFRA ENT Remarks:

OWNER 14 PEPPER LN LOUDONVILLE 12211. 5/20/94 CLOSURE REPORT RECEIVED

MEETS STARS

Material:

Site ID: 72309 Operable Unit ID: 989394 Operable Unit: 01 Material ID: 394266 Material Code: 8000 Material Name: Diesel Not reported Case No.: Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

HIST LTANKS:

Region of Spill: 4

Spill Number: 9308022 10/01/1993 Spill Date: Spill Time: 13:45 Spill Cause: Tank Failure Resource Affectd: On Land Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 02/06/95

Direction Distance Elevation

ance EDR ID Number vation Site Database(s) EPA ID Number

RUSHMORE & WEBER WOLF RD (Continued)

S103939493

Cleanup Ceased: 05/20/94 Cleanup Meets Standard: True

Investigator: CHRISTENSEN/TS Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 10/01/93 Reported to Department Time: 14:04

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Spiller Name: POSS FORMER OWNER

Spiller Address: Not reported Spiller City,St,Zip: Not reported

Spiller Cleanup Date: / /

Facility Contact:

Facility Phone:

Facility Extention:

Spill Notifier:

PBS Number:

Not reported

Not reported

Other

Not reported

Not reported

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/15/93
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 04/26/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: n Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False DIESEL Material: Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RUSHMORE & WEBER WOLF RD (Continued)

S103939493

Last Date: 19940728

DEC Remarks: SEE FOLDER.

FOUND CONT. SOIL @ TANK PULL @ FORMER RUSHMORE WEBER, PEFRA ENT OWNER 14 PEPPER Spill Cause:

LN LOUDONVILLE 12211. 5/20/94 CLOSURE REPORT RECEIVED MEETS STARS

J49 SUNBELT RENTALS WOLF RD NY Spills S109414367 NW 272 WOLF RD N/A

< 1/8 LATHAM, NY

0.015 mi.

78 ft. Site 4 of 6 in cluster J

NY Spills: Relative: Higher Site ID:

Facility Addr2: Not reported Actual: Facility ID: 0811298 295 ft. Spill Number: 0811298 Facility Type: ER

SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported 1/13/2009 Spill Date: Reported to Dept: 1/13/2009

CID: 21

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial/Industrial

Spill Notifier: DEC Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection:

Not reported Recommended Penalty: Penalty Not Recommended

408868

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/13/2009 Remediation Phase:

Date Entered In Computer: 1/13/2009 Spill Record Last Update: 3/27/2009

Spiller Name: JEFF DEMOULTIED Spiller Company: SUNBELT RENTALS Spiller Address: 272 WOLF RD Spiller City, St, Zip: LATHAM, NY

Spiller Company: 999

Contact Name: JEFF DEMOULTIED Contact Phone: Not reported

DEC Region: 4 **DER Facility ID:** 358127

02/13/09 - Called in by DEC Toom Sperbeck. Minor drip was DEC Memo:

repaired.Clean up by RP. Closed wtc

Remarks: Caller states fuel was dripping from a check valve onto soil. Cleanup

is pending, valve was repaired.

Material:

Site ID: 408868 Operable Unit ID: 1165378 Operable Unit: 01 2156785 Material ID: Material Code: 8000

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS WOLF RD (Continued)

S109414367

Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: Not reported Units: Not reported Not reported Recovered: Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

J50 SUNBELT RENTALS INC. UST U001845717 NW 272 WOLF ROAD **HIST UST** N/A < 1/8 LATHAM, NY 12110 **AST**

4-435864

0.015 mi.

Site 5 of 6 in cluster J 78 ft.

Relative: Higher

UST: Facility Id:

Region: STATE Actual: DEC Region: 295 ft. Site Status: Active Program Type: **PBS**

Expiration Date: 2012/09/17 UTM X: 598738 UTM Y: 4731603 Site ID: 36841

Tank Number: 1A Tank ID: 91156

Closed - Removed Tank Status: Not reported Tank Model: Pipe Model: Not reported Install Date: 12/1/1976 4000 Capacity Gallons: Tightness Test Method: 03

Next Test Date: Not reported 10/1/1993 Date Tank Closed: Tank Location:

Steel/carbon steel Tank Type:

Date Test: 4/1/1988 Register: True Modified By: rischowe Last Modified: 9/17/2007

Equipment Records:

J02 - Dispenser - Suction

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNBELT RENTALS INC. (Continued)

U001845717

EDR ID Number

D02 - Pipe Type - Galvanized Steel F00 - Pipe External Protection - None H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None C00 - Pipe Location - No Piping

100 - Overfill - None

G00 - Tank Secondary Containment - None B00 - Tank External Protection - None

Tank Number: 2A Tank ID: 91157

Tank Status:

Closed - Removed
Tank Model:

Not reported

Not reported
Install Date:

Capacity Gallons:

Tightness Test Method:

Closed - Removed

Not reported

12/1/1969

4000

101

Next Test Date: Not reported Date Tank Closed: 10/1/1993

Tank Location: 5

Tank Type: Steel/carbon steel

Date Test: 2/1/1986
Register: True
Modified By: rjschowe
Last Modified: 9/17/2007

Equipment Records:

J02 - Dispenser - Suction
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None

Tank Number: 3A Tank ID: 94961

Tank Status:

Closed - Removed
Tank Model:

Pipe Model:

Install Date:

Capacity Gallons:

Tightness Test Method:

Not reported

1/1/1976

4000

NN

Next Test Date:

Not reported

Not reported

Next Test Date: Not reported
Date Tank Closed: 10/1/1993

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: rjschowe
Last Modified: 9/17/2007

Equipment Records:

H00 - Tank Leak Detection - None

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

A00 - Tank Internal Protection - None

D01 - Pipe Type - Steel/Carbon Steel/Iron F00 - Pipe External Protection - None

C02 - Pipe Location - Underground/On-ground

100 - Overfill - None J00 - Dispenser - None

G00 - Tank Secondary Containment - None

B00 - Tank External Protection - None

Tank Number: 4A Tank ID: 94962

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 1/1/1976 Capacity Gallons: 1000 Tightness Test Method: NN

Next Test Date: Not reported 10/1/1993 Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: rjschowe Last Modified: 9/17/2007

Equipment Records:

A00 - Tank Internal Protection - None D01 - Pipe Type - Steel/Carbon Steel/Iron F00 - Pipe External Protection - None H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None

J00 - Dispenser - None

C02 - Pipe Location - Underground/On-ground

100 - Overfill - None

B00 - Tank External Protection - None

12/30/2008

Affiliation Records:

Date Last Modified:

Site Id: 36841

On-Site Operator Affiliation Type:

Company Name: SUNBELT RENTALS INC.

Contact Type: Not reported

JEFFREY DE MOULPIED Contact Name:

Address1: Not reported Address2: Not reported City: Not reported State: NY

Zip Code: Not reported Country Code: 001

Phone: (518) 462-0440 Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: tesperbe

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

Site Id: 36841 Affiliation Type: Mail Contact

Company Name: SUNBELT RENTALS INC.

Contact Type: Not reported

JEFFREY DE MOULPIED Contact Name: 272 WOLF ROAD Address1:

Address2: Not reported LATHAM City: State: NY Zip Code: 12110 Country Code: 001

(518) 452-0440 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: rjschowe 9/17/2007 Date Last Modified:

Site Id: 36841

Affiliation Type: **Emergency Contact** SUNBELT RENTALS Company Name:

Contact Type: Not reported

Contact Name: JEFFREY DE MOULPIED

Address1: Not reported Address2: Not reported City: Not reported State:

NN Zip Code:

Not reported Country Code: 999

(518) 424-7643 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: tesperbe 12/30/2008 Date Last Modified:

Site Id: 36841 Affiliation Type: Owner

SUNBELT RENTALS Company Name:

Contact Type: PROFIT CENTER MANAGER JEFFREY DE MOULPIED Contact Name: Address1: 2341 DEERFIELD DRIVE

Address2: Not reported FORT MILL City: State: SC Zip Code: 29715 Country Code: 001

(866) 573-6246 Phone: Phone Ext: Not reported Email: Not reported Not reported Fax Number: Modified By: tesperbe Date Last Modified: 12/30/2008

HIST UST:

PBS Number: 4-435864 SPDES Number: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

EDR ID Number

Emergency Contact: SUSAN WEBER Emergency Telephone: (518) 462-3247 SUSAN WEBER Operator: Operator Telephone: (518) 462-3247

Owner Name: RUSHMORE & WEBER INC 272 WOLF ROAD P.O. BOX 757 Owner Address:

Owner City, St, Zip: LATHAM, NY 12110 Owner Telephone: (518) 869-2221 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

PEFRA ENTERPRISES INC. Mailing Name:

Mailing Address: 14 PEPPER LANE Mailing Address 2: Not reported

Mailing City, St, Zip: LOUDONVILLE, NY 12211

Mailing Contact: SUSAN WEBER Mailing Telephone: (518) 462-3247 Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported

SWIS ID: 0126 Old PBS Number: Not reported

Facility Type:

TRUCKING/TRANSPORTATION

Inspected Date: Not reported Inspector: Not reported Not reported Inspection Result: Federal ID: Not reported Certification Flag: False 01/18/1994 Certification Date: 06/28/1998 **Expiration Date:** Renew Flag: False Renewal Date: Not reported

Total Capacity: FAMT: True

No Missing Data Facility Screen: No Missing Data Owner Screen:

Tank Screen: Dead Letter: False Not reported CBS Number: COLONIE Town or City: County Code: 01 Town or City: 26

Tank Id:

Region:

UNDERGROUND Tank Location: Tank Status: Closed-Removed

4

Install Date: 19761201 Capacity (gals): 4000

LEADED GASOLINE Product Stored: Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported

Pipe Type: **GALVANIZED STEEL**

Not reported Pipe Internal: Pipe External: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

EDR ID Number

Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: 04/01/1988 Next Test Date: Not reported Minor Data Missing Missing Data for Tank: 10/01/1993 Date Closed: Test Method: Horner EZ Check

Deleted: False Updated: True Lat/long: Not reported

Tank Id:

Product Stored:

Tank Location: UNDERGROUND Tank Status: Closed-Removed 19691201 Install Date: Capacity (gals): 4000 **DIESEL**

Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported

GALVANIZED STEEL Pipe Type:

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Suction Dispenser: Date Tested: 02/01/1986 Next Test Date: Not reported Missing Data for Tank: Minor Data Missing

10/01/1993 Date Closed: Test Method: Petro-Tite Deleted: False Updated: True Lat/long: Not reported

Tank Id:

UNDERGROUND Tank Location: Tank Status: Closed-Removed 19760101 Install Date:

4000 Capacity (gals):

Product Stored: **UNLEADED GASOLINE** Tank Type: Steel/carbon steel

Tank Internal: None Tank External: None

Underground Pipe Location: Pipe Type: STEEL/IRON None

Pipe Internal: Pipe External: None Second Containment: None None Leak Detection: Overfill Prot: None

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNBELT RENTALS INC. (Continued)

U001845717

EDR ID Number

Dispenser: Not reported Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing 10/01/1993 Date Closed: Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Tank Id:

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19760101
Capacity (gals): 1000
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel

Tank Internal: None
Tank External: None

Pipe Location: Underground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Not reported Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Date Closed: 10/01/1993 Test Method: Not reported Deleted: False

Lat/long: Not reported

True

AST:

Updated:

 Region:
 STATE

 DEC Region:
 4

 Site Status:
 Active

 Facility Id:
 4-435864

 Program Type:
 PBS

 UTM X:
 598738

 UTM Y:
 4731603

 Expiration Date:
 2012/09/17

Tank Number: 1
Tank Id: 219433
Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 4/1/2007
Capacity Gallons: 1000
Tightness Test Method: NN

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

Date Test: Not reported Next Test Date: Not reported Not reported Date Tank Closed: Register: True Modified By: rjschowe 9/17/2007 Last Modified:

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating

J02 - Dispenser - Suction

D01 - Pipe Type - Steel/Carbon Steel/Iron 104 - Overfill - Product Level Gauge (A/G) A00 - Tank Internal Protection - None K00 - Spill Prevention - None

C01 - Pipe Location - Aboveground

H00 - Tank Leak Detection - None

F01 - Pipe External Protection - Painted/Asphalt Coating

E00 - Piping Secondary Containment - None

105 - Overfill - Vent Whistle

L00 - Piping Leak Detection - None

G09 - Tank Secondary Containment - Modified Double-Walled

(Aboveground)

Tank Number: 2 Tank Id: 219434 Tank Location:

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service Tank Model: Not reported Not reported Pipe Model: Install Date: 4/1/2007 Capacity Gallons: 500 Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Date Tank Closed: Not reported Register: True Modified By: rjschowe 9/17/2007 Last Modified:

Equipment Records:

104 - Overfill - Product Level Gauge (A/G)

B01 - Tank External Protection - Painted/Asphalt Coating

105 - Overfill - Vent Whistle

F01 - Pipe External Protection - Painted/Asphalt Coating

E00 - Piping Secondary Containment - None

J02 - Dispenser - Suction

D01 - Pipe Type - Steel/Carbon Steel/Iron

H00 - Tank Leak Detection - None

C01 - Pipe Location - Aboveground

A00 - Tank Internal Protection - None

K00 - Spill Prevention - None

G09 - Tank Secondary Containment - Modified Double-Walled

(Aboveground)

L00 - Piping Leak Detection - None

Direction Distance

Elevation Site Database(s) EPA ID Number

SUNBELT RENTALS INC. (Continued)

Tank Number: 3
Tank Id: 219435
Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 6/1/2000
Capacity Gallons: 275
Tightness Test Method: NN

Date Test:

Not reported

Next Test Date:

Not reported

Date Tank Closed:

Register:

Modified By:

Last Modified:

Not reported

True

tesperbe

2/25/2009

Equipment Records:

G01 - Tank Secondary Containment - Diking (Aboveground)

J02 - Dispenser - Suction

A00 - Tank Internal Protection - None C00 - Pipe Location - No Piping

104 - Overfill - Product Level Gauge (A/G)

B01 - Tank External Protection - Painted/Asphalt Coating

F00 - Pipe External Protection - None H00 - Tank Leak Detection - None K00 - Spill Prevention - None

E00 - Piping Secondary Containment - None

D00 - Pipe Type - No Piping L00 - Piping Leak Detection - None

Tank Number: 4
Tank Id: 227444

Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 6/1/2000
Capacity Gallons: 275
Tightness Test Method: NN

Date Test:
Not reported
Next Test Date:
Not reported
Date Tank Closed:
Not reported
Register:
True
Modified By:
Last Modified:
2/25/2009

Equipment Records:

J02 - Dispenser - Suction

C00 - Pipe Location - No Piping

104 - Overfill - Product Level Gauge (A/G)

D00 - Pipe Type - No Piping

H00 - Tank Leak Detection - None

E00 - Piping Secondary Containment - None

A00 - Tank Internal Protection - None

G10 - Tank Secondary Containment - Impervious Underlayment

EDR ID Number

U001845717

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

F00 - Pipe External Protection - None

B01 - Tank External Protection - Painted/Asphalt Coating

K00 - Spill Prevention - None L00 - Piping Leak Detection - None

Tank Number: 5 Tank Id: 227445 Tank Location:

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 6/1/2000 Capacity Gallons: 275 Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Date Tank Closed: Not reported Register: True Modified By: tesperbe Last Modified: 2/25/2009

Equipment Records:

104 - Overfill - Product Level Gauge (A/G)

C00 - Pipe Location - No Piping D00 - Pipe Type - No Piping J02 - Dispenser - Suction

E00 - Piping Secondary Containment - None

G10 - Tank Secondary Containment - Impervious Underlayment

F00 - Pipe External Protection - None H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None

B01 - Tank External Protection - Painted/Asphalt Coating

K00 - Spill Prevention - None L00 - Piping Leak Detection - None

Tank Number: 6 Tank Id: 227446 Tank Location:

Steel/Carbon Steel/Iron Tank Type:

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 6/1/2000 Capacity Gallons: 275 Tightness Test Method: NN

Not reported Date Test: Not reported Next Test Date: Date Tank Closed: Not reported Register: True Modified By: tesperbe 2/25/2009 Last Modified:

Equipment Records:

104 - Overfill - Product Level Gauge (A/G)

B01 - Tank External Protection - Painted/Asphalt Coating

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

F00 - Pipe External Protection - None

E00 - Piping Secondary Containment - None

D00 - Pipe Type - No Piping J02 - Dispenser - Suction C00 - Pipe Location - No Piping A00 - Tank Internal Protection - None H00 - Tank Leak Detection - None

G01 - Tank Secondary Containment - Diking (Aboveground)

K00 - Spill Prevention - None L00 - Piping Leak Detection - None

Affiliation Records:

36841 Site Id:

On-Site Operator Affiliation Type:

SUNBELT RENTALS INC. Company Name:

Contact Type: Not reported

Contact Name: JEFFREY DE MOULPIED

Address1: Not reported Address2: Not reported City: Not reported

State: NY

Zip Code: Not reported Country Code:

(518) 462-0440 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: tesperbe Date Last Modified: 12/30/2008

Site Id: 36841 Affiliation Type: Mail Contact

Company Name: SUNBELT RENTALS INC.

Contact Type: Not reported

Contact Name: JEFFREY DE MOULPIED

Address1: 272 WOLF ROAD Address2: Not reported City: LATHAM State: NY 12110 Zip Code: Country Code: 001

Phone: (518) 452-0440 Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: rischowe Date Last Modified: 9/17/2007

Site Id: 36841

Emergency Contact Affiliation Type: Company Name: SUNBELT RENTALS

Contact Type: Not reported

Contact Name: JEFFREY DE MOULPIED

Address1: Not reported Address2: Not reported City: Not reported

State: NN

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SUNBELT RENTALS INC. (Continued)

U001845717

Zip Code: Not reported

Country Code: 999

(518) 424-7643 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: tesperbe Date Last Modified: 12/30/2008

Site Id: 36841 Affiliation Type: Owner

SUNBELT RENTALS Company Name: Contact Type: PROFIT CENTER MANAGER Contact Name: JEFFREY DE MOULPIED Address1: 2341 DEERFIELD DRIVE

Address2: Not reported FORT MILL City: State: SC Zip Code: 29715 Country Code: 001

Phone: (866) 573-6246 Phone Ext: Not reported Email: Not reported Fax Number: Not reported tesperbe Modified By: Date Last Modified: 12/30/2008

RUSHMORE WEBER J51 RCRA-NonGen 1000242863 NW 272 WOLF RD **FINDS** NYD002092492

0.015 mi.

< 1/8

78 ft. Site 6 of 6 in cluster J

LATHAM, NY 12110

Facility name:

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

Actual: Facility address: 272 WOLF RD 295 ft. LATHAM, NY 12110

NYD002092492 EPA ID:

WOLF RD Mailing address: LATHAM, NY 12110

Contact: Not reported

WOLF RD Contact address:

LATHAM, NY 12110

RUSHMORE WEBER

Contact country: US

Contact telephone: Not reported Not reported Contact email:

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: PETER WEBER Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 **MANIFEST**

Direction Distance

Elevation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: PETER WEBER
Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: Nο Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: RUSHMORE WEBER
Classification: Not a generator, verified

Date form received by agency: 03/14/1995

Facility name: RUSHMORE WEBER
Classification: Not a generator, verified

Date form received by agency: 09/18/1986

Facility name: RUSHMORE WEBER
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004338155

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

Distance Elevation

Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD002092492

Country: USA

Mailing Name: RUSHMORE & WEBER INC
Mailing Contact: RUSHMORE & WEBER INC

Mailing Address: 272 WOLF RD
Mailing Address 2: Not reported
Mailing City: LATHAM
Mailing State: NY
Mailing Zip: 12110
Mailing Zip4: 4805
Mailing Country: USA

Mailing Phone: 518-869-0996

Document ID: NYA9333134 Completed copy Manifest Status: Trans1 State ID: NY-DX1658 Trans2 State ID: Not reported Generator Ship Date: 890220 Trans1 Recv Date: 890220 Trans2 Recy Date: Not reported TSD Site Recv Date: 890223 Part A Recv Date: 890222 890303 Part B Recv Date:

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD980753784

 Waste Code:
 F003 - UNKNOWN

Quantity: 00036 Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: NYA9657652

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RUSHMORE WEBER (Continued)

1000242863

Manifest Status: Completed copy Trans1 State ID: NYDX1658 Not reported Trans2 State ID: Generator Ship Date: 891006 Trans1 Recv Date: 891006 Trans2 Recv Date: Not reported TSD Site Recv Date: 891012 Part A Recv Date: 891012 Part B Recv Date: 891016 Generator EPA ID: NYD002092492 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD980753784 Waste Code: F003 - UNKNOWN

Quantity: 00027 P - Pounds Units:

001 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 89 Year:

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9767507

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NY-DX1658 Trans2 State ID: Not reported Generator Ship Date: 891031 Trans1 Recv Date: 891031 Trans2 Recv Date: Not reported TSD Site Recv Date: 891102 Part A Recv Date: 891207 Part B Recv Date: 891115 Generator EPA ID: NYD002092492

Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD980753784 F003 - UNKNOWN Waste Code:

Quantity: 00027 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 89

Distance

Elevation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1077588

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

NYMM7800 Trans1 State ID: NJDEPS869 Trans2 State ID: Generator Ship Date: 901029 Trans1 Recv Date: 901029 Trans2 Recv Date: 901031 TSD Site Recv Date: 901101 Part A Recv Date: 910206 Part B Recv Date: 901214

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1101512

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

 Trans1 State ID:
 NYAC1984

 Trans2 State ID:
 \$8690

 Generator Ship Date:
 901005

 Trans1 Recv Date:
 901005

 Trans2 Recv Date:
 901008

Direction Distance

Elevation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

TSD Site Recv Date: 901009
Part A Recv Date: 910118
Part B Recv Date: 901031
Generator EPA ID: NYD002092492
Trans1 EPA ID: ILD051060408
Trans2 EPA ID: ILD051060408
TSDF ID: NJD069039626

Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP

Quantity: 00090
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00045
Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1060731

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYMM7800 Trans2 State ID: NJDEPS869 Generator Ship Date: 901126 Trans1 Recv Date: 901126 Trans2 Recv Date: 901129 TSD Site Recv Date: 901130 Part A Recv Date: 910417 Part B Recv Date: 910115 Generator EPA ID:

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00090
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Distance Elevation Site

Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Year: 90 Not reported Manifest Tracking Num: Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: NYC0776553

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYGS5776 Trans2 State ID: Not reported 910221 Generator Ship Date: Trans1 Recv Date: 910221 Trans2 Recv Date: Not reported TSD Site Recy Date: 910225 Part A Recv Date: 910422 Part B Recv Date: 910313

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD980753784

 Waste Code:
 F005 - UNKNOWN

Quantity: 00027
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 91

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1349137

Manifest Status: Completed copy
Trans1 State ID: NYLH2919
Trans2 State ID: NJDEPS869
Generator Ship Date: 920113
Trans1 Recv Date: 920113

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

Trans2 Recv Date: 920116 TSD Site Recv Date: 920117 920128 Part A Recv Date: Part B Recv Date: 920204 Generator EPA ID: NYD002092492 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00090
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: VTA0063625 Manifest Status: Completed copy Trans1 State ID: VT70A30 Trans2 State ID: Not reported Generator Ship Date: 940503 940503 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 940504 Part A Recv Date: 940517 Part B Recv Date: 940519

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 VTD982766537

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 VTD982766537

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00150
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00650
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Direction Distance

Elevation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Specific Gravity: 100
Waste Code: Not reported
Quantity: 02600
Units: P - Pounds
Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9474074 Manifest Status: Completed copy Trans1 State ID: NY-DX1658 Trans2 State ID: Not reported Generator Ship Date: 890512 Trans1 Recv Date: 890512 Trans2 Recv Date: Not reported TSD Site Recv Date: 890518 Part A Recv Date: 890515 Part B Recv Date: 890526 Generator EPA ID: NYD002092492 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD980753784 Waste Code: F003 - UNKNOWN

Quantity: 00027 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RUSHMORE WEBER (Continued)

TSDF ID:

1000242863

Document ID: NYA9625948 Manifest Status: Completed copy Trans1 State ID: 00000000 Trans2 State ID: 00000000 Generator Ship Date: 890808 Trans1 Recv Date: 890808 Trans2 Recv Date: Not reported TSD Site Recy Date: 890811 Part A Recv Date: 890809 Part B Recv Date: 890817 Generator EPA ID: NYD002092492 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported

Waste Code: F003 - UNKNOWN Quantity: 00027 P - Pounds Units:

001 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

NYD980753784

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9699142 Manifest Status: Completed copy Trans1 State ID: NY-LH2918 Trans2 State ID: Not reported Generator Ship Date: 890905 Trans1 Recv Date: 890905 Trans2 Recv Date: Not reported TSD Site Recv Date: 890906 Part A Recv Date: 890906 Part B Recv Date: 890920

Generator EPA ID: NYD002092492 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD980753784 Waste Code: F003 - UNKNOWN

Quantity: 00027 P - Pounds Units: Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Direction Distance Elevation

evation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Year: 89 Not reported Manifest Tracking Num: Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC0062561 Completed copy Manifest Status: 00000000 Trans1 State ID: Trans2 State ID: 00000000 Generator Ship Date: 900126 Trans1 Recv Date: 900126 Trans2 Recv Date: Not reported TSD Site Recy Date: 900201 Part A Recv Date: 900205 Part B Recv Date: 900215

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD980753784

 Waste Code:
 F003 - UNKNOWN

Quantity: 00027
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9814713

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYDX1658
Trans2 State ID: Not reported
Generator Ship Date: 891206
Trans1 Recv Date: 891206

Direction Distance Elevation

ation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Trans2 Recv Date: Not reported TSD Site Recv Date: 891215 Part A Recv Date: 891211 Part B Recv Date: 900103 Generator EPA ID: NYD002092492 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD980753784 Waste Code: F003 - UNKNOWN

Quantity: 00027
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC0024344 Manifest Status: Completed copy Trans1 State ID: NYDX1658 Trans2 State ID: Not reported 891228 Generator Ship Date: Trans1 Recv Date: 891228 Trans2 Recv Date: Not reported TSD Site Recv Date: 900108 Part A Recv Date: 900103 Part B Recv Date: 900118

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD980753784

 Waste Code:
 F003 - UNKNOWN

Quantity: 00027 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 89

Manifest Tracking Num:
Import Ind:
Export Ind:
Discr Quantity Ind:
Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Discr Residue Ind:
Discr Partial Reject Ind:
Discr Full Reject Ind:
Mot reported
Not reported

NYC1021206 Document ID: Completed copy Manifest Status: Trans1 State ID: NYGJ5776 Trans2 State ID: Not reported Generator Ship Date: 910613 Trans1 Recv Date: 910613 Trans2 Recv Date: Not reported TSD Site Recy Date: 910619 Part A Recv Date: 910621 Part B Recv Date: 910703

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD980753784

 Waste Code:
 F005 - UNKNOWN

Quantity: 00027 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 91

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYC1255138 Document ID: Manifest Status: Completed copy Trans1 State ID: NYGS5776 Trans2 State ID: Not reported Generator Ship Date: 911015 911015 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 911018 Part A Recv Date: Not reported Part B Recv Date: 911105 NYD002092492 Generator EPA ID: Trans1 EPA ID: ILD051060408

Direction Distance

Elevation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

EDR ID Number

Trans2 EPA ID: Not reported
TSDF ID: NYD980753784
Waste Code: F005 - UNKNOWN

Quantity: 00288
Units: P - Pounds
Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 91

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA9563343 Manifest Status: Completed copy Trans1 State ID: 00000000 Trans2 State ID: 00000000 Generator Ship Date: 890707 Trans1 Recv Date: 890707 Trans2 Recv Date: Not reported TSD Site Recy Date: 890711 Part A Recv Date: 890712 Part B Recv Date: 890720 NYD002092492 Generator EPA ID: ILD051060408 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD980753784

Quantity: 00027 Units: P - Pounds

Number of Containers: 001

Waste Code:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

F003 - UNKNOWN

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Not reported Discr Type Ind: Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

RUSHMORE WEBER (Continued)

1000242863

Mgmt Method Type Code: Not reported

Document ID: NYC0131141 Manifest Status: Completed copy Trans1 State ID: 00000000 Trans2 State ID: 00000000 Generator Ship Date: 900220 Trans1 Recv Date: 900220 Trans2 Recv Date: Not reported TSD Site Recv Date: 900222 900305 Part A Recv Date: Part B Recv Date: 900312 Generator EPA ID: NYD002092492

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD980753784

 Waste Code:
 F003 - UNKNOWN

Quantity: 00027 Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC0177175

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 00000000 Trans2 State ID: 00000000 Generator Ship Date: 900408 Trans1 Recv Date: 900408 Trans2 Recv Date: Not reported TSD Site Recv Date: 900412 Part A Recv Date: 900620 Part B Recv Date: 900502

 Generator EPA ID:
 NYD002092492

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD980753784

 Waste Code:
 F003 - UNKNOWN

Quantity: 00027 Units: P - Pounds Number of Containers: 001

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RUSHMORE WEBER (Continued)

1000242863

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

52 BFI TRUCK COMPUTER DR PK LOT SE 15 COMPUTER DR W PK LOT

NY Spills S107657654

N/A

< 1/8 COLONIE, NY 12205 0.052 mi. 276 ft.

NY Spills: Relative: Site ID: Higher

360965 PARKING LOT 15 COMPUTER DR WEST Facility Addr2:

Actual: Facility ID: 0514277 299 ft.

Spill Number: 0514277 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported

Spill Date: 3/14/2006 Reported to Dept: 3/14/2006 CID: 444

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial Vehicle Spill Notifier: Responsible Party Cleanup Ceased: Not reported Cleanup Meets Std: False

Last Inspection: Not reported Recommended Penalty: Penalty Not Recommended

UST Trust: False Known release with minimal potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 3/14/2006

Remediation Phase: Date Entered In Computer: 3/14/2006 Spill Record Last Update: 8/22/2006 Spiller Name: Not reported Spiller Company: **BFI TRUCK** Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller Company: 001

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BFI TRUCK COMPUTER DR PK LOT (Continued)

S107657654

Contact Name: JOE MCMANN Contact Phone: (518) 785-7030

DEC Region: 4 DER Facility ID: 311144

DEC Memo: 03/14/06 - Hydraulic line broke, BFI cleaned up spill. wtc

HOSE BROKE AND IS ALL CLEANED UP Remarks:

Material:

360965 Site ID: Operable Unit ID: 1118066 Operable Unit: 01 2108578 Material ID: Material Code: 0010 Material Name: Hydraulic Oil Case No.: Not reported Material FA: Petroleum Quantity: 15 Gallons Units: Recovered: 15 Resource Affected: Not reported

Oxygenate: False

Tank Test:

Site ID: Not reported Not reported Spill Tank Test: Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

K53 **TRANSCON LINES** UST U001844847 NW 280 WOLF ROAD **HIST UST** N/A

0.066 mi.

< 1/8

349 ft. Site 1 of 7 in cluster K

LATHAM, NY 12110

Relative: Higher

Actual:

299 ft.

UST:

Facility Id: 4-011029 Region: STATE DEC Region:

Site Status: Unregulated Program Type: **PBS Expiration Date:** N/A UTM X: 598769 UTM Y: 4731703 Site ID: 34858

Tank Number: 001 Tank ID: 92724

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TRANSCON LINES (Continued)

U001844847

EDR ID Number

Capacity Gallons: 2500 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

C00 - Pipe Location - No Piping

104 - Overfill - Product Level Gauge (A/G) G00 - Tank Secondary Containment - None

D00 - Pipe Type - No Piping H00 - Tank Leak Detection - None F00 - Pipe External Protection - None A00 - Tank Internal Protection - None

J02 - Dispenser - Suction

B00 - Tank External Protection - None

Affiliation Records:

Site Id: 34858 Affiliation Type: Owner

Company Name: TRANSCON LINES-ATTN REAL ESTAT

Contact Type: Not reported Contact Name: Not reported PO BOX 92220 Address1: Address2: Not reported LOS ANGELES City:

State: CA Zip Code: 90009 Country Code: 001

Phone: (213) 640-1800 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** 3/4/2004 Date Last Modified:

Site Id: 34858

Affiliation Type: On-Site Operator Company Name: TRANSCON LINES

Contact Type: Not reported Contact Name: TRANSCON LINES

Address1: Not reported Address2: Not reported City: Not reported

State: NY

Zip Code: Not reported Country Code:

(718) 388-8000 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **JMKRIMGO**

Direction Distance

Elevation Site Database(s) EPA ID Number

TRANSCON LINES (Continued)

U001844847

EDR ID Number

Date Last Modified: 3/24/2005

Site Id: 34858

Affiliation Type: Emergency Contact

Company Name: TRANSCON LINES-ATTN REAL ESTAT

Contact Type: Not reported

Contact Name: MR ED HOBIN, TERMINAL MANAGER

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported Country Code: 001

Phone: (518) 869-6737
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported

Modified By: TRANSLAT Date Last Modified: 3/4/2004

Site Id: 34858 Affiliation Type: Mail Contact

Company Name: TRANSCON LINES-ATTN REAL ESTAT

Contact Type: Not reported
Contact Name: Not reported
Address1: PO BOX 92220
Address2: Not reported
City: LOS ANGELES

State: CA
Zip Code: 90009
Country Code: 001

Phone: (213) 640-1800
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-011029 SPDES Number: Not reported

Emergency Contact: MR ED HOBIN, TERMINAL MANAGER

Emergency Telephone: (518) 869-6737 Operator: TRANSCON LINES Operator Telephone: (518) 869-6737

Owner Name: TRANSCON LINES-ATTN REAL ESTAT

Owner Address: PO BOX 92220

Owner City, St, Zip: LOS ANGELES, CA 90009

Owner Telephone: (213) 640-1800
Owner Type: Not reported
Owner Subtype: Not reported

Mailing Name: TRANSCON LINES-ATTN REAL ESTAT

Mailing Address: PO BOX 92220
Mailing Address 2: Not reported

Mailing City,St,Zip: LOS ANGELES, CA 90009

Mailing Contact: Not reported Mailing Telephone: (213) 640-1800

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TRANSCON LINES (Continued)

U001844847

Owner Mark: First Owner

2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) Facility Status:

and Subpart 360-14.

Facility Addr2: Not reported

SWIS ID: 0126

Old PBS Number: Not reported Not reported Facility Type: Inspected Date: Not reported Not reported Inspector: Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 12/02/1986 **Expiration Date:** 12/02/1991 Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: Minor Data Missing Owner Screen: Minor Data Missing Tank Screen: Minor Data Missing

Dead Letter: False CBS Number: Not reported COLONIE Town or City: County Code: 01 Town or City: 26 Region: 4

Tank Id: 001

UNDERGROUND Tank Location:

Tank Status: Closed Before April 1, 1991

Install Date: Not reported Capacity (gals): 2500 Product Stored: DIESEL

Steel/carbon steel Tank Type: Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None

Overfill Prot: **Product Level Gauge**

Dispenser: Suction Not reported Date Tested: Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

L54 LAZARE LINCOLN MERCURY, INC. UST U001846045 SSW 144 WOLF ROAD HIST UST N/A

< 1/8 COLONIE, NY 12205

0.068 mi.

360 ft. Site 1 of 4 in cluster L

Relative: Higher UST:

 Facility Id:
 4-600193

 Region:
 STATE

 DEC Region:
 4

Actual: 300 ft.

 Site Status:
 Unregulated

 Program Type:
 PBS

 Expiration Date:
 N/A

 UTM X:
 597889

 UTM Y:
 4730425

 Site ID:
 37527

Tank Number: 1 Tank ID: 94712

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 1/1/1971 Capacity Gallons: 2000 Tightness Test Method: NN Next Test Date: Not reported 8/1/1993 Date Tank Closed: Tank Location:

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

C02 - Pipe Location - Underground/On-ground

100 - Overfill - None

F00 - Pipe External Protection - None H00 - Tank Leak Detection - None G00 - Tank Secondary Containment - None

J02 - Dispenser - Suction

D02 - Pipe Type - Galvanized Steel A00 - Tank Internal Protection - None B00 - Tank External Protection - None

Tank Number: 2 Tank ID: 94713

Tank Status:

Closed - Removed
Tank Model:

Pipe Model:

Install Date:

Capacity Gallons:

Tightness Test Method:

Not reported

1/1/1971

2000

1/1/1971

Not reported

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

1/1/1971

Next Test Date: Not reported Date Tank Closed: 10/1/1994

Tank Location: 5

Tank Type: Steel/carbon steel

Date Test: 9/1/1993 Register: True

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY, INC. (Continued)

U001846045

EDR ID Number

Modified By: TRANSLAT Last Modified: 3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None

H00 - Tank Leak Detection - None D02 - Pipe Type - Galvanized Steel A00 - Tank Internal Protection - None

J02 - Dispenser - Suction

F00 - Pipe External Protection - None

100 - Overfill - None

B00 - Tank External Protection - None

C02 - Pipe Location - Underground/On-ground

Tank Number: 3
Tank ID: 95463

Tank Status:

Closed - Removed
Tank Model:

Pipe Model:

Install Date:

Capacity Gallons:

Tightness Test Method:

Not reported

1/1/1971

2000

NN

NN

Next Test Date: Not reported Date Tank Closed: 10/1/1994

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

C02 - Pipe Location - Underground/On-ground G00 - Tank Secondary Containment - None D01 - Pipe Type - Steel/Carbon Steel/Iron

100 - Overfill - None

F00 - Pipe External Protection - None H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None B00 - Tank External Protection - None

Affiliation Records:

Site Id: 37527

Affiliation Type: On-Site Operator

Company Name: LAZARE LINCOLN MERCURY, INC.

Contact Type: Not reported
Contact Name: JOSEPH D. LAZARE

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN

Zip Code: Not reported Country Code: 001

Phone: (518) 454-7550
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported

Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY, INC. (Continued)

U001846045

EDR ID Number

Modified By: TRANSLAT Date Last Modified: 3/4/2004

Site Id: 37527

Affiliation Type: Emergency Contact

Company Name: LAZARE LINCOLN MERCURY, INC.

Contact Type: Not reported
Contact Name: JOSEPH D. LAZARE

Address1: Not reported Address2: Not reported City: Not reported State: NN Zip Code: Not reported Not reported Not reported Not reported Not reported

Country Code: 001

Phone: (518) 454-7550
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37527 Affiliation Type: Owner

Company Name: LAZARE LINCOLN MERCURY, INC.

Contact Type: Not reported Contact Name: Not reported 144 WOLF ROAD Address1: Address2: Not reported COLONIE City: State: NYZip Code: 12205 Country Code: 001

Phone: (518) 458-7550
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37527 Affiliation Type: Mail Contact

Company Name: LAZARE LINCOLN MERCURY, INC.

Contact Type: Not reported
Contact Name: JOSEPH D. LAZARE
Address1: 144 WOLF ROAD
Address2: Not reported
City: COLONIE
State: NY

State: NY
Zip Code: 12205
Country Code: 001

Phone: (518) 458-7550
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Direction Distance

Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY, INC. (Continued)

U001846045

EDR ID Number

HIST UST:

4-600193 PBS Number: SPDES Number: Not reported **Emergency Contact:** JOSEPH D. LAZARE **Emergency Telephone:** (518) 383-0976 Operator: JOSEPH D. LAZARE

Operator Telephone: (518) 454-7550

LAZARE LINCOLN MERCURY, INC. Owner Name:

Owner Address: 144 WOLF ROAD Owner City, St, Zip: COLONIE, NY 12205 Owner Telephone: (518) 458-7550 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

LAZARE LINCOLN MERCURY, INC. Mailing Name:

Mailing Address: 144 WOLF ROAD Mailing Address 2: Not reported Mailing City, St, Zip: COLONIE, NY 12205 Mailing Contact: JOSEPH D. LAZARE Mailing Telephone: (518) 458-7550 Owner Mark: First Owner

2 - Unregulated by PBS (the total capacity is less than 1,101 gallons) Facility Status:

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126 Old PBS Number: Not reported Facility Type: **OTHER** Not reported Inspected Date: Inspector: Not reported Inspection Result: Not reported Not reported Federal ID: Certification Flag: False Certification Date: 11/23/1993 **Expiration Date:** 09/10/1998 Renew Flag: False Renewal Date: Not reported Total Capacity: 0 FAMT: True

Facility Screen:

No Missing Data No Missing Data Owner Screen:

Tank Screen: 0 Dead Letter: False CBS Number: Not reported COLONIE Town or City: County Code: 01 26

Town or City: Region: 4

Tank Id:

UNDERGROUND Tank Location: Tank Status: Closed-Removed Install Date: 19710101

Capacity (gals): 2000

UNLEADED GASOLINE Product Stored: Steel/carbon steel Tank Type:

Tank Internal: None Tank External: None Pipe Location: Underground

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY, INC. (Continued)

Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data 08/01/1993 Date Closed: Test Method: Not reported False Deleted: Updated: True Lat/long: Not reported

Tank ld: 2

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19710101
Capacity (gals): 2000
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel

Tank Internal: None Tank External: None

Pipe Location: Underground

Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction 09/01/1993 Date Tested: Not reported Next Test Date: Missing Data for Tank: No Missing Data Date Closed: 10/01/1994 Petro-Tite Test Method: Deleted: False Updated: True Lat/long: Not reported

Tank ld: 3

Tank Location: UNDERGROUND Tank Status: UNDERGROUND

Install Date: 19710101
Capacity (gals): 2000
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel

Tank Internal:
None
Tank External:
None
Pipe Location:
Underground
Pipe Type:
STEEL/IRON
Pipe Internal:
None
None

Pipe Internal: None Pipe External: None

U001846045

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY, INC. (Continued)

U001846045

Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: 0

Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 10/01/1994 Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

L55 LAZARE LINCOLN-MERCURY MANIFEST S109782301 N/A

SSW 144 WOLF RD **ALBANY, NY 12205** < 1/8

0.068 mi.

Site 2 of 4 in cluster L 360 ft.

Relative:

CT MANIFEST:

Higher

Waste:

Manifest No: CTF0908531 Actual:

Waste Occurence: 300 ft.

UNNA: 1993 Hazard Class:

US Dot Description: FLAMMABLE LIQUID N.O.S.

No of Containers: 001 Container Type: TT Quantity: 40 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 5/26/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0908531

Waste Occurence: **EPA Waste Code:** F003 Recycled Waste?: Date Record Was Last Modified: 5/26/2004 DEO Who Last Modified Record: IG

Detail:

Year: 2003 CTF0908531 Manifest ID: TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC

TSDF Address: 136 GRACEY AVE TSDF City,St,Zip: MERIDEN, CT 06450

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 10/29/2003 Transporter EPA ID: NJD080631369

ONYX ENVIRONMENTAL SERVICE LLC Transporter Name:

Transporter Country: USA

Direction Distance Elevation

Site Database(s) **EPA ID Number**

LAZARE LINCOLN-MERCURY (Continued)

S109782301

EDR ID Number

Transporter Phone: Not reported Not reported Trans 2 Date: Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City, St, Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported EPA ID: NYD002628451 Generator Phone: 5184587550 Generator Mailing Addr: 144 WOLF ROAD

Generator Mailing Town: ALBANY Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: No Date Shipped: 10/29/2003 Date Received: 10/31/2003 5/26/2004 Last modified date:

Last modified by: IG

Comments: Not reported

Waste:

Manifest No: CTF0402518

Waste Occurence: UNNA: 1993 Hazard Class:

FLAMMABLE LIQUID N.O.S. US Dot Description:

No of Containers: 001 Container Type: TT Quantity: 195 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0402518

Waste Occurence: EPA Waste Code: D001 Recycled Waste?:

Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Detail:

Year: 1996 Manifest ID: CTF0402518 TSDF EPA ID: CTD072138969

ENVIRONMENTAL WASTE RESOURCES TSDF Name:

TSDF Address: 130 FREIGHT ST. WATERBURY

TSDF City,St,Zip: CT 06725 TSDF Country: USA TSDF Telephone: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN-MERCURY (Continued)

S109782301

Transport Date: 1/15/1996 Transporter EPA ID: NJD080631369

Transporter Name: ONYX ENVIRONMENTAL SERVICE LLC

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City, St, Zip: CT USA Trans 2 Country:

Trans 2 Phone: Not reported EPA ID: NYD002628451 Generator Phone: 5184587550 Generator Mailing Addr: 144 WOLF ROAD

Generator Mailing Town: **ALBANY** Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: USA

Special Handling: Not reported Discrepancies: Not reported 1/15/1996 Date Shipped: Date Received: 1/19/1996 Last modified date: 4/26/2004 IG

Last modified by:

Comments: Not reported

Waste:

CTF0413865 Manifest No: Waste Occurence: UNNA: 1993

Hazard Class:

US Dot Description: WASTE FLAMMABLE LIQUID NOS

No of Containers: 001 Container Type: TT Quantity: 180 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0413865

Waste Occurence: EPA Waste Code: D001

Recycled Waste?: Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Detail:

1995 Year: Manifest ID: CTF0413865 TSDF EPA ID: CTD072138969

ENVIRONMENTAL WASTE RESOURCES TSDF Name:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN-MERCURY (Continued)

S109782301

130 FREIGHT ST. WATERBURY TSDF Address:

TSDF City,St,Zip: CT 06725 TSDF Country: USA TSDF Telephone: Not reported Transport Date: 7/12/1995 Transporter EPA ID: ILD099202681

CHEMICAL WASTE MANAGEMENT, INC. (TRANSPORTER) Transporter Name:

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Not reported Trans 2 EPA ID: Trans 2 Name: Not reported Not reported Trans 2 Address: Trans 2 City, St, Zip: СТ

USA Trans 2 Country: Trans 2 Phone: Not reported EPA ID: NYD002628451 Generator Phone: 5184587550 Generator Mailing Addr: 144 WOLF ROAD

ALBANY Generator Mailing Town: Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: USA Special Handling: Not reported Not reported Discrepancies: Date Shipped: 7/12/1995 Date Received: 7/14/1995 Last modified date: 4/26/2004 Last modified by: IG

Comments: Not reported

Waste:

CTF0356266 Manifest No:

Waste Occurence:

1993 UNNA: Hazard Class:

WASTE FLAMMABLE LIQUIDS US Dot Description:

No of Containers: 001 Container Type: TT 678 Quantity: Weight/Volume: G Additional Description: Υ Handling Code: T50 Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0356266

Waste Occurence: EPA Waste Code: D001 Recycled Waste?: Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN-MERCURY (Continued)

S109782301

Detail:

Year: 1994 Manifest ID: CTF0356266 TSDF EPA ID: CTD072138969

ENVIRONMENTAL WASTE RESOURCES TSDF Name:

TSDF Address: 130 FREIGHT ST. WATERBURY

TSDF City,St,Zip: CT 06725 TSDF Country: USA TSDF Telephone: Not reported Transport Date: 7/14/1994 ILD099202681 Transporter EPA ID:

Transporter Name: CHEMICAL WASTE MANAGEMENT, INC. (TRANSPORTER)

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City, St, Zip: CT USA Trans 2 Country:

Trans 2 Phone: Not reported EPA ID: NYD002628451 Generator Phone: 5184587550 Generator Mailing Addr: 144 WOLF ROAD

Generator Mailing Town: **ALBANY** Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: USA Special Handling: Yes Discrepancies: Nο Date Shipped: 7/14/1994 Date Received: 7/15/1994 Last modified date: 4/26/2004 Last modified by: IG

Comments: Not reported

LAZARE LINCOLN MERCURY RCRA-CESQG 1000155239 NYD002628451 **FINDS**

SSW 144 WOLF RD < 1/8 **ALBANY, NY 12205** 0.068 mi.

MANIFEST NY Spills Site 3 of 4 in cluster L **NY Hist Spills**

RCRA-CESQG: Relative:

L56

360 ft.

Date form received by agency: 01/01/2007 Higher

Facility name: LAZARE LINCOLN MERCURY INC

Actual: Facility address: 144 WOLF RD

300 ft. ALBANY, NY 122051196

NYD002628451 EPA ID: Mailing address: WOLF RD

ALBANY, NY 12205

Contact: Not reported Contact address: WOLF RD

ALBANY, NY 12205

Contact country: US

Contact telephone: Not reported Contact email: Not reported

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar

month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from

the cleanup of a spill, into or on any land or water, of acutely

hazardous waste

Owner/Operator Summary:

Owner/operator name: Not reported
Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: Not reported
Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Direction Distance Elevation

tion Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: LAZARE LINCOLN MERCURY INC

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/08/1999

Facility name: LAZARE LINCOLN MERCURY INC

Classification: Not a generator, verified

Date form received by agency: 10/03/1985

Facility name: LAZARE LINCOLN MERCURY INC

Classification: Small Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 01/26/1989

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

State

FINDS:

Registry ID: 110004341837

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

NY MANIFEST:

EPA ID: NYD002628451

Country: USA

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Mailing Name: LAZARE LINCOLN MERCURY INCORPORATED
Mailing Contact: LAZARE LINCOLN MERCURY INCORPORATED

Mailing Address: 144 WOLF ROAD
Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12205
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 518-458-7550

Document ID: CTB0074438 Manifest Status: Completed copy Trans1 State ID: VATJ71868 Trans2 State ID: Not reported Generator Ship Date: 870219 Trans1 Recv Date: 870219 Trans2 Recv Date: Not reported TSD Site Recv Date: 870223 Part A Recv Date: 870311 Part B Recv Date: 870305

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 VAD980831580

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

 Waste Code:
 F003 - UNKNOWN

Quantity: 00025

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: NYA7548039 Manifest Status: Completed copy 00000000 Trans1 State ID: Trans2 State ID: 00000000 880726 Generator Ship Date: Trans1 Recv Date: 880726 Trans2 Recy Date: Not reported TSD Site Recy Date: 880729 Part A Recv Date: 880728

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

 Part B Recv Date:
 880809

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 VAD980831580

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD043815703

 Waste Code:
 F005 - UNKNOWN

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 88

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB1414134

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

00000000 Trans1 State ID: Trans2 State ID: 00000000 Generator Ship Date: 900731 Trans1 Recv Date: 900731 Trans2 Recv Date: Not reported TSD Site Recv Date: 900802 Part A Recv Date: 900914 Part B Recv Date: 900820 Generator EPA ID: NYD002628451 Trans1 EPA ID: ILD099202681 Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: F005 - UNKNOWN

Quantity: 00145

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported

Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported

Document ID: NYC1944101 Completed copy Manifest Status: Trans1 State ID: NYCY9802 Trans2 State ID: Not reported Generator Ship Date: 921113 Trans1 Recv Date: 921113 Trans2 Recv Date: Not reported TSD Site Recv Date: 921113 Part A Recv Date: Not reported Part B Recv Date: 921125 NYD002628451 Generator EPA ID:

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00027
Units: P - Pounds
Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100
Year: 92
Manifest Tracking Num: Not r

Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1337576 Completed copy Manifest Status: Trans1 State ID: NYIM5676 NJDEPS869 Trans2 State ID: Generator Ship Date: 920302 Trans1 Recv Date: 920302 920305 Trans2 Recy Date: TSD Site Recv Date: 920306

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

 Part A Recv Date:
 Not reported

 Part B Recv Date:
 920319

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYC1695341 Document ID: Manifest Status: Completed copy NYEC2075 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 920623 Trans1 Recv Date: 920623 Trans2 Recv Date: Not reported TSD Site Recv Date: 920623 Not reported Part A Recv Date: Part B Recv Date: 920630 Generator EPA ID: NYD002628451 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00090 Units: P - Pounds

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num:
Import Ind:
Export Ind:
Discr Quantity Ind:
Discr Type Ind:
Discr Residue Ind:
Discr Partial Reject Ind:
Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Discr Full Reject Ind:

Manifest Ref Num:

Alt Fac RCRA Id:

Alt Fac Sign Date:

Mot reported

Not reported

Document ID: NYC1995568 Manifest Status: Completed copy Trans1 State ID: NYEC2075 Not reported Trans2 State ID: 920916 Generator Ship Date: 920916 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 920916 Part A Recv Date: Not reported 920925 Part B Recv Date:

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00090
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC1759375 Manifest Status: Completed copy Trans1 State ID: NYDX1658 Trans2 State ID: Not reported Generator Ship Date: 920723 Trans1 Recv Date: 920723 Trans2 Recv Date: Not reported TSD Site Recv Date: 920723 Part A Recv Date: Not reported Part B Recv Date: 920803 Generator EPA ID: NYD002628451 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00036
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00027
Units: P - Pounds
Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC1888727 Manifest Status: Completed copy Trans1 State ID: NYEC2076 Trans2 State ID: Not reported Generator Ship Date: 921015 Trans1 Recv Date: 921015 Trans2 Recv Date: Not reported TSD Site Recv Date: 921015 Part A Recv Date: Not reported Part B Recv Date: 921028

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

Waste Code: D006 - CADMIUM 1.0 MG/L TCLP

Quantity: 00036 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Year: 92 Not reported Manifest Tracking Num: Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAH3827060 Completed copy Manifest Status: Trans1 State ID: P52018IL Trans2 State ID: Not reported Generator Ship Date: 940125 Trans1 Recv Date: 940125 Trans2 Recv Date: Not reported TSD Site Recy Date: 940202 Part A Recv Date: 940201 Part B Recv Date: 940211

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 ILD099202681

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 MAD053452637

 Waste Code:
 F003 - UNKNOWN

Quantity: 00095

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC2739598

Manifest Status: Completed copy
Trans1 State ID: DX1658NY
Trans2 State ID: Not reported
Generator Ship Date: 931220
Trans1 Recv Date: 931220

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY (Continued)

1000155239

Not reported Trans2 Recv Date: TSD Site Recv Date: 931220 Part A Recv Date: Not reported Part B Recv Date: 931230 Generator EPA ID: NYD002628451 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00012

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 93

Document ID:

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Manifest Status: Completed copy Trans1 State ID: AC1984NY Trans2 State ID: Not reported Generator Ship Date: 931122 Trans1 Recv Date: 931122 Trans2 Recv Date: Not reported TSD Site Recv Date: 931122 Part A Recv Date: Not reported Part B Recv Date: 931207 Generator EPA ID: NYD002628451 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

NYC2682461

Quantity: 80000

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00006

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY (Continued)

1000155239

Specific Gravity: 100 93 Year:

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYC2665146 Document ID: Completed copy Manifest Status: Trans1 State ID: DV1658NY Trans2 State ID: Not reported Generator Ship Date: 931109 Trans1 Recv Date: 931109 Trans2 Recy Date: Not reported TSD Site Recv Date: 931109 Part A Recv Date: Not reported Part B Recv Date: 931123 Generator EPA ID: NYD002628451 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00012

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Waste Code: Not reported 00005 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Not reported Discr Type Ind: Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Document ID: NYC2996695 Manifest Status: Completed copy Trans1 State ID: EC2075 Not reported Trans2 State ID: Generator Ship Date: 940214 Trans1 Recv Date: 940214 Trans2 Recv Date: Not reported TSD Site Recy Date: 940214 Part A Recv Date: Not reported Part B Recv Date: 940228 Generator EPA ID: NYD002628451 ILD984908202 Trans1 EPA ID: Trans2 EPA ID: Not reported

NYD986872869 D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00007

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 001

TSDF ID:

Container Type: DM - Metal drums, barrels

R Material recovery of more than 75 percent of the total material. Handling Method:

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF0413865 Manifest Status: Completed copy Trans1 State ID: P52018IL Trans2 State ID: Not reported Generator Ship Date: 950712 Trans1 Recv Date: 950712 Trans2 Recv Date: Not reported TSD Site Recv Date: 950714 Part A Recv Date: Not reported Part B Recv Date: 950802 Generator EPA ID: NYD002628451

Trans1 EPA ID: ILD099202681 Trans2 EPA ID: Not reported TSDF ID: CTD072138969

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00180

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Year: 95 Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTC0119363

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: G65142CT Trans2 State ID: Not reported Generator Ship Date: 871104 Trans1 Recv Date: 871104 Trans2 Recy Date: Not reported TSD Site Recy Date: 871105 Part A Recv Date: 871201 Part B Recv Date: 871113

 Generator EPA ID:
 NYD002628451

 Trans1 EPA ID:
 VAD980831580

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

 Waste Code:
 F003 - UNKNOWN

Quantity: 00060

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTB0086887

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: G54385CT
Trans2 State ID: Not reported
Generator Ship Date: 870806
Trans1 Recv Date: 870806

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Not reported Trans2 Recv Date: 870807 TSD Site Recv Date: Part A Recv Date: 870909 Part B Recv Date: 870812 Generator EPA ID: NYD002628451 Trans1 EPA ID: VAD980831580 Trans2 EPA ID: Not reported TSDF ID: CTD072138969 Waste Code: F003 - UNKNOWN

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Not reported Manifest Ref Num: Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC2002307 Manifest Status: Completed copy Trans1 State ID: NYEC2075 Trans2 State ID: Not reported 920929 Generator Ship Date: Trans1 Recv Date: 920929 Trans2 Recv Date: Not reported TSD Site Recv Date: 920929 Part A Recv Date: Not reported Part B Recv Date: 921007 Generator EPA ID: NYD002628451 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYB5762538 Document ID: Manifest Status: Completed copy P22295IL Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 920708 Trans1 Recv Date: 920708 Trans2 Recv Date: Not reported TSD Site Recy Date: 920713 Part A Recv Date: Not reported Part B Recv Date: 920724

NYD002628451 Generator EPA ID: Trans1 EPA ID: ILD099202681 Trans2 EPA ID: Not reported TSDF ID: NYD049836679 Waste Code: F005 - UNKNOWN Quantity: 00175

Units:

G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92 Manifest Tracking Num:

Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYB5547042 Document ID: Manifest Status: Completed copy Trans1 State ID: P22295IL Trans2 State ID: Not reported Generator Ship Date: 930121 Trans1 Recv Date: 930121 Trans2 Recv Date: Not reported TSD Site Recv Date: 930127 Part A Recv Date: 930129 Part B Recv Date: 930210 NYD002628451 Generator EPA ID: Trans1 EPA ID: ILD099202681

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY (Continued)

1000155239

Trans2 EPA ID: Not reported TSDF ID: NYD049836679 F005 - UNKNOWN Waste Code:

00165 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

NY Spills:

Site ID: 313760 Not reported Facility Addr2: Facility ID: 9306177 Spill Number: 9306177 Facility Type: ER SWIS: 0126 WTCHRIST Investigator:

Referred To: Not reported 8/19/1993 Spill Date: Reported to Dept: 8/19/1993 CID: Not reported Spill Cause: Other Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/5/1997

Remediation Phase: Date Entered In Computer: 8/24/1993 Spill Record Last Update: 4/9/2010 Spiller Name: Not reported

Spiller Company: LAZARE LINCOLN MERCURY

Spiller Address: Not reported

Spiller City, St, Zip: ZZ

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN MERCURY (Continued)

1000155239

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4 276395 DER Facility ID:

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" SEE 9408681. PBS 4-600193 01/07/97 - letter sent 10/08/96 for closure report. 12/05/97 - AFTER REVIEW OF THE FILE THE

MINOR CONTAMINATION THAT REMAINED DOES NOT POSE ANY ENVIRONMENTAL

CONCERN.

CONT. SOIL @ TANK PULL, SAMPLED, CLEAN-UP PLAN & CLOSURE RPT BEING Remarks:

PREPARED.

Material:

313760 Site ID: Operable Unit ID: 984328 Operable Unit: 01 396067 Material ID: Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False

Tank Test:

313760 Site ID: Spill Tank Test: 1541892 Tank Number: 0 Tank Size: 0 Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills 10/1/2004 Last Modified: Test Method: Unknown

NY Hist Spills:

Region of Spill: 4 9306177 Spill Number: Investigator: **CHRISTENSEN** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported 08/19/1993 12:00 Spill Date/Time: Reported to Dept Date/Time: 08/19/93 12:43

SWIS: 01

Spiller Name: LAZARE LINCOLN MERCURY

Spiller Contact: Not reported Spiller Phone: (518) 458-7550

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN MERCURY (Continued)

1000155239

EDR ID Number

Spiller Address:
Spiller City, St, Zip:
Spill Cause:
Reported to Dept:
Water Affected:
Not reported
On Land
Not reported

Spill Source: 01
Spill Notifier: Other
PBS Number: 4-600193
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /
UST Involvement: True

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/05/97

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 08/24/93
Date Spill Entered In Computer Data File: Not reported

Update Date: 01/31/00 Is Updated: False

Tank:

PBS Number: Not reported

Tank Number: 0
Tank Size: 0

Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: **GASOLINE** GASOLINE Class Type: Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: SEE 9408681. 01/07/97 - letter sent 10/08/96 for closure report. 12/05/97 -

AFTER REVIEW OF THE FILE THE MINOR CONTAMINATION THAT REMAINED DOES NOT POSE

ANY ENVIRONMENTAL CONCERN.

Remark: CONT. SOIL @ TANK PULL, SAMPLED, CLEAN-UP PLAN CLOSURE RPT BEING PREPARED.

Direction Distance

Elevation Site Database(s) **EPA ID Number**

57 LEATSO'S FARM WOLF RD **NY Spills** S105058906 NE **216 WOLF RD NY Hist Spills** N/A

COLONIE, NY < 1/8

0.070 mi. 367 ft.

NY Spills: Relative:

Higher Actual:

298 ft.

275652 Site ID: Facility Addr2: Not reported Facility ID: 0103945 Spill Number: 0103945 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST

Referred To: Not reported Spill Date: 7/13/2001 Reported to Dept: 7/13/2001

CID: 21

Spill Cause: Housekeeping Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: True Not reported Last Inspection:

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/20/2001

Remediation Phase:

Date Entered In Computer: 7/13/2001 Spill Record Last Update: 11/20/2001 Spiller Name: Not reported Spiller Company: LEATSO'S FARM Spiller Address: 216 WOLF RD COLONIE, NY Spiller City, St, Zip:

Spiller Company: 001

Contact Name: JEFF MT. PLEASANT Contact Phone: (518) 377-9841

DEC Region: 4 DER Facility ID: 224122

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 07/31/2001 - No report at this time. 08/08/2001 - Spoke to Jeff Mt. Pleasent about site. He said that they dug down by head about 3 1/2 ft. and contamination was found at the water table. When his report is finished he will send me a copy. He did fax a letter written to Michael C Hoffman, President of Turf Hotels who are interested in buying the property. wtc 11/20/2001 - Received Phase II investigation Report from Tyree. Site meets current NYS Groundwater

and Soil Standards. Colsed wtc

area in which there were a few above ground tanks and drums oil Remarks:

assorted oils near greenhouses found to have contaminated soil and

groundwater at 3 ft down.

Material:

275652 Site ID: Operable Unit ID: 840556 Operable Unit: 01 Material ID: 532455 **EDR ID Number**

Direction Distance Elevation

tion Site Database(s) EPA ID Number

LEATSO'S FARM WOLF RD (Continued)

Material Code: 0066A

Material Name: UNKNOWN PETROLEUM

Case No.:

Mot reported

Material FA:

Petroleum

Quantity:

Units:

Gallons

Recovered:

No

Resource Affected:

Not reported

Resource Affected: Not rep
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 0103945 Investigator: CHRISTENSEN Not reported Caller Name: Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 07/13/2001 10:00 Spill Date/Time: Reported to Dept Date/Time: 07/13/01 10:55

SWIS: 01

Spiller Name: LEATSO'S FARM
Spiller Contact: Not reported
Spiller Phone: Not reported

Spiller Contact: JEFF MT. PLEASANT Spiller Phone: (518) 377-9841 Spiller Address: 216 WOLF RD Spiller City, St, Zip: COLONIE, NY Spill Cause: Housekeeping Reported to Dept: Groundwater Water Affected: Not reported Spill Source: 01 Spill Notifier: Other

PBS Number: Not reported Cleanup Ceased: // Cleanup Meets Std: True Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: / /
Enforcement Date: / /
Invstgn Complete: / /

S105058906

EDR ID Number

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

LEATSO'S FARM WOLF RD (Continued)

S105058906

UST Involvement: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/20/01

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 07/13/01 Not reported Date Spill Entered In Computer Data File:

Update Date: 11/20/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Quantity Recovered:

Unkonwn Quantity Recovered: False

Material: UNKNOWN PETROLEUM Class Type: UNKNOWN PETROLEUM

Times Material Entry In File: 16414 CAS Number: Not reported 19940929 Last Date:

08/08/2001 - Spoke to Jeff Mt. DEC Remarks: 07/31/2001 - No report at this time.

> Pleasent about site. He said that they dug down by head about 3 1/2 ft. and contamination was found at the water table. When his report is finished he will send me a copy. He did fax a letter written to Michael C Hoffman, President of Turf Hotels who are interested in buying the property. wtc 11/20/2001 -Received Phase II investigation Report from Tyree. Site meets current NYS

Groundwater and Soil Standards. Colsedwtc

Remark: area in which there were a few above ground tanks and drums oil assorted oils

near greenhouses found to have contaminated soil and groundwater at 3 ft down.

K58 **CAPITALAND TIRE MART INC**

NW **284 WOLF RD** LATHAM, NY 12110 < 1/8

0.070 mi.

367 ft. Site 2 of 7 in cluster K

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

CAPITALAND TIRE MART INC Facility name: Facility address: 284 WOLF RD

Actual: 299 ft.

LATHAM, NY 121104804

EPA ID: NYD987039393

PO BOX 947 Mailing address:

LATHAM, NY 12110 Contact: Not reported

Contact address: PO BOX 947

LATHAM, NY 12110

Contact country: US 1000872721

NYD987039393

RCRA-NonGen

FINDS

Direction Distance

Elevation Site Database(s) **EPA ID Number**

CAPITALAND TIRE MART INC (Continued)

1000872721

EDR ID Number

Contact telephone: Not reported Not reported Contact email:

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

RON DURANTE Owner/operator name: Owner/operator address: 79 N FRANKLIN TNPK RAMSEY, NJ 07446

Owner/operator country: US

(201) 327-1033 Owner/operator telephone: Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: **RON DURANTE** Owner/operator address: 79 N FRANKLIN TNPK

RAMSEY, NJ 07446

Owner/operator country: US

Owner/operator telephone: (201) 327-1033 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

CAPITALAND TIRE MART INC Facility name: Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: CAPITALAND TIRE MART INC Classification: Not a generator, verified

Date form received by agency: 08/14/1993

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CAPITALAND TIRE MART INC (Continued)

1000872721

Facility name: CAPITALAND TIRE MART INC Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

110004507926 Registry ID:

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

M59 **WESTERN UNION** RCRA-NonGen 1000694392 SSE 17 COMPUTER DR NYD987007051 FINDS

< 1/8 **ALBANY, NY 12205**

0.073 mi.

385 ft. Site 1 of 2 in cluster M

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher Facility name: WESTERN UNION

Actual: Facility address: 17 COMPUTER DR 299 ft. ALBANY, NY 12205

> EPA ID: NYD987007051 Mailing address: LAKE ST

UPPER SADDLE RIVER, NY 07458

Contact: Not reported

Contact address: LAKE ST

UPPER SADDLE RIVER, NY 07458

US Contact country:

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: **NEW VALLEY CORP**

Owner/operator address: 1 LAKE ST

UPPER SADDLE RIVER, NJ 07458

Owner/operator country: US

Owner/operator telephone: (201) 818-5894 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: **NEW VALLEY CORP**

Owner/operator address: 1 LAKE ST

UPPER SADDLE RIVER, NJ 07458

Owner/operator country: US

Owner/operator telephone: (201) 818-5894

Distance

Elevation Site Database(s) EPA ID Number

WESTERN UNION (Continued)

1000694392

EDR ID Number

Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006
Facility name: WESTERN UNION
Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: WESTERN UNION
Classification: Not a generator, verified

Date form received by agency: 06/25/1992
Facility name: WESTERN UNION
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004491899

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

 K60
 FEDERAL EXPRESS WOLF RD
 NY Spills
 \$103827550

 NW
 281 OLD WOLF RD
 NY Hist Spills
 N/A

/ 281 OLD WOLF RD NY Hist Spills N/A /8 LATHAM, NY

< 1/8 LATHA 0.075 mi.

394 ft. Site 3 of 7 in cluster K

NY Spills:

Relative: Higher

Actual:

299 ft.

Site ID: 138048
Facility Addr2: Not reported
Facility ID: 9813073
Spill Number: 9813073
Facility Type: ER

SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 1/22/1999 Reported to Dept: 1/25/1999 CID: 257 Spill Cause: Unknown Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Last inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/2/1999
Remediation Phase: 0
Date Entered In Computer: 1/25/1999
Spill Record Last Update: 5/16/2006
Spiller Name: Not reported

Spiller Company: FEDERAL EXPRESS

Spiller Address: 281 WOLF RD [OLD WOLF RD]

Spiller City, St, Zip: ALBANY, NJ

Spiller Company: 001

Contact Name: ERIN WERBIN
Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 118049

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9212441, 9309661, 9813073, 0107682, 0501750, 0513766
PBS 4-462497 2/2/99 - RECEIVED CLOSURE REPORT FROM TYREE. SITE MEETS
NYS SOIL GUIDLINES AND GROUNDWATER STANDARDS EXCEPT FOR A MINOR
EXCEEDENCE FOR BENZENE = 1.4, TOLUENE = 12.8, & TOTAL XYLENES = 16.3.

THIS GROUNDWATER SAMPLE WAS TAKEN FROM THE BOTTOM OF EXCAVATION AND

IS FROM A PERCHED GROUNDWATER TABLE. NO FURTHER REMEDIATION IS REQUIRED.

Remarks: SOIL SAMPLES WERE TAKEN AND RESULT CAME BACK SHOWING SOME

CONTAMINATION

Material:

 Site ID:
 138048

 Operable Unit ID:
 1070442

 Operable Unit:
 01

 Material ID:
 313348

 Material Code:
 0009

 Material Name:
 Gasoline

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXPRESS WOLF RD (Continued)

S103827550

Case No.: Not reported Material FA: Petroleum Quantity: O Units: Gallons Recovered: No Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 9813073 Investigator: **CHRISTENSEN** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 01/22/1999 12:00 Reported to Dept Date/Time: 01/25/99 10:19

SWIS: 01

Spiller Name: FEDERAL EXPRESS

Spiller Contact: Not reported Spiller Phone: ()

Spiller Contact: **ERIN WERBIN**

281 WOLF RD [OLD WOLF RD] Spiller Address:

Spiller City, St, Zip: ALBANY, NJ Spill Cause: Unknown Reported to Dept: On Land Water Affected: Not reported Spill Source: 01

Spill Notifier: Other PBS Number: 4-462497 Cleanup Ceased: / / Cleanup Meets Std: False Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** / / Invstgn Complete: // **UST Involvement:** True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXPRESS WOLF RD (Continued)

S103827550

Spill Closed Dt: 02/02/99 Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 01/25/99 Date Spill Entered In Computer Data File: Not reported

09/18/00 Update Date: Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: False GASOLINE Material: Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 9212441 2/2/99 - RECEIVED CLOSURE REPORT FROM TYREE. SITE MEETS NYS SOIL

GUIDLINES AND GROUNDWATER STANDARDS EXCEPT FOR A MINOR EXCEEDENCE FOR BENZENE =

1.4, TOLUENE = 12.8, TOTAL XYLENES = 16.3. THIS GROUNDWATER SAMPLE WAS TAKEN FROM THE BOTTOM OF EXCAVATION AND IS FROM A PERCHED GROUNDWATER TABLE. NO

FURTHER REMEDIATION IS REQUIRED.

SOIL SAMPLES WERE TAKEN AND RESULT CAME BACK SHOWING SOME CONTAMINATION Remark:

K61 **AMERICAN FREIGHTWAY TERM**

NW **4 TERMINAL DR LATHAM COLONIE?**, NY < 1/8

0.075 mi.

Site 4 of 7 in cluster K 397 ft.

NY Spills:

Relative: Higher

Actual:

299 ft.

Site ID: 312396 Facility Addr2: Not reported Facility ID: 0012464 Spill Number: 0012464 Facility Type: ER SWIS: 0126

Investigator: WTCHRIST Referred To: Not reported Spill Date: 2/20/2001 Reported to Dept: 2/21/2001 CID: 382

Equipment Failure Spill Cause: Water Affected: Not reported Spill Source: Tank Truck Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: True

S104952954

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

AMERICAN FREIGHTWAY TERM (Continued)

S104952954

EDR ID Number

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 4/13/2001

Remediation Phase: 0

Date Entered In Computer: 2/21/2001 Spill Record Last Update: 4/13/2001 Spiller Name: TIM GARLAND

Spiller Company: US FLEET SERV @AM FREIGHT

Spiller Address: 132 WELSH RD Spiller City,St,Zip: HORSHAM, PA 19044-

Spiller Company: 001
Contact Name: JIM WOLF
Contact Phone: (518) 869-2220

DEC Region: 4

DER Facility ID: 278759

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" NO COPY IN DATA ENTRY TRAY. See 0012463 as active spill

number.

Remarks: NOZZLE BROKE LOOSE FROM HOSE WHILE FUELING VEHICLE. CLEAN UP COMPLETED

BY OPTECH.

Material:

Site ID: 312396 Operable Unit ID: 833991 Operable Unit: 01 Material ID: 542729 Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: 10 Units: Gallons Recovered: 10 Not reported

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 0012464
Investigator: CHRISTENSEN
Caller Name: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

AMERICAN FREIGHTWAY TERM (Continued)

S104952954

EDR ID Number

Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/20/2001 20:15
Reported to Dept Date/Time: 02/21/01 09:32

SWIS: 01

Spiller Name: US FLEET SERV @AM FREIGHT

Spiller Contact: TIM GARLAND
Spiller Phone: (877) 305-4427
Spiller Contact: JIM WOLF
Spiller Phone: (518) 869-2220
Spiller Address: 132 WELSH RD
Spiller City,St,Zip: HORSHAM, PA 19044Spill Cause: Equipment Failure

Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 08
Spill Notifier: Other

Cleanup Ceased: //
Cleanup Meets Std: True
Last Inspection: //

PBS Number:

Recommended Penalty: Penalty Not Recommended

Not reported

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 04/13/01 Corrective Action Plan Submitted:

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/21/01
Date Spill Entered In Computer Data File: Not reported

Update Date: 04/13/01 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 10 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False DIESEL Material: Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

AMERICAN FREIGHTWAY TERM (Continued)

S104952954

Last Date: 19940728

DEC Remarks: NO COPY IN DATA ENTRY TRAY. See 0012463 as active spill number.

Remark: NOZZLE BROKE LOOSE FROM HOSE WHILE FUELING VEHICLE. CLEAN UP COMPLETED BY

OPTECH.

K62 AMERICAN FREIGHTWAYS NY Spills S104952953
NW 4 TERMINAL DR NY Hist Spills N/A

< 1/8 COLONIE (LATHAM?), NY

0.075 mi.

397 ft. Site 5 of 7 in cluster K

Relative: NY Spills:

 Higher
 Site ID:
 312395

 Facility Addr2:
 Not reported

 Actual:
 Facility ID:
 0012463

 299 ft.
 Spill Number:
 0012463

 Facility Type:
 ER

 SWIS:
 0126

 SWIS:
 0126

 Investigator:
 WTCHRIST

 Referred To:
 Not reported

 Spill Date:
 2/20/2001

 Reported to Dept:
 2/21/2001

 CID:
 211

Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Tank Truck
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 4/13/2001 Remediation Phase: 0

Date Entered In Computer: 2/21/2001 Spill Record Last Update: 4/13/2001 Spiller Name: TIM GARLAND

Spiller Company: US FLEET SERV @AM FREIGHT

Spiller Address: 215 OAKWOOD AV Spiller City,St,Zip: TROY, NY 12180-

Spiller Company: 001

Contact Name: SCOTT FETZKO Contact Phone: (518) 869-2220

DEC Region: 4
DER Facility ID: 251898

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" ALSO RPTd AS 0012464. 4/13/2001 - Received from Op-Tech

the disposal receipts . 2 drums were generated from this release.

Material was a surface diesel spill. wtc

Remarks: caller states nozzle broke during fueling operation causing spill -

fire dept was on scene - spill cleaned up by op tech

Material:

 Site ID:
 312395

 Operable Unit ID:
 834363

 Operable Unit:
 01

Direction Distance

Elevation Site Database(s) EPA ID Number

AMERICAN FREIGHTWAYS (Continued)

S104952953

EDR ID Number

Material ID: 542728

Material Code: 0008

Material Name: Diesel

Case No.: Not reported

Material FA: Petroleum

Quantity: 4

Quantity: 4
Units: Gallons
Recovered: 4

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 0012463 **CHRISTENSEN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 02/20/2001 20:30 Reported to Dept Date/Time: 02/21/01 09:26

SWIS: 01

Spiller Name: US FLEET SERV @AM FREIGHT

Spiller Contact: TIM GARLAND
Spiller Phone: (518) 270-1997
Spiller Contact: SCOTT FETZKO
Spiller Phone: (518) 869-2220
Spiller Address: 215 OAKWOOD AV
Spiller City,St,Zip: TROY, NY 12180Spill Cause: Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 08

Spill Notifier: Affected Persons
PBS Number: Not reported

Cleanup Ceased: //
Cleanup Meets Std: True
Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AMERICAN FREIGHTWAYS (Continued)

S104952953

Invstgn Complete: // UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 04/13/01

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 02/21/01 Date Spill Entered In Computer Data File: Not reported

Update Date: 04/13/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Last Date:

Material Class Type: Petroleum Quantity Spilled: 4 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported 19940728

DEC Remarks: ALSO RPTd AS 0012464. 4/13/2001 - Received from Op-Tech the disposal

receipts . 2 drums were generated from this release. Material was a surface

diesel spill, wtc

caller states no le broke during fueling operation causing spill - fire dept Remark:

was on scene - spill cleaned up by op tech

N63 **COLONIE LIBRARY ALBANY SH 629 ALBANY SHAKER RD** SE

S102659959 **LTANKS HIST LTANKS** N/A

COLONIE, NY < 1/8 0.077 mi.

406 ft. Site 1 of 2 in cluster N

LTANKS:

Relative:

Site ID: 182892 Higher Spill No:

8907090 Actual: Spill Date: 10/18/1989 300 ft. Spill Cause: Tank Test Failure

Spill Source: Institutional, Educational, Gov., Other

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 5/4/1990 Facility Addr2: Not reported Cleanup Ceased: 12/1/1989 Cleanup Meets Standard: True SWIS: 0126 Investigator: **TESPERBE** Referred To: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE LIBRARY ALBANY SH (Continued)

S102659959

10/18/1989 Reported to Dept: CID: 21

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: False Remediation Phase:

Date Entered In Computer: 11/28/1989 Spill Record Last Update: 2/24/1999 Spiller Name: Not reported Spiller Company: **COLONIE LIBRARY** Spiller Address: 629 ALBANY SHAKER RD

Spiller City, St, Zip: COLONIE, ZZ

Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region:

DER Facility ID: 153227

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"SPERBECK"

Remarks: 2 4K UGT MANIFOLDED FAILED PETROTITE @ -.25 GPH, EIR, TANK REMOVED.

CLEAN.

False

Material:

Site ID: 182892 Operable Unit ID: 934836 Operable Unit: 01 443889 Material ID: Material Code: 0001 Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: Units: Pounds Recovered: No Resource Affected: Not reported

Tank Test:

Oxygenate:

Site ID: 182892 Spill Tank Test: 1536263 Tank Number: Not reported

Tank Size: 0 Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

HIST LTANKS:

Region of Spill:

Spill Number: 8907090

Direction Distance Elevation

evation Site Database(s) EPA ID Number

COLONIE LIBRARY ALBANY SH (Continued)

S102659959

EDR ID Number

 Spill Date:
 10/18/1989

 Spill Time:
 16:00

Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported

Spill Source: Other Non Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 05/04/90 Cleanup Ceased: 12/01/89 Cleanup Meets Standard: True **SPERBECK** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Not reported Notifier Extension: Reported to Department Date: 10/18/89 Reported to Department Time: 16:41 SWIS:

SWIS: 01
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Spiller Name: COLONIE LIBRARY
Spiller Address: 629 ALBANY SHAKER RD

Spiller City,St,Zip: COLONIE
Spiller Cleanup Date: //

Facility Contact:

Facility Phone:

Facility Phone:

Facility Extention:

Spill Notifier:

PBS Number:

Not reported

Tank Tester

Not reported

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: False

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 11/28/89
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/24/99
Is Updated: False

Tank:

PBS Number: 7-129003 Tank Number: Not reported

Tank Size: 0

Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE LIBRARY ALBANY SH (Continued)

S102659959

S103561266

Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Pounds Quantity Recovered: 0 Unkonwn Quantity Recovered: True

Material: #2 FUEL OIL #2 FUEL OIL Class Type: Times Material Entry In File: 24464 CAS Number: Not reported Last Date: 19941207

DEC Remarks: Not reported

2 4K UGT MANIFOLDED FAILED PETROTITE @ -.25 GPH, EIR. TANK REMOVED, CLEAN. Spill Cause:

SUNOCO ALBANY SHAKER RD **NY Spills**

N64 SE 650 ALBANY SHAKER RD

NY Hist Spills N/A

ALBANY, NY < 1/8 0.082 mi.

Site 2 of 2 in cluster N 435 ft.

Relative:

NY Spills:

Site ID: 268673 Higher Facility Addr2: Not reported

Actual: Facility ID: 9406278 301 ft. Spill Number: 9406278 Facility Type: ER SWIS: 0126

> Investigator: WTCHRIST Referred To: Not reported Spill Date: 8/8/1994 Reported to Dept: 8/8/1994 CID: 21 Spill Cause: Other Water Affected: Not reported Spill Source: Gasoline Station Spill Notifier: Responsible Party

Cleanup Ceased: 10/11/1994 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/13/1994

Remediation Phase: Date Entered In Computer: 9/9/1994 Spill Record Last Update: 3/17/2000 Spiller Name: Not reported Spiller Company: SUNOCO

650 ALBANY SHAKER RD Spiller Address:

Spiller City, St, Zip: ALBANY, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported DEC Region: 4

DER Facility ID: 218867

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN" 9204711, 9406278, 9406344, 9414525, 9914217; 8604528.

LINE TEST FAILURE, LINE TAKEN O-O-S, TO RETEST 8/10. SEE 9406344, Remarks:

Direction
Distance
Elevation

vation Site Database(s) EPA ID Number

SUNOCO ALBANY SHAKER RD (Continued)

9414525.

S103561266

EDR ID Number

Material:

268673 Site ID: Operable Unit ID: 1003642 Operable Unit: 01 Material ID: 379327 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons

Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 9406278 CHRISTENSEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 08/08/1994 17:00 Reported to Dept Date/Time: 08/08/94 17:28

SWIS: 01
Spiller Name: SUNOCO
Spiller Contact: Not reported
Spiller Phone: (215) 976-6801

Spiller Address: 650 ALBANY SHAKER RD

Spiller City,St,Zip: ALBANY
Spill Cause: Other
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 05

Spill Notifier: Responsible Party

PBS Number: 4-066524
Cleanup Ceased: 10/11/94
Cleanup Meets Std: True
Last Inspection: / /

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

SUNOCO ALBANY SHAKER RD (Continued)

S103561266

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/13/94

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 09/09/94
Date Spill Entered In Computer Data File: Not reported

Update Date: 03/17/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: True Material: **GASOLINE** GASOLINE Class Type: Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 9204711, 9406278, 9406344, 9414525, 9914217; 8604528.

Remark: LINE TEST FAILURE, LINE TAKEN O-O-S, TO RETEST 8/10. SEE 9406344, 9414525.

K65 VEOLIA ES TECHNICAL SOLUTIONS LLC

NW 10 TERMINAL DR < 1/8 LATHAM, NY 12110

0.084 mi.

442 ft. Site 6 of 7 in cluster K

Relative: RCRA-CESQG:

Higher Date form received by agency: 01/01/2007

Facility name: VEOLIA ES TECHNICAL SOLUTIONS LLC

Actual: 299 ft. Facility address: 10 TERMINAL DR LATHAM, NY 12110

EPA ID: NYR000136788

Mailing address: TERMINAL DR
LATHAM, NY 12110

Contact: SEAN E ABELL

Contact address: TERMINAL DR LATHAM, NY 12110

Contact country: US

Contact telephone: (518) 218-0246

Contact email: SEAN.ABELL@VEOLIASES.COM

EPA Region: 02

1009218216 NYR000136788

RCRA-CESQG

MANIFEST

MANIFEST

Direction Distance Elevation

Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Land type: Private

Conditionally Exempt Small Quantity Generator Classification:

Handler: generates 100 kg or less of hazardous waste per calendar Description:

month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from

the cleanup of a spill, into or on any land or water, of acutely

hazardous waste

Owner/Operator Summary:

Owner/operator name: NO NAME FOUND Owner/operator address:

Not reported Not reported

US

Owner/operator country:

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Operator 01/16/2001

Owner/Op start date: Owner/Op end date: Not reported

Owner/operator name: VEOLIA ES TECHNICAL SOLUTIONS LLC

Not reported Owner/operator address: Not reported

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: 01/16/2001 Owner/Op end date: Not reported

DURANTE Owner/operator name:

Owner/operator address: N FRANKLIN TNPK

RAMSEY, NJ 07446

Owner/operator country:

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Owner Owner/Op start date: 01/16/2001 Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No

Direction Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

Furnace exemption: No Used oil fuel burner: No Used oil processor: Nο User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: Nο

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 07/18/2006

VEOLIA ES TECHNICAL SOLUTIONS LLC Facility name: Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/17/2006

VEOLIA ES TECHNICAL SOLUTIONS LLC Facility name: Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 01/18/2006

VEOLIA ES TECHNICAL SOLUTIONS LLC Facility name: Site name: ONYX ENVIRONMENTAL SERVICES Classification: Conditionally Exempt Small Quantity Generator

Hazardous Waste Summary:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET. WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D002

A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS Waste name:

> CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

D007 Waste code: Waste name: **CHROMIUM**

Waste code: D009 Waste name: **MERCURY**

Waste code: F001

Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED

FLUOROCARBONS: ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED

Direction Distance

Elevation Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE

SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F002

Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE,

METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE,

CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND

1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND

SPENT SOLVENT MIXTURES.

Waste code: F003

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL

ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL

ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT

MIXTURES.

Waste code: F005

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL

KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE,

2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF

THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: U002 Waste name: ACETONE (I)

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 11/28/2007

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Not reported Date achieved compliance: Not reported Evaluation lead agency: State

Evaluation date: 07/19/2006

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

NY MANIFEST:

EPA ID: NYR000136788

Country: USA

Mailing Name: VEOLIA ES TECHNICAL SOLUTIONS LLC

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

Mailing Contact: SEAN ABELL

Mailing Address: 10 TERMINAL DRIVE

Mailing Address 2: Not reported
Mailing City: LATHAM
Mailing State: NY
Mailing Zip: 12110
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 518-218-0246

NJA5329535 Document ID: Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: Not reported Generator Ship Date: 06/19/2006 Trans1 Recy Date: 06/19/2006 Trans2 Recv Date: Not reported TSD Site Recv Date: 06/20/2006 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: S2265 Trans2 EPA ID: Not reported NJD980536593 TSDF ID: Waste Code: F003 - UNKNOWN

Quantity: 00080

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 06

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 NJD054126164 Trans2 State ID: Generator Ship Date: 2008-01-17 2008-01-17 Trans1 Recv Date: 2008-01-25 Trans2 Recv Date: TSD Site Recv Date: 2008-01-25 Part A Recv Date: Not reported Part B Recv Date: Not reported

Direction Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported 200.0 Quantity: P - Pounds Units: 1.0 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 80 Year:

000140697VES Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported NJD080631369 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2008-05-16 Trans1 Recv Date: 2008-05-16 Trans2 Recv Date: Not reported TSD Site Recv Date: 2008-05-16 Not reported Part A Recv Date: Not reported Part B Recv Date: NYR000136788 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD980536593 TSDF ID: Waste Code: Not reported Quantity: 0.08 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 80

Manifest Tracking Num: 000169043VES

Import Ind: Ν **Export Ind:** Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H141

Document ID: Not reported Not reported Manifest Status: NJD054126164 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2008-06-19 2008-06-19 Trans1 Recv Date: Not reported Trans2 Recv Date: 2008-06-20 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 300.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 80

Manifest Tracking Num: 000169201VES

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD080631369 Trans2 State ID: NJD054126164 Generator Ship Date: 2009-01-02 Trans1 Recv Date: 2009-01-02 Trans2 Recv Date: 2009-01-07 TSD Site Recv Date: 2009-01-09 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported

Quantity: 5.0

Direction Distance Elevation

ce EDR ID Number on Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

Units: P - Pounds

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 09

Manifest Tracking Num: 000168847VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: Not reported 2009-06-02 Generator Ship Date: Trans1 Recv Date: 2009-06-02 Trans2 Recv Date: Not reported TSD Site Recv Date: 2009-06-03 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000136788 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 86.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 09

Manifest Tracking Num: 000379739VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported

MAP FINDINGS Map ID Direction

Distance Elevation

Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Manifest Status: Not reported NJD054126164 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2009-02-20 Trans1 Recv Date: 2009-02-20 Trans2 Recv Date: Not reported 2009-02-24 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 300.0 P - Pounds Units:

1.0 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 09

000168656VES Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported H141

Mgmt Method Type Code:

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: Not reported 2009-05-07 Generator Ship Date: Trans1 Recv Date: 2009-05-07 Not reported Trans2 Recv Date: TSD Site Recv Date: 2009-05-08 Part A Recv Date: Not reported Not reported Part B Recv Date: NYR000136788 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 40.0 Units: P - Pounds

Number of Containers:

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 09

Direction Distance Elevation

EDR ID Number

n Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

Manifest Tracking Num: 000379616VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD080631369 NJD054126164 Trans2 State ID: Generator Ship Date: 2009-01-02 Trans1 Recv Date: 2009-01-02 Trans2 Recv Date: 2009-01-07 TSD Site Recv Date: 2009-01-09 Not reported Part A Recv Date: Part B Recv Date: Not reported NYR000136788 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 25.0 P - Pounds Units:

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 09

Manifest Tracking Num: 000168847VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID:

Manifest Status:
Not reported

Manifest Status:
Not reported

NJD054126164

Trans2 State ID:
Not reported

Generator Ship Date:
2009-08-27

Trans1 Recv Date:
2009-08-27

Trans2 Recv Date:
Not reported

1009218216

Direction Distance Elevation

ce EDR ID Number ion Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

TSD Site Recv Date: 2009-09-01 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 200.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 09

Manifest Tracking Num: 000382709VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported

Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD080631369 Trans2 State ID: Not reported Generator Ship Date: 2008-05-16 2008-05-16 Trans1 Recv Date: Not reported Trans2 Recv Date: TSD Site Recv Date: 2008-05-16 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Not reported Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 80.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 000169043VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N

Direction Distance Elevation

on Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported NJD054126164 Trans1 State ID: Not reported Trans2 State ID: 2008-06-19 Generator Ship Date: Trans1 Recv Date: 2008-06-19 Trans2 Recv Date: Not reported TSD Site Recv Date: 2008-06-20 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported NJD980536593 TSDF ID: Waste Code: Not reported Quantity: 300.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 000169201VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: NJD054126164 Trans2 State ID: NJD054126164 Generator Ship Date: 2008-01-17 Trans1 Recv Date: 2008-01-17 2008-01-25 Trans2 Recv Date: TSD Site Recv Date: 2008-01-25 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported

Direction Distance Elevation

nce EDR ID Number ation Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

TSDF ID: NJD980536593
Waste Code: Not reported
Quantity: 200.0
Units: P - Pounds
Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 000140697VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: NJD054126164 Trans2 State ID: Not reported Generator Ship Date: 2010-02-03 Trans1 Recv Date: 2010-02-03 Trans2 Recv Date: Not reported TSD Site Recv Date: 2010-02-05 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 225.0 Units: P - Pounds

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 10

Manifest Tracking Num: 000354198VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Direction Distance Elevation

on Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Document ID: Not reported Not reported Manifest Status: Trans1 State ID: NJD054126164 Trans2 State ID: NJD054126164 Generator Ship Date: 2008-01-17 Trans1 Recv Date: 2008-01-17 Trans2 Recv Date: 2008-01-25 TSD Site Recv Date: 2008-01-25 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000136788 Generator EPA ID: Trans1 EPA ID: Not reported Not reported Trans2 EPA ID: TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 200.0 P - Pounds Units:

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 000140697VES

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported NJD054126164 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2008-06-19 Trans1 Recv Date: 2008-06-19 Trans2 Recv Date: Not reported 2008-06-20 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 300.0 P - Pounds Units:

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0

MAP FINDINGS Map ID Direction

Distance Elevation

Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Year: 80

000169201VES Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H141

Document ID: Not reported Manifest Status: Not reported NJD080631369 Trans1 State ID: Trans2 State ID: Not reported 2008-05-16 Generator Ship Date: Trans1 Recv Date: 2008-05-16 Trans2 Recv Date: Not reported TSD Site Recy Date: 2008-05-16 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYR000136788 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: NJD980536593 Waste Code: Not reported Quantity: 0.08 Units: P - Pounds Number of Containers:

1.0 Container Type:

DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 80

000169043VES Manifest Tracking Num:

Import Ind: Ν Export Ind: Ν Discr Quantity Ind: Ν Discr Type Ind: Ν Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H141

Document ID:

000040802VES Manifest Status: Trans1 State ID: NYR000136788 Trans2 State ID: Not reported Generator Ship Date: NJD980536593 Trans1 Recv Date: Not reported

Direction Distance Elevation

on Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Trans2 Recv Date: NJD080631369
TSD Site Recv Date: Not reported
Part A Recv Date: NJD080631369
Part B Recv Date: 2006-10-26

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: DM
Container Type: 200
Handling Method: P
Specific Gravity: 1
Waste Code: L

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Specific Gravity: Not reported Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: 06

NJA5329535 Manifest Status: NYR000136788 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: NJD980536593 Trans1 Recv Date: Not reported Trans2 Recv Date: NJD054126164 TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: DM
Container Type: 80
Handling Method: K

Direction Distance Elevation

Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

Specific Gravity:

1009218216

EDR ID Number

В Waste Code: Quantity: Not reported Units: Not reported Number of Containers: Not reported Not reported Container Type: Not reported Handling Method: Specific Gravity: Not reported Not reported Year: Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported

Document ID: 07

Alt Fac Sign Date:

Mgmt Method Type Code:

000040313VES Manifest Status: Trans1 State ID: NYR000136788 Trans2 State ID: Not reported Generator Ship Date: NJD980536593 Trans1 Recv Date: Not reported NJD054126164 Trans2 Recv Date: TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

Not reported

Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units: 1
Number of Containers: DM
Container Type: 200
Handling Method: P
Specific Gravity: 1
Waste Code: B

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported Not reported Specific Gravity: Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

> Click this hyperlink while viewing on your computer to access Kz(

NJ MANIFEST:

000379616VES Manifest Code: EPA ID: NYR000136788 Date Shipped: 05/07/09 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 05/07/09 Not reported Date Trans2 Transported Waste: Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 05/08/09 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: Not reported Reference Manifest Number: Not reported Was Load Rejected (Y/N):

Reason Load Was Rejected: Not reported

Waste Code: D001

Manifest Year: 2009 New Jersey Manifest Data

Quantity: 40 Unit: Hand Code: H141

Manifest Code: 000140187VES EPA ID: NYR000136788 Date Shipped: 9/28/200 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

Not reported

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

Transporter 4 EPA ID:

1009218216

EDR ID Number

Not reported Transporter 5 EPA ID: Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 9/28/2 Date Trans2 Transported Waste: Not reported Not reported Date Trans3 Transported Waste: Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Not reported Date Trans10 Transported Waste: Date TSDF Received Waste: 9/28/2 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: Not reported Reference Manifest Number: Not reported Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: F002

Manifest Year: 2007 New Jersey Manifest Data

180 Quantity: Unit: Ρ Hand Code: H14

Manifest Code: 000379739VES EPA ID: NYR000136788 Date Shipped: 06/02/09 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Not reported Transporter 6 EPA ID: Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 10 EPA ID: 06/02/09 Date Trans1 Transported Waste: Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported 06/03/09 Date TSDF Received Waste: Not reported Tranporter 1 Decal: Tranporter 2 Decal: Not reported

Direction Distance Elevation

n Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Data Entry Number: Not reported Reference Manifest Number: Not reported

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: F002

Manifest Year: 2009 New Jersey Manifest Data

Quantity: 85 Unit: P Hand Code: H141

Manifest Code: 000105794VES EPA ID: NYR000136788 Date Shipped: 7/6/2007 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 7/6/20 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported

Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 7/6/20 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: Not reported Reference Manifest Number: Not reported

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: F005

Manifest Year: 2007 New Jersey Manifest Data

Quantity: 2 Unit: P Hand Code: H14

Waste Code: D018

Manifest Year: 2007 New Jersey Manifest Data

Quantity: 3 Unit: P Hand Code: H14

Manifest Code: 000105729VES

Direction Distance Elevation

Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

EPA ID: NYR000136788 6/14/200 Date Shipped: TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Not reported Transporter 5 EPA ID: Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 6/14/2 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Not reported Date Trans5 Transported Waste: Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 6/15/2 Tranporter 1 Decal: Not reported Not reported Tranporter 2 Decal: Data Entry Number: Not reported Reference Manifest Number: Not reported Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: F002

Manifest Year: 2007 New Jersey Manifest Data

Quantity: 100 Unit: P Hand Code: H14

Manifest Code: 000382709VES EPA ID: NYR000136788 Date Shipped: 08/27/09 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 08/27/09 Date Trans2 Transported Waste: Not reported Not reported Date Trans3 Transported Waste: Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported

Map ID MAP FINDINGS Direction

Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

Date Trans8 Transported Waste: Not reported Not reported Date Trans9 Transported Waste: Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 09/01/09 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Not reported Data Entry Number: Reference Manifest Number: Not reported

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: F002

2009 New Jersey Manifest Data Manifest Year:

200 Quantity: Unit: Hand Code: H141

Manifest Code: 000169201VES EPA ID: NYR000136788 Date Shipped: 6/19/2008 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Not reported Transporter 4 EPA ID: Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 10 EPA ID: 6/19/2008 Date Trans1 Transported Waste: Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Not reported Date Trans4 Transported Waste: Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Not reported Date Trans10 Transported Waste: Date TSDF Received Waste: 6/20/2008 Tranporter 1 Decal: Not reported Not reported Tranporter 2 Decal: Data Entry Number: Not reported Reference Manifest Number: Not reported Was Load Rejected (Y/N): No Reason Load Was Rejected: Not reported

Waste Code: F002

Manifest Year: 2008 New Jersey Manifest Data

300 Quantity: H141 Hand Code:

Manifest Code: 000169043VES

Direction Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EPA ID: NYR000136788 Date Shipped: 5/16/2008 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD080631369 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Not reported Transporter 5 EPA ID: Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 5/16/2008 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 5/16/2008 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: Not reported Reference Manifest Number: Not reported Was Load Rejected (Y/N): No Reason Load Was Rejected: Not reported

Waste Code: F002

2008 New Jersey Manifest Data Manifest Year:

Quantity: 80 Unit: Hand Code: H141

Manifest Code: 000040466VES EPA ID: NYR000136788 Date Shipped: 4/9/2007 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 4/9/20 Date Trans2 Transported Waste: Not reported Not reported Date Trans3 Transported Waste: Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported

Direction Distance Elevation

n Site Database(s) EPA ID Number

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Date Trans8 Transported Waste: Not reported Not reported Date Trans9 Transported Waste: Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 4/10/2 Tranporter 1 Decal: Not reported Not reported Tranporter 2 Decal: Not reported Data Entry Number: Reference Manifest Number: Not reported

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: D001

Manifest Year: 2007 New Jersey Manifest Data

Quantity: 120 Unit: P Hand Code: H14

Waste Code: D001

Manifest Year: 2007 New Jersey Manifest Data

Quantity: 5 Unit: P Hand Code: H14

 Manifest Code:
 000040313VES

 EPA ID:
 NYR000136788

 Date Shipped:
 2/15/200

Date Shipped: TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 2/15/2 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Not reported Date Trans4 Transported Waste: Date Trans5 Transported Waste: Not reported

Date Trans6 Transported Waste:
Date Trans7 Transported Waste:
Date Trans8 Transported Waste:
Date Trans9 Transported Waste:
Date Trans10 Transported Waste:
Date TSDF Received Waste:

Not reported
Not reported
Not reported
Vot reported
Not reported
Vot reported
Vot

Tranporter 1 Decal:
Tranporter 2 Decal:

Data Entry Number:

Reference Manifest Number:

Not reported
Not reported
Not reported
Not reported

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: F002

Manifest Year: 2007 New Jersey Manifest Data

Quantity: 200

Direction Distance Elevation

Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Unit: Ρ H14 Hand Code:

Manifest Code: 000140697VES EPA ID: NYR000136788 1/17/2008 Date Shipped: TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: NJD054126164 Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 1/17/2008 1/25/2008 Date Trans2 Transported Waste: Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported 1/25/2008 Date TSDF Received Waste: Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: Not reported Reference Manifest Number: Not reported No

Was Load Rejected (Y/N):

Reason Load Was Rejected: Not reported

F003 Waste Code:

2008 New Jersey Manifest Data Manifest Year:

Quantity: 200 Unit: Ρ H141 Hand Code:

000168847VES Manifest Code: EPA ID: NYR000136788 Date Shipped: 01/02/09 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD080631369 Transporter 2 EPA ID: NJD054126164 Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 01/02/09

Direction Distance Elevation

Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

EDR ID Number

Date Trans2 Transported Waste: 1/7/09 Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 01/09/09 Tranporter 1 Decal: Not reported Not reported Tranporter 2 Decal: Data Entry Number: Not reported Reference Manifest Number: Not reported Was Load Rejected (Y/N):

Reason Load Was Rejected: Not reported

Waste Code: D001

Manifest Year: 2009 New Jersey Manifest Data

Quantity: Ρ Unit: Hand Code: H141

Waste Code: D001

Manifest Year: 2009 New Jersey Manifest Data

Quantity: 25 Unit: Р Hand Code: H141

Manifest Code: 000168656VES EPA ID: NYR000136788 Date Shipped: 02/20/09 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 02/20/09 Date Trans2 Transported Waste: Not reported Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Not reported Date Trans10 Transported Waste: Date TSDF Received Waste: 02/24/09 Tranporter 1 Decal: Not reported Not reported Tranporter 2 Decal: Data Entry Number: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VEOLIA ES TECHNICAL SOLUTIONS LLC (Continued)

1009218216

Not reported Reference Manifest Number:

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code:

Manifest Year: 2009 New Jersey Manifest Data

Quantity: 300 Unit: Р H141 Hand Code:

Manifest Code: NJA5329535 NYR000136788 EPA ID: Date Shipped: 20060619 TSDF EPA ID: NJD980536593 Transporter EPA ID: NJD054126164 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 060619 Date Trans2 Transported Waste: 000000 Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported 060620 Date TSDF Received Waste: Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: 08220621 Reference Manifest Number: Not reported Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: Not reported Manifest Year: Not reported Quantity: Not reported Unit: Not reported Hand Code: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

K66 **ONYX ENVIRONMENTAL SERVICES** RCRA-NonGen 1006810198 NW 10 TERMINAL DR FINDS NYN008012163

LATHAM, NY 12210 < 1/8

0.084 mi.

442 ft. Site 7 of 7 in cluster K

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

ONYX ENVIRONMENTAL SERVICES Facility name:

Actual: Facility address: 10 TERMINAL DR 299 ft.

LATHAM, NY 12210

EPA ID: NYN008012163 Mailing address: **TERMINAL DR**

LATHAM, NY 12210

Contact: SEAN ABELL Contact address: TERMINAL DR

LATHAM, NY 12210

Contact country: US

Contact telephone: (518) 555-1212 Not reported Contact email: 02

EPA Region: Land type: Private Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

ONYX ENVIRONMENTAL SERVICES Facility name:

Classification: Not a generator, verified

Date form received by agency: 04/04/2003

Facility name: ONYX ENVIRONMENTAL SERVICES

Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 11/04/2004

COMPLIANCE EVALUATION INSPECTION ON-SITE Evaluation:

EDR ID Number

Direction Distance

Elevation Site Database(s) **EPA ID Number**

ONYX ENVIRONMENTAL SERVICES (Continued)

1006810198

EDR ID Number

Area of violation: Not reported Date achieved compliance: Not reported Evaluation lead agency: State

Evaluation date: 06/20/2002

COMPLIANCE EVALUATION INSPECTION ON-SITE Evaluation:

Area of violation: Not reported Date achieved compliance: Not reported Evaluation lead agency: State

FINDS:

Registry ID: 110014448801

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

COMMERCIAL PROPERTY SUNSET BLVD 67 NW **200 SUNSET BLVD**

NY Spills S110045328

N/A

< 1/8 COLONIE, NY

0.085 mi. 450 ft.

NY Spills: Relative: Higher

Site ID: 422064

Facility Addr2: COMMERCIAL PROPERTY 200 SUNSET BVLD Facility ID:

0909368

Actual: 295 ft.

Spill Number: 0909368 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 11/20/2009 Spill Date: Reported to Dept: 11/20/2009 CID: Not reported Spill Cause: Other Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. (Highly

> Improbable) 12/9/2009

Spill Closed Dt: Remediation Phase:

Date Entered In Computer: 11/20/2009 Spill Record Last Update: 12/9/2009 Spiller Name: SUSAN CERONE Spiller Company: **CERONE PROPERTIES**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COMMERCIAL PROPERTY SUNSET BLVD (Continued)

S110045328

Spiller Address: 200 SUNSET BVLD

Spiller City, St, Zip: COLONIE, NY

Spiller Company: 999

Contact Name: **EMILY PEREIRA** Contact Phone: (845) 486-1558

DEC Region: 4 DER Facility ID: 371007

DEC Memo: 12/01/09 - Spoke to Emily Pereiro of THe Chazen Company. Minor

contamination in a small area. Report to follow. wtc 12/09/09 -Received Phase II report from Chazen. Some very minor hits in the groundwater that requires no further remedial work. Close wtc

CALLER STATES PHASE 2 INVESTIGATION WITH ELEVATED GASOLINE LEVELS IN Remarks:

GROUND WATER.

Material:

422064 Site ID: Operable Unit ID: 1177924 Operable Unit: 01 Material ID: 2170775 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Not reported Units: Gallons Not reported Recovered: Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

ALBANY MARRIOTT HOTEL

SW 189 WOLF RD. < 1/8 COLONIE, NY 12205

0.090 mi.

O68

477 ft. Site 1 of 3 in cluster O

UST: Relative:

Facility Id: 4-484466 Higher Region: STATE

Actual: DEC Region: 300 ft.

Site Status: Unregulated

Program Type: **PBS Expiration Date:** N/A UTM X: 598224 4730823 UTM Y: Site ID: 37162

UST

HIST UST

U000383696

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

ALBANY MARRIOTT HOTEL (Continued)

1

Tank ID: 92100

Tank Status: Closed - In Place
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 7/1/1985
Capacity Gallons: 2200
Tightness Test Method: NN
Not Test Potes

Next Test Date: Not reported
Date Tank Closed: 12/1/1998

Tank Location: 5

Tank Type: Equivalent technology

Date Test:
Register:
Modified By:
Last Modified:
Not reported
True
TRANSLAT
3/4/2004

Equipment Records:

Tank Number:

A00 - Tank Internal Protection - None F00 - Pipe External Protection - None I04 - Overfill - Product Level Gauge (A/G) H00 - Tank Leak Detection - None

G03 - Tank Secondary Containment - Vault (w/o access)

J02 - Dispenser - Suction

C02 - Pipe Location - Underground/On-ground D01 - Pipe Type - Steel/Carbon Steel/Iron B00 - Tank External Protection - None

Affiliation Records:

Site Id: 37162 Affiliation Type: Mail Contact

Company Name: ALBANY MARRIOTT HOTEL

Contact Type: Not reported Contact Name: Not reported Address1: 189 WOLF RD. Address2: Not reported City: ALBANY State: NY Zip Code: 12205 Country Code: 001

Phone: (518) 458-8444
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37162 Affiliation Type: Owner

Company Name: INTERSTATE/COLONIE ASSOCIATES

Contact Type: Not reported Contact Name: Not reported

Address1: FOSTER PLAZA X, 680 ANDERSON D

Address2: Not reported City: PITTSBURGH

State: PA Zip Code: 15220 **EDR ID Number**

U000383696

Direction Distance

Elevation Site Database(s) **EPA ID Number**

ALBANY MARRIOTT HOTEL (Continued)

U000383696

EDR ID Number

Country Code: 001

(412) 937-0600 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 37162

Affiliation Type: **Emergency Contact**

INTERSTATE/COLONIE ASSOCIATES Company Name:

Contact Type: Not reported Contact Name: MATT LACLAIR Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

(518) 899-3104 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 37162

Affiliation Type: On-Site Operator

ALBANY MARRIOTT HOTEL Company Name:

Contact Type: Not reported

Contact Name: INTERSTATE HOTELS CORP. #102

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 458-8444 Phone Ext: Not reported Email: Not reported Fax Number: Not reported **TRANSLAT** Modified By: Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-484466 SPDES Number: Not reported **Emergency Contact:** MATT LACLAIR Emergency Telephone: (518) 899-3104

INTERSTATE HOTELS CORP. #102 Operator:

Operator Telephone: (518) 458-8444

Owner Name: INTERSTATE/COLONIE ASSOCIATES FOSTER PLAZA X, 680 ANDERSON D Owner Address:

Owner City, St, Zip: PITTSBURGH, PA 15220

Owner Telephone: (412) 937-0600 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

ALBANY MARRIOTT HOTEL (Continued)

U000383696

EDR ID Number

ALBANY MARRIOTT HOTEL Mailing Name:

189 WOLF RD. Mailing Address: Mailing Address 2: Not reported Mailing City, St, Zip: ALBANY, NY 12205 Mailing Contact: Not reported Mailing Telephone: (518) 458-8444 Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported 0126 SWIS ID: Old PBS Number: Not reported OTHER Facility Type: Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Not reported Federal ID: Certification Flag: False 06/22/1994 Certification Date: 06/22/1999 **Expiration Date:** Renew Flag: False Renewal Date: Not reported

Total Capacity:

FAMT:

Facility Screen: No Missing Data Owner Screen: No Missing Data

True

Tank Screen: Dead Letter: False Not reported CBS Number: COLONIE Town or City: County Code: 01 Town or City: 26

Tank Id:

Region:

Tank Location: UNDERGROUND Tank Status: Closed-In Place Install Date: 19850701 Capacity (gals): 2200

Product Stored: **DIESEL** Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None Tank External: None Pipe Location: Underground STEEL/IRON Pipe Type: Pipe Internal: None

Pipe External: None Second Containment: Diking Leak Detection: None

Overfill Prot: **Product Level Gauge**

Dispenser: Suction Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: No Missing Data Date Closed: 12/01/1998 Test Method: Not reported Deleted: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ALBANY MARRIOTT HOTEL (Continued) U000383696

Updated: True

Lat/long: Not reported

O69 AGFADIV RCRA-NonGen 1004759892 SW **189 WOLF RD FINDS** NYR000024752

< 1/8 **ALBANY, NY 12205**

0.090 mi.

477 ft. Site 2 of 3 in cluster O

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher Facility name: A G F A DIV

Actual: Facility address: 189 WOLF RD 300 ft.

ALBANY, NY 12205 EPA ID: NYR000024752

Mailing address: **BALLARDVALE ST** AGFA MS200-3-7D WILLINGTON, NY 01887

Contact: DAVID DEWITT

BALLARDVALE ST AGFA MS200-3-7D Contact address:

WILLINGTON, NY 01887

Contact country:

Contact telephone: (800) 451-4000 Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: ALBANY MARRIOTT Owner/operator address: 189 WOLF RD

ALBANY, NY 12205

Owner/operator country:

(518) 458-8444 Owner/operator telephone: Private Legal status: Owner/Operator Type: Operator Owner/Op start date: Not reported

Owner/Op end date: Not reported ALBANY MARRIOTT Owner/operator name:

Owner/operator address: 189 WOLF RD ALBANY, NY 12205

Owner/operator country: US

Owner/operator telephone: (518) 458-8444 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AGFADIV (Continued) 1004759892

On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006 Facility name: A G F A DIV

Classification: Not a generator, verified

Date form received by agency: 05/31/1996 Facility name:

Classification: Conditionally Exempt Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004525504

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

070 **BLUE SHIELD** RCRA-NonGen 1000693553 **187 WOLF RD FINDS** NYD986996072 SW

< 1/8 **ALBANY, NY 12205**

0.093 mi.

493 ft. Site 3 of 3 in cluster O

Relative:

RCRA-NonGen:

Higher

Date form received by agency: 01/01/2007

Facility name: BLUE SHIELD OF NORTHEASTERN NY

Actual: 300 ft.

187 WOLF RD Facility address: ALBANY, NY 12205

EPA ID: NYD986996072 Mailing address: WOLF RD

> ALBANY, NY 12205 AVERY INGLE

Contact: Contact address: WOLF RD

ALBANY, NY 12205

Contact country: US

Contact telephone: (518) 453-5507 Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

MANIFEST

Direction Distance Elevation

evation Site Database(s) EPA ID Number

BLUE SHIELD (Continued) 1000693553

Owner/Operator Summary:

Owner/operator name: WHOLEHEALTH INS NETWORK INC

Owner/operator address: 187 WOLF RD

ALBANY, NY 12205

Owner/operator country: US

Owner/operator telephone: (518) 453-5507
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: WHOLEHEALTH INS NETWORK INC

Owner/operator address: 187 WOLF RD

ALBANY, NY 12205

Owner/operator country: US

Owner/operator telephone: (518) 453-5507
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: Nο Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: BLUE SHIELD OF NORTHEASTERN NY

Classification: Not a generator, verified

Date form received by agency: 01/14/1992

Facility name: BLUE SHIELD OF NORTHEASTERN NY

Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004487564

Environmental Interest/Information System

EDR ID Number

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

BLUE SHIELD (Continued)

1000693553

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986996072

Country: USA

Mailing Name: BLUE SHIELD
Mailing Contact: HARRY INGLE
Mailing Address: 187 WOLF RD STE 8

Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12205
Mailing Zip4: 1158
Mailing Country: USA

Mailing Phone: 518-453-5507

Document ID: NJA1747737 Completed copy Manifest Status: Trans1 State ID: ILP39085 Trans2 State ID: NJDEPES86 Generator Ship Date: 931215 Trans1 Recv Date: 931215 Trans2 Recv Date: 931220 TSD Site Recv Date: 931221 Part A Recv Date: Not reported Part B Recv Date: 940104 NYD986996072 Generator EPA ID:

 Generator EPA ID:
 NYD986996072

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 ILD984908202

 TSDF ID:
 NJD002182897

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00503 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93 Manifest Tracking Num: Not i

Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BLUE SHIELD (Continued)

1000693553

Document ID: NJA1952770

Completed after the designated time period for a TSDF to get a copy to the DEC Manifest Status:

Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 950925 Trans1 Recv Date: 950925 Trans2 Recv Date: Not reported TSD Site Recy Date: 951003 Part A Recv Date: 951002 Part B Recv Date: 951024 NYD986996072 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported

Waste Code: D011 - SILVER 5.0 MG/L TCLP

NJD002182897

Quantity: 00277 P - Pounds Units: Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

TSDF ID:

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAK1981670

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

NYGS5776 Trans1 State ID: Trans2 State ID: CALFT9759 Generator Ship Date: 970815 Trans1 Recv Date: 970815 Trans2 Recv Date: 970826 TSD Site Recv Date: 970827 Part A Recv Date: 970828 Part B Recv Date: 970925

Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202 MOD095038998 Trans2 EPA ID: TSDF ID: MAD982755639

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00250 P - Pounds Units: Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BLUE SHIELD (Continued)

Alt Fac RCRA Id:

Alt Fac Sign Date: Mgmt Method Type Code: 1000693553

Year: 97 Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported

Document ID: NJA1460118

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: ILP60984 Trans2 State ID: NJDEPS869 Generator Ship Date: 920730 Trans1 Recv Date: 920730 Trans2 Recv Date: 920803 TSD Site Recy Date: 920804 Part A Recv Date: Not reported Part B Recv Date: 920826 Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD002182897

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Not reported Not reported

Not reported

Quantity: 00504 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

100 Specific Gravity: Year: 92

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1808286 Manifest Status: Completed copy Trans1 State ID: ILP39085 Trans2 State ID: NJDEPE086 Generator Ship Date: 940517 Trans1 Recv Date: 940517

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

BLUE SHIELD (Continued)

1000693553

Trans2 Recv Date: 940523 940524 TSD Site Recv Date: Part A Recv Date: 940523 Part B Recv Date: 940607 Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: ILD984908202 TSDF ID: NJD002182897

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00503 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1928521 Manifest Status: Completed copy Trans1 State ID: ILP39085 Trans2 State ID: 08690 941101 Generator Ship Date: Trans1 Recv Date: 941101 Trans2 Recv Date: 941103 TSD Site Recv Date: 941104 Part A Recv Date: 941107 Part B Recv Date: 941117

 Generator EPA ID:
 NYD986996072

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 ILD984908202

 TSDF ID:
 NJD002182897

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00503 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported

Direction Distance Elevation

n Site Database(s) EPA ID Number

BLUE SHIELD (Continued)

1000693553

EDR ID Number

Discr Residue Ind:
Discr Partial Reject Ind:
Discr Full Reject Ind:
Mot reported
Not reported
Mgmt Method Type Code:
Not reported

Document ID: NJA2531023

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 960726 Trans1 Recv Date: 960726 Trans2 Recv Date: Not reported TSD Site Recy Date: 960730 Part A Recv Date: 960808 Part B Recv Date: 960821

 Generator EPA ID:
 NYD986996072

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002182897

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00148 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100
Year: 96
Manifest Tracking Num: Not reported

Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1952771
Manifest Status: Completed copy

Trans1 State ID: 08690 Trans2 State ID: Not reported Generator Ship Date: 960123 Trans1 Recv Date: 960123 Trans2 Recv Date: Not reported TSD Site Recv Date: 960131 Part A Recv Date: 960130 Part B Recv Date: 960214

Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202

Direction Distance

Elevation Site Database(s) EPA ID Number

BLUE SHIELD (Continued) 1000693553

Trans2 EPA ID: Not reported TSDF ID: NJD002182897

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00277
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAK2656080

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYGS5776 Trans2 State ID: HQ8073503 Generator Ship Date: 971124 Trans1 Recv Date: 971124 Trans2 Recv Date: 971215 TSD Site Recy Date: 971216 Part A Recv Date: 971204 Part B Recv Date: 980120 NYD986996072 Generator EPA ID: ILD984908202 Trans1 EPA ID: Trans2 EPA ID: MOD095038998

TSDF ID: MAD982755639
Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00250 Units: P - Pounds

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported **EDR ID Number**

Direction Distance

Elevation Site Database(s) EPA ID Number

BLUE SHIELD (Continued) 1000693553

Mgmt Method Type Code: Not reported

Document ID: NJA1417225 Manifest Status: Completed copy Trans1 State ID: ILP60984 Trans2 State ID: NJDEPS869 Generator Ship Date: 930127 Trans1 Recv Date: 930127 Trans2 Recv Date: 930201 TSD Site Recv Date: 930201 Part A Recv Date: 930204 Part B Recv Date: 930212

 Generator EPA ID:
 NYD986996072

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD002182897

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00504 Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: NJA2114474 Completed copy Manifest Status: Trans1 State ID: NJDEPE086 Trans2 State ID: Not reported Generator Ship Date: 960531 Trans1 Recv Date: 960531 Trans2 Recv Date: Not reported TSD Site Recv Date: 960607 Part A Recv Date: 960607 Part B Recv Date: 960624

 Generator EPA ID:
 NYD986996072

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NJD002182897

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00296
Units: P - Pounds
Number of Containers: 002

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BLUE SHIELD (Continued) 1000693553

Container Type: DF - Fiberboard or plastic drums (glass) B Incineration, heat recovery, burning. Handling Method:

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: MAJ4500720

Completed after the designated time period for a TSDF to get a copy to the DEC Manifest Status:

Trans1 State ID: ILP39085 Trans2 State ID: 32667 Generator Ship Date: 960910 Trans1 Recv Date: 960910 Trans2 Recv Date: 961003 TSD Site Recv Date: 961004 Part A Recy Date: 960917 Part B Recv Date: 961029

Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: MOD095038998 TSDF ID: MAD982755639

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00125 P - Pounds Units: Number of Containers: 001

DF - Fiberboard or plastic drums (glass) Container Type:

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA2057093 Manifest Status: Completed copy

Trans1 State ID: 08690

Direction Distance Elevation

Site Database(s) **EPA ID Number**

BLUE SHIELD (Continued)

1000693553

EDR ID Number

Trans2 State ID: 08690 950517 Generator Ship Date: Trans1 Recv Date: 950517 Trans2 Recv Date: 950522 TSD Site Recv Date: 950523 Part A Recv Date: Not reported Part B Recv Date: 950607 Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: ILD984908202

TSDF ID: NJD002182897 Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00277 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1938696 Completed copy Manifest Status: ILP39085 Trans1 State ID: 08690 Trans2 State ID: Generator Ship Date: 950220 Trans1 Recv Date: 950220 Trans2 Recv Date: 950227 TSD Site Recv Date: 950228 Part A Recv Date: 950303 Part B Recv Date: 950314

Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: ILD984908202 TSDF ID: NJD002182897

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00251 P - Pounds Units: Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Import Ind: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BLUE SHIELD (Continued)

1000693553

Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: MAJ4685430

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: ILP226666 Trans2 State ID: Not reported Generator Ship Date: 961226 Trans1 Recv Date: 961226 Trans2 Recv Date: Not reported TSD Site Recv Date: 970113 Part A Recv Date: 970106 Part B Recv Date: 970207

Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: MAD982755639

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00250 Units: P - Pounds Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 96

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: MAK6028320 Manifest Status: Not reported ILD984908202 Trans1 State ID: Trans2 State ID: Not reported 07/22/1998 Generator Ship Date: Trans1 Recv Date: 07/22/1998 Trans2 Recy Date: Not reported 08/13/1998 TSD Site Recy Date: Part A Recv Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BLUE SHIELD (Continued)

1000693553

Part B Recv Date: Not reported NYD986996072 Generator EPA ID: SCD077995488 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: ILP226666

D011 - SILVER 5.0 MG/L TCLP Waste Code:

00250 Quantity: Units: P - Pounds Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 98

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1652921 Manifest Status: Completed copy Trans1 State ID: NJDEPS869 NJDEPS869 Trans2 State ID: Generator Ship Date: 930715 Trans1 Recv Date: 930715 Trans2 Recv Date: 930719 TSD Site Recv Date: 930719 Part A Recv Date: Not reported Part B Recv Date: 930730 Generator EPA ID: NYD986996072 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: ILD984908202 TSDF ID: NJD002182897

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00504 P - Pounds Units: Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BLUE SHIELD (Continued) 1000693553

Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

Document ID: MAJ4976620

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYIM5676 Trans2 State ID: Not reported 970410 Generator Ship Date: 970410 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 970428 Part A Recv Date: 970418 Part B Recv Date: 970523

NYD986996072 Generator EPA ID: Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: MAD982755639

Waste Code: D011 - SILVER 5.0 MG/L TCLP

Quantity: 00250 P - Pounds Units:

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

M71 **GENERAL ELECTRIC - FORMER SHOP** RCRA-NonGen 1000790902 MANIFEST NYD987023942

14 VATRANO RD South < 1/8 **ALBANY, NY 12205**

0.096 mi. 509 ft. Site 2 of 2 in cluster M

RCRA-NonGen: Relative: Date form received by agency: 01/01/2007 Higher

Facility name: GENERAL ELECTRIC - FORMER SHOP

Actual: Facility address: 14 VATRANO RD 299 ft. ALBANY, NY 122053404

NYD987023942 EPA ID:

VATRANO RD Mailing address: ALBANY, NY 12205 Contact: Not reported

Contact address: VATRANO RD ALBANY, NY 12205

Direction Distance

Elevation Site Database(s) EPA ID Number

GENERAL ELECTRIC - FORMER SHOP (Continued)

1000790902

EDR ID Number

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/Op end date:

Owner/operator name: VETRANO REALTY TRUST
Owner/operator address: BRIN REALTY 1095 CENTRAL

ALBANY, NY 12205

Owner/operator country:

Owner/operator telephone:

Legal status:

Owner/Operator Type:

Owner/Op start date:

US
(518) 438-2678
Private
Owner
Owner

Owner

Not reported

Owner/operator name: VETRANO REALTY TRUST
Owner/operator address: BRIN REALTY 1095 CENTRAL

ALBANY, NY 12205

Not reported

Owner/operator country: US

U.S. importer of hazardous waste:

Owner/operator telephone: (518) 438-2678
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Unknown

Handler Activities Summary:

Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: GENERAL ELECTRIC - FORMER SHOP

Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: GENERAL ELECTRIC - FORMER SHOP

Classification: Not a generator, verified

Direction Distance

Elevation Site Database(s) EPA ID Number

GENERAL ELECTRIC - FORMER SHOP (Continued)

1000790902

EDR ID Number

Date form received by agency: 12/14/1992

Facility name: GENERAL ELECTRIC - FORMER SHOP

Classification: Large Quantity Generator

Violation Status: No violations found

NY MANIFEST:

EPA ID: NYD987023942

Country: USA

Mailing Name: GENERAL ELECTRIC
Mailing Contact: JOHN HARRSEN

Mailing Address: 1 COMPUTER DR SOUTH

Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12205
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 518-458-6611

Document ID: NYB4788117 Completed copy Manifest Status: Trans1 State ID: PD9796NY Trans2 State ID: Not reported 930518 Generator Ship Date: Trans1 Recv Date: 930518 Trans2 Recy Date: Not reported TSD Site Recv Date: 930520 Part A Recv Date: 930602 930603 Part B Recv Date:

 Generator EPA ID:
 NYD987023942

 Trans1 EPA ID:
 NYD980769947

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 OHD004527008

Waste Code: B007 - OTHER MISCELLANEOUS PCB WASTES

Quantity: 00025

Units: K - Kilograms (2.2 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00139

Units: K - Kilograms (2.2 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GENERAL ELECTRIC - FORMER SHOP (Continued)

1000790902

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

P72 NIMO WOLF RD **NY Spills** S102561009 NNW **292 WOLF RD NY Hist Spills** N/A LATHAM, NY

< 1/8 0.101 mi.

Site 1 of 2 in cluster P 533 ft.

Relative: Higher

Actual:

299 ft.

NY Spills: 82991 Site ID: Facility Addr2: Not reported 9701052 Facility ID: Spill Number: 9701052 Facility Type: ER

SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported 4/24/1997 Spill Date: Reported to Dept: 4/24/1997 CID: 21

Spill Cause: Traffic Accident Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Fire Department Cleanup Ceased: Not reported Cleanup Meets Std: False

Last Inspection: Not reported Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 4/24/1997 Remediation Phase:

Date Entered In Computer: 4/24/1997 Spill Record Last Update: 3/14/2008 Spiller Name: Not reported

Spiller Company: NIAGARA MOHAWK NIMO

Spiller Address: Not reported Spiller City, St, Zip: ZZ -Spiller Company: 001

Contact Name: **ROY STILES** Contact Phone: (518) 783-2833

DEC Region: 4 **DER Facility ID:** 76433

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN" bILL BLAIN CHECKED SITE IN AM AND I CHECKED IN PM.

CLEAN UP SATISFACTORY. NO PCB OIL INVOLVED

TRUCK STRUCK WIRES PULLING THEM DOWN ALSO TAKING DOWN A TRANSFORMER Remarks:

CAUSING THE FUILD IN TRANSFORMER TO SPILL - NOTHING BEING DONE YET DO

TO THE LIVE ELECTRIC WIRE STILL DOWN AND IN THE ROAD

Material:

Site ID: 82991 Operable Unit ID: 1047199 Operable Unit: 01

Direction Distance

Elevation Site Database(s) EPA ID Number

NIMO WOLF RD (Continued)

S102561009

EDR ID Number

Material ID: 337617 Material Code: 0020A

Material Name: TRANSFORMER OIL

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Resource Affected:

Oxygenate:

Not reported

Petroleum

O gallons

No

No

No

Resource Affected:

Not reported

False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 9701052 **CHRISTENSEN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 04/24/1997 06:36 Reported to Dept Date/Time: 04/24/97 06:58

SWIS: 01

Spiller Name: NIAGARA MOHAWK NIMO

Spiller Contact:

Spiller Phone:

Spiller Contact:

Spiller Contact:

Spiller Phone:

Spiller Address:

Spiller City,St,Zip:

Not reported

Not reported

Spill Cause: Traffic Accident
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 01
Spill Notifier: Fire Department
PBS Number: Not reported

Cleanup Ceased: //
Cleanup Meets Std: False
Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: / /
Enforcement Date: / /

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO WOLF RD (Continued) S102561009

Invstgn Complete: // UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 04/24/97

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 04/24/97 Date Spill Entered In Computer Data File: Not reported

Update Date: 05/23/97 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False

Material: TRANSFORMER OIL Class Type: TRANSFORMER OIL

Times Material Entry In File: 533 CAS Number: Not reported 19940926 Last Date:

DEC Remarks: **BILL BLAIN CHECKED SITE IN AM AND I CHECKED IN PM. CLEAN UP SATISFACTORY. NO**

PCB OIL INVOLVED

Remark: TRUCK STRUCK WIRES PULLING THEM DOWN ALSO TAKING DOWN A TRANSFORMER CAUSING THE

FUILD IN TRANSFORMER TO SPILL - NOTHING BEING DONE YET DO TO THE LIVE ELECTRIC

WIRE STILL DOWN AND IN THE ROAD

LTANKS S101341472 L73 LAZARE LINCOLN WOLF RD 144 WOLF RD SSW **HIST LTANKS** N/A

COLONIE, NY < 1/8

0.106 mi.

Site 4 of 4 in cluster L 561 ft.

LTANKS:

Relative: Higher

313761 Site ID:

Spill No: 9408681 Actual: Spill Date: 9/29/1994 302 ft.

Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/1/1994 Facility Addr2: Not reported Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

LAZARE LINCOLN WOLF RD (Continued)

S101341472

EDR ID Number

Reported to Dept: 9/29/1994

CID: 21

Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 10/4/1994
Spill Record Last Update: 10/23/2006
Spiller Name: Not reported

Spiller Company: LAZARE LINCOLN MERCURY

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller County: 001

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

DEC Region: 4

DER Facility ID: 252993

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" SEE 9306177. PBS 4-600193 5/4/00 - Site was closed by

PBS on 10/01/1994. Waste oil tank was the last to be closed. 08/28/2001 - Letter sent to Lazare for a copy of the closure report. wtc 09/04/2001 - I reviewed Spill # 93-06177 also at Lazares. 4 M/W were installed at the site. Final sampling showed minor contamination remaining. Believe that these wells would have shown any problems with the waste oil tanks. wtc 10/23/2001 - Received closure report

for the 2 oil tanks. Analytical meets TAGMs standards. wtc

Remarks: 2K WO UGT FAILED VACUUM TEST, TO EMPTY & REMOVE. 10/20-LOOKS OK,

AWAITING RESULTS.

Material:

 Site ID:
 313761

 Operable Unit ID:
 1006397

 Operable Unit:
 01

 Material ID:
 378107

 Material Code:
 0022

Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0

Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported

Oxygenate: False

Tank Test:

 Site ID:
 313761

 Spill Tank Test:
 1543194

 Tank Number:
 0

 Tank Size:
 0

 Test Method:
 00

 Leak Rate:
 0

Gross Fail: Not reported Modified By: Spills

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LAZARE LINCOLN WOLF RD (Continued)

S101341472

Last Modified: 10/1/2004 Test Method: Unknown

HIST LTANKS:

Region of Spill:

Spill Number: 9408681 Spill Date: 09/29/1994 Spill Time: 14:30

Spill Cause: Tank Test Failure Resource Affectd: On Land Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/01/94 Cleanup Ceased: // Cleanup Meets Standard: False

CHRISTENSEN Investigator: Not reported Caller Name: Caller Agency: Not reported Not reported Caller Phone: Caller Extension: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 09/29/94 Reported to Department Time: 14:56 SWIS: 01

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: LAZARE LINCOLN MERCURY

Spiller Address: Not reported Spiller City, St, Zip: Not reported Spiller Cleanup Date: Facility Contact: Not reported Facility Phone: (518) 458-7550 Facility Extention: Not reported Spill Notifier: Responsible Party

PBS Number: 4-600193

Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: // **UST Involvement:** False

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: 10/04/94 Date Spill Entered In Computer Data File: Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 10/23/01 Is Updated: False

Tank:

PBS Number: Not reported

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

LAZARE LINCOLN WOLF RD (Continued)

S101341472

Tank Number: 0 Tank Size: 0

Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: True Material: WASTE OIL Class Type: WASTE OIL Times Material Entry In File: 9509 CAS Number: Not reported Last Date: 19940927

DEC Remarks: SEE 9306177. 5/4/00 - Site was closed by PBS on 10/01/1994. Waste oil tank was

> the last to be closed. 08/28/2001 - Letter sent to La are for a copy of the closure report. wtc 09/04/2001 - I reviewed Spill 93-06177 also at La ares. 4 M/W were installed at the site. Final sampling showed minor contamination remaining. Believe that these wells would have shown any problems with the waste oil tanks. wtc 10/23/2001 - Received closure report for the 2 oil tanks.

Analytical meets TAGMs standards. wtc

Spill Cause: 2K WO UGT FAILED VACUUM TEST, TO EMPTY REMOVE. 10/20-LOOKS OK, AWAITING RESULTS.

P74 FEDERAL EXPRESS CORP RCRA-NonGen 1000446658 NNW NYD986904720 281 OLD WOLF RD **FINDS**

LATHAM, NY 12110 < 1/8 0.109 mi.

HIST LTANKS 575 ft. Site 2 of 2 in cluster P **HIST UST MANIFEST** Relative: **CBS**

Higher

RCRA-NonGen:

Actual: Date form received by agency: 01/01/2007 299 ft.

FEDERAL EXPRESS CORP Facility name:

Facility address: 281 OLD WOLF RD

LATHAM, NY 12110 NYD986904720

EPA ID: Mailing address: OLD WOLF RD LATHAM, NY 12110 SHARON LYTLE Contact:

OLD WOLF RD Contact address: LATHAM, NY 12110

Contact country: US

Contact telephone: (518) 456-1120 Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: FEDERAL EXPRESS CORP

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US **LTANKS**

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

FEDERAL EXPRESS CORP (Continued)

1000446658

EDR ID Number

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: FEDERAL EXPRESS CORP

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: Nο Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: Nο Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: FEDERAL EXPRESS CORP
Classification: Not a generator, verified

Date form received by agency: 06/21/1990

Facility name: FEDERAL EXPRESS CORP
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004448651

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXPRESS CORP (Continued)

1000446658

LTANKS:

Site ID: 280634 Spill No: 9212441 Spill Date: 2/1/1993

Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/3/1993 Facility Addr2: Not reported Cleanup Ceased: 11/3/1993 Cleanup Meets Standard: True SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Reported to Dept: 2/2/1993 CID: Not reported Water Affected: Not reported Spill Notifier: Responsible Party Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: False Remediation Phase: Date Entered In Computer: 2/9/1993 Spill Record Last Update: 5/16/2006 Spiller Name: Not reported Spiller Company: FEDERAL EXPRESS

Spiller Address: 281 OLD WOLF RD Spiller City, St, Zip: LATHAM, NY

Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported DEC Region: 4

DER Facility ID: 227871

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9212441, 9309661, 9813073, 0107682, 0501750, 0513766

PBS 4-462497

330 UGT FAILED PETROTITE, PIPE FITTINGS APPEAR LOOSE, TO REPLACE & Remarks:

RETEST.

Material:

Site ID: 280634 Operable Unit ID: 976921 Operable Unit: 01 Material ID: 402293 Material Code: 0022

Waste Oil/Used Oil Material Name: Not reported Case No.: Material FA: Petroleum

Quantity: Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False

Direction
Distance

Elevation Site Database(s) EPA ID Number

FEDERAL EXPRESS CORP (Continued)

1000446658

EDR ID Number

Tank Test:

Site ID: 280634
Spill Tank Test: 1541129
Tank Number: Not reported

Tank Size: 0
Test Method: 00
Leak Rate: 0

Gross Fail: Not reported Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill:

 Spill Number:
 9212441

 Spill Date:
 02/01/1993

 Spill Time:
 17:20

Spill Cause: Tank Test Failure
Resource Affectd: On Land

Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/03/93 Cleanup Ceased: 11/03/93 Cleanup Meets Standard: True

CHRISTENSEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 02/02/93 Reported to Department Time: 16:34 SWIS: 01

Spiller Contact:

Spiller Phone:

Spiller Extention:

Spiller Name:

Spiller Address:

Spiller City,St,Zip:

Not reported

Not reported

Not reported

Spiller AL EXPRESS

281 OLD WOLF RD

LATHAM, NY

Spiller Cleanup Date: //

Facility Contact:
Responsible Party

Not reported
(518) 456-1120
Responsible Party

Not reported
Responsible Party

PBS Number: 4-462497 Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXPRESS CORP (Continued)

1000446658

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted:

Date Spill Entered In Computer Data File: 02/09/93 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 09/18/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: False WASTE OIL Material: Class Type: WASTE OIL Times Material Entry In File: 9509 CAS Number: Not reported Last Date: 19940927

DEC Remarks: 9813073

330 UGT FAILED PETROTITE, PIPE FITTINGS APPEAR LOOSE, TO REPLACE RETEST. Spill Cause:

HIST UST:

PBS Number: 4-462497 SPDES Number: Not reported

Emergency Contact: MAHONEY NOTIFIER Emergency Telephone: (518) 793-7788 FEDERAL EXPRESS Operator: Operator Telephone: (518) 456-1120 Owner Name: FEDERAL EXPRESS Owner Address: 281 OLD WOLF RD. Owner City,St,Zip: LATHAM, NY 12110 Owner Telephone: (518) 456-1120 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: FEDERAL EXPRESS

Mailing Address: **ENVIRONMENTAL MANAGEMENT GROUP** Mailing Address 2: 2003 CORPORATE AVE, 2ND FLOOR

Mailing City, St, Zip: MEMPHIS, TN 38132 Mailing Contact: Not reported (901) 395-3885 Mailing Telephone: Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Not reported Facility Addr2: SWIS ID: 0126 Old PBS Number: Not reported

Facility Type: OTHER Inspected Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

FEDERAL EXPRESS CORP (Continued)

1000446658

EDR ID Number

Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 04/22/1994 02/15/1999 **Expiration Date:** Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: No Missing Data
Owner Screen: Minor Data Missing

Tank Screen: 0
Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26
Region: 4

Tank ld:

Tank Location: UNDERGROUND Tank Status: UNDERGROUND

Install Date: 19881001 Capacity (gals): 10000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported Not reported Pipe Type: Pipe Internal: Not reported Pipe External: Not reported Second Containment: Vault (w/access) Not reported Leak Detection: Overfill Prot: Product Level Gauge

Dispenser: Submersible
Date Tested: Not reported
Next Test Date: Not reported
Missing Data for Tank: Minor Data Missing
Date Closed: 12/01/1998

Test Method: Not reported
Deleted: False
Updated: True
Lat/long: Not reported

MANIFEST:

9/10/2001 GEN Cert Date: Transporter Recpt Date: 8/4/2003 Number Of Containers: 0 Container Type: NONE Waste Code1: NONE Waste Code2: Not reported Waste Code3: Not reported Comment: Not reported Fee Exempt Code: Not reported

TSDF Name: Northland Environmental Inc.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXPRESS CORP (Continued)

1000446658

TSDF ID: rid040098352 TSDF Date: 7/30/2007

Date Imported: 9/5/2003 1:26:58 PM Transporter 2 Name: Not reported Transporter 2 ID: Not reported

Manifest Docket Number: Not reported Not reported Waste Description: Quantity: Not reported WT/Vol Units: Not reported Item Number: Not reported Transporter Name: Not reported Not reported Transporter EPA ID: Not reported **GEN Cert Date:** Not reported Transporter Recpt Date: Transporter 2 Recpt Date: Not reported TSDF Recpt Date: Not reported EPA ID: Not reported Transporter 2 ID: Not reported

CBS:

4-000314 CBS Number: Program Type: CBS Dec Region: **Expiration Date:** N/A

Facility Status: Unregulated UTMX: Not reported UTMY: Not reported

75 NIMO TRANSFORMER SE **4 COMPUTER DR** 1/8-1/4 **ALBANY COLONIE, NY 12205**

0.147 mi. 774 ft.

NY Spills: Relative:

Site ID: 373962 Higher Facility Addr2: Not reported

Actual: 0609669 Facility ID: 299 ft. Spill Number: 0609669 Facility Type: ER SWIS: 0126

Investigator: wtchrist Referred To: Not reported Spill Date: 11/22/2006 Reported to Dept: 11/22/2006 CID: 73

Spill Cause: **Equipment Failure** Not reported Water Affected: Spill Source: Commercial/Industrial Spill Notifier: Responsible Party Cleanup Ceased: Not reported

Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

NY Spills

S108296229

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

NIMO TRANSFORMER (Continued)

S108296229

EDR ID Number

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 4/25/2007

Remediation Phase: 0

Date Entered In Computer: 11/23/2006
Spill Record Last Update: 2/1/2008
Spiller Name: Not reported
Spiller Company: NIMO NAT GRID
Spiller Address: Not reported

Spiller City,St,Zip: ZZ -Spiller Company: 999

Contact Name: BARB SCHEURER Contact Phone: (518) 433-3696

DEC Region: 4
DER Facility ID: 323682

DEC Memo: 4/25/07 - Non PCB oil. wtc

Remarks: PAD MOUNTED TRANSFORMER HAD A SLOW LEAK - CAUSING SPILL ONTO THE

CONCRETE PAD AND SOIL. LEAK IS ACTIVE, BUT CONTAINED. REPLACEMENT &

CLEAN UP SCHEDULED FOR MONDAY.

Material:

 Site ID:
 373962

 Operable Unit ID:
 1131650

 Operable Unit:
 01

 Material ID:
 2121363

 Material Code:
 0020A

Material Name: TRANSFORMER OIL

Case No.: Not reported Material FA: Petroleum Quantity: 1
Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Not reported Last Modified: Test Method: Not reported

RONALD DURANTE/SMITH TRAN

TERMINAL DRIVE
COLONIE, NY

1/8-1/4 0.152 mi. 803 ft.

76

NW

Relative: HIST LTANKS:

Higher Region of Spill: 4

 Spill Number:
 8806058

 Actual:
 Spill Date:
 10/17/1988

 300 ft.
 Spill Time:
 08:00

HIST LTANKS S100132842 NY Spills N/A

Direction Distance Elevation

ation Site Database(s) EPA ID Number

RONALD DURANTE/SMITH TRAN (Continued)

S100132842

EDR ID Number

Spill Cause: Tank Failure
Resource Affectd: Groundwater
Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class:

Spill Closed Dt:

Cleanup Ceased:

Cleanup Meets Standard:

Investigator:

Caller Name:

Not reported
10/17/88
True
MCDONALD
Not reported

Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 10/17/88 Reported to Department Time: 08:10 SWIS: 01

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Spiller Name: RONALD DURANTE
Spiller Address: Not reported
Spiller City,St,Zip: NEW JERSEY

Spiller Cleanup Date: / /

Facility Contact:

Facility Phone:

Facility Phone:

Facility Extention:

Spill Notifier:

PBS Number:

Not reported

Responsible Party

Not reported

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/28/88
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: //
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 500
Unkonwn Quantity Spilled: False
Units: Gallons

Direction Distance

Elevation Site Database(s) EPA ID Number

RONALD DURANTE/SMITH TRAN (Continued)

S100132842

EDR ID Number

Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: DIESEL
Class Type: DIESEL
Times Material Entry In File: 10625
CAS Number: Not reported
Last Date: 19940728

DEC Remarks: Not reported

Spill Cause: WEST CENTRAL REMOVING DIESEL TANKS AT SMITH TRANSPORTATION, FOUND CONTAMINATED

SOIL, REMOVED TO ALBANY CO. LANDFILL. 10/17/88 MCDONALD ON SCENE.

NY Spills:

Site ID: 234240 Facility Addr2: Not reported Facility ID: 8806058 Spill Number: 8806058 Facility Type: ER SWIS: 0126 Investigator: **MCDONALD** Not reported Referred To: Spill Date: 10/17/1988 Reported to Dept: 10/17/1988 CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported

Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 10/17/1988

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/17/1988

Remediation Phase: 0

Date Entered In Computer: Not reported
Spill Record Last Update: 6/2/2008

Spiller Name: Not reported
Spiller Company: RONALD DURANTE
Spiller Address: Not reported
Spiller City, St, Zip: NEW JERSEY, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 192966
DEC Memo: Not reported

Remarks: WEST CENTRAL REMOVING DIESEL TANKS AT SMITH TRANSPORTATION, FOUND

CONTAMINATED SOIL, REMOVED TO ALBANY CO. LANDFILL. 10/17/88 MCDONALD

ON SCENE.

Material:

 Site ID:
 234240

 Operable Unit ID:
 921216

 Operable Unit:
 01

 Material ID:
 570847

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

RONALD DURANTE/SMITH TRAN (Continued)

S100132842

1000131728

NYD066822099

RCRA-CESQG

MANIFEST

FINDS

Material Code: 8000 Material Name: Diesel Case No.: Not reported Petroleum Material FA: Quantity: 500 Units: Gallons Recovered: No Not reported

Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Q77 **SHERWIN WILLIAMS CO STORE 5101**

SSW **WOLF RD** 1/8-1/4 **ALBANY, NY 12205**

0.159 mi.

839 ft. Site 1 of 4 in cluster Q

RCRA-CESQG: Relative:

Date form received by agency: 01/01/2007 Higher

Facility name: SHERWIN WILLIAMS CO STORE 5101

Actual: Facility address: WOLF RD 300 ft.

ALBANY, NY 12205 EPA ID: NYD066822099

Contact: MARK J LANAHAN Contact address: WOLF RD

ALBANY, NY 12205

Contact country: US

(518) 459-1050 Contact telephone: Contact email: Not reported

EPA Region: 02 Land type: Private

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar

> month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any

time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from

the cleanup of a spill, into or on any land or water, of acutely

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

hazardous waste

Owner/Operator Summary:

Owner/operator name: THE SHERWIN-WILLIAMS CO

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country:

(212) 555-1212 Owner/operator telephone: Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: MAUREEN J HOMICZ, WMJ SCHULTZ, HAROLD SCHU

Owner/operator address: DEER RUN DR

BALLSTON SPA, NY 12020

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Operator Owner/Op start date: 01/01/1973 Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Universal Waste Summary:

Batteries Waste type: Accumulated waste on-site: Unknown Generated waste on-site: Unknown

Waste type: Lamps Accumulated waste on-site: Unknown Generated waste on-site: Unknown

Pesticides Waste type: Accumulated waste on-site: Unknown Generated waste on-site: Unknown

Waste type: Thermostats

Direction Distance

Elevation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Accumulated waste on-site: Unknown Generated waste on-site: Unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: SHERWIN WILLIAMS CO STORE 5101

Classification: Small Quantity Generator

Date form received by agency: 02/04/2004

Facility name: SHERWIN WILLIAMS CO STORE 5101

Classification: Large Quantity Generator

Date form received by agency: 06/25/2002

Facility name: SHERWIN WILLIAMS CO STORE 5101
Site name: SHERWIN-WILLIAMS STORE 5101

Classification: Large Quantity Generator

Date form received by agency: 01/01/2001

Facility name: SHERWIN WILLIAMS CO STORE 5101

Site name: SHERWIN WILLIAMS
Classification: Large Quantity Generator

Date form received by agency: 10/31/1991

Facility name: SHERWIN WILLIAMS CO STORE 5101

Site name: SHERWIN-WILLIAMS CO THE Classification: Small Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: SR - 373-3.2, 373-3.4 Area of violation: Generators - General

Date violation determined: 05/02/2002
Date achieved compliance: 08/02/2002
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 05/15/2002
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Paid penalty amount: Not reported
Not reported

Regulation violated: SR - 376.1(g)(1)(ii)
Area of violation: LDR - General
Date violation determined: 05/02/2002
Date achieved compliance: 08/02/2002
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 05/15/2002
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Regulation violated: SR - 372.2(b)(3) % (4) Area of violation: Generators - Manifest

Date violation determined: 05/02/2002
Date achieved compliance: 08/02/2002
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 05/15/2002
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 372.2(b)(5)
Area of violation: Generators - General

Date violation determined: 05/02/2002
Date achieved compliance: 08/02/2002
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 05/15/2002
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 06/08/2004

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

State

Evaluation date: 05/02/2002

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 08/02/2002 Evaluation lead agency: State

Evaluation date: 05/02/2002

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Manifest

Date achieved compliance: 08/02/2002 Evaluation lead agency: State

Evaluation date: 05/02/2002

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: LDR - General Date achieved compliance: 08/02/2002 Evaluation lead agency: State

FINDS:

Registry ID: 110004365099

Direction Distance

Elevation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD066822099

Country: USA

Mailing Name: SHERWIN WILLIAMS COMPANY

Mailing Contact: MARK LANAHAN
Mailing Address: 130 WOLF ROAD
Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12205
Mailing Zip4: Not reported

Mailing Country: USA

Mailing Phone: 518-459-1050

Document ID: NYH2857032 Manifest Status: Not reported NYD049253719 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 10/24/2005 Trans1 Recv Date: 10/24/2005 Trans2 Recv Date: Not reported TSD Site Recv Date: 10/26/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD066822099 Generator EPA ID: 2450B7NY Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: NYD049253719

Waste Code: D035 - METHYL ETHYL KETONE 200.0 MG/L TCLP

Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 044

Alt Fac Sign Date:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Not reported

01.00 Specific Gravity: Year: Not reported Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Mgmt Method Type Code: Not reported

Document ID: NYB4570038 Manifest Status: Completed copy OHT309AC Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 920106 Trans1 Recv Date: 920106 Trans2 Recv Date: Not reported TSD Site Recv Date: 920107 Part A Recv Date: Not reported Part B Recv Date: 920129 Generator EPA ID: NYD066822099 Trans1 EPA ID: OHD987027604 Trans2 EPA ID:

Not reported OHD980681571 D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00440

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 800

TSDF ID:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100

Waste Code: Not reported Quantity: 00027

Units: Y - Cubic yards* (.85 tons)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

002 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB7794477 Completed copy Manifest Status: U78923 Trans1 State ID: Trans2 State ID: Not reported

Direction Distance Elevation

Site Database(s) **EPA ID Number**

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Generator Ship Date: 951010 951010 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 951012 Part A Recv Date: 951019 Part B Recv Date: 951023 Generator EPA ID: NYD066822099 Trans1 EPA ID: CT5000000570 Trans2 EPA ID: Not reported

OHD980681571 D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00265

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 005

TSDF ID:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Not reported Discr Type Ind: Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB7794684 Manifest Status: Completed copy CTV26825 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 950711 Trans1 Recv Date: 950711 Trans2 Recv Date: Not reported TSD Site Recv Date: 950713 Part A Recv Date: Not reported Part B Recv Date: 950801

Generator EPA ID: NYD066822099 Trans1 EPA ID: NYN00002A234 Trans2 EPA ID: Not reported TSDF ID: OHD980681571

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00660

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 012

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Map ID MAP FINDINGS
Direction

Distance Elevation

Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB4734153 Completed copy Manifest Status: Trans1 State ID: 80367VNY Trans2 State ID: Not reported Generator Ship Date: 970516 970516 Trans1 Recy Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 970519 Part A Recv Date: 970528 Part B Recv Date: 970609

 Generator EPA ID:
 NYD066822099

 Trans1 EPA ID:
 NYD982792814

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 OHD980681571

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB7794963

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 48473VNY Trans2 State ID: Not reported Generator Ship Date: 970124 970124 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 970128 Not reported Part A Recv Date: Part B Recv Date: 970224

Direction Distance

Elevation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

 Generator EPA ID:
 NYD066822099

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 OHD980681571

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG1309869 Manifest Status: Not reported Trans1 State ID: NYD982792814 Trans2 State ID: Not reported Generator Ship Date: 12/10/1998 Trans1 Recy Date: 12/10/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 12/11/1998 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD066822099 Generator EPA ID: Trans1 EPA ID: OHD980681571 Trans2 EPA ID: Not reported TSDF ID: 80346VNNY

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported

Document ID: NYG1309905 Manifest Status: Not reported Trans1 State ID: NYD982792814 Trans2 State ID: Not reported Generator Ship Date: 10/28/1998 10/28/1998 Trans1 Recv Date: Not reported Trans2 Recv Date: 10/30/1998 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 Trans1 EPA ID: OHD980681571 Trans2 EPA ID: Not reported TSDF ID: Not reported

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002 Container Type: DM - Me

Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG1865457 Manifest Status: Not reported Trans1 State ID: NYD049253719 Trans2 State ID: Not reported Generator Ship Date: 01/22/2001 Trans1 Recv Date: 01/22/2001 Trans2 Recv Date: Not reported TSD Site Recv Date: 01/23/2001 Part A Recy Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 NYD049253719 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: 1306A0NY

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00055

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 01

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG1938429 Manifest Status: Not reported Trans1 State ID: NYD049283719 Trans2 State ID: Not reported Generator Ship Date: 02/19/2001 02/19/2001 Trans1 Recv Date: Trans2 Recy Date: Not reported TSD Site Recv Date: 02/19/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD066822099 Generator EPA ID: Trans1 EPA ID: NYD049253719 Trans2 EPA ID: Not reported TSDF ID: 8604B6NY

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

00165 Quantity:

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 01

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG2681172

Direction Distance Elevation

ation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Manifest Status: Not reported NYD049253719 Trans1 State ID: Not reported Trans2 State ID: Generator Ship Date: 03/25/2003 Trans1 Recv Date: 03/25/2003 Trans2 Recv Date: Not reported 03/25/2003 TSD Site Recv Date: Part A Recy Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 Trans1 EPA ID: NYD049253719 Trans2 EPA ID: Not reported TSDF ID: AC12162NY

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00990

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 178

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: 03

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYH2857032 Manifest Status: Not reported Trans1 State ID: NYD049253719 Trans2 State ID: Not reported Generator Ship Date: 10/24/2005 Trans1 Recv Date: 10/24/2005 Not reported Trans2 Recv Date: TSD Site Recv Date: 10/26/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 Trans1 EPA ID: 2450B7NY Trans2 EPA ID: Not reported TSDF ID: NYD049253719

Waste Code: D035 - METHYL ETHYL KETONE 200.0 MG/L TCLP

Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 044

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00
Year: Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported Manifest Status: Not reported OHD042311209 Trans1 State ID: NJD054126164 Trans2 State ID: Generator Ship Date: 2008-10-22 Trans1 Recv Date: 2008-10-22 Trans2 Recv Date: 2008-10-31 TSD Site Recv Date: 2008-11-03 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: ARD981057870 Waste Code: Not reported

Quantity: 45.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 9.0

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 08

Manifest Tracking Num: 002272369FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H141

Document ID: Not reported
Manifest Status: Not reported
Trans1 State ID: OHD042311209
Trans2 State ID: NJD054126164
Generator Ship Date: 2008-11-26
Trans1 Recv Date: 2008-12-05

Direction Distance Elevation

ation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

TSD Site Recv Date: 2008-12-08 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: ARD981057870 Waste Code: Not reported

Quantity: 20.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 1.0

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 002306881FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

Document ID: Not reported Manifest Status: Not reported OHD042311209 Trans1 State ID: Trans2 State ID: NJD054126164 Generator Ship Date: 2008-10-22 Trans1 Recv Date: 2008-10-22 2008-10-31 Trans2 Recv Date: TSD Site Recv Date: 2008-11-03 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: ARD981057870 Waste Code: Not reported

Quantity: 26.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 8.0

Container Type: CF - Fiber or plastic boxes, cartons

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 08

Manifest Tracking Num: 002272369FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N

Direction Distance Elevation

vation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: OHD042311209 Trans2 State ID: NJD054126164 2008-11-26 Generator Ship Date: Trans1 Recv Date: 2008-11-26 Trans2 Recv Date: 2008-12-05 TSD Site Recv Date: 2008-12-08 Part A Recy Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD066822099 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: ARD981057870 Waste Code: Not reported

Quantity: 192.0

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 48.0

Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 002306881FLE

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H061

Document ID: NYB7793973
Manifest Status: Completed copy

Trans1 State ID: U78923 Trans2 State ID: Not reported Generator Ship Date: 951227 Trans1 Recv Date: 951227 Trans2 Recv Date: Not reported TSD Site Recv Date: 951228 Part A Recv Date: Not reported Part B Recv Date: 960112

 Generator EPA ID:
 NYD066822099

 Trans1 EPA ID:
 CT5000000570

 Trans2 EPA ID:
 Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

TSDF ID: OHD980681571

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

00220 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00202

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 202

Container Type: CM - Metal boxes, cases, roll-offs B Incineration, heat recovery, burning. Handling Method:

Specific Gravity: Waste Code: Not reported Quantity: 00355

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: CM - Metal boxes, cases, roll-offs Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Not reported Mgmt Method Type Code:

Document ID: NYB7795458 Manifest Status: Completed copy Trans1 State ID: Not reported Not reported Trans2 State ID: Generator Ship Date: 960429 Trans1 Recv Date: 960429 Trans2 Recv Date: Not reported TSD Site Recv Date: 960503 Part A Recv Date: Not reported Part B Recv Date: 960522

Generator EPA ID: NYD066822099 Trans1 EPA ID: CT5000000570 Trans2 EPA ID: Not reported TSDF ID: OHD980681571

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

DM - Metal drums, barrels Container Type:

Handling Method: B Incineration, heat recovery, burning.

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

Specific Gravity: 100 96 Year:

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG0099531

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 44571TNY Trans2 State ID: Not reported Generator Ship Date: 971112 Trans1 Recv Date: 971112 Trans2 Recy Date: Not reported TSD Site Recv Date: 971114 Part A Recv Date: 971126 Part B Recv Date: 971218

Generator EPA ID: NYD066822099 Trans1 EPA ID: NYD982792814 Trans2 EPA ID: Not reported TSDF ID: OHD980681571

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00165

G - Gallons (liquids only)* (8.3 pounds) Units:

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB7795107

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 80359VNY Not reported Trans2 State ID: Generator Ship Date: 970905

Direction Distance

Elevation Site Database(s) EPA ID Number

SHERWIN WILLIAMS CO STORE 5101 (Continued)

1000131728

EDR ID Number

 Trans1 Recv Date:
 970905

 Trans2 Recv Date:
 Not reported

 TSD Site Recv Date:
 970908

 Part A Recv Date:
 970912

 Part B Recv Date:
 971016

 Concrete FPA ID:
 NYD0668200

 Generator EPA ID:
 NYD066822099

 Trans1 EPA ID:
 NYD982792814

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 OHD980681571

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 97

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

Q78 SHERMAN WILLIAMS STORE WOLF RD

SSW 130 WOLF RD

1/8-1/4 ALBANY COLONIE, NY 12205

0.159 mi.

839 ft. Site 2 of 4 in cluster Q

Relative: Higher

Actual:

300 ft.

NY Spills:

Site ID: 289329
Facility Addr2: Not reported
Facility ID: 0110658
Spill Number: 0110658

 Facility Type:
 ER

 SWIS:
 0126

 Investigator:
 WTCHRIST

 Referred To:
 Not reported

 Spill Date:
 2/7/2002

 Reported to Dept:
 2/7/2002

 CID:
 365

Spill Cause: Equipment Failure Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True

Last Inspection: Not reported

NY Spills

S108980863

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SHERMAN WILLIAMS STORE WOLF RD (Continued)

S108980863

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/3/2002 Remediation Phase: Date Entered In Computer: 2/7/2002 Spill Record Last Update: 4/9/2010

Spiller Name: **GREG STALLINGS**

Spiller Company: SHERWIN WILLIAMS PAINT

Spiller Address: 130 WOLF RD Spiller City, St, Zip: ALBANY, NY

Spiller Company: 001

Contact Name: **GREG STALLINGS** Contact Phone: (216) 566-1710

DEC Region: DER Facility ID: 234295

Prior to Sept, 2004 data translation this spill Lead DEC Field was DEC Memo:

"CHRISTENSEN" SAME AS 0110620, SHOULD TANK HAVE BEEN REGISTERED?

Remarks: source has been removed & soil excavated - samples taken - it was an

old emergency spill containment tank made of concrete

Material:

Site ID: 289329 Operable Unit ID: 849133 Operable Unit: 01 Material ID: 528279 Material Code: 0059A Material Name: **SOLVENTS** Case No.: Not reported Material FA: Other Quantity: 0 Units: Gallons Recovered: No

Not reported Resource Affected: Oxygenate: False Site ID: 289329 Operable Unit ID: 849133 Operable Unit: 01 528280 Material ID: Material Code: 1797A **THINNERS** Material Name: Case No.: Not reported Material FA: Other Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SHERMAN WILLIAMS STORE WOLF RD (Continued)

S108980863

EDR ID Number

Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 289328 Facility Addr2: Not reported Facility ID: 0110620 Spill Number: 0110620 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Spill Date: 2/6/2002 Reported to Dept: 2/6/2002 CID: 257

Spill Cause: Equipment Failure Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/27/2002
Remediation Phase: 0
Date Entered In Computer: 2/6/2002
Spill Record Last Update: 4/9/2010

Spiller Name: GREG STALINGS

Spiller Company: SHERMAN WILLIAMS STORE

Spiller Address: 130 WOLF RD Spiller City,St,Zip: ALBANY, NY

Spiller Company: 001

Contact Name: GREG STALINGS Contact Phone: (216) 566-1710

DEC Region: 4
DER Facility ID: 321714

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" IS TANK REGISTERED? ALSO RPTd AS 0110658. 06/27/2002 -

Reviewed closure report from Parsons. Site meets TAGMs 4046. Closed

wtc

Remarks: DURING A TANK REMOVAL CALLER FOUND CONTAMINATED SOIL TANK IS A 3000

GAL UST

Material:

289328 Site ID: Operable Unit ID: 849091 Operable Unit: 01 Material ID: 528241 Material Code: 0001 Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SHERMAN WILLIAMS STORE WOLF RD (Continued)

S108980863

Units: Gallons Recovered: No Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Click this hyperlink while viewing on your computer to access

GAL UST

Q79 **SHERWIN-WILLIAMS STORE #5101**

SSW 130 WOLF RD

N/A

UST

U004048283

1/8-1/4 COLONIE, NY 12205 0.159 mi.

839 ft. Site 3 of 4 in cluster Q UST:

Relative:

Higher

Facility Id: 4-600832 Region: STATE DEC Region:

Actual: 300 ft.

Site Status: Unregulated Program Type: **PBS** Expiration Date: N/A

UTM X: 597730.84488999995 UTM Y: 4730267.9886600003

Site ID: 38165

UST-1 Tank Number: Tank ID: 99241

Tank Status: Closed - Removed Tank Model: Not reported Not reported Pipe Model: Not reported Install Date: Capacity Gallons: 3000 Tightness Test Method: NNNext Test Date:

Not reported Date Tank Closed: 2/5/2002 Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None

C03 - Pipe Location - Aboveground/Underground Combination

Direction Distance

Elevation Site Database(s) **EPA ID Number**

SHERWIN-WILLIAMS STORE #5101 (Continued)

U004048283

EDR ID Number

H00 - Tank Leak Detection - None

J02 - Dispenser - Suction

F01 - Pipe External Protection - Painted/Asphalt Coating

100 - Overfill - None

A00 - Tank Internal Protection - None D01 - Pipe Type - Steel/Carbon Steel/Iron B00 - Tank External Protection - None

Affiliation Records:

Site Id: 38165

On-Site Operator Affiliation Type:

SHERWIN-WILLIAMS STORE #5101 Company Name:

Contact Type: Not reported

SHERWIN-WILLIAMS Contact Name:

Address1: Not reported Not reported Address2: Not reported City: State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 459-1050 Not reported Phone Ext: Email: Not reported Not reported Fax Number: TRANSLAT Modified By: Date Last Modified: 3/4/2004

Site Id: 38165 Affiliation Type: Mail Contact

THE SERWIN-WILLIAMS CO Company Name:

Contact Type: Not reported Contact Name: **GREG STALLINGS**

101 PROSPECT AVE, N.W. Address1: SUITE 1080 MIDLAND BLDG Address2:

CLEVELAND City: State: ОН Zip Code: 44115 Country Code: 001

Phone: (216) 566-1710 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 38165

Affiliation Type: **Emergency Contact**

Company Name: HAROLD & WILLIAM SCHULTZ

Contact Type: Not reported **GARY COLLOTON** Contact Name: Address1: Not reported Address2: Not reported Not reported City: State: NN

Zip Code: Not reported Country Code:

(518) 459-1050 Phone:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SHERWIN-WILLIAMS STORE #5101 (Continued)

U004048283

Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: TRANSLAT Date Last Modified: 3/4/2004

38165 Site Id: Affiliation Type: Owner

Company Name: HAROLD & WILLIAM SCHULTZ

Contact Type: Not reported Contact Name: Not reported

Address1: 831 RT 67 - CURTIS IND. PARK

Address2: Not reported City: **BALLSTON SPA**

State: NY Zip Code: 12020 Country Code: 001

(518) 885-0060 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

80 **COLONIE ATHLETIC CLUB** SE **636 ALBANY SHAKER RD** 1/8-1/4 **ALBANY** (COLONIE), NY

NY Spills S102158184 **NY Hist Spills** N/A

0.163 mi. 861 ft.

NY Spills: Relative: Site ID: Higher

Facility Addr2: Not reported Actual: Facility ID: 9308014 304 ft. Spill Number: 9308014 Facility Type: ER SWIS:

0126 WTCHRIST Investigator:

Referred To: **SOLID & HAZARDOUS MATERIALS**

76018

Spill Date: 10/1/1993 Reported to Dept: 10/1/1993 CID: Not reported Spill Cause: Deliberate Water Affected: Not reported Spill Source: Commercial/Industrial

Spill Notifier: Citizen 10/1/1993 Cleanup Ceased:

Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 10/15/1993

0 Remediation Phase:

Date Entered In Computer: 10/15/1993 Spill Record Last Update: 11/5/1999

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE ATHLETIC CLUB (Continued)

S102158184

Spiller Name: Not reported

COLONIE ATHLETIC CLUB Spiller Company: Spiller Address: 636 ALBANY SHAKER RD

Spiller City, St, Zip: ALBANY, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 277094

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN/SOLID WASTE" 09/28/95: This is additional information

about material spilled from the translation of the old spill file:

ASBESTOS? INSULATION.

DUMPING DUCT INSULATION (ASBESTOS?) IN SWAMP BEHIND CLUB. REFD TO Remarks:

SOLID WASTE.

Material:

76018 Site ID: Operable Unit ID: 989388 Operable Unit: 01 Material ID: 394258 Material Code: 0064A

UNKNOWN MATERIAL Material Name:

Case No.: Not reported Material FA: Other Quantity: Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False Site ID: 76018 Operable Unit ID: 989388 Operable Unit: 01 Material ID: 394257 Material Code: 0026A Material Name: **ASBESTOS** Case No.: 01332214

Material FA: Hazardous Material

Quantity: 0 Units:

Gallons Recovered: No Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

COLONIE ATHLETIC CLUB (Continued)

S102158184

EDR ID Number

NY Hist Spills:

Region of Spill: 4

Spill Number: 9308014

Investigator: CHRISTENSEN/SOLID WASTE

Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 10/01/1993 12:30 Spill Date/Time: Reported to Dept Date/Time: 10/01/93 12:30

SWIS: 01

Spiller Name: COLONIE ATHLETIC CLUB

Spiller Contact: Not reported Spiller Phone: Not reported

Spiller Address: 636 ALBANY SHAKER RD

Spiller City,St,Zip: ALBANY
Spill Cause: Deliberate
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 01
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 10/01/93
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required. 10/15/93

Spill Closed Dt: 10/15/93
Corrective Action Plan Submitted: /

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/15/93
Date Spill Entered In Computer Data File: Not reported

Update Date: 11/05/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage

Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE ATHLETIC CLUB (Continued)

S102158184

UNKNOWN MATERIAL Material: **UNKNOWN MATERIAL** Class Type:

Times Material Entry In File: 9140 CAS Number: Not reported Last Date: 19941109

Material Class Type: Nonpetroleum/Nonhazardous

Quantity Spilled: 0 Unkonwn Quantity Spilled: True Gallons Units: Quantity Recovered: Unkonwn Quantity Recovered: False **ASBESTOS** Material: Class Type: **ASBESTOS** Times Material Entry In File:

CAS Number: 01332214 Last Date: Not reported

DEC Remarks: 09/28/95: This is additional information about material spilled from the

translation of the old spill file: ASBESTOS? INSULATION.

DUMPING DUCT INSULATION ASBESTOS?) IN SWAMP BEHIND CLUB. REFD TO SOLID WASTE. Remark:

Q81 **HESS STATION #32334** UST U000382996 SSW 156 WOLF RD W/S **HIST UST** N/A COLONIE, NY 12205

1/8-1/4 0.173 mi.

911 ft. Site 4 of 4 in cluster Q

UST: Relative:

Facility Id: 4-163775 Higher Region: STATE Actual:

DEC Region: 4 300 ft. Site Status: Active Program Type: **PBS**

Expiration Date: 2012/06/05 UTM X: 597941 UTM Y: 4730483 Site ID: 36343

Tank Number: Tank ID: 89441

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1977 Capacity Gallons: 10000 Tightness Test Method:

Next Test Date: Not reported 9/1/1993 Date Tank Closed: Tank Location:

Tank Type: Equivalent technology

Date Test: 6/1/1992 Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None D02 - Pipe Type - Galvanized Steel

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS STATION #32334 (Continued)

U000382996

J01 - Dispenser - Submersible F00 - Pipe External Protection - None 104 - Overfill - Product Level Gauge (A/G) C02 - Pipe Location - Underground/On-ground G00 - Tank Secondary Containment - None B00 - Tank External Protection - None

Tank Number: 2 Tank ID: 89442

Tank Status: Closed - Removed Not reported Tank Model: Not reported Pipe Model: Install Date: 12/1/1977 Capacity Gallons: 10000 Tightness Test Method: 01

Next Test Date: Not reported Date Tank Closed: 9/1/1993

Tank Location:

Equivalent technology Tank Type:

Date Test: 6/1/1992 Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None 104 - Overfill - Product Level Gauge (A/G) H00 - Tank Leak Detection - None D02 - Pipe Type - Galvanized Steel J01 - Dispenser - Submersible

A00 - Tank Internal Protection - None

C02 - Pipe Location - Underground/On-ground B00 - Tank External Protection - None G00 - Tank Secondary Containment - None

Tank Number: Tank ID: 89443

Tank Status: Closed - Removed Tank Model: Not reported Not reported Pipe Model: Install Date: 12/1/1977 Capacity Gallons: 10000 Tightness Test Method:

Next Test Date: Not reported Date Tank Closed: 9/1/1993 Tank Location:

Equivalent technology Tank Type:

6/1/1992 Date Test: Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None J01 - Dispenser - Submersible A00 - Tank Internal Protection - None

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS STATION #32334 (Continued)

U000382996

104 - Overfill - Product Level Gauge (A/G)

H00 - Tank Leak Detection - None

D02 - Pipe Type - Galvanized Steel

C02 - Pipe Location - Underground/On-ground G00 - Tank Secondary Containment - None B00 - Tank External Protection - None

Tank Number: Tank ID: 89444

Tank Status: Closed - Removed Tank Model: Not reported Not reported Pipe Model: Install Date: 12/1/1977 Capacity Gallons: 10000 Tightness Test Method: 01

Next Test Date: Not reported Date Tank Closed: 9/1/1993

Tank Location:

Equivalent technology Tank Type:

Date Test: 6/1/1992 Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

A00 - Tank Internal Protection - None H00 - Tank Leak Detection - None J01 - Dispenser - Submersible F00 - Pipe External Protection - None D02 - Pipe Type - Galvanized Steel 104 - Overfill - Product Level Gauge (A/G) G00 - Tank Secondary Containment - None C02 - Pipe Location - Underground/On-ground B00 - Tank External Protection - None

Tank Number: Tank ID: 94877 Tank Status: In Service Tank Model: 104 Pipe Model: D Install Date: 9/1/1993 Capacity Gallons: 12000 Tightness Test Method: NN Next Test Date: Not reported

Date Tank Closed: Not reported

Tank Location:

Equivalent technology Tank Type:

Not reported Date Test: Register: True Modified By: tesperbe Last Modified: 10/16/2008

Equipment Records:

K01 - Spill Prevention - Catch Basin F04 - Pipe External Protection - Fiberglass

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

Direction Distance Elevation

ance EDR ID Number ation Site Database(s) EPA ID Number

HESS STATION #32334 (Continued)

U000382996

L07 - Piping Leak Detection - Pressurized Piping Leak Detector

103 - Overfill - Automatic Shut-Off

J01 - Dispenser - Submersible

E04 - Piping Secondary Containment - Double-Walled (Underground)

A00 - Tank Internal Protection - None

G04 - Tank Secondary Containment - Double-Walled (Underground)

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

C02 - Pipe Location - Underground/On-ground

H05 - Tank Leak Detection - In-Tank System (ATG)

B04 - Tank External Protection - Fiberglass

Tank Number: 6 Tank ID: 94878 Tank Status: In Service Tank Model: 104 Pipe Model: D Install Date: 9/1/1993 Capacity Gallons: 10000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Equivalent technology

Date Test:
Register:
Modified By:
Last Modified:
Not reported
True
tesperbe
tesperbe
10/16/2008

Equipment Records:

103 - Overfill - Automatic Shut-Off

J01 - Dispenser - Submersible

A00 - Tank Internal Protection - None K01 - Spill Prevention - Catch Basin

F04 - Pipe External Protection - Fiberglass

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

C02 - Pipe Location - Underground/On-ground

B04 - Tank External Protection - Fiberglass

H05 - Tank Leak Detection - In-Tank System (ATG)

L07 - Piping Leak Detection - Pressurized Piping Leak Detector G04 - Tank Secondary Containment - Double-Walled (Underground)

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

E04 - Piping Secondary Containment - Double-Walled (Underground)

Tank Number: 7 94879 Tank ID: Tank Status: In Service Tank Model: 104 Pipe Model: D 9/1/1993 Install Date: Capacity Gallons: 10000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Equivalent technology

Date Test: Not reported

Direction
Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

HESS STATION #32334 (Continued)

U000382996

Register: True
Modified By: tesperbe
Last Modified: 10/16/2008

Equipment Records:

F04 - Pipe External Protection - Fiberglass

K01 - Spill Prevention - Catch Basin

G04 - Tank Secondary Containment - Double-Walled (Underground)

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

103 - Overfill - Automatic Shut-Off A00 - Tank Internal Protection - None

E04 - Piping Secondary Containment - Double-Walled (Underground)

J01 - Dispenser - Submersible

L07 - Piping Leak Detection - Pressurized Piping Leak Detector

C02 - Pipe Location - Underground/On-ground

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

H05 - Tank Leak Detection - In-Tank System (ATG)

B04 - Tank External Protection - Fiberglass

Tank Number: 8 94880 Tank ID: Tank Status: In Service Tank Model: 104 Pipe Model: D Install Date: 9/1/1993 Capacity Gallons: 10000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Equivalent technology

Date Test:
Register:
Modified By:
Last Modified:
Not reported
True
tesperbe
tesperbe
10/16/2008

Equipment Records:

F04 - Pipe External Protection - Fiberglass

K01 - Spill Prevention - Catch Basin

H05 - Tank Leak Detection - In-Tank System (ATG)

103 - Overfill - Automatic Shut-Off

B04 - Tank External Protection - Fiberglass

J01 - Dispenser - Submersible

A00 - Tank Internal Protection - None

C02 - Pipe Location - Underground/On-ground

E04 - Piping Secondary Containment - Double-Walled (Underground)

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

L07 - Piping Leak Detection - Pressurized Piping Leak Detector G04 - Tank Secondary Containment - Double-Walled (Underground)

 Tank Number:
 9

 Tank ID:
 94881

 Tank Status:
 In Service

 Tank Model:
 104

 Pipe Model:
 D

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS STATION #32334 (Continued)

U000382996

Install Date: 9/1/1993 8000 Capacity Gallons: Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location:

Tank Type: Equivalent technology

Date Test: Not reported Register: True Modified By: tesperbe 10/16/2008 Last Modified:

Equipment Records:

F04 - Pipe External Protection - Fiberglass

103 - Overfill - Automatic Shut-Off J01 - Dispenser - Submersible A00 - Tank Internal Protection - None K01 - Spill Prevention - Catch Basin B04 - Tank External Protection - Fiberglass

H05 - Tank Leak Detection - In-Tank System (ATG)

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

C02 - Pipe Location - Underground/On-ground

E04 - Piping Secondary Containment - Double-Walled (Underground)

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

L07 - Piping Leak Detection - Pressurized Piping Leak Detector

G04 - Tank Secondary Containment - Double-Walled (Underground)

Affiliation Records:

Site Id: 36343

Affiliation Type: **Emergency Contact** Company Name: HESS CORPORATION

Contact Type: Not reported

Contact Name: **HESS CORPORATION**

Address1: Not reported Address2: Not reported City: Not reported State: NN Zip Code: Not reported

Country Code: 999 Phone:

(732) 750-6000 Phone Ext: Not reported Not reported Email: Fax Number: Not reported **MAPERSSO** Modified By: Date Last Modified: 2/16/2010

Site Id: 36343 Affiliation Type: Mail Contact

Company Name: **HESS CORPORATION**

Contact Type: Not reported JANICE FLAHERTY Contact Name: Address1: 1 HESS PLAZA Not reported Address2: City: WOODBRIDGE

State: NJ Zip Code: 07095 Country Code: 001

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS STATION #32334 (Continued)

U000382996

EDR ID Number

Phone: (732) 750-6350 Phone Ext: Not reported

Email: JFLAHERTY@HESS.COM

Fax Number: Not reported Modified By: MAPERSSO Date Last Modified: 2/16/2010

Site Id: 36343 Affiliation Type: Owner

Company Name: HESS CORPORATION
Contact Type: MGR RETAIL MAINTENANCE

Contact Name: JIM HOWARD
Address1: 1 HESS PLAZA
Address2: Not reported
City: WOODBRIDGE

State: NJ
Zip Code: 07095
Country Code: 001

Phone: (732) 750-6000
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: WLSTEVEN
Date Last Modified: 2/23/2009

Site Id: 36343

Affiliation Type: On-Site Operator
Company Name: HESS STATION #32334

Contact Type: Not reported
Contact Name: SITE MANAGER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY

Zip Code: Not reported

Country Code: 001

Phone: (518) 435-0612
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: tesperbe
Date Last Modified: 1/14/2009

HIST UST:

PBS Number: 4-163775 SPDES Number: Not reported

Emergency Contact: AMERADA HESS CORPORATION

Emergency Telephone: (732) 750-6000 Operator: SITE MANAGER Operator Telephone: (518) 435-0612

Owner Name: AMERADA HESS CORPORATION

Owner Address: 1 HESS PLAZA

Owner City,St,Zip: WOODBRIDGE, NJ 07095

Owner Telephone: (732) 750-6000 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: AMERADA HESS CORPORATION

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS STATION #32334 (Continued)

U000382996

EDR ID Number

Mailing Address: 1 HESS PLAZA
Mailing Address 2: Not reported

Mailing City, St, Zip: WOODBRIDGE, NJ 07095
Mailing Contact: JANICE FLAHERTY
Mailing Telephone: (732) 750-6350
Owner Mark: First Owner

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is

greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

or not at the facility.

Facility Addr2: Not reported SWIS ID: 0126
Old PBS Number: Not reported

Facility Type: RETAIL GASOLINE SALES

Inspected Date: 20010314 Inspector: TS

Inspection Result: Not reported Not reported Federal ID: Certification Flag: False Certification Date: 09/07/2000 06/05/2002 **Expiration Date:** Renew Flag: False Renewal Date: Not reported Total Capacity: 50000 FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data

Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26
Region: 4

Tank ld: 1

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19771201
Capacity (gals): 10000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal:
None
Tank External:
Pipe Location:
Underground
Pipe Type:
GALVANIZED STEEL

Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None

Overfill Prot: Product Level Gauge

Dispenser:
Date Tested:
O6/01/1992
Next Test Date:
Not reported
Missing Data for Tank:
Date Closed:
O9/01/1993
Test Method:
Deleted:
Submersible
O6/01/1992
Not reported
No Missing Data
O9/01/1993
Petro-Tite
Deleted:
False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS STATION #32334 (Continued)

U000382996

Updated: True Not reported Lat/long:

Tank Id:

UNDERGROUND Tank Location: Tank Status: Closed-Removed Install Date: 19771201 Capacity (gals): 10000

Product Stored: **UNLEADED GASOLINE**

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None Tank External: None Pipe Location: Underground

GALVANIZED STEEL Pipe Type:

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None

Product Level Gauge Overfill Prot:

Dispenser: Submersible 06/01/1992 Date Tested: Next Test Date: Not reported Missing Data for Tank: No Missing Data 09/01/1993 Date Closed: Test Method: Petro-Tite Deleted: False Updated: True Lat/long: Not reported

Tank Id:

Tank Location: **UNDERGROUND** Tank Status: Closed-Removed 19771201 Install Date: 10000 Capacity (gals): Product Stored: DIESEL

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None Tank External: None Pipe Location: Underground Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None

Overfill Prot: Product Level Gauge

Dispenser: Submersible 06/01/1992 Date Tested: Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: 09/01/1993 Test Method: Petro-Tite Deleted: False Updated: True Lat/long: Not reported

Direction Distance Elevation

vation Site Database(s) EPA ID Number

HESS STATION #32334 (Continued)

U000382996

EDR ID Number

Tank Id:

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19771201
Capacity (gals): 10000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal:
None
Tank External:
Pipe Location:
Underground
Pipe Type:
GALVANIZED STEEL

Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None

Overfill Prot: Product Level Gauge

Dispenser: Submersible 06/01/1992 Date Tested: Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 09/01/1993 Petro-Tite Test Method: Deleted: False Updated: True Lat/long: Not reported

Tank ld: 5

Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19930901
Capacity (gals): 12000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access)
Leak Detection: Electronic

Overfill Prot: Automatic Shut-Off, Catch Basin

Dispenser: Submersible Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: No Missing Data Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Tank ld: 6

Tank Location: UNDERGROUND Tank Status: UNDERGROUND

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS STATION #32334 (Continued)

Install Date: 19930901 Capacity (gals): 10000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access)
Leak Detection: Electronic

Overfill Prot: Automatic Shut-Off, Catch Basin

Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Not reported Date Closed: Test Method: Not reported False Deleted: Updated: True Lat/long: Not reported

Tank ld: 7

Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19930901
Capacity (gals): 10000

Product Stored: UNLEADED GASOLINE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access)
Leak Detection: Electronic

Overfill Prot: Automatic Shut-Off, Catch Basin

Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Tank ld: 8

Tank Location: UNDERGROUND
Tank Status: In Service
Install Date: 19930901
Capacity (gals): 10000
Product Stored: DIESEL

U000382996

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS STATION #32334 (Continued)

U000382996

EDR ID Number

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access)
Leak Detection: Electronic

Overfill Prot: Automatic Shut-Off, Catch Basin

Submersible Dispenser: Not reported Date Tested: Not reported Next Test Date: Missing Data for Tank: No Missing Data Not reported Date Closed: Not reported Test Method: Deleted: False Updated: True Lat/long: Not reported

Tank ld: 9

Tank Location: UNDERGROUND

Tank Status: In Service
Install Date: 19930901
Capacity (gals): 8000
Product Stored: KEROSENE

Tank Type: Fiberglass reinforced plastic [FRP]

Tank Internal: None
Tank External: None
Pipe Location: Underground

Pipe Type: STAINLESS STEEL ALLOY

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/access)
Leak Detection: Electronic

Overfill Prot: Automatic Shut-Off, Catch Basin

Dispenser: Submersible Date Tested: Not reported Not reported Next Test Date: No Missing Data Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

82 RYMANOWSKI RES COMPASS ST

NW 5 COMPASS ST 1/8-1/4 COLONIE, NY

0.199 mi. 1052 ft.

Relative: NY Spills:

Higher Site ID: 83654

Facility Addr2: Not reported

Actual: Facility ID: 9504237

298 ft. Spill Number: 9504237

S104496820

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) **EPA ID Number**

RYMANOWSKI RES COMPASS ST (Continued)

S104496820

EDR ID Number

Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 7/8/1995 Reported to Dept: 7/8/1995 CID: 21

Spill Cause: **Abandoned Drums** Water Affected: Not reported Spill Source: Unknown Spill Notifier: Citizen Cleanup Ceased: 7/13/1995 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 7/19/1995

Remediation Phase: O

Date Entered In Computer: Not reported Spill Record Last Update: 12/2/2003 Spiller Name: Not reported Spiller Company: UNKNOWN Spiller Address: Not reported Spiller City,St,Zip: NY

Spiller Company: 999 Contact Name: Not reported

Contact Phone: Not reported DEC Region:

DER Facility ID: 76959

DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was

"CHRISTENSEN"

Remarks: FOUND BARREL W/15GAL OIL BY HOUSE, SOURCE UNK.

Material:

Site ID: 83654 Operable Unit ID: 1018704 Operable Unit: 01 Material ID: 365739 Material Code: 0022

Material Name: Waste Oil/Used Oil Case No.: Not reported Material FA: Petroleum

Quantity:

Units: Not reported Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

RYMANOWSKI RES COMPASS ST (Continued)

S104496820

EDR ID Number

Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4 Spill Number: 9504237 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 07/08/1995 20:40 Reported to Dept Date/Time: 07/08/95 20:40

SWIS: 01

Spiller Name: UNKNOWN
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spill Cause: Abandoned Drums

Reported to Dept:
Water Affected:
Spill Source:
Spill Notifier:
PBS Number:
Cleanup Ceased:
Cleanup Meets Std:
On Land
Not reported
Citizen
Not reported
O7/13/95
True

Last Inspection:

Recommended Penalty: Penalty Not Recommended

//

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 07/19/95
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/19/95
Date Spill Entered In Computer Data File: Not reported

Update Date: //
Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

RYMANOWSKI RES COMPASS ST (Continued)

S104496820

EDR ID Number

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Not reported
Quantity Recovered: 0

Unkonwn Quantity Recovered: True
Material: WASTE OIL
Class Type: WASTE OIL
Times Material Entry In File: 9509
CAS Number: Not reported
Last Date: 19940927

DEC Remarks: Not reported

Remark: FOUND BARREL W/15GAL OIL BY HOUSE, SOURCE UNK.

CTF0625200

R83 M K ENGINE SYSTEMS CO MANIFEST S109784441
North NORTHWAY LN N/A

1/8-1/4 LATHAM, NY 12110

0.207 mi.

1091 ft. Site 1 of 29 in cluster R

Relative: CT MANIFEST:

Higher

Waste:

Manifest No:

Actual:

298 ft. Waste Occurence: 1 UNNA: 3082

Hazard Class: 308

US Dot Description: env. Hazardous substance liquid nos

No of Containers: 001
Container Type: TT
Quantity: 648
Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0625200

Waste Occurence: 1
EPA Waste Code: D006
Recycled Waste?: F

Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Detail:

 Year:
 1997

 Manifest ID:
 CTF0625200

 TSDF EPA ID:
 CTD021816889

TSDF Name: UNITED OIL RECOVERY INC./UIS DBA ADVANCED LIQ. REC

TSDF Address: 136 GRACEY AVE.
TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA
TSDF Telephone: Not reported

Transport Date: 6/27/1997
Transporter EPA ID: NYD000708271

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

M K ENGINE SYSTEMS CO (Continued)

S109784441

WEST CENTRAL ENVIRONMENTAL CORPORATION, Transporter Name:

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City, St, Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported EPA ID: NYD982278764 Generator Phone: 5187830545

6 NORTHWAY LANE Generator Mailing Addr:

Generator Mailing Town: LATHAM Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Not reported

Discrepancies: Not reported Date Shipped: 6/27/1997 Date Received: 6/27/1997 Last modified date: 4/26/2004 Last modified by: IG

Comments: Not reported

Waste:

Manifest No: CTF0360473

Waste Occurence: UNNA: 1719 Hazard Class: 8

US Dot Description: caustic alkali liquid nos

No of Containers: 001 Container Type: TT Quantity: 975 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Waste CD:

CTF0360473 Manifest No:

Waste Occurence: D002 **EPA Waste Code:** Recycled Waste?:

Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Detail:

Year: 1996 Manifest ID: CTF0360473 TSDF EPA ID: CTD072138969

TSDF Name: **ENVIRONMENTAL WASTE RESOURCES INC**

TSDF Address: 130 FREIGHT ST WATERBURY, CT 06702 TSDF City,St,Zip:

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

M K ENGINE SYSTEMS CO (Continued)

S109784441

TSDF Country: USA
TSDF Telephone: Not reported
Transport Date: 1/26/1996
Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL

Transporter Country: USA

Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported

Trans 2 City,St,Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported
EPA ID: NYD982278764
Generator Phone: 5187830545
Congretor Meiling Add: 6 NORTHWAY LAN

Generator Mailing Addr: 6 NORTHWAY LANE Generator Mailing Town: LATHAM

Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 1/26/1996 Date Received: Not reported 4/26/2004 Last modified date: Last modified by: IG

Comments: Not reported

R84 TMS, INC. MANIFEST S109784442
North NORTHWAY LN N/A

1/8-1/4 LATHAM, NY 12110

0.207 mi.

1091 ft. Site 2 of 29 in cluster R

Relative: Higher CT MANIFEST:

_

Waste:

Actual: 298 ft.

Manifest No: CTF0351786
Waste Occurence: 1
UNNA: 3082

Hazard Class: 9

US Dot Description: HAZARDOUS WASTE LIQUID NOS

No of Containers: 001
Container Type: TT
Quantity: 1029
Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0351786

Waste Occurence: 1
EPA Waste Code: D006
Recycled Waste?: F

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TMS, INC. (Continued) S109784442

Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Detail:

Year: 1995

CTF0351786 Manifest ID: TSDF EPA ID: CTD072138969

TSDF Name: **ENVIRONMENTAL WASTE RESOURCES**

TSDF Address: 130 FREIGHT ST. WATERBURY

TSDF City,St,Zip: CT 06725 TSDF Country: USA TSDF Telephone: Not reported Transport Date: 9/22/1995 Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL CORPORATION,

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Not reported Trans 2 Name: Not reported Trans 2 Address:

Trans 2 City, St, Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported NYD982278764 EPA ID: Generator Phone: 5187830545

Generator Mailing Addr: **6 NORTHWAY LANE**

Generator Mailing Town: LATHAM Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: USA

Special Handling: Not reported Discrepancies: Yes Date Shipped: 9/22/1995 Date Received: 9/22/1995 4/26/2004 Last modified date:

Last modified by: IG

Comments: Not reported

Waste:

Manifest No: CTF0249314

Waste Occurence: UNNA: 3082 Hazard Class: ORM-E

US Dot Description: HAZARDOUS WASTE LIQUID, NOS

No of Containers: 001 Container Type: TT Quantity: 817 Weight/Volume: G Additional Description: Υ Handling Code: T40 Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TMS, INC. (Continued) S109784442

Waste CD:

Manifest No: CTF0249314

Waste Occurence: **EPA Waste Code:** D006 Recycled Waste?:

Date Record Was Last Modified: 4/26/2004 DEO Who Last Modified Record: IG

Detail:

1994 Year: Manifest ID: CTF0249314 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES, INC.

TSDF Address: 130 FREIGHT STREET TSDF City,St,Zip: WATERBURY, CT 06702

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 3/18/1994 Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL CORPORATION,

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Not reported Trans 2 EPA ID: Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT USA Trans 2 Country:

Trans 2 Phone: Not reported EPA ID: NYD982278764 Generator Phone: 5187830545

Generator Mailing Addr: **6 NORTHWAY LANE**

Generator Mailing Town: LATHAM NY Generator Mailing State: Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Yes Discrepancies: No 3/18/1994 Date Shipped: Date Received: 3/18/1994 Last modified date: 4/26/2004 Last modified by: IG

Comments: Not reported

Waste:

CTF0163834 Manifest No:

Waste Occurence: UNNA: 9189 Hazard Class: ORM-E

HAZARDOUS WASTE LIQUID US Dot Description:

No of Containers: 001 Container Type: TT Quantity: 818 Weight/Volume: G Additional Description: Υ

Direction Distance

Elevation Site Database(s) EPA ID Number

TMS, INC. (Continued) S109784442

Handling Code: T01
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0163834

Waste Occurence: 1
EPA Waste Code: D008
Recycled Waste?: F

Date Record Was Last Modified: 4/27/2004 DEO Who Last Modified Record: IG

Detail:

 Year:
 1993

 Manifest ID:
 CTF0163834

 TSDF EPA ID:
 CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES, INC.

TSDF Address: 130 FREIGHT STREET TSDF City,St,Zip: WATERBURY, CT 06702

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 3/26/1993 Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL CORPORATION,

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported Not reported

Trans 2 City,St,Zip: CT
Trans 2 Country: USA

Trans 2 Phone: Not reported EPA ID: NYD982278764 Generator Phone: 5187830545

Generator Mailing Addr: 6 NORTHWAY LANE

Generator Mailing Town: LATHAM Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Yes Discrepancies: Yes Date Shipped: 3/26/1993 Date Received: 3/26/1993 Last modified date: 4/27/2004 Last modified by: IG

Comments: Not reported

EDR ID Number

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

R85 GENUINE PARTS CO RCRA-CESQG 1000425170

North 301 WOLF RD FINDS NYD065193518

1/8-1/4 LATHAM, NY 12110 0.208 mi.

1098 ft. Site 3 of 29 in cluster R

Relative: RCRA-CESQG:

Higher Date form received by agency: 01/01/2007
Facility name: GENUINE PAR

Facility name: GENUINE PARTS CO
Actual: Facility address: 301 WOLF RD
298 ft.

LATHAM, NY 12110 EPA ID: NYD065193518

Mailing address: WOLF RD LATHAM, NY 12110

Contact: NELSON CURTIS

Contact address: WOLF RD

LATHAM, NY 12110

Contact country: US

Contact telephone: (518) 785-3781 Contact email: Not reported

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar

month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from

MANIFEST

the cleanup of a spill, into or on any land or water, of acutely

hazardous waste

Owner/Operator Summary:

Owner/operator name: GENUINE PARTS CO
Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: GENUINE PARTS CO
Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 Legal status: Private Owner/Operator Type: Operator

Owner/Operator Type. Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: Nο User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: GENUINE PARTS CO

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 03/05/1987

Facility name: GENUINE PARTS CO
Classification: Small Quantity Generator

Date form received by agency: 03/29/1985

Facility name: GENUINE PARTS CO
Classification: Not a generator, verified

Facility Has Received Notices of Violations:

Regulation violated: SR - 376.1(g)(1)(ii)
Area of violation: Generators - General

Date violation determined: 10/23/2002
Date achieved compliance: 12/11/2002
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 10/30/2002
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 10/23/2002

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 12/11/2002 Evaluation lead agency: State

Evaluation date: 12/07/1990

Direction Distance

Elevation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

State

Evaluation date: 03/30/1989

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

State

FINDS:

Registry ID: 110004364312

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD065193518

Country: USA

Mailing Name: NAPA AUTO PARTS Mailing Contact: NAPA AUTO PARTS 301 WOLF RD Mailing Address: Mailing Address 2: Not reported Mailing City: LATHAM Mailing State: NY Mailing Zip: 12110 Mailing Zip4: 4806 Mailing Country: USA

Mailing Phone: 518-785-3781

Document ID: CTC0229516

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 53526B Trans2 State ID: Not reported 890426 Generator Ship Date: Trans1 Recv Date: 890426 Trans2 Recv Date: Not reported TSD Site Recv Date: 890426 Part A Recv Date: 890607 Part B Recv Date: 890526

 Generator EPA ID:
 NYD065193518

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 01865

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Direction Distance

Elevation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: INA1386482 Manifest Status: Not reported Trans1 State ID: IND058484114 Trans2 State ID: Not reported Generator Ship Date: 11/30/1999 Trans1 Recv Date: 11/30/1999 Trans2 Recv Date: Not reported TSD Site Recv Date: 12/04/1999 Part A Recy Date: Not reported Part B Recv Date: Not reported NYD065193518 Generator EPA ID: Trans1 EPA ID: IND093219012 Trans2 EPA ID: Not reported TSDF ID: Not reported

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00100
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00900
Units: P - Pounds
Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00200
Units: P - Pounds
Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 01.00
Year: 99
Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported

Direction Distance Elevation

Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Discr Quantity Ind: Not reported Not reported Discr Type Ind: Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: TXR000050930 Trans2 State ID: NJD071629976 2008-09-10 Generator Ship Date: 2008-09-10 Trans1 Recy Date: Trans2 Recv Date: 2008-09-18 TSD Site Recv Date: 2008-09-19 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD065193518 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported KYD053348108 TSDF ID: Waste Code: Not reported Quantity: 300.0 Units: P - Pounds Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 001302895SKS

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num: Not reported
Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: H061

CTB0042181 Document ID: Manifest Status: Completed copy Trans1 State ID: W37985/NY Trans2 State ID: Not reported Generator Ship Date: 870615 870615 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 870615 870617 Part A Recv Date: Part B Recv Date: 870624

Direction Distance

Elevation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

 Generator EPA ID:
 NYD065193518

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 02650

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTC0229489

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC Trans1 State ID: 77282D(NY

Trans2 State ID: Not reported 890712 Generator Ship Date: Trans1 Recy Date: 890712 Trans2 Recv Date: Not reported TSD Site Recv Date: 890713 Part A Recv Date: 890816 Part B Recv Date: 890810 NYD065193518 Generator EPA ID: Trans1 EPA ID: NYD000708271 Trans2 EPA ID: Not reported TSDF ID: CTD072138969

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00150

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 100
Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported

Direction Distance Elevation

nce EDR ID Number ation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported

Document ID: NYA7606701

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 45873V(NY Trans2 State ID: Not reported Generator Ship Date: 891215 Trans1 Recv Date: 891215 Trans2 Recv Date: Not reported TSD Site Recv Date: 891220 Part A Recv Date: 900118 Part B Recv Date: 891229

 Generator EPA ID:
 NYD065193518

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD043815703

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00330

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 006 Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF0163844 Manifest Status: Completed copy Trans1 State ID: 75126ZNY Trans2 State ID: Not reported 930402 Generator Ship Date: Trans1 Recv Date: 930402 Trans2 Recv Date: Not reported TSD Site Recv Date: 930402 930409 Part A Recv Date: Part B Recv Date: 930416

 Generator EPA ID:
 NYD065193518

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

 Waste Code:
 F003 - UNKNOWN

Quantity: 17320

Direction Distance

Elevation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Units: P - Pounds

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF0249883 Manifest Status: Completed copy Trans1 State ID: 77282DNY Trans2 State ID: Not reported Generator Ship Date: 940517 Trans1 Recv Date: 940517 Trans2 Recy Date: Not reported TSD Site Recv Date: 940520 Part A Recv Date: Not reported 940606 Part B Recv Date:

 Generator EPA ID:
 NYD065193518

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 00200

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 100
Year: 94

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB7684092

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: Not reported Not reported Trans2 State ID: Generator Ship Date: 960129 Trans1 Recv Date: 960129 Trans2 Recv Date: 960201 TSD Site Recv Date: 960215 Part A Recy Date: 960206 Part B Recv Date: 960322 Generator EPA ID:

 Generator EPA ID:
 NYD065193518

 Trans1 EPA ID:
 MOD095038998

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 GAD093380814

Waste Code: F002 - HALO SOLV + STILL BOTTOMS FM REC OF SOLV

Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG2685078 Manifest Status: Not reported Trans1 State ID: IND058484114 Trans2 State ID: Not reported Generator Ship Date: 12/15/2003 Trans1 Recv Date: 12/15/2003 Trans2 Recv Date: Not reported TSD Site Recv Date: 12/27/2003 Part A Recv Date: Not reported Not reported Part B Recv Date: NYD065193518 Generator EPA ID: Trans1 EPA ID: IND093219012 Trans2 EPA ID: Not reported TSDF ID: VTADE668

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00900
Units: P - Pounds
Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 01.00 Year: 03 Map ID MAP FINDINGS
Direction

Distance Elevation

Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported Manifest Status: Not reported IND058484114 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 2009-03-23 2009-03-23 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 2009-04-03 Part A Recy Date: Not reported Part B Recv Date: Not reported NYD065193518 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: IND093219012 Waste Code: Not reported 1725.0 Quantity: P - Pounds Units:

Number of Containers: 5.0

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 09

Manifest Tracking Num: 000232423WAS

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
H141

Document ID:

Manifest Status:
Not reported

Trans1 State ID:
IND058484114

Trans2 State ID:
Not reported

Generator Ship Date:
2009-03-23

Trans1 Recv Date:
2009-03-23

Trans2 Recv Date:
Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GENUINE PARTS CO (Continued)

1000425170

TSD Site Recv Date: 2009-04-03 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD065193518 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: IND093219012 Waste Code: Not reported Quantity: 2070.0 Units: P - Pounds

Number of Containers: 6.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Year: 09

Manifest Tracking Num: 000232423WAS

Import Ind: Ν **Export Ind:** Ν Discr Quantity Ind: Ν Ν Discr Type Ind: Discr Residue Ind: Ν Discr Partial Reject Ind: Ν Discr Full Reject Ind: Ν

Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: H061

Document ID: NYB8094024

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 614195ME Trans2 State ID: 619001 Generator Ship Date: 960624 Trans1 Recv Date: 960624 960701 Trans2 Recv Date: TSD Site Recv Date: 960715 Part A Recv Date: Not reported Part B Recv Date: 960809 Generator EPA ID: NYD065193518 Trans1 EPA ID: MAD039322250 Trans2 EPA ID: MAD039322250

MDD980555189 Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00055

TSDF ID:

Units: G - Gallons (liquids only)* (8.3 pounds) Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass) Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 96

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported

Direction Distance Elevation

tion Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Discr Partial Reject Ind:
Discr Full Reject Ind:
Mot reported
Not reported
Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
Not reported

Document ID: ILA7627286 Manifest Status: Not reported Trans1 State ID: MAD039322250 Not reported Trans2 State ID: 03/26/1998 Generator Ship Date: Trans1 Recv Date: 03/26/1998 Trans2 Recv Date: Not reported TSD Site Recv Date: 04/13/1998 Part A Recy Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD065193518 Trans1 EPA ID: ILD000608471 Trans2 EPA ID: Not reported 1478 TSDF ID:

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: 98

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: 06

000012620WAS Manifest Status: Trans1 State ID: NYD065193518 Trans2 State ID: Not reported Generator Ship Date: IND093219012 Trans1 Recv Date: Not reported IND058484114 Trans2 Recv Date: TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

Generator EPA ID: N Trans1 EPA ID: N Trans2 EPA ID: N

Direction Distance Elevation

vation Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

TSDF ID: N Waste Code: N

Quantity: Not reported

Units: 1
Number of Containers: DM
Container Type: 345
Handling Method: P
Specific Gravity: 1
Waste Code: B

Quantity: Not reported Units: Not reported Not reported Number of Containers: Not reported Container Type: Handling Method: Not reported Specific Gravity: Not reported Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: 06

Manifest Status: 000012620WAS Trans1 State ID: NYD065193518 Trans2 State ID: Not reported IND093219012 Generator Ship Date: Trans1 Recv Date: Not reported Trans2 Recv Date: IND058484114 TSD Site Recv Date: Not reported Part A Recv Date: Not reported Part B Recv Date: Not reported

 Generator EPA ID:
 N

 Trans1 EPA ID:
 N

 Trans2 EPA ID:
 N

 TSDF ID:
 N

 Waste Code:
 N

Quantity: Not reported

Units:

Number of Containers: DM
Container Type: 345
Handling Method: P
Specific Gravity: 1
Waste Code: L

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported Handling Method: Not reported

Direction Distance Elevation

on Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Specific Gravity: Not reported Year: Not reported Not reported Manifest Tracking Num: Import Ind: Not reported **Export Ind:** Not reported Not reported Discr Quantity Ind: Not reported Discr Type Ind: Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYG2685168 Manifest Status: Not reported Trans1 State ID: UTADE668 Trans2 State ID: Not reported Generator Ship Date: 01/12/2004 Trans1 Recv Date: 01/12/2004 Trans2 Recv Date: Not reported TSD Site Recv Date: 01/28/2004 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD065193518 Trans1 EPA ID: IND058484114 Trans2 EPA ID: Not reported TSDF ID: IND093219

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00600 Units: P - Pounds Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 01.00 Year: 04

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: Not reported

Manifest Status: Not reported

Trans1 State ID: TXR000050930

Trans2 State ID: NJD071629976

Generator Ship Date: 2008-09-10

Direction Distance Elevation

Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Trans1 Recv Date: 2008-09-10 2008-09-18 Trans2 Recv Date: TSD Site Recv Date: 2008-09-19 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD065193518 Generator EPA ID: Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: KYD053348108 Waste Code: Not reported Quantity: 300.0 P - Pounds Units:

Number of Containers: 1.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 08

Manifest Tracking Num: 001302895SKS

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
Not reported

Document ID: Not reported Manifest Status: Not reported Trans1 State ID: IND058484114 Not reported Trans2 State ID: Generator Ship Date: 2009-03-23 Trans1 Recv Date: 2009-03-23 Trans2 Recv Date: Not reported TSD Site Recv Date: 2009-04-03 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD065193518 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: IND093219012 Waste Code: Not reported Quantity: 2070.0 Units: P - Pounds

Number of Containers: 6.0

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1.0 Year: 09

Manifest Tracking Num: 000232423WAS

Import Ind: N Export Ind: N Discr Quantity Ind: N

Direction Distance Elevation

n Site Database(s) EPA ID Number

GENUINE PARTS CO (Continued)

1000425170

EDR ID Number

Discr Type Ind:

N
Discr Residue Ind:
N
Discr Partial Reject Ind:
N
Discr Full Reject Ind:
N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported
Not reported

Not reported Document ID: Manifest Status: Not reported Trans1 State ID: IND058484114 Trans2 State ID: Not reported 2009-03-23 Generator Ship Date: Trans1 Recv Date: 2009-03-23 Trans2 Recy Date: Not reported 2009-04-03 TSD Site Recv Date: Part A Recv Date: Not reported Not reported Part B Recv Date: Generator EPA ID: NYD065193518 Trans1 EPA ID: Not reported Trans2 EPA ID: Not reported TSDF ID: IND093219012 Waste Code: Not reported Quantity: 1725.0 P - Pounds Units:

Number of Containers: 5.0

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 1.0
Year: 09

Manifest Tracking Num: 000232423WAS

Import Ind: N
Export Ind: N
Discr Quantity Ind: N
Discr Type Ind: N
Discr Residue Ind: N
Discr Partial Reject Ind: N
Discr Full Reject Ind: N

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
H141

Click this hyperlink while viewing on your computer to access

Kz(

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

R86 NAPA AUTO PARTS MANIFEST S109783048 N/A

North 301 WOLF RD 1/8-1/4 LATHAM, NY 12110

0.208 mi.

1098 ft. Site 4 of 29 in cluster R

Relative:

CT MANIFEST:

Higher

Waste:

CTF0255515 Manifest No: Actual: Waste Occurence: 298 ft.

UNNA: 3077 Hazard Class: ORM-E

HAZARDOUS WASTE SOLID US Dot Description:

No of Containers: 003 Container Type: DM Quantity: 1200 Weight/Volume: Ρ Additional Description: Υ Handling Code: D81 Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0255515

Waste Occurence: D008 EPA Waste Code: Recycled Waste?:

Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Detail:

1994 Year:

Manifest ID: CTF0255515 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES, INC.

TSDF Address: 130 FREIGHT STREET TSDF City,St,Zip: WATERBURY, CT 06702

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 1/11/1994 Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL CORPORATION,

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Not reported Trans 2 Name: Trans 2 Address: Not reported Trans 2 City, St, Zip: СТ

Trans 2 Country: USA Trans 2 Phone: Not reported EPA ID: NYD065193518 Generator Phone: 5187853781

Generator Mailing Addr: 301 WOLF ROAD EXTENSION

Generator Mailing Town: LATHAM Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: **USA**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NAPA AUTO PARTS (Continued)

S109783048

Special Handling: Yes Discrepancies: No Date Shipped: 1/11/1994 Date Received: 1/12/1994 Last modified date: 4/26/2004 Last modified by: IG

Comments: Not reported

Waste:

Manifest No: CTF0163849

Waste Occurence:

UNNA: 3077 Hazard Class: ORM-E

US Dot Description: HAZARDOUS WASTE SUBSTANCE

No of Containers: 002 Container Type: DM Quantity: 600 Weight/Volume: Ρ Additional Description: Υ Handling Code: NY=L Date Record Was Last Modified: 4/27/2004 DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0163849

Waste Occurence: EPA Waste Code: D008 Recycled Waste?: Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Detail:

1993 Year: Manifest ID: CTF0163849 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES, INC.

TSDF Address: 130 FREIGHT STREET TSDF City,St,Zip: WATERBURY, CT 06702

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 4/8/1993 Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL CORPORATION,

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Not reported Trans 2 EPA ID: Trans 2 Name: Not reported Trans 2 Address: Not reported Trans 2 City, St, Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported EPA ID: NYD065193518 Generator Phone: 5187853781

301 WOLF ROAD EXTENSION Generator Mailing Addr:

Direction Distance

Elevation Site Database(s) EPA ID Number

NAPA AUTO PARTS (Continued)

S109783048

EDR ID Number

Generator Mailing Town: **LATHAM** Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Yes Discrepancies: No Date Shipped: 4/8/1993 Date Received: 4/12/1993 Last modified date: 4/27/2004 Last modified by: IG

Comments: Not reported

Waste:

Manifest No: CTC0229489

Waste Occurence: 1
UNNA: 9189
Hazard Class: ORM-E

US Dot Description: HAZARDOUS WASTE LIQUID NOS

No of Containers: 003
Container Type: DM
Quantity: 150
Weight/Volume: G
Additional Description: Y
Handling Code: S01
Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTC0229489

Waste Occurence: 1
EPA Waste Code: D008
Recycled Waste?: F
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Detail:

 Year:
 1989

 Manifest ID:
 CTC0229489

 TSDF EPA ID:
 CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES, INC.

TSDF Address: 130 FREIGHT STREET TSDF City,St,Zip: WATERBURY, CT 06702

TSDF Country: USA
TSDF Telephone: Not reported
Transport Date: 7/12/1989
Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL CORPORATION,

Transporter Country: USA

Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City.St.Zip: CT

Trans 2 City,St,Zip: CT
Trans 2 Country: USA

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NAPA AUTO PARTS (Continued)

S109783048

S103482333

N/A

NY Spills

NY Hist Spills

Trans 2 Phone: Not reported NYD065193518 EPA ID: Generator Phone: 5187853781

Generator Mailing Addr: 301 WOLF ROAD EXTENSION

Generator Mailing Town: LATHAM Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Yes Discrepancies: No Date Shipped: 7/12/1989 Date Received: 7/13/1989 Last modified date: 4/27/2004 Last modified by: IG

Comments: Not reported

R87 NIMO BACKHOE DRUM NWAY LN NNW 6 NORTHWAY LN @ MK SYS? 1/8-1/4

LATHAM, NY

0.210 mi.

1110 ft. Site 5 of 29 in cluster R

NY Spills: Relative:

Higher

Site ID: 251017 Facility Addr2: Not reported

Actual: Facility ID: 9612534 299 ft. Spill Number: 9612534 Facility Type: ER

SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 1/21/1997 1/21/1997 Reported to Dept: CID: 297

Spill Cause: Human Error Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Responsible Party Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/21/1997 Remediation Phase: 0 Date Entered In Computer: 1/21/1997 Spill Record Last Update: 3/14/2008

Spiller Name: **BILL CAMPBELL** Spiller Company: NIAGRA MOHAWK NIMO [SP]

Spiller Address: 5215 WESTERN AV Spiller City,St,Zip: GUILDERLAND, NY 12009-

Spiller Company:

BILL CAMPBELL Contact Name: Contact Phone: (518) 356-6471

DEC Region:

Direction Distance

Elevation Site Database(s) EPA ID Number

NIMO BACKHOE DRUM NWAY LN (Continued)

S103482333

EDR ID Number

DER Facility ID: 205741

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 1/28/97 - NIMO DID CLEAN UP, NO DEC RESPONSE. 9507376.

Remarks: A NIMO BACKHOE HIT A 55 GALLON DRUM OF WASTE OIL AND KNOCKED OVER THE

CONTAINER - SPILL IS BEING CLEANED UP WITH ABSORBANTS

Material:

 Site ID:
 251017

 Operable Unit ID:
 1044040

 Operable Unit:
 01

 Material ID:
 341177

 Material Code:
 0022

Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons

Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 9612534 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 01/21/1997 14:30 Reported to Dept Date/Time: 01/21/97 15:00

SWIS: 01

Spiller Name: NIAGRA MOHAWK [NIAGARA]

Spiller Contact:
Spiller Phone:
Spiller Contact:
Spiller Contact:
Spiller Contact:
Spiller Phone:
Spiller Phone:
Spiller Address:
Spiller Address:
Spiller City, St, Zip:
Spiller Contact:
Spille

Spill Cause: Human Error Reported to Dept: On Land Water Affected: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO BACKHOE DRUM NWAY LN (Continued)

S103482333

Spill Source:

Spill Notifier: Responsible Party PBS Number: Not reported

Cleanup Ceased: Cleanup Meets Std: False Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** // Invstgn Complete: // **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 01/21/97 Date Spill Entered In Computer Data File: Not reported

Update Date: 03/21/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: False WASTE OIL Material: WASTE OIL Class Type: Times Material Entry In File: 9509 CAS Number: Not reported Last Date: 19940927

1/28/97 - NIMO DID CLEAN UP, NO DEC RESPONSE. 9507376. DEC Remarks:

A NIMO BACKHOE HIT A 55 GALLON DRUM OF WASTE OIL AND KNOCKED OVER THE CONTAINER Remark:

- SPILL IS BEING CLEANED UP WITH ABSORBANTS

R88 **MLB INDUSTRIES INC** UST U001844843 North **3 NORTHWAY LANE HIST UST** N/A

1/8-1/4 LATHAM, NY 12110 0.210 mi.

1111 ft. Site 6 of 29 in cluster R

Relative:

4-021601 Higher Facility Id: Region: STATE

Actual: DEC Region: 298 ft.

Site Status: Unregulated

PBS Program Type: **Expiration Date:** N/A UTM X: 598809 **NY Spills**

NY Hist Spills

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MLB INDUSTRIES INC (Continued)

U001844843

UTM Y: 4732051 Site ID: 34976

Tank Number: 001 Tank ID: 92742

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1968 Capacity Gallons: 550 Tightness Test Method: NN

Next Test Date: Not reported Not reported Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True **TRANSLAT** Modified By: Last Modified: 3/4/2004

Equipment Records:

A00 - Tank Internal Protection - None

J02 - Dispenser - Suction

H00 - Tank Leak Detection - None D02 - Pipe Type - Galvanized Steel F00 - Pipe External Protection - None C00 - Pipe Location - No Piping

100 - Overfill - None

G00 - Tank Secondary Containment - None B00 - Tank External Protection - None

Tank Number: 002 Tank ID: 92743

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1968 Capacity Gallons: 2000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron F00 - Pipe External Protection - None

A00 - Tank Internal Protection - None

J02 - Dispenser - Suction 100 - Overfill - None

C00 - Pipe Location - No Piping H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MLB INDUSTRIES INC (Continued)

U001844843

B00 - Tank External Protection - None

Tank Number: 003 Tank ID: 92744

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1973 Capacity Gallons: 3000 Tightness Test Method: NN

Next Test Date: Not reported Not reported Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True **TRANSLAT** Modified By: Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None

J02 - Dispenser - Suction

A00 - Tank Internal Protection - None D01 - Pipe Type - Steel/Carbon Steel/Iron

100 - Overfill - None

F00 - Pipe External Protection - None C00 - Pipe Location - No Piping

G00 - Tank Secondary Containment - None B00 - Tank External Protection - None

Affiliation Records:

Site Id: 34976

On-Site Operator Affiliation Type: Company Name: MLB INDUSTRIES INC

Contact Type: Not reported

Contact Name: MLB INDUSTRIES INC

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

(518) 785-1371 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 34976

Affiliation Type: **Emergency Contact** Company Name: MLB INDUSTRIES INC

Contact Type: Not reported

DONALD R. BROCKWEHL Contact Name:

Address1: Not reported Address2: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

MLB INDUSTRIES INC (Continued)

U001844843

EDR ID Number

City: Not reported

State: NN Zip Code: Not reported

Country Code: 001

Phone: (518) 785-9826
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 34976 Affiliation Type: Owner

Company Name: MLB INDUSTRIES INC

Contact Type: Not reported
Contact Name: Not reported
Address1: 3 NORTHWAY LANE

Address2: Not reported City: LATHAM State: NY Zip Code: 12110 Country Code: 001

Phone: (518) 785-1371
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site ld: 34976 Affiliation Type: Mail Contact

Company Name: MLB INDUSTRIES INC

Contact Type: Not reported
Contact Name: Not reported

Address1: 3 NORTHWAY LANE

 Address2:
 Not reported

 City:
 LATHAM

 State:
 NY

 Zip Code:
 12110

 Country Code:
 001

Phone: (518) 785-1371
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-021601 SPDES Number: Not reported

Emergency Contact: DONALD R. BROCKWEHL

Emergency Telephone: (518) 785-9826 Operator: MLB INDUSTRIES INC

Operator Telephone: (518) 785-1371

Owner Name: MLB INDUSTRIES INC
Owner Address: 3 NORTHWAY LANE
Owner City,St,Zip: LATHAM, NY 12110

Direction Distance

Elevation Site Database(s) EPA ID Number

MLB INDUSTRIES INC (Continued)

U001844843

EDR ID Number

Owner Telephone: (518) 785-1371
Owner Type: Not reported
Owner Subtype: Not reported

Mailing Name: MLB INDUSTRIES INC Mailing Address: 3 NORTHWAY LANE

Mailing Address 2: Not reported
Mailing City, St, Zip: LATHAM, NY 12110
Mailing Contact: Not reported
Mailing Telephone: (518) 785-1371
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126 Old PBS Number: Not reported Facility Type: Not reported Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 12/02/1986 **Expiration Date:** 12/02/1991 Renew Flag: False Renewal Date: Not reported **Total Capacity:** 0

FAMT: True

Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing

Tank Screen: 0
Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26

Town or City: 26 Region: 4

Tank ld: 001

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19681201 Capacity (gals): 550

Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported

Pipe Type: GALVANIZED STEEL

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: Minor Data Missing

Direction Distance

Elevation Site Database(s) EPA ID Number

MLB INDUSTRIES INC (Continued)

U001844843

EDR ID Number

Date Closed: Not reported
Test Method: Not reported
Deleted: False
Updated: False
Lat/long: Not reported

Tank ld: 002

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19681201 Capacity (gals): 2000

LEADED GASOLINE Product Stored: Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported STEEL/IRON Pipe Type: Pipe Internal: Not reported Not reported Pipe External: Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Not reported Date Tested: Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

Tank ld: 003

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19731201 Capacity (gals): 3000

Deleted:

LEADED GASOLINE Product Stored: Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Not reported Pipe Location: STEEL/IRON Pipe Type: Not reported Pipe Internal: Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported

False

Direction Distance

Elevation Site Database(s) EPA ID Number

MLB INDUSTRIES INC (Continued)

U001844843

EDR ID Number

Updated: False Lat/long: Not reported

NY Spills:

Site ID: 61809 Facility Addr2: Not reported Facility ID: 0107771 Spill Number: 0107771 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 10/22/2001 Spill Date: 10/30/2001 Reported to Dept: CID: 21 Spill Cause: Other Water Affected: Not reported

Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/27/2002

Remediation Phase: 0

Date Entered In Computer: 10/30/2001 Spill Record Last Update: 10/27/2006 Spiller Name: OWNER

Spiller Company: MLB INDUSTRIES
Spiller Address: 3 NORTHWAY LANE

Spiller City,St,Zip: LATHAM, NY
Spiller Company: 001
Contact Name: CALLER
Contact Phone: Not reported
DEC Region: 4

DER Facility ID: 60017

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 8809194? 11/02/2001 - Contaminated soil found by old tank excavation. Believe that tanks were filled with sand and closed in place. wtc 12/18/2001 - Three UST removed. They were filled with sand back in 1988. Some contaminated soil found and the sand inside the tanks is being taken to ESMI. Bottom and sidewall samples will be taken. wtc 02/27/2002 - Received closure report from Knickerbocker Development Corporation. A total of 450 tons of contaminated soil was

removed and disposed of at ESMI. Minor soil and groundwater contamination remains but there is no environmental or health concerns. No further remediation is required at this time. wtc

Remarks: old tank site. contaminated soil.

Material:

 Site ID:
 61809

 Operable Unit ID:
 845014

 Operable Unit:
 01

 Material ID:
 529033

Direction Distance

Elevation Site Database(s) EPA ID Number

MLB INDUSTRIES INC (Continued)

Material Code: 0009
Material Name: Gasoline
Case No.: Not reported
Material FA: Petroleum

Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Percourse Affected: Not report

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 0107771 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 10/22/2001 12:00 Spill Date/Time: Reported to Dept Date/Time: 10/30/01 14:05

SWIS: 01

Spiller Name: MLB INDUSTRIES

Spiller Contact:

Spiller Phone:

Spiller Contact:

Spiller Contact:

Spiller Phone:

OWNER

(518) 785-1378

CALLER

() -

Spiller Address: 3 NORTHWAY LANE

Spiller City,St,Zip: LATHAM, NY
Spill Cause: Other
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 01

Spill Notifier: Responsible Party

PBS Number: 4-021601
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: // Enforcement Date: // Invstgn Complete: // U001844843

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MLB INDUSTRIES INC (Continued)

U001844843

UST Involvement: True

Known release that creates potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 10/30/01 Date Spill Entered In Computer Data File: Not reported

Update Date: 12/18/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Quantity Recovered:

Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

8809194? 11/02/2001 - Contaminated soil found by old tank excavation. DEC Remarks:

> Believe that tanks were filled with sand and closed in place. wtc 12/18/2001 - Three UST removed. They were filled with sand back in 1988. Some contaminated

soil found and the sand inside the tanks is being taken to ESMI. Bottom and

sidewall samples will be taken. wtc

old tank site. contaminated soil. Remark:

TRANS-BORDERS FREIGHT SYSTEMS R89

RCRA-NonGen **3 NORTHWAY LN** LATHAM, NY 12110 **MANIFEST**

1/8-1/4 0.210 mi.

North

1111 ft. Site 7 of 29 in cluster R

Relative:

RCRA-NonGen:

Date form received by agency: 01/01/2007 Higher

Facility name: TRANS-BORDERS FREIGHT SYSTEMS

Actual: 298 ft.

Facility address: 3 NORTHWAY LN LATHAM, NY 12110

EPA ID: NYR000094532 Mailing address: **NORTHWAY LN** LATHAM, NY 12110

Not reported

Contact: Contact address: **NORTHWAY LN** LATHAM, NY 12110

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02 1004762200

FINDS

NYR000094532

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

TRANS-BORDERS FREIGHT SYSTEMS (Continued)

1004762200

EDR ID Number

Land type: Private
Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: THOMAS ECKERT
Owner/operator address: 3 NORTHWAY LANE FL 1
LATHAM, NY 12110

Owner/operator country: US

Owner/operator telephone: (518) 785-1371

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/2001
Owner/Op end date: Not reported

Owner/operator name: THOMAS ECKERT
Owner/operator address: 3 NORTHWAY LANE FL 1

LATHAM, NY 12110

Owner/operator country: US

Owner/operator telephone: (518) 785-1371
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 01/01/2001
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: Unknown Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: Unknown On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: Unknown Used oil processor: Unknown User oil refiner: Unknown Used oil fuel marketer to burner: Unknown Used oil Specification marketer: Unknown Used oil transfer facility: Unknown Used oil transporter: Unknown

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: TRANS-BORDERS FREIGHT SYSTEMS

Classification: Not a generator, verified

Date form received by agency: 04/02/2004

Facility name: TRANS-BORDERS FREIGHT SYSTEMS
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 05/15/2002

Facility name: TRANS-BORDERS FREIGHT SYSTEMS

Site name: MLB INDUSTRIES INC

Direction Distance

Elevation Site Database(s) EPA ID Number

TRANS-BORDERS FREIGHT SYSTEMS (Continued)

1004762200

EDR ID Number

Classification: Large Quantity Generator

Date form received by agency: 02/16/2001

Facility name: TRANS-BORDERS FREIGHT SYSTEMS

Site name: M L B INDUSTRIES
Classification: Small Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: SR - 371.1(f)
Area of violation: Listing - General
Date violation determined: 05/23/2002
Date achieved compliance: 06/10/2002
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 05/24/2002
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 07/15/2003

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

State

Evaluation date: 05/23/2002

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Listing - General Date achieved compliance: 06/10/2002 Evaluation lead agency: State

FINDS:

Registry ID: 110004567371

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYR000094532

Country: USA

Mailing Name: MLB INDUSTRIES
Mailing Contact: FRANK D RICUPERO
Mailing Address: 3 NORTHWAY LN FL 1

Mailing Address 2: Not reported Mailing City: LATHAM

Direction Distance

Elevation Site Database(s) EPA ID Number

TRANS-BORDERS FREIGHT SYSTEMS (Continued)

1004762200

EDR ID Number

Mailing State: NY
Mailing Zip: 12110
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 518-785-1371

Document ID: NJA3236491 Manifest Status: Not reported Trans1 State ID: NY0001031814 Trans2 State ID: NJD003812047 Generator Ship Date: 03/07/2001 Trans1 Recv Date: 03/07/2001 Trans2 Recv Date: 03/15/2001 TSD Site Recv Date: 03/15/2001 Part A Recv Date: Not reported Not reported Part B Recv Date: NYR000094532 Generator EPA ID: Trans1 EPA ID: NJD002200046 Trans2 EPA ID: Not reported 40317AE TSDF ID:

Waste Code: D018 - BENZENE 0.5 MG/L TCLP

003

Quantity: 00150

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 00.80

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00350
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00280

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 00.80 Year: 01

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance Elevation

on Site Database(s) EPA ID Number

TRANS-BORDERS FREIGHT SYSTEMS (Continued)

1004762200

EDR ID Number

Document ID: NJA3236492 Manifest Status: Not reported NY0001031814 Trans1 State ID: NJD003812047 Trans2 State ID: Generator Ship Date: 03/07/2001 Trans1 Recv Date: 03/07/2001 Trans2 Recv Date: 03/15/2001 TSD Site Recv Date: 03/15/2001 Part A Recv Date: Not reported Part B Recv Date: Not reported NYR000094532 Generator EPA ID: Trans1 EPA ID: NJD002200046 Trans2 EPA ID: Not reported TSDF ID: 40317AE

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 01100 Units: P - Pounds Number of Containers: 002

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00900
Units: P - Pounds
Number of Containers: 001

Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 01.00 Year: 01

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

 Document ID:
 NJA3236493

 Manifest Status:
 Not reported

 Trans1 State ID:
 NY0001031814

 Trans2 State ID:
 NJD003812047

 Generator Ship Date:
 03/07/2001

 Trans1 Recv Date:
 03/07/2001

 Trans2 Recv Date:
 03/15/2001

Direction Distance

Elevation Site Database(s) EPA ID Number

TRANS-BORDERS FREIGHT SYSTEMS (Continued)

1004762200

EDR ID Number

TSD Site Recv Date: 03/15/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYR000094532
Trans1 EPA ID: NJD002200046
Trans2 EPA ID: Not reported
TSDF ID: 40317AE

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 01.00 Year: 01

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

R90 ENGINE SYSTEMS CO
NNW 6 NORTHWAY LANE
1/8-1/4 LATHAM, NY 12110

0.211 mi. 1112 ft. Site 8 of 29 in cluster R

Relative: RCRA-LQG:

Higher Date form received by agency: 02/27/2008

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Actual: Facility address: 6 NORTHWAY LANE

LATHAM, NY 12110
EPA ID: NYD982278764
Mailing address: NORTHWAY I N

Mailing address: NORTHWAY LN LATHAM, NY 12110

Contact: EDWARD J MONACO
Contact address: Not reported

Not reported

Contact country: Not reported
Contact telephone: (518) 786-2337

Contact email: ED.MONACO@TRANS.GE.COM

EPA Region: 02 Land type: Private

Classification: Large Quantity Generator

Description: Handler: generates 1,000 kg or more of hazardous waste during any

calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1

RCRA-LQG

MANIFEST

MANIFEST

FINDS

1000118695

NYD982278764

Map ID MAP FINDINGS
Direction

Distance Elevation

Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: GE TRANSPORTATION

Owner/operator address: E LAKE RD ERIE, PA 16531

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private Owner/Operator Type: Owner Owner/Op start date: 11/19/2001 Owner/Op end date: Not reported

Owner/operator name: GE TRANSPORTATION

Owner/operator address: E LAKE RD

ERIE, PA 16531

Owner/operator country: US

Owner/operator telephone: Not reported Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 11/19/2001
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No Mixed waste (haz. and radioactive): No Recycler of hazardous waste: No Transporter of hazardous waste: No Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: No Furnace exemption: No Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Universal Waste Summary:

Waste type: Batteries Accumulated waste on-site: No

Generated waste on-site: Not reported

Waste type: Lamps Accumulated waste on-site: No

Generated waste on-site: Not reported

Waste type: Pesticides Accumulated waste on-site: No

Direction Distance

Elevation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Generated waste on-site: Not reported

Waste type: Thermostats

Accumulated waste on-site: No

Generated waste on-site: Not reported

Historical Generators:

Date form received by agency: 01/01/2007

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Classification: Large Quantity Generator

Date form received by agency: 03/02/2006

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Classification: Large Quantity Generator

Date form received by agency: 03/01/2006

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Classification: Large Quantity Generator

Date form received by agency: 02/24/2004

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: GE TRANSPORTATION SYSTEMS ENGINE SYSTEMS

Classification: Large Quantity Generator

Date form received by agency: 04/01/2003

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: GE TRANSPORTATION SYSTEMS

Classification: Large Quantity Generator

Date form received by agency: 03/21/2002

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: GE ENGINE SYSTEMS
Classification: Large Quantity Generator

Date form received by agency: 01/01/2001

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: ENGINE SYSTEMS
Classification: Large Quantity Generator

Date form received by agency: 07/21/1999

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: M K ENGINE SYSTEMS CO
Classification: Large Quantity Generator

Date form received by agency: 04/23/1998

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: ENGINE SYSTEMS CO
Classification: Large Quantity Generator

Date form received by agency: 02/01/1996

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: M K ENGINE SYSTEMS CO
Classification: Large Quantity Generator

Date form received by agency: 02/23/1995

Facility name: GE TRANSPORTATION ENGINE SYSTEMS

Site name: M K ENGINE SYSTEMS CO

Direction Distance

EDR ID Number Elevation **EPA ID Number** Site Database(s)

ENGINE SYSTEMS CO (Continued)

1000118695

Classification: Small Quantity Generator

Date form received by agency: 03/31/1994

GE TRANSPORTATION ENGINE SYSTEMS Facility name:

Site name:

Classification: Large Quantity Generator

Hazardous Waste Summary:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code:

Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS

CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH. IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS, HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH. IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE

DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Waste code: D004 Waste name: **ARSENIC**

D006 Waste code: CADMIUM Waste name:

Waste code: D007

Waste name: **CHROMIUM**

Waste code: D008 Waste name: **LEAD** Waste code: D018 Waste name: **BENZENE**

Waste code: D035

Waste name: METHYL ETHYL KETONE

Waste code: F003

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL

ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL

ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT

MIXTURES.

Waste code: F005

Direction Distance Elevation

evation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL

KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE,

2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF

THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Biennial Reports:

Last Biennial Reporting Year: 2009

Annual Waste Handled:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 1064

Waste code: D002

Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS

CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE

DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Amount (Lbs): 35720.4

Waste code: D004
Waste name: ARSENIC
Amount (Lbs): 9897.4

Waste code: D006
Waste name: CADMIUM
Amount (Lbs): 35720.4

Waste code: D007
Waste name: CHROMIUM
Amount (Lbs): 45617.8

Waste code: D008 Waste name: LEAD Amount (Lbs): 35720.4

Waste code: D018
Waste name: BENZENE
Amount (Lbs): 1064

Waste code: D035

Waste name: METHYL ETHYL KETONE

Amount (Lbs): 1064

Waste code: F003

Direction Distance Elevation

evation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL

ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT

MIXTURES.

Amount (Lbs): 1526

Waste code: F005

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL

KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE,

2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS

LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF

THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Amount (Lbs): 1526

Facility Has Received Notices of Violations:

Regulation violated: Not reported

Area of violation: State Statute or Regulation

Date violation determined: 10/08/2008
Date achieved compliance: 10/17/2008
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 10/21/2008

Enf. disposition status: Action Satisfied (Case Closed)
Enf. disp. status date: 11/19/2008

Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: LDR - General

Date violation determined: 10/08/2008

Date achieved compliance: 11/17/2008 Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 10/21/2008

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 11/19/2008
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: TSD IS-Contingency Plan and Emergency Procedures

Date violation determined: 10/08/2008
Date achieved compliance: 10/17/2008
Violation lead agency: State

Distance

Elevation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 10/21/2008

Enf. disposition status: Action Satisfied (Case Closed)

Enf. disp. status date: 11/19/2008
Enforcement lead agency: State
Proposed penalty amount: Not reported
Paid penalty amount: Not reported
Not reported

Regulation violated: SR - 372.2(b)(2)(i) & (ii)
Area of violation: Generators - Manifest

Date violation determined: 11/10/2004
Date achieved compliance: 11/24/2004
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 11/24/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 374-3.2(d)(4)(i) & (f)(1)
Area of violation: Generators - General

Date violation determined: 11/10/2004
Date achieved compliance: 12/13/2004
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 11/24/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 372.2(a)(8)(i)('a')
Area of violation: Generators - General

Date violation determined: 11/10/2004
Date achieved compliance: 11/10/2004
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 11/24/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State

Proposed penalty amount: Not reported Final penalty amount: Not reported Paid penalty amount: Not reported

Regulation violated: SR - 372.2(a)(8)(ii)
Area of violation: Generators - General

Date violation determined: 11/10/2004
Date achieved compliance: 11/10/2004
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Map ID MAP FINDINGS Direction

Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

Paid penalty amount:

1000118695

Enforcement action date: 11/24/2004 Enf. disposition status: Not reported Enf. disp. status date: Not reported Enforcement lead agency: State Proposed penalty amount: Not reported Final penalty amount: Not reported

SR - 373-3.3(f) Regulation violated: Area of violation: Generators - General

Not reported

Date violation determined: 11/10/2004 Date achieved compliance: 12/13/2004 Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 11/24/2004 Enf. disposition status: Not reported Enf. disp. status date: Not reported Enforcement lead agency: State Proposed penalty amount: Not reported Final penalty amount: Not reported Paid penalty amount: Not reported

SR - 372, 373-1 Regulation violated: Area of violation: Generators - General

Date violation determined: 07/29/2002 12/06/2002 Date achieved compliance: Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 10/01/2002 Enf. disposition status: Not reported Enf. disp. status date: Not reported Enforcement lead agency: State

Proposed penalty amount: Not reported Final penalty amount: Not reported Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Manifest

Date violation determined: 10/25/1999 Date achieved compliance: 11/02/1999 Violation lead agency: State

WRITTEN INFORMAL Enforcement action:

Enforcement action date: 11/02/1999 Enf. disposition status: Not reported Enf. disp. status date: Not reported Enforcement lead agency: State

Proposed penalty amount: Not reported Final penalty amount: Not reported Paid penalty amount: Not reported

Regulation violated: Not reported Area of violation: Generators - General

Date violation determined: 10/25/1999 11/02/1999 Date achieved compliance: Violation lead agency: State

WRITTEN INFORMAL Enforcement action:

Enforcement action date: 11/02/1999

Direction Distance

Elevation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Enf. disposition status:

Enf. disp. status date:

Enforcement lead agency:

Proposed penalty amount:

Final penalty amount:

Paid penalty amount:

Not reported

Not reported

Not reported

Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 10/25/1999
Date achieved compliance: Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 11/02/1999
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 10/08/2008

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: LDR - General Date achieved compliance: 11/17/2008 Evaluation lead agency: State

Evaluation date: 10/08/2008

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE Area of violation: TSD IS-Contingency Plan and Emergency Procedures Date achieved compliance: 10/17/2008

Date achieved compliance: 10/17/ Evaluation lead agency: State

Evaluation date: 10/08/2008

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: State Statute or Regulation

Date achieved compliance: 10/17/2008 Evaluation lead agency: State

Evaluation date: 10/03/2006

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Not reported Date achieved compliance: Not reported Evaluation lead agency: State

Evaluation date: 11/10/2004

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 12/13/2004 Evaluation lead agency: State

Evaluation date: 11/10/2004

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Manifest

Date achieved compliance: 11/24/2004 Evaluation lead agency: State Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Evaluation date: 11/10/2004

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 11/10/2004

Evaluation lead agency: State

Evaluation date: 07/29/2002

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 12/06/2002 Evaluation lead agency: State

Evaluation date: 10/25/1999

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - Manifest

Date achieved compliance: 11/02/1999 Evaluation lead agency: State

Evaluation date: 10/25/1999

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 11/02/1999 Evaluation lead agency: State

Evaluation date: 10/25/1999

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: LDR - General Date achieved compliance: 11/02/1999 Evaluation lead agency: State

Evaluation date: 02/23/1993

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

State

FINDS:

Registry ID: 110000897664

Environmental Interest/Information System

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department

Direction Distance Elevation

Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Not reported

NJ MANIFEST:

 Manifest Code:
 003345398JJK

 EPA ID:
 NYD982278764

 Date Shipped:
 9/8/2007

TSDF EPA ID: NJD002385730 Transporter EPA ID: NYD000708271 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 9/8/20

Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 9/10/2 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: Not reported Reference Manifest Number: Not reported

Was Load Rejected (Y/N): No

Reason Load Was Rejected: Not reported

Waste Code: D002

Date Trans2 Transported Waste:

Manifest Year: 2007 New Jersey Manifest Data

Quantity: 3080 Unit: G Hand Code: H08

Manifest Code: 003735128JJK EPA ID: NYD982278764 Date Shipped: 6/30/2008 TSDF EPA ID: NJD002385730 Transporter EPA ID: NYD000708271 Transporter 2 EPA ID: Not reported Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Transporter 5 EPA ID: Not reported Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 6/30/2008

Map ID MAP FINDINGS
Direction

Distance Elevation

n Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Date Trans2 Transported Waste: Not reported Not reported Date Trans3 Transported Waste: Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Not reported Date Trans7 Transported Waste: Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 6/30/2008 Tranporter 1 Decal: Not reported Not reported Tranporter 2 Decal: Data Entry Number: Not reported Reference Manifest Number: Not reported Was Load Rejected (Y/N):

Reason Load Was Rejected: Not reported

Waste Code: D002

Manifest Year: 2008 New Jersey Manifest Data

Quantity: 2867 Unit: G Hand Code: H081

Manifest Code: NJA2922562 EPA ID: NYD982278764 Date Shipped: 20041209 TSDF EPA ID: NJD002385730 Transporter EPA ID: NYD000708271 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 041209 Date Trans2 Transported Waste: 000000 Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Not reported Date Trans7 Transported Waste: Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 041209 Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: 01190525 Reference Manifest Number: Not reported Was Load Rejected (Y/N): Reason Load Was Rejected: Not reported

Waste Code: Not reported Manifest Year: Not reported Quantity: Not reported

Direction Distance Elevation

tance EDR ID Number vation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

Unit: Not reported Hand Code: Not reported

Manifest Code: NJA2922519 EPA ID: NYD982278764 Date Shipped: 20040821 TSDF EPA ID: NJD002385730 Transporter EPA ID: NYD000708271 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Transporter 6 EPA ID: Not reported Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Transporter 10 EPA ID: Not reported Date Trans1 Transported Waste: 040821 000000 Date Trans2 Transported Waste: Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Date Trans8 Transported Waste: Not reported Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported 040823 Date TSDF Received Waste: Tranporter 1 Decal: Not reported Tranporter 2 Decal: Not reported Data Entry Number: 09160421 Reference Manifest Number: Not reported

Was Load Rejected (Y/N): N

Reason Load Was Rejected: Not reported

Waste Code: Not reported
Manifest Year: Not reported
Quantity: Not reported
Unit: Not reported
Hand Code: Not reported

Manifest Code: NJA2922596 EPA ID: NYD982278764 Date Shipped: 20050806 TSDF EPA ID: NJD002385730 Transporter EPA ID: NYD000708271 Transporter 2 EPA ID: Not reported Transporter 3 EPA ID: Not reported Transporter 4 EPA ID: Not reported Transporter 5 EPA ID: Not reported Not reported Transporter 6 EPA ID: Transporter 7 EPA ID: Not reported Transporter 8 EPA ID: Not reported Not reported Transporter 10 EPA ID: Date Trans1 Transported Waste: 050806

MAP FINDINGS Map ID Direction

Distance Elevation Site

Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Date Trans2 Transported Waste: 000000 Date Trans3 Transported Waste: Not reported Date Trans4 Transported Waste: Not reported Date Trans5 Transported Waste: Not reported Date Trans6 Transported Waste: Not reported Date Trans7 Transported Waste: Not reported Not reported Date Trans8 Transported Waste: Date Trans9 Transported Waste: Not reported Date Trans10 Transported Waste: Not reported Date TSDF Received Waste: 050811 Not reported Tranporter 1 Decal: Tranporter 2 Decal: Not reported Data Entry Number: 09120521 Reference Manifest Number: Not reported Was Load Rejected (Y/N):

Reason Load Was Rejected: Not reported

Not reported Waste Code: Manifest Year: Not reported Quantity: Not reported Unit: Not reported Hand Code: Not reported

NY MANIFEST:

EPA ID: NYD982278764

Country: USA

Mailing Name: **ENGINE SYSTEMS** Mailing Contact: **CHESTER MELIUS 6 NORTHWAY LANE** Mailing Address:

Mailing Address 2: Not reported Mailing City: **LATHAM** Mailing State: NY Mailing Zip: 12110 Mailing Zip4: 4809 Mailing Country: USA

Mailing Phone: 518-783-0545

Document ID: NJA0913587

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 00000000 Trans2 State ID: 00000000 Generator Ship Date: 900815 Trans1 Recv Date: 900815 Trans2 Recv Date: Not reported TSD Site Recv Date: 900817 Part A Recv Date: 901025 Part B Recv Date: 900907 Generator EPA ID: NYD982278764 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00131 Units: P - Pounds Number of Containers: 002

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

1000118695

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 90 Year:

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1090842

Completed after the designated time period for a TSDF to get a copy to the DEC Manifest Status:

Trans1 State ID: NYMM7800 Trans2 State ID: S8690 Generator Ship Date: 901019 Trans1 Recv Date: 901019 Trans2 Recv Date: 901022 TSD Site Recv Date: 901024 Part A Recy Date: 901030 Part B Recv Date: 901114

Generator EPA ID: NYD982278764 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP

Quantity: 00131 P - Pounds Units: 002 Number of Containers:

DM - Metal drums, barrels Container Type:

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYB1809693

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 00000000

MAP FINDINGS Map ID Direction

Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

1000118695

Trans2 State ID: 00000000 900710 Generator Ship Date: Trans1 Recv Date: 900710 Trans2 Recv Date: Not reported TSD Site Recv Date: 900710 Part A Recv Date: 901018 Part B Recv Date: 900730 Generator EPA ID: NYD982278764

Trans1 EPA ID: NYD057770109 Trans2 EPA ID: Not reported TSDF ID: NYD057770109

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00165

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DF - Fiberboard or plastic drums (glass)

Handling Method: L Landfill. Specific Gravity: 100 Waste Code: Not reported Quantity: 00220

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00110

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 90 Manifest Tracking Num: Not reported

Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Not reported Mgmt Method Type Code:

Document ID: NJA0930032

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 00000000 00000000 Trans2 State ID: Generator Ship Date: 900726 Trans1 Recv Date: 900726 Trans2 Recv Date: 900730 TSD Site Recv Date: 900801 Part A Recv Date: 901017 Part B Recv Date: 900824

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

1000118695

Generator EPA ID: NYD982278764 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00176 P - Pounds Units: Number of Containers: 003

DM - Metal drums, barrels Container Type:

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 90 Year:

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1068992

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYHM9172 Trans2 State ID: NJDEPS869 Generator Ship Date: 901105 Trans1 Recy Date: 901105 Trans2 Recv Date: 901108 TSD Site Recv Date: 901109 Part A Recv Date: 901121 Part B Recv Date: 901214 NYD982278764 Generator EPA ID: Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00176 Units: P - Pounds

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Alt Fac RCRA Id: Not reported
Alt Fac Sign Date: Not reported
Mgmt Method Type Code: Not reported

Document ID: NJA1046490

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYEC2076 Trans2 State ID: NJDEPS869 Generator Ship Date: 901227 Trans1 Recv Date: 901227 Trans2 Recv Date: 910103 TSD Site Recv Date: 910104 Part A Recv Date: 910117 Part B Recv Date: 910131

 Generator EPA ID:
 NYD982278764

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00176 Units: P - Pounds Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1100143

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYEC2075 NJDEPS869 Trans2 State ID: Generator Ship Date: 900921 Trans1 Recv Date: 900921 Trans2 Recv Date: 900927 TSD Site Recv Date: 900928 901009 Part A Recv Date: Part B Recv Date: 901023

| Strict | S

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00176

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

1000118695

Units: P - Pounds

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 90

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1077952

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYEC2075 Trans2 State ID: NJDEPS869 Generator Ship Date: 901130 Trans1 Recv Date: 901130 Trans2 Recy Date: 901203 TSD Site Recv Date: 901204 Part A Recv Date: 910104 Part B Recv Date: 910104 Generator EPA ID: NYD982278764

Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

00131 Quantity: P - Pounds Units: Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1062548

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

TSDF ID:

1000118695

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYEC2075 NJDEPS869 Trans2 State ID: Generator Ship Date: 910327 Trans1 Recv Date: 910327 Trans2 Recv Date: 910401 TSD Site Recv Date: 910403 Part A Recy Date: 910403 Part B Recv Date: 910425 Generator EPA ID: NYD982278764 Trans1 EPA ID: ILD051060408 ILD051060408 Trans2 EPA ID:

NJD069039626 Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00131 P - Pounds Units: 002 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 91 Year:

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC1482704 Manifest Status: Completed copy Trans1 State ID: NYEC2076 Trans2 State ID: Not reported Generator Ship Date: 920410 Trans1 Recv Date: 920410 Trans2 Recv Date: Not reported TSD Site Recv Date: 920410 Part A Recv Date: 920417 Part B Recv Date: 920420 Generator EPA ID: NYD982278764

Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported NYD986872869 TSDF ID:

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00086 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Waste Code: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

1000118695

Quantity: 00036 P - Pounds Units: Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1321229 Manifest Status: Completed copy Trans1 State ID: ILP60984 Trans2 State ID: NJDEPS869 Generator Ship Date: 920311 Trans1 Recy Date: 920311 Trans2 Recv Date: 920312 TSD Site Recv Date: 920313 Part A Recv Date: 920317 Part B Recv Date: 920327 Generator EPA ID: NYD982278764 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

00086 Quantity: Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

Document ID: NJA1368965 Manifest Status: Completed copy Trans1 State ID: **NYEC2076** Trans2 State ID: NJDEPS869 Generator Ship Date: 920127 Trans1 Recv Date: 920127 Trans2 Recv Date: 920130 TSD Site Recy Date: 920131 Part A Recv Date: 920203 Part B Recv Date: 920218 NYD982278764 Generator EPA ID: Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00176 Units: P - Pounds Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 92

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF0249314 Manifest Status: Completed copy Trans1 State ID: 75126ZNY Trans2 State ID: Not reported Generator Ship Date: 940318 Trans1 Recv Date: 940318 Trans2 Recv Date: Not reported TSD Site Recv Date: 940318 Part A Recv Date: Not reported Part B Recv Date: 940330 Generator EPA ID: NYD982278764

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

Waste Code: D006 - CADMIUM 1.0 MG/L TCLP

Quantity: 07260
Units: P - Pounds
Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100

Direction Distance Elevation

nce EDR ID Number ation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

Year: 94 Manifest Tracking Num: Not reported

Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYC2568082 Document ID: Completed copy Manifest Status: NYGS5776 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 931026 Trans1 Recv Date: 931026 Trans2 Recv Date: Not reported TSD Site Recy Date: 931026 Part A Recv Date: 931123 Part B Recv Date: 931105

 Generator EPA ID:
 NYD982278764

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

 Waste Code:
 F005 - UNKNOWN

Quantity: 00027
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTF0255826

Manifest Status: Completed copy
Trans1 State ID: 75126ZNY
Trans2 State ID: Not reported
Generator Ship Date: 931021
Trans1 Recv Date: 931021

Direction Distance

Elevation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Trans2 Recv Date: Not reported 931021 TSD Site Recv Date: Part A Recv Date: Not reported Part B Recv Date: 931105 Generator EPA ID: NYD982278764 Trans1 EPA ID: NYD000708271 Trans2 EPA ID: Not reported TSDF ID: CTD072138969

Waste Code: D006 - CADMIUM 1.0 MG/L TCLP

Quantity: 00765

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC2568385 Manifest Status: Completed copy Trans1 State ID: NYGS5776 Trans2 State ID: Not reported Generator Ship Date: 931111 Trans1 Recv Date: 931111 Trans2 Recv Date: Not reported TSD Site Recv Date: 931111 Part A Recv Date: 931203 Part B Recv Date: 931123

 Generator EPA ID:
 NYD982278764

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

 Waste Code:
 F005 - UNKNOWN

Quantity: 00027 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported

Direction Distance Elevation

tion Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Discr Residue Ind:
Discr Partial Reject Ind:
Discr Full Reject Ind:
Mot reported
Not reported
Mgmt Method Type Code:
Not reported

Document ID: NYC2742298 Completed copy Manifest Status: NYGS5776 Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 931220 Trans1 Recv Date: 931220 Trans2 Recv Date: Not reported TSD Site Recy Date: 931220 Part A Recv Date: 931230 Part B Recv Date: 931230

 Generator EPA ID:
 NYD982278764

 Trans1 EPA ID:
 ILD984908202

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD986872869

 Waste Code:
 F005 - UNKNOWN

Quantity: 00027 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYC2695173 Document ID: Manifest Status: Completed copy Trans1 State ID: NYGS5776 Trans2 State ID: Not reported Generator Ship Date: 931123 Trans1 Recv Date: 931123 Trans2 Recv Date: Not reported TSD Site Recv Date: 931123 Part A Recv Date: 931207 Part B Recv Date: 931207

 Generator EPA ID:
 NYD982278764

 Trans1 EPA ID:
 ILD984908202

Direction Distance

Elevation Site Database(s) EPA ID Number

ENGINE SYSTEMS CO (Continued)

1000118695

EDR ID Number

Trans2 EPA ID: Not reported
TSDF ID: NYD986872869
Waste Code: F005 - UNKNOWN

Quantity: 00027
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: TXA0823414

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: **NYAC1985** Trans2 State ID: 40582 940622 Generator Ship Date: Trans1 Recv Date: 940622 940703 Trans2 Recv Date: TSD Site Recy Date: 940705 Part A Recv Date: Not reported Part B Recv Date: 940808 Generator EPA ID: NYD982278764 ILD984908202 Trans1 EPA ID:

Trans2 EPA ID: NYD980769947 TSDF ID: TXD077603371

Waste Code: D007 - CHROMIUM 5.0 MG/L TCLP

Quantity: 00030 Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ENGINE SYSTEMS CO (Continued)

1000118695

Mgmt Method Type Code: Not reported

Document ID: NYC2801520 Manifest Status: Completed copy Trans1 State ID: NYGS5776 Trans2 State ID: Not reported 940413 Generator Ship Date: Trans1 Recv Date: 940413 Trans2 Recv Date: Not reported TSD Site Recv Date: 940413 940419 Part A Recv Date: Part B Recv Date: 940421

Generator EPA ID: NYD982278764 Trans1 EPA ID: ILD984908202 Trans2 EPA ID: Not reported TSDF ID: NYD986872869 F005 - UNKNOWN Waste Code:

Quantity: 00027 P - Pounds Units:

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 94

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

R91 MK ENGINE SYSTEMS NWAY LN

NNW **6 NORTHWAY LN** 1/8-1/4 LATHAM, NY

0.211 mi.

Actual:

298 ft.

1112 ft. Site 9 of 29 in cluster R

NY Spills: Relative: Site ID: Higher

128047 Facility Addr2: Not reported Facility ID: 9507376 Spill Number:

9507376

Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 9/15/1995

Reported to Dept: 9/15/1995 S102158857

N/A

NY Spills

NY Hist Spills

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MK ENGINE SYSTEMS NWAY LN (Continued)

S102158857

CID: 21

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Responsible Party

Cleanup Ceased: 9/15/1995 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Known release with minimal potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/21/1995

Remediation Phase:

Date Entered In Computer: Not reported 3/14/2008 Spill Record Last Update:

Spiller Name: KATHLEEN DEBVOG Spiller Company: MK ENGINE SYSTEMS Spiller Address: **6 NORTHWAY LANE**

LATHAM, ZZ Spiller City, St, Zip:

Spiller Company: 001

KATHLEEN DEBVOG Contact Name:

Contact Phone: Not reported DEC Region: 4 DER Facility ID: 110501

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9612534.

Remarks: SEAL BROKE ON TEST CELL - ONYO GRAVEL. CLEAN UP IN PROGRESS

Material:

128047 Site ID: Operable Unit ID: 1022124 Operable Unit: 01 361806 Material ID: Material Code: 0022

Material Name: Waste Oil/Used Oil Case No.: Not reported Material FA: Petroleum Quantity: 15 Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

MK ENGINE SYSTEMS NWAY LN (Continued)

S102158857

EDR ID Number

NY Hist Spills:

Region of Spill:

Spill Number: 9507376 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 09/15/1995 12:50 Spill Date/Time: Reported to Dept Date/Time: 09/15/95 13:45

SWIS: 01

Spiller Name: MK ENGINE SYSTEMS
Spiller Contact: KATHLEEN DEBVOG

Spiller Phone: Not reported

Spiller Contact: KATHLEEN DEBVOG Spiller Address: 6 NORTHWAY LANE

Spiller City, St, Zip: LATHAM

Spill Cause: Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 01

Spill Notifier: Responsible Party
PBS Number: Not reported
Cleanup Ceased: 09/15/95
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: 09/15/95
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 09/21/95

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: //

Date Spill Entered In Computer Data File: Not reported

Update Date: 03/21/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 15
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MK ENGINE SYSTEMS NWAY LN (Continued)

S102158857

N/A

Material: WASTE OIL WASTE OIL Class Type: Times Material Entry In File: 9509 CAS Number: Not reported Last Date: 19940927

DEC Remarks: 9612534.

SEAL BROKE ON TEST CELL - ONYO GRAVEL. CLEAN UP IN PROGRESS Remark:

MANIFEST S109784472 R92 **MK ENGINES**

NNW **6 NORTHWAY LANE**

1/8-1/4 LATHAM, NY

0.211 mi.

1112 ft. Site 10 of 29 in cluster R

Relative:

Higher

CT MANIFEST:

Waste:

Manifest No: CTF0542040 Actual: Waste Occurence: 298 ft.

UNNA: 3082

Hazard Class: 9

US Dot Description: env. Hazardous substance liquid nos

No of Containers: 001 Container Type: TT Quantity: 880 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Waste CD:

CTF0542040 Manifest No:

Waste Occurence:

EPA Waste Code: D006 Recycled Waste?: Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Detail:

Year: 1996 Manifest ID: CTF0542040 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY INC./UIS DBA ADVANCED LIQ. REC

TSDF Address: 136 GRACEY AVE. TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA TSDF Telephone:

Not reported Transport Date: 10/4/1996 Transporter EPA ID: NYD000708271

WEST CENTRAL ENVIRONMENTAL CORPORATION, Transporter Name:

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Not reported Trans 2 Address:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MK ENGINES (Continued) S109784472

Trans 2 City, St, Zip: CT USA Trans 2 Country:

Trans 2 Phone: Not reported EPA ID: NYD982287764 Generator Phone: Not reported

6 NORTHWAY LANE Generator Mailing Addr:

Generator Mailing Town: LATHAM Generator Mailing State: NY

Generator Mailing Zip: Not reported Generator Mailing Country: USA

Special Handling: Not reported Discrepancies: Not reported Date Shipped: 10/4/1996 Date Received: Not reported Last modified date: 4/26/2004 Last modified by: IG

Comments: Not reported

HARPER PROP NORTHWAY LN S103478470 R93 **HIST LTANKS** North **5 NORTHWAY LN NY Spills** N/A

1/8-1/4 0.211 mi. 1113 ft.

COLONIE (LATHAM), NY Site 11 of 29 in cluster R

HIST LTANKS: Relative: Region of Spill: Higher

Spill Number: 8904181 Actual: 06/29/1989 Spill Date: 298 ft. Spill Time: 12:00 Spill Cause:

Tank Failure Resource Affectd: Groundwater Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 06/29/89 06/29/89 Cleanup Ceased: Cleanup Meets Standard: True **MCDONALD** Investigator:

Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Not reported Notifier Extension: Reported to Department Date: 06/29/89 Reported to Department Time: 12:01 SWIS:

Spiller Contact: SUSAN HARPER Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: SUSAN HARPER Spiller Address: 333 HIGHLAND DRIVE Spiller City, St, Zip: SCHENECTADY, NY

Spiller Cleanup Date: 06/29/89

Direction Distance

Elevation Site Database(s) EPA ID Number

HARPER PROP NORTHWAY LN (Continued)

S103478470

EDR ID Number

Facility Contact: Not reported
Facility Phone: (518) 356-1467
Facility Extention: Not reported
Spill Notifier: Other
PBS Number: Not reported

Last Inspection: /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: 06/29/89
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: 06/29/89
Date Spill Entered In Computer Data File: 07/28/89
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 09/01/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: Not reported

Spill Cause: REMOVING 1K UGT, FOUND EXTENSIVE G/W CONTAMINATION. SPILLER HIRED DOMERMUTH.

SOIL TANKS REMOVED, COMPLETE.

NY Spills: Site ID:

299895 Facility Addr2: Not reported Facility ID: 8904181 Spill Number: 8904181 Facility Type: ER SWIS: 0126 Investigator: **MCDONALD** Referred To: Not reported Spill Date: 6/29/1989 Reported to Dept: 6/29/1989 CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HARPER PROP NORTHWAY LN (Continued)

S103478470

6/29/1989 Cleanup Ceased: Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/29/1989 Remediation Phase: Date Entered In Computer: 7/28/1989 Spill Record Last Update: 2/1/2008 Spiller Name: Not reported Spiller Company: SUSAN HARPER Spiller Address: 333 HIGHLAND DRIVE Spiller City, St, Zip: SCHENECTADY, NY

Spiller Company: 001

Contact Name: SUSAN HARPER Contact Phone: Not reported

DEC Region:

DER Facility ID: 242604 DEC Memo: Not reported

REMOVING 1K UGT, FOUND EXTENSIVE G/W CONTAMINATION. SPILLER HIRED Remarks:

DOMERMUTH. SOIL & TANKS REMOVED, COMPLETE.

Material:

Site ID: 299895 Operable Unit ID: 931940 Operable Unit: 01 Material ID: 448241 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Distance EDR ID Number
Elevation Site EPA ID Number

94 FEDERAL EXP NORTHWAY LN NY Spills S103481975 NNE NORTHWAY LN NY Hist Spills N/A

1/8-1/4 0.212 mi. 1118 ft.

Actual:

289 ft.

Relative: NY Spills:

COLONIE, NY

Lower Site ID: 297894

Facility Addr2: Not reported
Facility ID: 8806827
Spill Number: 8806827
Facility Type: ER

SWIS: 0126 MCDONALD Investigator: Not reported Referred To: Spill Date: 10/31/1988 Reported to Dept: 10/31/1988 CID: Not reported Spill Cause: Unknown Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: DEC
Cleanup Ceased: 11/17/1988
Cleanup Meets Std: True
Last Inspection: 11/17/1988

Recommended Penalty: Penalty Not Recommended

UST Trust: Tru

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/23/1988

Remediation Phase: 0

Date Entered In Computer: 11/23/1988
Spill Record Last Update: 9/9/1998
Spiller Name: Not reported
Spiller Company: FEDERAL EX

Spiller Company: FEDERAL EXPRESS
Spiller Address: 8 NORTHWAY LN
Spiller City,St,Zip: COLONIE, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 241006
DEC Memo: Not reported

Remarks: 10/31/88 TANKS IN GOOD CONDITION. CONTAMINATED SOIL FOUND. 200PPM

HNU.DOMERMUTH TO REMOVE SOIL & INSTALL MW.REMOVED 17 LOADS. 11/17MCD ON SITE-TALKED TO SCOTT BRYANT-MW INTO 5' GW-NO ODORS, NO PROBLEM

Material:

297894 Site ID: Operable Unit ID: 921990 Operable Unit: 01 455170 Material ID: Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXP NORTHWAY LN (Continued)

S103481975

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

Spill Number: 8806827 **MCDONALD** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 10/31/1988 12:00 Reported to Dept Date/Time: 10/31/88 15:00

SWIS: 01

Spiller Name: FEDERAL EXPRESS

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: 8 NORTHWAY LN Spiller City, St, Zip: COLONIE, NY Spill Cause: Unknown Reported to Dept: Groundwater Water Affected: Not reported

Spill Source: 01 Spill Notifier: DEC 4-460818 PBS Number: Cleanup Ceased: 11/17/88 Cleanup Meets Std: True Last Inspection: 11/17/88

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: 11 Enforcement Date: // Invstgn Complete: / / **UST Involvement:**

Known release that creates potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/23/88

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / 11/23/88 Date Spill Entered In Computer Data File: Date Spill Entered In Computer Data File: Not reported

Update Date: 09/09/98 Is Updated: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXP NORTHWAY LN (Continued)

S103481975

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: **GASOLINE GASOLINE** Class Type: Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: Not reported

10/31/88 TANKS IN GOOD CONDITION. CONTAMINATED SOIL FOUND. 200PPM HNU.DOMERMUTH Remark:

TO REMOVE SOIL INSTALL MW.REMOVED 17 LOADS, 11/17MCD ON SITE-TALKED TO SCOTT

BRYANT-MW INTO 5 GW-NO ODORS, NO PROBLEM

R95 ST JOHNSBURY NORTHWAY LN **HIST LTANKS** S104513579 **NY Spills** N/A

NNW 7-9 NORTHWAY LN 1/8-1/4 COLONIE LATHAM, NY

0.212 mi.

1120 ft. Site 12 of 29 in cluster R

HIST LTANKS: Relative:

Higher Region of Spill:

Water Affected:

Spill Number: 9200206 Actual: Spill Date: 04/06/1992 298 ft. Spill Time: 15:00 Spill Cause: Tank Failure Resource Affectd: On Land

> Other Commercial/Industrial Spill Source:

Not reported

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/07/92 09/11/92 Cleanup Ceased: Cleanup Meets Standard: True

CHRISTENSEN/TS Investigator: Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Not reported Notifier Extension: Reported to Department Date: 04/06/92 Reported to Department Time: 16:51 SWIS:

Spiller Contact: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ST JOHNSBURY NORTHWAY LN (Continued)

S104513579

Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: ST. JOHNSBURY TRUCKING Spiller Address: 7-9 NORTHWAY LANE Spiller City, St, Zip: COLONIE LATHAM

Spiller Cleanup Date:

Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Notifier: Responsible Party

4-020214 PBS Number:

Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: **UST Involvement:** False

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: Date Spill Entered In Computer Data File: 04/08/92 Time Spill Entered In Computer Data File: Not reported

03/21/00 Spill Record Last Update: Is Updated: False

Tank:

PBS Number: Not reported

Tank Number: Tank Size:

Test Method: Not reported Leak Rate Failed Tank: 0.00 Not reported Gross Leak Rate:

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False WASTE OIL Material: WASTE OIL Class Type: Times Material Entry In File: 9509 CAS Number: Not reported Last Date: 19940927

SEE 8604254, 9604075; 8801295?. 7-9 NORTHWAY Ln HAS 3 PBS REGs: 4-020214 St DEC Remarks:

JOHNSBURY), 4-020206 St JOHNSBURY), 4-133795 SULZER TURBO).

275GAL WASTE OIL AGT LEAKING TO SOIL, CLEAN HARBORS TO CLEAN. WTC FOUND SPILL Spill Cause:

WHILE INVESTIGATING OTHER RPT LEB VAL CLEANING, TS FOR UGTS. SM QUAN CONT.

REMOVED, TANK EMPTY.

NY Spills:

Site ID: 201423 Facility Addr2: Not reported Facility ID: 9200206 Spill Number: 9200206 Facility Type: ER SWIS: 0126 WTCHRIST Investigator:

Direction Distance

Elevation Site Database(s) EPA ID Number

ST JOHNSBURY NORTHWAY LN (Continued)

S104513579

EDR ID Number

Referred To:

Spill Date:

4/6/1992

Reported to Dept:

CID:

Spill Cause:

Water Affected:

Spill Source:

Not reported

Equipment Failure

Not reported

Commercial/Industrial

Spill Notifier: Responsible Party
Cleanup Ceased: 9/11/1992
Classur March Ctd.

Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/7/1992

Remediation Phase: 0
Date Entered In Computer: 4/8/1992
Spill Record Last Update: 1/31/2008
Spiller Name: Not reported

Spiller Company: ST. JOHNSBURY TRUCKING
Spiller Address: 7-9 NORTHWAY LANE
Spiller City, St, Zip: COLONIE LATHAM, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 167584

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN/TS" SEE 8604254, 9604075; 8801295?. 7-9 NORTHWAY Ln HAS

3 PBS REGs: 4-020214 (St JOHNSBURY), 4-020206 (St JOHNSBURY),

4-133795 (SULZER TURBO).

Remarks: 275GAL WASTE OIL AGT LEAKING TO SOIL, CLEAN HARBORS TO CLEAN. [WTC

FOUND SPILL WHILE INVESTIGATING OTHER RPT] LEB VAL CLEANING, TS FOR

UGTS. SM QUAN CONT. REMOVED, TANK EMPTY.

Material:

 Site ID:
 201423

 Operable Unit ID:
 967424

 Operable Unit:
 01

 Material ID:
 415030

 Material Code:
 0022

Material Name: Waste Oil/Used Oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 0
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

 Site ID:
 201423

 Spill Tank Test:
 1539833

 Tank Number:
 0

 Tank Size:
 0

 Test Method:
 00

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ST JOHNSBURY NORTHWAY LN (Continued)

S104513579

Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

R96 **FEDERAL EXPRESS** UST U000414836 **HIST UST** NNW **8 NORTHWAY LANE** N/A

1/8-1/4 0.213 mi.

1124 ft. Site 13 of 29 in cluster R

LATHAM, NY 12110

Relative:

UST: Facility Id: 4-460818 Higher Region: STATE

Actual: DEC Region: 299 ft.

Site Status: Unregulated PBS Program Type: **Expiration Date:** N/A UTM X: 598736 UTM Y: 4732054 Site ID: 37003

001 Tank Number: Tank ID: 93196

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Not reported Pipe Model: Install Date: 12/1/1982 Capacity Gallons: 8000 Tightness Test Method: NN

Next Test Date: Not reported Not reported Date Tank Closed: Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

D02 - Pipe Type - Galvanized Steel C00 - Pipe Location - No Piping A00 - Tank Internal Protection - None

J02 - Dispenser - Suction 100 - Overfill - None

F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None

H00 - Tank Leak Detection - None B00 - Tank External Protection - None

Affiliation Records:

37003 Site Id: Affiliation Type: Mail Contact

Company Name: R. A. B. DEVELOPMENT CORP.

Contact Type: Not reported Not reported Contact Name:

Direction Distance

Elevation Site Database(s) EPA ID Number

FEDERAL EXPRESS (Continued)

U000414836

EDR ID Number

Address1: 6 NORTHWAY LANE

Address2: Not reported City: LATHAM State: NY Zip Code: 12110 Country Code: 001

Phone: (518) 785-1378
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37003

Affiliation Type: On-Site Operator
Company Name: FEDERAL EXPRESS

Contact Type: Not reported

Contact Name: FEDERAL EXPRESS

Address1: Not reported
Address2: Not reported
City: Not reported

State: NN

Zip Code: Not reported
Country Code: 001
Phone: (914) 567-0081
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT

Site Id: 37003 Affiliation Type: Owner

Date Last Modified:

Company Name: R. A. B. DEVELOPMENT CORP.

3/4/2004

Contact Type: Not reported Contact Name: Not reported

Address1: 6 NORTHWAY LANE

 Address2:
 Not reported

 City:
 LATHAM

 State:
 NY

 Zip Code:
 12110

 Country Code:
 001

Phone: (518) 785-1378
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 37003

Affiliation Type: Emergency Contact

Company Name: R. A. B. DEVELOPMENT CORP.

Contact Type: Not reported
Contact Name: DAVE DEMPSEY
Address1: Not reported
Address2: Not reported
City: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

FEDERAL EXPRESS (Continued)

U000414836

EDR ID Number

State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 383-1432
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-460818
SPDES Number: Not reported
Emergency Contact: DAVE DEMPSEY
Emergency Telephone: (518) 383-1432
Operator: FEDERAL EXPRESS
Operator Telephone: (518) 783-1504

Owner Name: R. A. B. DEVELOPMENT CORP.

Owner Address: 6 NORTHWAY LANE
Owner City, St, Zip: LATHAM, NY 12110
Owner Telephone: (518) 785-1378
Owner Type: Not reported
Owner Subtype: Not reported

Mailing Name: R. A. B. DEVELOPMENT CORP.

Mailing Address: 6 NORTHWAY LANE

Mailing Address 2: Not reported
Mailing City,St,Zip: LATHAM, NY 12110
Mailing Contact: Not reported
Mailing Telephone: (518) 785-1378
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported

SWIS ID: 0126

Old PBS Number: Not reported Facility Type: Not reported Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 10/14/1988 10/14/1993 **Expiration Date:** Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: Minor Data Missing
Owner Screen: Minor Data Missing
Tank Screen: Minor Data Missing
Minor Data Missing

Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01

Town or City: 26
Region: 4

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXPRESS (Continued)

Tank Id: 001

UNDERGROUND Tank Location:

Tank Status: Closed Before April 1, 1991

Install Date: 19821201 Capacity (gals): 8000

UNLEADED GASOLINE Product Stored: Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported

GALVANIZED STEEL Pipe Type:

Not reported Pipe Internal: Not reported Pipe External: Second Containment: None Leak Detection: None Overfill Prot: Not reported Suction Dispenser: Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

R97 SULZER TURBO/SYSTEMS INC NNW **7 NORTHWAY LANE**

1/8-1/4 LATHAM, NY 12110

0.214 mi.

1132 ft. Site 14 of 29 in cluster R

UST: Relative:

Facility Id: 4-133795 Higher Region: STATE Actual: DEC Region:

299 ft. Site Status: Unregulated Program Type: PBS **Expiration Date:** N/A

UTM X: 598725 UTM Y: 4732055 Site ID: 35894

Tank Number: 1 Tank ID: 87932

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported Capacity Gallons: 3000 Tightness Test Method: 01

Next Test Date: Not reported 3/1/1992 Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel Date Test: 12/1/1987 Register: True Modified By: **TRANSLAT**

TC2896934.2s Page 470

U000414836

U000382644

N/A

UST

HIST UST

Direction Distance

Elevation Site Database(s) EPA ID Number

SULZER TURBO/SYSTEMS INC (Continued)

U000382644

EDR ID Number

Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None

C00 - Pipe Location - No Piping H00 - Tank Leak Detection - None D01 - Pipe Type - Steel/Carbon Steel/Iron

I00 - Overfill - None J02 - Dispenser - Suction

A00 - Tank Internal Protection - None B00 - Tank External Protection - None

Affiliation Records:

Site Id: 35894

Affiliation Type: Emergency Contact

Company Name: SULZER TURBO/SYSTEMS INC

Contact Type: Not reported
Contact Name: GARY BENARD
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 783-1625
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 35894 Affiliation Type: Owner

Company Name: SULZER TURBO/SYSTEMS INC

Contact Type: Not reported
Contact Name: Not reported
Address1: 7 NORTHWAY LANE

Address2: Not reported City: LATHAM State: NY Zip Code: 12110 Country Code: 001

Phone: (518) 783-1625
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 35894
Affiliation Type: Mail Contact

Company Name: SULZER TURBO/SYSTEMS INC

Contact Type: Not reported
Contact Name: GARY BENARD
Address1: 7 NORTHWAY LANE

Address2: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

SULZER TURBO/SYSTEMS INC (Continued)

U000382644

EDR ID Number

City: LATHAM
State: NY
Zip Code: 12110
Country Code: 001

Phone: (518) 783-1625
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 35894

Affiliation Type: On-Site Operator

Company Name: SULZER TURBO/SYSTEMS INC

Contact Type: Not reported
Contact Name: GARY BENARD
Address1: Not reported
Address2: Not reported
City: Not reported

State: NN

Zip Code: Not reported Country Code: 001 Phone: (518) 783-1625 Phone Ext: Not reported Email: Not reported Not reported Fax Number: Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-133795
SPDES Number: Not reported
Emergency Contact: GARY BENARD
Emergency Telephone: (518) 783-6838
Operator: GARY BENARD
Operator Telephone: (518) 783-1625

Owner Name: SULZER TURBO/SYSTEMS INC

Owner Address: 7 NORTHWAY LANE
Owner City,St,Zip: LATHAM, NY 12110
Owner Telephone: (518) 783-1625
Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: SULZER TURBO/SYSTEMS INC

Mailing Address: 7 NORTHWAY LANE

Mailing Address 2: Not reported
Mailing City,St,Zip: LATHAM, NY 12110
Mailing Contact: GARY BENARD
Mailing Telephone: (518) 783-1625
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported
SWIS ID: 0126
Old PBS Number: Not reported
Facility Type: MANUFACTURING
Inspected Date: Not reported
Inspector: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SULZER TURBO/SYSTEMS INC (Continued)

U000382644

Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 03/24/1987 **Expiration Date:** 03/24/1992 Renew Flag: False Renewal Date: Not reported

Total Capacity: FAMT: True

Facility Screen: No Missing Data No Missing Data Owner Screen:

Tank Screen: Dead Letter: False CBS Number: Not reported COLONIE Town or City: County Code: 01 Town or City: 26 Region: 4

Tank Id:

Tank Location: UNDERGROUND Tank Status: Closed-Removed Install Date: Not reported

Capacity (gals): 3000

NOS 1,2, OR 4 FUEL OIL Product Stored: Steel/carbon steel Tank Type:

Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported Pipe Type: STEEL/IRON Not reported Pipe Internal: Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Suction Dispenser: Date Tested: 12/01/1987 Next Test Date: Not reported Missing Data for Tank: Minor Data Missing

03/01/1992 Date Closed: Petro-Tite Test Method: Deleted: False Updated: True Lat/long: Not reported

R98 **TURBOSYSTEMS INTERNATIONAL**

7 NORTHWAY LANE LATHAM, NY 12110

1/8-1/4 0.214 mi.

299 ft.

NNW

1132 ft. Site 15 of 29 in cluster R

CT MANIFEST: Relative: Higher

Waste:

Manifest No: CTF0188228 Actual: Waste Occurence:

9189 UNNA: Hazard Class: ORM-E S109783578

N/A

MANIFEST

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTERNATIONAL (Continued)

EDR ID Number

S109783578

US Dot Description: HAZARDOUS WASTE LIQUID, NOS

No of Containers: 001
Container Type: DM
Quantity: 40003
Weight/Volume: G
Additional Description: Y

Handling Code: Not reported
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Manifest No: CTF0188228

Waste Occurence: 2
UNNA: 1993
Hazard Class: FLAMMABLE

US Dot Description: WASTE FLAMMABLE LIQUID, NOS

No of Containers: 001
Container Type: DM
Quantity: 50
Weight/Volume: G
Additional Description: Y

Handling Code: Not reported Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Manifest No: CTF0188228

Waste Occurence: 3
UNNA: 9189
Hazard Class: ORM-E

US Dot Description: HAZARDOUS WASTE LIQUID, NOS

No of Containers: 001
Container Type: DM
Quantity: 30
Weight/Volume: G
Additional Description: Y

Handling Code: Not reported
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0188228

Waste Occurence: 2
EPA Waste Code: F001
Recycled Waste?: F
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Manifest No: CTF0188228

Waste Occurence: 3
EPA Waste Code: D006
Recycled Waste?: F
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Manifest No: CTF0188228

Waste Occurence: 1
EPA Waste Code: D003
Recycled Waste?: F

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TURBOSYSTEMS INTERNATIONAL (Continued)

S109783578

EDR ID Number

Date Record Was Last Modified: 4/27/2004 DEO Who Last Modified Record: IG

Detail:

Year: 1993

Manifest ID: CTF0188228 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES, INC.

TSDF Address: 130 FREIGHT STREET TSDF City,St,Zip: WATERBURY, CT 06702

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 1/7/1993 Transporter EPA ID: NYD000708271

Transporter Name: WEST CENTRAL ENVIRONMENTAL CORPORATION,

Transporter Country: USA Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Not reported Trans 2 Name: Not reported Trans 2 Address:

Trans 2 City, St, Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported NYD144771482 EPA ID: Generator Phone: 5187831625 Generator Mailing Addr: 7 NORTHWAY LANE

Generator Mailing Town: LATHAM Generator Mailing State: NY Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Yes Discrepancies: No Date Shipped: 1/7/1993 Date Received: 1/8/1993 4/27/2004

Last modified by: IG

Last modified date:

Comments: Not reported

Waste:

Manifest No: CTC0123311

Waste Occurence: UNNA: 1789

Hazard Class: **CORROSIVE**

US Dot Description: WASTE HYDROCHLORIC ACID MIX MATERIAL

No of Containers: 001 Container Type: DM Quantity: 7 Weight/Volume: G Additional Description: Handling Code: S01 Date Record Was Last Modified: 4/27/2004 DEO Who Last Modified Record: IG

Manifest No: CTC0123311

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTERNATIONAL (Continued)

S109783578

EDR ID Number

Waste Occurence: 1
UNNA: 2031
Hazard Class: OXIDIZER

US Dot Description: WASTE NITRIC ACID

No of Containers: 001
Container Type: DM
Quantity: 10
Weight/Volume: G
Additional Description: Y
Handling Code: S01
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Manifest No: CTC0123311

Waste Occurence: 4 UNNA: 1760

Hazard Class: CORROSIVE

US Dot Description: WASTE LIQ MAT'L NOS

No of Containers: 003
Container Type: DM
Quantity: 1500
Weight/Volume: P
Additional Description: Y
Handling Code: S01
Date Record Was Last Modified: 4/27/2004

DEO Who Last Modified Record: IG

Manifest No: CTC0123311

Waste Occurence: 3
UNNA: 2796
Hazard Class: CORROSIVE

US Dot Description: WASTE ELECTROLYTE BATTERY FLUID MATERIAL

No of Containers: 001
Container Type: DM
Quantity: 10
Weight/Volume: G
Additional Description: Y
Handling Code: S01
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTC0123311

Waste Occurence: 1
EPA Waste Code: D003
Recycled Waste?: F
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Manifest No: CTC0123311

Waste Occurence: 2
EPA Waste Code: D002
Recycled Waste?: F
Date Record Was Last Modified: 4/27/2004
DEO Who Last Modified Record: IG

Manifest No: CTC0123311

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TURBOSYSTEMS INTERNATIONAL (Continued)

S109783578

Waste Occurence: 4 EPA Waste Code: D002 Recycled Waste?: F Date Record Was Last Modified: 4/27/2004 DEO Who Last Modified Record: IG

CTC0123311 Manifest No:

Waste Occurence: EPA Waste Code: D002 Recycled Waste?: Date Record Was Last Modified: 4/27/2004 DEO Who Last Modified Record: IG

Detail:

1989 Year: Manifest ID: CTC0123311 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES, INC.

TSDF Address: 130 FREIGHT STREET TSDF City,St,Zip: WATERBURY, CT 06702

TSDF Country: USA

TSDF Telephone: Not reported Transport Date: 1/12/1989 Transporter EPA ID: NYD000708271

WEST CENTRAL ENVIRONMENTAL CORPORATION, Transporter Name:

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Not reported Trans 2 Name: Trans 2 Address: Not reported Trans 2 City, St, Zip: CT Trans 2 Country: **USA**

Trans 2 Phone: Not reported EPA ID: NYD144771482 5187831625 Generator Phone: Generator Mailing Addr: 7 NORTHWAY LANE

Generator Mailing Town: Not reported

Generator Mailing State: NE Generator Mailing Zip: 12110 Generator Mailing Country: USA Special Handling: Yes Discrepancies: No Date Shipped: 1/12/1989 Date Received: 1/13/1989 4/27/2004 Last modified date: Last modified by: IG Not reported

Comments:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

R99 ST JOHNSBURY TRUCKING UST U003644645 NNW 7-9 NORTHWAY LANE **HIST UST** N/A

1/8-1/4 0.214 mi.

1132 ft. Site 16 of 29 in cluster R

Site ID:

Relative:

UST:

Facility Id: 4-020214 Higher STATE Region: Actual: DEC Region:

NORTH LATHAM, NY 12110

299 ft.

Site Status: Unregulated Program Type: **PBS Expiration Date:** N/A UTM X: 598725 UTM Y: 4732055

Tank Number: 1 Tank ID: 84816

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported Capacity Gallons: 4000 Tightness Test Method: 06

Next Test Date: Not reported 9/1/1986 Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel

Date Test: 5/1/1986 Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None F00 - Pipe External Protection - None C00 - Pipe Location - No Piping J02 - Dispenser - Suction

34972

A00 - Tank Internal Protection - None

100 - Overfill - None

G00 - Tank Secondary Containment - None

D00 - Pipe Type - No Piping

B00 - Tank External Protection - None

Affiliation Records:

34972 Site Id:

On-Site Operator Affiliation Type:

Company Name: ST JOHNSBURY TRUCKING CO INC

Contact Type: Not reported **BOB RIELLY** Contact Name: Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 783-1195 Phone Ext: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ST JOHNSBURY TRUCKING (Continued)

U003644645

EDR ID Number

Email: Not reported Fax Number: Not reported Modified By: TRANSLAT Date Last Modified: 3/4/2004

Site Id: 34972 Affiliation Type: Owner

Company Name: ST JOHNSBURY TRUCKING CO INC

Contact Type: Not reported
Contact Name: Not reported
Address1: 38 MAIN ST
Address2: Not reported
City: ST JOHNSBURY

State: VT
Zip Code: 05819
Country Code: 001

Phone: (803) 748-7877
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 34972 Affiliation Type: Mail Contact

Company Name: ST JOHNSBURY TRUCKING CO INC

Contact Type: Not reported
Contact Name: S. G. DENIO
Address1: 38 MAIN ST
Address2: Not reported
City: ST JOHNSBURY

State: VT Zip Code: 05819 Country Code: 001

Phone: (803) 748-8131
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 34972

Affiliation Type: Emergency Contact

Company Name: ST JOHNSBURY TRUCKING CO INC

Contact Type: Not reported
Contact Name: BOB RIELLY
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 783-1195
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT

Direction Distance

Elevation Site Database(s) EPA ID Number

ST JOHNSBURY TRUCKING (Continued)

U003644645

EDR ID Number

Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-020214
SPDES Number: Not reported
Emergency Contact: BOB RIELLY
Emergency Telephone: (518) 783-1195
Operator: BOB RIELLY
Operator Telephone: (518) 783-1195

Owner Name: ST JOHNSBURY TRUCKING CO INC

Owner Address: 38 MAIN ST

Owner City,St,Zip: ST JOHNSBURY, VT 05819

Owner Telephone: (802) 748-7877 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: ST JOHNSBURY TRUCKING CO INC

Mailing Address: 38 MAIN ST Mailing Address 2: Not reported

Mailing City, St, Zip: ST JOHNSBURY, VT 05819

Mailing Contact: S. G. DENIO
Mailing Telephone: (802) 748-7877
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126
Old PBS Number: Not reported

Facility Type: TRUCKING/TRANSPORTATION

Inspected Date: Not reported Not reported Inspector: Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 12/02/1986 12/02/1991 **Expiration Date:** Renew Flag: False Renewal Date: Not reported Total Capacity: FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data

Tank Screen: 0
Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01

Town or City: 26
Region: 4

Tank ld:

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (gals): 4000
Product Stored: DIESEL

Tank Type: Steel/carbon steel
Tank Internal: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ST JOHNSBURY TRUCKING (Continued)

U003644645

Tank External: Not reported Pipe Location: Not reported Not reported Pipe Type: Not reported Pipe Internal: Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: 05/01/1986 Next Test Date: Not reported Missing Data for Tank: Minor Data Missing

Date Closed: 09/01/1986 Test Method: Hunter Deleted: False Updated: True Lat/long: Not reported

R100 **TURBOSYSTEMS INTL** RCRA-NonGen 1000164434 NNW **7 NORTHWAY LANE FINDS** NYD144771482

LATHAM, NY 12110 SHWS 1/8-1/4 0.214 mi. **VAPOR REOPENED** 1132 ft. Site 17 of 29 in cluster R **MANIFEST**

RCRA-NonGen:

Relative:

Date form received by agency: 01/01/2007 Higher

Facility name: TURBOSYSTEMS INTL Actual: Facility address: 7 NORTHWAY LANE

299 ft. LATHAM, NY 121104810 NYD144771482 EPA ID:

> Mailing address: **NORTHWAY LANE**

LATHAM, NY 12110

Contact: Not reported NORTHWAY LANE Contact address:

LATHAM, NY 12110

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: SULZER-ESCHER WYSS LTD

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

Owner/operator name: SULZER-ESCHER WYSS LTD

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Owner/operator country: US

Owner/operator telephone: (212) 555-1212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: TURBOSYSTEMS INTL Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: TURBOSYSTEMS INTL Classification: Not a generator, verified

Date form received by agency: 11/17/1986

Facility name: TURBOSYSTEMS INTL Classification: Small Quantity Generator

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 04/02/1987

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:

Date achieved compliance:

Evaluation lead agency:

Not reported

Not reported

State

FINDS:

Registry ID: 110004383541

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

Direction Distance Elevation

Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

SHWS:

Program: HW
Site Code: 56106
Classification: C
Region: 4
Acres: 6.000
HW Code: 401038

Record Add: 11/18/1999 12:00:00 PM Record Upd: 9/29/2009 11:09:00 AM

Updated By: JAQUINN

Site Description: Lattitude: 42 44'05" Longitude: 73 47'56" The facility is

located on Northway Lane, west of Wolf Road in the Town of Colonie, Albany County. At various times this facility stored drums of miscellaneous solvents. A dispensing area consisted of horizontal drums with stopcocks. Waste solvents were frequently poured back into drums after use. According to former Sulzer employees this operation

was sloppy (e.g. spills, overfills, exposure to the elements). Samples of soil and water in a catch basin were collected by DEE staff on 5/16/88. These samples showed low level contamination by

tetrachloroethene, vinyl chloride, trichloroethene, and

1,1,1-trichloroethane. A DEE consent order was signed for a Phase II Investigation, which resulted in acceptance by the Department of the Phase II report. Additional work was required of the responsible party, and has been completed. All hazardous wastes have been removed. Minor contamination remains in on-site groundwater monitoring wells. Water is not used as a potable source, and minor remaining contamination does not pose a significant threat to the public health or environment. As of this update, a soil vapor investigation will be necessary at this site. Next step, contact the

PRP to conduct the investigation.

Env Problem: Solvent disposal due to spills and poor houskeeping practices is

associated with this site. An assessment of the extent of

environmentalproblems indicates residual contamination and minor

contravention of ground- water standards.

Health Problem: There is potential for groundwater contamination, however, all area

businesses and residences are on public water. Latham public water supply wells in the vicinity of the site are standby wells only. They have not been used for several years and have recently been abandoned and grouted. Site contaminants have been removed, and no surficial

contamination remains for direct contact.

 Dump:
 False

 Structure:
 True

 Lagoon:
 False

 Landfill:
 False

 Pond:
 False

 Disp Start:
 1972

 Disp Term:
 1988

Lat/Long: 42:44:08:0 / 73:47:49:0

Dell: False

Record Add: 11/18/1999 12:00:00 PM Record Upd: 11/18/1999 12:00:00 PM

Updated By: INITIAL

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Own Op: Disp. Owner Sub Type: NNN

Owner Name: Not reported

Owner Company: SULZER TURBOSYSTEMS

Owner Address: Not reported
Owner Addr2: Not reported

Owner City, St, Zip: ZZ

Owner Country: United States of America
Own Op: On-Site Operator

Sub Type: E

Owner Name: Not reported

Owner Company: Sulzer Turbosystems
Owner Address: 7 NORTHWAY LANE

Owner Addr2: Not reported
Owner City,St,Zip: LATHAM, NY 12110

Owner Country: United States of America
Own Op: Owner
Sub Type: E

Owner Name: GARY BENARD, MGR.

Owner Company: Sulzer Turbosystems, Incorporated

Owner Address: 7 NORTHWAY LANE
Owner Addr2: Not reported
Owner City,St,Zip: LATHAM, NY 12110
Owner Country: United States of America

HW Code: 401038

Waste Type: SOLVENTS (F001, F003, F005)

Waste Quantity: 85+ DRUMS
Waste Code: Not reported
HW Code: 401038

Waste Type: IGNITABLE WASTES (D001)

Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: Not reported
Cross Ref Type Code: Not reported
Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: UNKNOWN
Not reported
Not reported
Not reported

VAPOR REOPENED:

Site Code: 401038 Facility Status: Underway

NY MANIFEST:

EPA ID: NYD144771482

Country: USA

Mailing Name: SULZER TURBOSYSTEMS
Mailing Contact: SULZER TURBOSYSTEMS
Mailing Address: 7 NORTHWAY LANE

Mailing Address 2: Not reported
Mailing City: LATHAM
Mailing State: NY
Mailing Zip: 12110
Mailing Zip4: 4810
Mailing Country: USA

Mailing Phone: 518-783-1625

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Document ID: CTC0123311 Manifest Status: Completed copy Trans1 State ID: 77282DNY Not reported Trans2 State ID: Generator Ship Date: 890112 890112 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recv Date: 890113 Part A Recv Date: 890118 Part B Recv Date: 890202

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

Waste Code: D003 - NON-LISTED REACTIVE WASTES

Quantity: 00010

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100

Waste Code: Not reported

Quantity: 00007

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00010

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 01500
Units: P - Pounds
Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 89

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Document ID: CTC0123324 Manifest Status: Completed copy Trans1 State ID: 77282DNY Not reported Trans2 State ID: Generator Ship Date: 890223 Trans1 Recv Date: 890223 Trans2 Recv Date: Not reported TSD Site Recv Date: 890224 Part A Recv Date: 890228 Part B Recv Date: 890309 Generator EPA ID: NYD144771482

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00250
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill. Specific Gravity: 100

Waste Code: Not reported

Quantity: 00050

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 100
Year: 89

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1101539

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYSMM7800 Trans2 State ID: S8690 Generator Ship Date: 901019 Trans1 Recv Date: 901019 Trans2 Recv Date: 901022 TSD Site Recv Date: 901024 Part A Recv Date: 901102 Part B Recv Date: 901114

 Part B Recv Date:
 901114

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Waste Code: D039 - TETRACHLOROETHYLENE 0.73 MG/L TCLP

Quantity: 00176 Units: P - Pounds Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100
Year: 90
Manifest Tracking Num: Not reported Import Ind: Not reported
Export Ind: Not reported

Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1068991

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYCY9802 NJDEPS869 Trans2 State ID: Generator Ship Date: 901109 Trans1 Recv Date: 901109 Trans2 Recv Date: 901112 TSD Site Recv Date: 901114 Part A Recv Date: 901204 Part B Recv Date: 901227

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TURBOSYSTEMS INTL (Continued)

1000164434

Document ID: NJA1077951

Completed after the designated time period for a TSDF to get a copy to the DEC Manifest Status:

Trans1 State ID: NYEC2075 Trans2 State ID: NJDEPS869 Generator Ship Date: 901130 Trans1 Recv Date: 901130 Trans2 Recv Date: 901203 TSD Site Recy Date: 901204 Part A Recv Date: 910104 Part B Recv Date: 910115 NYD144771482 Generator EPA ID: Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

00172 Quantity: P - Pounds Units: 002 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYC1846427 Manifest Status: Completed copy Trans1 State ID: NYGS7503 Trans2 State ID: Not reported Generator Ship Date: 920911 Trans1 Recv Date: 920911 Trans2 Recv Date: Not reported TSD Site Recv Date: 920911 Part A Recv Date: 920925 Part B Recv Date: 920921

Generator EPA ID: NYD144771482 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD986872869

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00045 P - Pounds Units: Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

Year:

1000164434

EDR ID Number

Not reported Manifest Tracking Num: Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported

92

Manifest Ref Num:
Alt Fac RCRA Id:
Not reported
Not reported
Not reported
Not reported
Mgmt Method Type Code:
Not reported
Not reported

Document ID: NJA1138742 Completed copy Manifest Status: NYEC2075 Trans1 State ID: Trans2 State ID: NJDEPS869 Generator Ship Date: 910425 Trans1 Recv Date: 910425 Trans2 Recv Date: 910429 TSD Site Recy Date: 910430 Part A Recv Date: 910501 Part B Recv Date: 910520

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00045 Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 91

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1121375

Manifest Status: Completed copy
Trans1 State ID: NYPC7617

Trans2 State ID: NJDEPS869

Generator Ship Date: 910523

Trans1 Recv Date: 910523

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TURBOSYSTEMS INTL (Continued)

1000164434

Trans2 Recv Date: 910528 910529 TSD Site Recv Date: Part A Recv Date: 910603 Part B Recv Date: 910613 Generator EPA ID: NYD144771482 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00172 Units: P - Pounds Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 91

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1336621

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYBC2076 Trans2 State ID: T407FSOHI 911007 Generator Ship Date: Trans1 Recv Date: 911007 Trans2 Recv Date: 911011 TSD Site Recv Date: 911014 Part A Recv Date: 911029 Part B Recv Date: 911105

Generator EPA ID: NYD144771482 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

00045 Quantity: Units: P - Pounds Number of Containers: 001

Container Type: DM - Metal drums, barrels

R Material recovery of more than 75 percent of the total material. Handling Method:

Specific Gravity: 100 Year: 91

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported

Direction Distance Elevation

tion Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Discr Residue Ind:
Discr Partial Reject Ind:
Discr Full Reject Ind:
Mot reported
Not reported
Mgmt Method Type Code:
Not reported

CTF0188228 Document ID: Manifest Status: Completed copy 45873VNY Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 930107 Trans1 Recv Date: 930107 Trans2 Recv Date: Not reported TSD Site Recv Date: 930108 Part A Recv Date: 930114 Part B Recv Date: 930121

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

Waste Code: D003 - NON-LISTED REACTIVE WASTES
Quantity: 00040
Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00050

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00030

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 93

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Document ID: CTC0123374 Manifest Status: Completed copy Trans1 State ID: 75121ZNY Not reported Trans2 State ID: Generator Ship Date: 880831 Trans1 Recv Date: 880831 Trans2 Recv Date: Not reported TSD Site Recv Date: 880901 Part A Recv Date: 880902 Part B Recv Date: 880908 Generator EPA ID: NYD144771482 Trans1 EPA ID: NYD000708271 Trans2 EPA ID: Not reported

CTD072138969 D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00500 P - Pounds Units: 004 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100

TSDF ID:

Waste Code: Not reported

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 88

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1071653

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: NYEC2075 Trans2 State ID: NJDEPS869 Generator Ship Date: 910130 Trans1 Recv Date: 910130 Trans2 Recv Date: 910204 TSD Site Recv Date: 910206 Part A Recv Date: 910225 Part B Recv Date: 910228

Generator EPA ID: NYD144771482 ILD051060408 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: TSDF ID: NJD069039626

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TURBOSYSTEMS INTL (Continued)

1000164434

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00221 P - Pounds Units: Number of Containers: 004

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

100 Specific Gravity: Year: 91

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1223952 Manifest Status: Completed copy Trans1 State ID: NYEC2076 Trans2 State ID: NJDEPS869 Generator Ship Date: 910913 Trans1 Recv Date: 910913 Trans2 Recv Date: 910916 TSD Site Recv Date: 910917 Part A Recv Date: 910920 Part B Recv Date: 911002

Generator EPA ID: NYD144771482 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00172 Units: P - Pounds Number of Containers: 002

Container Type: DM - Metal drums, barrels

R Material recovery of more than 75 percent of the total material. Handling Method:

Specific Gravity: 100 91 Year:

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance Elevation

ation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

NJA1144836 Document ID: Manifest Status: Completed copy Trans1 State ID: NYCY9802 Trans2 State ID: NJDEPS869 Generator Ship Date: 910722 Trans1 Recv Date: 910722 Trans2 Recv Date: 910725 TSD Site Recy Date: 910726 Part A Recv Date: 910805 Part B Recv Date: 910809 Generator EPA ID: NYD144771482 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: ILD051060408 TSDF ID: NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00217
Units: P - Pounds
Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 91

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NJA1366135 Manifest Status: Completed copy Trans1 State ID: NYMM7800 Trans2 State ID: NJDEPS869 Generator Ship Date: 911230 Trans1 Recv Date: 911230 Trans2 Recv Date: 920103 TSD Site Recv Date: 920106 Part A Recv Date: 920113 Part B Recv Date: 920117

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 ILD051060408

 Trans2 EPA ID:
 ILD051060408

 TSDF ID:
 NJD069039626

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00217
Units: P - Pounds
Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Direction Distance Elevation

ance EDR ID Number vation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

Year: 91

Not reported Manifest Tracking Num: Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTC0123533 Completed copy Manifest Status: Trans1 State ID: 53526BNY Trans2 State ID: Not reported 880518 Generator Ship Date: Trans1 Recv Date: 880518 Trans2 Recv Date: Not reported TSD Site Recy Date: 880518 Part A Recv Date: 880520 Part B Recv Date: 880526

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

 Waste Code:
 F001 - UNKNOWN

Quantity: 00976

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 88

Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTC0123530

Manifest Status: Completed copy
Trans1 State ID: 75126Z(NY
Trans2 State ID: 751267(NY
Generator Ship Date: 880517

Trans1 Recv Date: 880517

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Not reported Trans2 Recv Date: 880518 TSD Site Recv Date: 880527 Part A Recv Date: Part B Recv Date: 880526 Generator EPA ID: NYD144771482 Trans1 EPA ID: NYD000708271 Trans2 EPA ID: Not reported TSDF ID: CTD072138969

Waste Code: D002 - NON-LISTED CORROSIVE WASTES

Quantity: 00826

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 88

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTC0123535 Manifest Status: Completed copy Trans1 State ID: 75121Z(NY Trans2 State ID: Not reported 880519 Generator Ship Date: Trans1 Recv Date: 880519 Trans2 Recv Date: Not reported TSD Site Recv Date: 880520 Part A Recv Date: 880523 Part B Recv Date: 880601

 Generator EPA ID:
 NYD144771482

 Trans1 EPA ID:
 NYD000708271

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 CTD072138969

 Waste Code:
 F001 - UNKNOWN

Quantity: 02500
Units: P - Pounds
Number of Containers: 005

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 01000
Units: P - Pounds
Number of Containers: 002

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.

Direction Distance

Elevation Site Database(s) EPA ID Number

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00100
Units: P - Pounds

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: L Landfill.
Specific Gravity: 100
Year: 88
Manifest Tracking Num: Not reporte

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTC0123498 Manifest Status: Completed copy Trans1 State ID: 77282DNY Trans2 State ID: Not reported Generator Ship Date: 881229 Trans1 Recv Date: 881229 Trans2 Recv Date: Not reported TSD Site Recv Date: 881230 Part A Recv Date: 890104 Part B Recv Date: 890110 Generator EPA ID: NYD144771482 NYD000708271 Trans1 EPA ID: Trans2 EPA ID: Not reported TSDF ID: CTD072138969

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 02500 Units: P - Pounds Number of Containers: 005

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100

Waste Code:

Quantity:

Units:

Number of Containers:

Not reported
00900

P - Pounds
003

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 88

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TURBOSYSTEMS INTL (Continued)

1000164434

EDR ID Number

Discr Residue Ind: Not reported Not reported Discr Partial Reject Ind: Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: CTC0123495

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

751202NY Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 881229 Trans1 Recv Date: 881229 Trans2 Recv Date: Not reported TSD Site Recy Date: 881230 Part A Recv Date: 890217 Part B Recv Date: 890201

NYD144771482 Generator EPA ID: Trans1 EPA ID: NYD000708271 Trans2 EPA ID: Not reported TSDF ID: CTD072138969 Waste Code: F005 - UNKNOWN Quantity: 00660

Units:

G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: TT - Cargo tank, tank trucks

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 100 Year: 88 Manifest Tracking Num: Not reported

Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

R101 ST JOHNSBURY TRUCKING CO. UST U003644644 NNW 7-9 NORTHWAY LANE **HIST UST** N/A

1/8-1/4 0.214 mi.

1132 ft. Site 18 of 29 in cluster R

UST: Relative:

Facility Id: 4-020206 Higher STATE Region:

Actual: DEC Region:

NORTH LATHAM, NY 12110

299 ft. Site Status: Unregulated

Direction Distance

Elevation Site Database(s) EPA ID Number

ST JOHNSBURY TRUCKING CO. (Continued)

U003644644

EDR ID Number

 Program Type:
 PBS

 Expiration Date:
 N/A

 UTM X:
 598725

 UTM Y:
 4732055

 Site ID:
 34971

Tank Number: 1 Tank ID: 85392

Tank Status:

Closed - Removed
Tank Model:

Pipe Model:

Install Date:

Capacity Gallons:

Tightness Test Method:

Not reported

9/1/1986

4000

NN

NN

Next Test Date: Not reported Date Tank Closed: 5/1/1992
Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True

Modified By: TRANSLAT Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None D02 - Pipe Type - Galvanized Steel A00 - Tank Internal Protection - None H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None

B02 - Tank External Protection - Original Sacrificial Anode

C02 - Pipe Location - Underground/On-ground

100 - Overfill - None J02 - Dispenser - Suction

Tank Number: 2
Tank ID: 85390

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported Capacity Gallons: 4000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

J02 - Dispenser - Suction

G00 - Tank Secondary Containment - None A00 - Tank Internal Protection - None

D00 - Pipe Type - No Piping

B00 - Tank External Protection - None

Direction Distance Elevation

ation Site Database(s) EPA ID Number

ST JOHNSBURY TRUCKING CO. (Continued)

U003644644

EDR ID Number

H00 - Tank Leak Detection - None F00 - Pipe External Protection - None C00 - Pipe Location - No Piping

100 - Overfill - None

Tank Number: 3
Tank ID: 85391

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 4000
Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

C00 - Pipe Location - No Piping H00 - Tank Leak Detection - None F00 - Pipe External Protection - None

D00 - Pipe Type - No Piping

G00 - Tank Secondary Containment - None

100 - Overfill - None

B00 - Tank External Protection - None A00 - Tank Internal Protection - None

J02 - Dispenser - Suction

Affiliation Records:

Site Id: 34971 Affiliation Type: Owner

Company Name: ST JOHNSBURY TRUCKING CO INC

Contact Type: Not reported
Contact Name: Not reported
Address1: 38 MAIN ST
Address2: Not reported
City: ST JOHNSBURY

State: VT
Zip Code: 05819
Country Code: 001

Phone: (803) 748-7877
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 34971

Affiliation Type: Emergency Contact

Company Name: ST JOHNSBURY TRUCKING CO INC

Contact Type: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ST JOHNSBURY TRUCKING CO. (Continued)

U003644644

Contact Name: **BOB REILLY** Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

(518) 783-1195 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 34971

On-Site Operator Affiliation Type:

ST JOHNSBURY TRUCKING CO INC Company Name:

Contact Type: Not reported Contact Name: **BOB REILLY** Address1: Not reported Address2: Not reported City: Not reported State: NN Zip Code: Not reported

Country Code: 001

Phone: (518) 783-1195 Not reported Phone Ext: Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Site Id: 34971 Affiliation Type: Mail Contact

ST JOHNSBURY TRUCKING CO INC Company Name:

Contact Type: Not reported Contact Name: S. G. DENIO Address1: 38 MAIN ST Address2: Not reported ST JOHNSBURY City:

State: VT Zip Code: 05819 Country Code: 001

(803) 748-8131 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

HIST UST:

4-020206 PBS Number: SPDES Number: Not reported **BOB REILLY Emergency Contact:** Emergency Telephone: (518) 783-1195 Operator: **BOB REILLY** Operator Telephone: (518) 783-1195

Direction Distance

Elevation Site Database(s) EPA ID Number

ST JOHNSBURY TRUCKING CO. (Continued)

U003644644

EDR ID Number

Owner Name: ST JOHNSBURY TRUCKING CO INC

Owner Address: 38 MAIN ST

Owner City, St, Zip: ST JOHNSBURY, VT 05819

Owner Telephone: (803) 748-7877 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: ST JOHNSBURY TRUCKING CO INC

Mailing Address: 38 MAIN ST Mailing Address 2: Not reported

Mailing City,St,Zip: ST JOHNSBURY, VT 05819

Mailing Contact: S. G. DENIO
Mailing Telephone: (803) 748-8131
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported

SWIS ID: 0126

Old PBS Number: Not reported

Facility Type: TRUCKING/TRANSPORTATION

Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False 10/10/1991 Certification Date: **Expiration Date:** 11/07/1996 Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data

Tank Screen: 0
Dead Letter: True
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26
Region: 4

Tank ld: 1

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19860901
Capacity (gals): 4000
Product Stored: DIESEL

Tank Type: Steel/carbon steel
Tank Internal: None

Tank External: Sacrificial Anode
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL

Pipe Internal: None
Pipe External: None
Second Containment: None
Leak Detection: None
Overfill Prot: None
Dispenser: Suction

Direction Distance

Elevation Site Database(s) EPA ID Number

ST JOHNSBURY TRUCKING CO. (Continued)

U003644644

EDR ID Number

Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: No Missing Data Date Closed: 05/01/1992 Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Tank ld: 2

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: Not reported Capacity (gals): 4000 Product Stored: DIESEL

Steel/carbon steel Tank Type: Tank Internal: Not reported Tank External: Not reported Not reported Pipe Location: Pipe Type: Not reported Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

Tank ld: 3

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: Not reported Capacity (gals): 4000 Product Stored: DIESEL

Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported Pipe Type: Not reported Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: Minor Data Missing

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ST JOHNSBURY TRUCKING CO. (Continued)

U003644644

Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

R102 **GENERAL STEEL FABRICATORS RCRA-NonGen** 1008404379 NYN008014755

NNW 11 NORTHWAY LA 1/8-1/4 LATHAM, NY 12110

0.215 mi.

1136 ft. Site 19 of 29 in cluster R

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

GENERAL STEEL FABRICATORS Facility name:

Actual: 299 ft.

Facility address: 11 NORTHWAY LA

LATHAM, NY 12110

EPA ID: NYN008014755 Mailing address: **NORTHWAY LA**

LATHAM, NY 12110

ROBERT J ROCK Contact: Contact address: NORTHWAY LA

LATHAM, NY 12110

Contact country: US

Contact telephone: (518) 463-5700 Not reported Contact email:

EPA Region: 02 Land type: Private Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: Unknown Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: Unknown Underground injection activity: Unknown On-site burner exemption: Unknown Furnace exemption: Unknown Unknown Used oil fuel burner: Used oil processor: Unknown User oil refiner: Unknown Used oil fuel marketer to burner: Unknown Used oil Specification marketer: Unknown Used oil transfer facility: Unknown Used oil transporter: Unknown

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: GENERAL STEEL FABRICATORS

Classification: Not a generator, verified

Date form received by agency: 06/23/2005

Facility name: **GENERAL STEEL FABRICATORS**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

GENERAL STEEL FABRICATORS (Continued)

1008404379

Classification: Not a generator, verified

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 04/26/2005

COMPLIANCE EVALUATION INSPECTION ON-SITE Evaluation:

Area of violation: Not reported Date achieved compliance: Not reported Evaluation lead agency: State

R103 **CROWN ENTERPRISES INC** 1000990096 **RCRA-NonGen** NNW **10 NORTHWAY LANE FINDS** NYR00000554

LATHAM, NY 12110 **HIST LTANKS** 1/8-1/4 0.215 mi. UST

HIST UST 1137 ft. Site 20 of 29 in cluster R

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

Facility name: **CROWN ENTERPRISES INC** Actual: Facility address: 10 NORTHWAY LANE

299 ft. LATHAM, NY 121104809

> EPA ID: NYR000000554 STEPHENS DR Mailing address: WARREN, NY 48089

Contact: Not reported Contact address: STEPHENS DR WARREN, NY 48089

US

Contact telephone: Not reported Contact email: Not reported

EPA Region:

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Contact country:

Owner/operator name: **CROWN ENTERPRISES INC** Owner/operator address: 12225 STEPHENS DR

WARREN, MI 48089

Owner/operator country: US

Owner/operator telephone: (800) 521-4343 Legal status: Private Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

CROWN ENTERPRISES INC Owner/operator name: Owner/operator address: 12225 STEPHENS DR

WARREN, MI 48089

Owner/operator country: US

Owner/operator telephone: (800) 521-4343 Legal status: Private

Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Map ID MAP FINDINGS
Direction

Distance

Elevation Site Database(s) EPA ID Number

CROWN ENTERPRISES INC (Continued)

1000990096

EDR ID Number

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: CROWN ENTERPRISES INC Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: CROWN ENTERPRISES INC Classification: Not a generator, verified

Date form received by agency: 02/24/1995

Facility name: CROWN ENTERPRISES INC Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110009483923

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

HIST LTANKS:

Region of Spill: 4

Spill Number: 9415293
Spill Date: 02/22/1995
Spill Time: 11:45
Spill Cause: Tank Failure
Resource Affectd: Groundwater
Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Direction Distance Elevation

n Site Database(s) EPA ID Number

CROWN ENTERPRISES INC (Continued)

1000990096

EDR ID Number

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 06/06/01 Cleanup Ceased: / / Cleanup Meets Standard: False

Investigator: **CHRISTENSEN** Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Not reported Notifier Phone: Notifier Extension: Not reported Reported to Department Date: 02/22/95 Reported to Department Time: 12:00 SWIS:

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Spiller Name: CROWN ENTERPRISES

Spiller Address: 10 NORTHERN LN [NORTHWAY]

Spiller City,St,Zip: LATHAM
Spiller Cleanup Date: //
Facility Contact: Not reported
Facility Phone: (518) 783-0201
Facility Extention: Not reported
Spill Notifier: Other
PBS Number: 4-600349

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/07/95
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 11/19/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: GASOLINE
Class Type: GASOLINE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CROWN ENTERPRISES INC (Continued)

1000990096

Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: 9/11/97 - CONFERENCE CALL WITH MINDY SAYERS AND RICHARD FROM GZA ABOUT

> REMEDIATION AND FURTHER INVESTIGATION OF 10 NORTHWAY LANE CROWN ENTERPRISES) WELL ARE TO BE BAILED TO CHECK FOR FREE PRODUCT AND FURTHER GEO PROBING TO BE DONE THIS MONTH OR EARLY NEXT MONTH TO FIND THE EXTENT OF THE FREE PRODUCT AND

DEVELOP AN PLAN TO REMEDIATE THE SITE. See Folder for all reports. 9/19/00 -Received a report from Crown, done for them by MC Environmental. It shows that

contaminationhas not gone off site but they are not proposing to do any remediation. I have referred it to legal again. 01/05/2001 - Keith Goert was at site when it was dug out by MC Environmental. Site was heavily contaminated. Waiting for closure report. Site was dug up in Novemberof 2000. 06/06/2001 -Closure report received on January 25,2001 and showed contamination remaining above TAGMs in the bottom and West Wall of the excavation. Groundwater also above standards. A second round of groundwater sampling showed minor exceedences for Ben ene 23ppb), M-P Xylene 42ppb), 1,3,5 Trimethylben ene 62ppb) and Naphthalene 88ppb). Based on these results the site was closed as

not meeting New York State Soil or Groundwater Standards. wtc

FOUND CONT. SOIL @ TANK PULL. SEE FOLDER. Spill Cause:

UST:

Facility Id: 4-600349 Region: STATE DEC Region:

Site Status: Unregulated Program Type: **PBS Expiration Date:** N/A UTM X: 598697

4732056 UTM Y: Site ID: 37683

Tank Number:

95699 Tank ID:

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported 4000 Capacity Gallons:

Tightness Test Method: NN Next Test Date: Not reported Date Tank Closed: 2/1/1995

Tank Location: Tank Type: Steel/carbon steel Date Test: Not reported Register: True **TRANSLAT** Modified By:

Last Modified: 3/4/2004

Equipment Records: C02 - Pipe Location - Underground/On-ground

B01 - Tank External Protection - Painted/Asphalt Coating

100 - Overfill - None

F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None

H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CROWN ENTERPRISES INC (Continued)

1000990096

D01 - Pipe Type - Steel/Carbon Steel/Iron

J02 - Dispenser - Suction

Tank Number: Tank ID: 95700

Closed - Removed Tank Status: Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported 4000 Capacity Gallons: Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: 2/1/1995

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

C02 - Pipe Location - Underground/On-ground G00 - Tank Secondary Containment - None

100 - Overfill - None

B01 - Tank External Protection - Painted/Asphalt Coating

F00 - Pipe External Protection - None D01 - Pipe Type - Steel/Carbon Steel/Iron H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None

J02 - Dispenser - Suction

Tank Number:

Tank ID: 95701

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: Not reported 4000 Capacity Gallons: Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: 2/1/1995 Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True **TRANSLAT** Modified By: Last Modified: 3/4/2004

Equipment Records:

100 - Overfill - None

H00 - Tank Leak Detection - None

C02 - Pipe Location - Underground/On-ground G00 - Tank Secondary Containment - None F00 - Pipe External Protection - None

J02 - Dispenser - Suction

B01 - Tank External Protection - Painted/Asphalt Coating

Direction Distance

Elevation Site Database(s) **EPA ID Number**

CROWN ENTERPRISES INC (Continued)

1000990096

EDR ID Number

A00 - Tank Internal Protection - None D01 - Pipe Type - Steel/Carbon Steel/Iron

Affiliation Records:

Site Id: 37683

On-Site Operator Affiliation Type:

Company Name: CROWN ENTERPRISES INC.

Contact Type: Not reported Contact Name: DICK DOMINICK Address1: Not reported Address2: Not reported City: Not reported State: NN Zip Code: Not reported Country Code: 001

Phone: (518) 783-6201 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: TRANSLAT

Date Last Modified: 3/4/2004

Site Id: 37683 **Emergency Contact** Affiliation Type:

Company Name: CROWN ENTERPRISES INC.

Contact Type: Not reported Contact Name: DICK DOMINICK Address1: Not reported Address2: Not reported City: Not reported

State: NN

Zip Code: Not reported

Country Code: 001

(518) 783-6201 Phone: Not reported Phone Ext: Not reported Email: Fax Number: Not reported Modified By: **TRANSLAT** 3/4/2004 Date Last Modified:

Site Id: 37683 Affiliation Type: Owner

Company Name: CROWN ENTERPRISES INC.

Contact Type: Not reported Contact Name: Not reported

Address1: 12225 STEPHENS DRIVE

Address2: Not reported City: WARREN State: ΜI Zip Code: 48089 Country Code: 001

(800) 334-4883 Phone: Phone Ext: Not reported Email: Not reported Not reported Fax Number: Modified By: **TRANSLAT** Date Last Modified: 3/4/2004

Direction Distance

Elevation Site Database(s) EPA ID Number

CROWN ENTERPRISES INC (Continued)

1000990096

EDR ID Number

Site Id: 37683
Affiliation Type: Mail Contact

Company Name: CROWN ENTERPRISES INC.

Contact Type: Not reported

Contact Name: MR. DICK DOMINICK

Address1: A DIVISION OF CENTRAL TRANSPORT

Address2: 12225 STEPHENS DRIVE

 City:
 WARREN

 State:
 MI

 Zip Code:
 48089-2010

 Country Code:
 001

Phone: (800) 334-4883
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

HIST UST:

PBS Number: 4-600349
SPDES Number: Not reported
Emergency Contact: DICK DOMINICK
Emergency Telephone: (800) 334-4883
Operator: DICK DOMINICK
Operator Telephone: (518) 783-6201

Owner Name: CROWN ENTERPRISES INC.
Owner Address: 12225 STEPHENS DRIVE
Owner City,St,Zip: WARREN, MI 48089
Owner Telephone: (800) 334-4883
Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: CROWN ENTERPRISES INC.

Mailing Address: A DIVISION OF CENTRAL TRANSPORT

Mailing Address 2: 12225 STEPHENS DRIVE
Mailing City,St,Zip: WARREN, MI 48089-2010
Mailing Contact: MR. DICK DOMINICK
Mailing Telephone: (800) 334-4883
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126
Old PBS Number: Not reported

Facility Type: TRUCKING/TRANSPORTATION

Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 05/30/1995 **Expiration Date:** 05/30/2000 Renew Flag: False Renewal Date: Not reported Λ

Total Capacity: 0 FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data

Direction Distance

Elevation Site Database(s) EPA ID Number

CROWN ENTERPRISES INC (Continued)

1000990096

EDR ID Number

Tank Screen: 0
Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26

Tank ld:

Region:

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (gals): 4000

Capacity (gals): 4000
Product Stored: DIESEL

Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Painted/Asphalt Coating

4

Pipe Location: Underground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data 02/01/1995 Date Closed: Test Method: Not reported Deleted: False Updated: True Lat/long: Not reported

Tank ld: 2

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: Not reported
Capacity (gals): 4000
Product Stored: DIESEL

Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Painted/Asphalt Coating

Pipe Location: Underground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Not reported Date Tested: Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 02/01/1995 Test Method: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CROWN ENTERPRISES INC (Continued)

1000990096

Deleted: False Updated: True Lat/long: Not reported

Tank Id:

Tank Location: UNDERGROUND Tank Status: Closed-Removed Install Date: Not reported

Capacity (gals): 4000

UNLEADED GASOLINE Product Stored: Steel/carbon steel Tank Type:

Tank Internal: None

Tank External: Painted/Asphalt Coating

Underground Pipe Location: STEEL/IRON Pipe Type:

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: None Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: 02/01/1995 Date Closed: Test Method: Not reported Deleted: False Updated: True Not reported Lat/long:

CROWN ENTERPRISES INC R104 **MANIFEST** S109786360 NNW 10 NORTHWAY LN N/A

1/8-1/4 0.215 mi.

Site 21 of 29 in cluster R

LATHAM, NY 12110

1137 ft. Relative:

Actual:

299 ft.

CT MANIFEST: Waste:

Higher

Manifest No: CTF0201023

Waste Occurence:

UNNA: 1203 Hazard Class:

US Dot Description: WASTE GASOLINE MIXTURE

No of Containers: 001 Container Type: TT Quantity: 1713 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 4/26/2004

DEO Who Last Modified Record: IG

Waste CD:

CTF0201023 Manifest No:

Waste Occurence: EPA Waste Code: D018

Direction Distance

Elevation Site Database(s) EPA ID Number

CROWN ENTERPRISES INC (Continued)

S109786360

EDR ID Number

Recycled Waste?: F
Date Record Was Last Modified: 4/26/2004
DEO Who Last Modified Record: IG

Detail:

Year: 1995

Manifest ID: CTF0201023 TSDF EPA ID: CTD072138969

TSDF Name: ENVIRONMENTAL WASTE RESOURCES

TSDF Address: 130 FREIGHT ST. WATERBURY

TSDF City,St,Zip: CT 06725
TSDF Country: USA
TSDF Telephone: Not reported
Transport Date: 3/28/1995
Transporter EPA ID: NYD980761191

Transporter Name: ENVIRONMENTAL PRODUCTS AND SERVICES, INC.

Transporter Country: USA

Transporter Phone: Not reported Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City,St,Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported EPA ID: NYP000919027 Generator Phone: Not reported

Generator Mailing Addr: 10 NORTHWAY LANE

Generator Mailing Town: LATHAEM

Generator Mailing State: NY

Generator Mailing Zip: Not reported

Generator Mailing Country: USA Special Handling: Not re

Special Handling: Not reported Discrepancies: No Date Shipped: 3/28/1995 Date Received: 3/29/1995

Last modified date: 4/26/2004 Last modified by: IG

Comments: Not reported

R105 CROWN ENT NORTHWAY LN NNW 10 NORTHWAY LN 1/8-1/4 LATHAM, NY

0.215 mi.

1137 ft. Site 22 of 29 in cluster R

Relative: NY Spills:

Higher Site ID: 241281

Facility Addr2: 10 NORTHERN LN OR NORTHWAY

Actual: Facility ID: 9415293

 299 ft.
 Spill Number:
 9415293

 Facility Type:
 ER

 SWIS:
 0126

 Investigator:
 WTCHRIST

Investigator: WTCHRIST
Referred To: Not reported
Spill Date: 2/22/1995

S109416205

N/A

NY Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

CROWN ENT NORTHWAY LN (Continued)

S109416205

EDR ID Number

Reported to Dept: 2/22/1995

CID: 21

Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial

Spill Notifier:
Cleanup Ceased:
Cleanup Meets Std:

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/6/2001
Remediation Phase: 0
Date Entered In Computer: 4/7/1995
Spill Record Last Update: 1/8/2009
Spiller Name: Not reported

Spiller Company: CROWN ENTERPRISES

Spiller Address: 10 NORTHERN LN [NORTHWAY]

Spiller City, St, Zip: LATHAM, ZZ

Spiller Company: 001

Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 4
DER Facility ID: 198386

DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was

"CHRISTENSEN" 9/11/97 - CONFERENCE CALL WITH MINDY SAYERS AND RICHARD FROM GZA ABOUT REMEDIATION AND FURTHER INVESTIGATION OF 10 NORTHWAY LANE (CROWN ENTERPRISES) WELL ARE TO BE BAILED TO CHECK FOR FREE PRODUCT AND FURTHER GEO PROBING TO BE DONE THIS MONTH OR EARLY NEXT MONTH TO FIND THE EXTENT OF THE FREE PRODUCT AND DEVELOP AN PLAN TO

REMEDIATE THE SITE. See Folder (Edocs) for all reports. 9/19/00 - Received a report from Crown, done for them by MC Environmental. It shows that contaminationhas not gone off site but they are not proposing to do any remediation. I have referred it to legal again. 01/05/2001 - Keith Goertz was at site when it was dug out by MC Environmental. Site was heavily contaminated. Waiting for closure report. Site was dug up in November of 2000. 06/06/2001 - Closure report received on January 25,2001 and showed contamination remaining

above TAGMs in the bottom and West Wall of the excavation. Groundwater also above standards. A second round of groundwater sampling showed minor exceedences for Benzene (23ppb), M-P Xylene (42ppb), 1,3,5 Trimethylbenzene (62ppb) and Naphthalene (88ppb). Based on these results the site was closed as not meeting New York

State Soil or Groundwater Standards. wtc

Remarks: FOUND CONT. SOIL @ TANK PULL. SEE FOLDER.

Material:

Site ID: 241281 Operable Unit ID: 1012609 Operable Unit: 01 Material ID: 370472 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CROWN ENT NORTHWAY LN (Continued)

S109416205

Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: True Site ID: 241281 Operable Unit ID: 1012609 Operable Unit: 01 Material ID: 573265 Material Code: 1213A

Material Name: MTBE (METHYL-TERT-BUTYL ETHER)

01634044 Case No.:

Material FA: Hazardous Material Quantity: Not reported Units: Not reported Recovered: Not reported Resource Affected: Not reported Oxygenate: True

Tank Test:

Site ID: 241281 Spill Tank Test: 1543626 Tank Number: Not reported

Tank Size: Test Method: 00 Leak Rate:

Not reported Gross Fail: Spills Modified By: Last Modified: 10/1/2004 Test Method: Unknown

R106 **CROWN ENTERPRIZES** NNW 10 NORTHWAY LN **LATHAM, NY 12110** 1/8-1/4

0.215 mi.

1137 ft. Site 23 of 29 in cluster R

RCRA-NonGen: Relative:

Date form received by agency: 02/03/1996 Higher

CROWN ENTERPRIZES Facility name: Actual: Facility address: 10 NORTHWAY LN 299 ft. LATHAM, NY 121100000

EPA ID: NYP000919027

Contact: ANTHONY LAZARECKI Contact address: 10 NORTHWAY LN LATHAM, NY 121100000

Contact country: US

(810) 939-7000 Contact telephone:

Telephone ext.: 2420 Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown RCRA-NonGen

MANIFEST

1007205180

NYP000919027

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CROWN ENTERPRIZES (Continued)

1007205180

Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: Unknown Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: Unknown On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: Unknown Used oil processor: Unknown User oil refiner: Unknown Used oil fuel marketer to burner: Unknown Used oil Specification marketer: Unknown Used oil transfer facility: Unknown Used oil transporter: Unknown

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 02/02/1996

Facility name: **CROWN ENTERPRIZES** Classification: Not a generator, verified

Date form received by agency: 02/01/1996

Facility name: **CROWN ENTERPRIZES** Classification: Large Quantity Generator

Violation Status: No violations found

NY MANIFEST:

NYR000000554 EPA ID:

Country: USA

Mailing Name: **CROWN ENTERPRISES**

Mailing Contact: MIKE

Mailing Address: 12225 STEPHENS INC

Mailing Address 2: Not reported Mailing City: WARREN Mailing State: MI Mailing Zip: 48089 Mailing Zip4: Not reported Mailing Country: USA

Mailing Phone: 800-521-4343

Document ID: CTF0201023 Manifest Status: Completed copy PR1941NY Trans1 State ID: Trans2 State ID: Not reported Generator Ship Date: 950328 Trans1 Recv Date: 950328 Trans2 Recv Date: Not reported TSD Site Recy Date: 950329 Part A Recv Date: Not reported Part B Recv Date: 950407 NYP000919027 Generator EPA ID: Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID: CTD072138969

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Direction Distance

Elevation Site Database(s) **EPA ID Number**

CROWN ENTERPRIZES (Continued)

1007205180

EDR ID Number

Quantity: 14260 P - Pounds Units: 001

Number of Containers:

Container Type: TT - Cargo tank, tank trucks

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Year: 95

Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

EPA ID: NYP000919027

Country: USA

Mailing Name: **CROWN ENTERPRISES** Mailing Contact: HENRY HEIDECKER Mailing Address: 12225 STEPHENS DRIVE

Mailing Address 2: Not reported Mailing City: WARREN Mailing State: MΙ Mailing Zip: 48089 Mailing Zip4: Not reported Mailing Country: USA

Mailing Phone: 800-521-4343

Document ID: CTF0201023 Manifest Status: Completed copy Trans1 State ID: PR1941NY Trans2 State ID: Not reported Generator Ship Date: 950328 Trans1 Recv Date: 950328 Trans2 Recv Date: Not reported TSD Site Recv Date: 950329 Part A Recv Date: Not reported Part B Recv Date: 950407

NYP000919027 Generator EPA ID: Trans1 EPA ID: NYD980761191 Trans2 EPA ID: Not reported TSDF ID: CTD072138969

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 14260 P - Pounds Units: Number of Containers:

TT - Cargo tank, tank trucks Container Type:

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 100 Year: 95

Manifest Tracking Num: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CROWN ENTERPRIZES (Continued)

1007205180

Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

BLUE LINE EXP NORTHWAY LN R107 **NY Spills** S103481963 NNW **16 NORTHWAY LN NY Hist Spills** N/A

1/8-1/4 COLONIE, NY

0.220 mi.

1164 ft. Site 24 of 29 in cluster R

Relative:

NY Spills: Site ID: Higher

Actual: 299 ft.

117579 Facility Addr2: Not reported Facility ID: 8804166 Spill Number: 8804166 Facility Type: ER SWIS: 0126 **TESPERBE** Investigator: Referred To: Not reported

Spill Date: 8/11/1988 Reported to Dept: 8/11/1988 CID: Not reported Equipment Failure Spill Cause: Water Affected: Not reported Spill Source: Commercial/Industrial

Responsible Party Cleanup Ceased: 1/17/1989 Cleanup Meets Std: True Last Inspection: 12/28/1988

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Notifier:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/17/1989

Remediation Phase:

Date Entered In Computer: 8/31/1988 Spill Record Last Update: 4/17/2000 Spiller Name: PHIL BERMAN

BLUE LINES EXPRESS * Spiller Company: Spiller Address: 16 NORTHWAY LANE

Spiller City, St, Zip: LATHAM, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 102283

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"SPERBECK" 08/12/88: 8/11 1700 SPERBECK TELECON COFFEY. SHEAR VALVE LEAKING. ANDERSON REPAIRED.SPERBECK TO INSPECT.8/12 1600SPERBECK TEECON COFFEY REMOVE CONT. SOIL, DIG TEST HOLE, CALL FOR INSPECTION.

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

BLUE LINE EXP NORTHWAY LN (Continued)

S103481963

08/25/88: 13:00-SPERBECK INSPECTED, CLEAN-UP NOT COMPLETE, TOLD COFFEY TO HIRE BACKHOE TO REMOVE CONT. SOIL & CONTACT ON STARTING DATE. 08/29/88: 10:30-SPERBECK INSPECTED, DOMERMUTH REMOVED 1 TRUCKLOAD CONT. SOIL, HNU READINGS 30-50 PPM IN AREA, MORE SOIL MUST BE REMOVED, TEST HOLES IN OTHER AREAS READ 100-150 PPM, PAST SPILL, WILL CONTACT ... 08/29/88: OWNER ABOUT CLEAN-UP, COFFEY TO FINISH HIS

SPILL. SEE Rpt; 8804758.

Remarks: DAVE COFFEY:LEAK CAUSED DUE TO SHEAR VALVE ON DIESEL PUMP.APPLIED

SPEEDIDRY. 8-12/88-SPERBECK FOUND OLD CONT. UNDER NEW SPILL, ARRANGED

FOR BERMAN TO CLEAN, W.CENTRAL REMOVED CONT. SOIL, COMPLETE.

Material:

Site ID: 117579 Operable Unit ID: 919220 Operable Unit: 01 Material ID: 456121 Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: 35 Gallons Units: Recovered: No Resource Affected: Not reported

Resource Affected: Not repor

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 8804166 Investigator: **SPERBECK** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported 08/11/1988 11:00 Spill Date/Time: Reported to Dept Date/Time: 08/11/88 14:07

SWIS: 01

Spiller Name: BLUE LINES EXPRESS *

Spiller Contact: PHIL BERMAN
Spiller Phone: (518) 783-5222
Spiller Address: 16 NORTHWAY LANE

Spiller City, St, Zip: LATHAM, NY

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BLUE LINE EXP NORTHWAY LN (Continued)

S103481963

Equipment Failure Spill Cause:

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 01

Spill Notifier: Responsible Party PBS Number: Not reported 01/17/89 Cleanup Ceased: Cleanup Meets Std: True Last Inspection: 12/28/88

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** // Invstgn Complete: / / **UST Involvement:** False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 01/17/89

Corrective Action Plan Submitted: / / Date Region Sent Summary to Central Office: / /

08/31/88 Date Spill Entered In Computer Data File: Date Spill Entered In Computer Data File: Not reported

Update Date: 04/17/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Petroleum Quantity Spilled: 35 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported Last Date: 19940728

DEC Remarks: 08/12/88: 8/11 1700 SPERBECK TELECON COFFEY. SHEAR VALVE LEAKING. ANDERSON

REPAIRED.SPERBECK TO INSPECT.8/12 1600SPERBECK TEECON COFFEY REMOVE CONT. SOIL,

DIG TEST HOLE, CALL FOR INSPECTION. 08/25/88: 13:00-SPERBECK INSPECTED, CLEAN-UP NOT COMPLETE, TOLD COFFEY TO HIRE BACKHOE TO REMOVE CONT. SOIL CONTACT ON STARTING DATE. 08/29/88: 10:30-SPERBECK INSPECTED, DOMERMUTH REMOVED 1 TRUCKLOAD CONT. SOIL, HNU READINGS 30-50 PPM IN AREA, MORE SOIL MUST BE REMOVED. TEST HOLES IN OTHER AREASREAD 100-150 PPM. PAST SPILL. WILL CONTACT

08/29/88: OWNER ABOUT CLEAN-UP, COFFEY TO FINISH HIS SPILL.

Rpt; 8804758.

DAVE COFFEY:LEAK CAUSED DUE TO SHEAR VALVE ON DIESEL PUMP.APPLIED SPEEDIDRY. Remark:

8-12/88-SPERBECK FOUND OLD CONT. UNDER NEW SPILL, ARRANGED FOR BERMAN TO CLEAN,

W.CENTRAL REMOVED CONT. SOIL, COMPLETE.

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

R108 BIRMAN NORTHWAY LN NY Spills S103481964
NNW 16 NORTHWAY LN NY Hist Spills N/A

1/8-1/4 ALBANY LATHAM COLONIE, NY

0.224 mi.

1182 ft. Site 25 of 29 in cluster R

Relative: Higher NY Spills:
Site ID: 117580
Facility Addr2: Not reported

Actual: 299 ft.

Facility Addiz.

Facility ID:

Spill Number:

Spill Number:

8804758

Spill Number:

ER

SWIS:

0126

Investigator:

TESPERBE

Referred To:

Not reported

Spill Date:

8/29/1988

Reported to Dept:

8/29/1988

Reported to Dept: 8/29/1988
CID: Not reported
Spill Cause: Unknown
Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: DEC
Cleanup Ceased: 11/1/1988
Cleanup Meets Std: True
Last Inspection: 8/29/1988

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 8/10/1990
Remediation Phase: 0
Date Entered In Computer: 9/2/1988
Spill Record Last Update: 3/22/2000
Spiller Name: Not reported

Spiller Company: PHILIP BIRMAN [BERMAN?]
Spiller Address: 2200 HAMILTON SUITE 312
Spiller City, St, Zip: ALLENTOWN, PA 18104

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 284381

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"SPERBECK" 08/10/90: CLEANUP COMP.

Remarks: DURING INSPECTION OF SP #8804166 FOUND OLDER CONTAMINATED SOIL WITH

100-150 PPM HNU THROUGHOUT FUEL TANK AREA.TONY DEPOMA 783-1685 OWNS

WHITE TANK.

Material:

Site ID: 117580 Operable Unit ID: 919874 Operable Unit: 01 456686 Material ID: Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity:

Units: Gallons
Recovered: No

Direction Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

BIRMAN NORTHWAY LN (Continued)

S103481964

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

8804758 Spill Number: **SPERBECK** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 08/29/1988 11:00 08/29/88 11:00 Reported to Dept Date/Time:

SWIS: 01

Spiller Name: PHILIP BIRMAN [BERMAN?]

Spiller Contact: Not reported Spiller Phone: (215) 432-7736

Spiller Address: 2200 HAMILTON SUITE 312 Spiller City, St, Zip: ALLENTOWN, PA 18104 Spill Cause:

Unknown

Reported to Dept: Groundwater Water Affected: Not reported Spill Source: 01 Spill Notifier: DEC PBS Number: Not reported

Cleanup Ceased: 11/01/88 Cleanup Meets Std: True 08/29/88 Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: // **Enforcement Date:** / / Invstgn Complete: / / **UST Involvement:** False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 08/10/90

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 09/02/88 Date Spill Entered In Computer Data File: Not reported

Update Date: 03/22/00

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

BIRMAN NORTHWAY LN (Continued)

S103481964

Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: **GASOLINE GASOLINE** Class Type: Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 **DEC Remarks:** 08/10/90: CLEANUP COMP.

Remark: DURING INSPECTION OF SP 8804166 FOUND OLDER CONTAMINATED SOIL WITH 100-150 PPM

HNU THROUGHOUT FUEL TANK AREA.TONY DEPOMA 783-1685 OWNS WHITE TANK.

 109
 VANTAGE EQUIPMENT, LLC
 AST
 A100296537

 NNW
 17 NORTHWAY LANE
 N/A

 1/8-1/4
 LATHAM, NY 12110
 N/A

1/8-1/4 0.228 mi. 1203 ft.

Relative: AST:

Higher Region: STATE
DEC Region: 4

Actual: Site Status: Active

300 ft. Site Status: Active 4-600952 Program Type: PBS

UTM X: 598767.53052999999 UTM Y: 4732059.6907400005

Expiration Date: 2009/12/06

Tank Number: 001
Tank Id: 178828
Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 1/1/2002
Capacity Gallons: 1000
Tightness Test Method: NN

Date Test:
Not reported
Next Test Date:
Not reported
Date Tank Closed:
Not reported
Register:
True
Modified By:
TESPERBE
Last Modified:
12/6/2004

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VANTAGE EQUIPMENT, LLC (Continued)

A100296537

Equipment Records:

G99 - Tank Secondary Containment - Other E00 - Piping Secondary Containment - None D01 - Pipe Type - Steel/Carbon Steel/Iron C01 - Pipe Location - Aboveground

J02 - Dispenser - Suction

F00 - Pipe External Protection - None A00 - Tank Internal Protection - None 104 - Overfill - Product Level Gauge (A/G) K01 - Spill Prevention - Catch Basin

B01 - Tank External Protection - Painted/Asphalt Coating

L00 - Piping Leak Detection - None

H02 - Tank Leak Detection - Interstitial - Manual Monitoring

Tank Number: 002 Tank Id: 178829 Tank Location:

Tank Type: Steel/Carbon Steel/Iron

Tank Status: Tank Converted to Non-Regulated Use

Not reported Tank Model: Pipe Model: Not reported Install Date: 1/1/2002 Capacity Gallons: 360 Tightness Test Method: NN

Date Test: Not reported Not reported Next Test Date: Date Tank Closed: 1/1/2002 Register: True **TESPERBE** Modified By: Last Modified: 12/6/2004

Equipment Records:

K00 - Spill Prevention - None

F01 - Pipe External Protection - Painted/Asphalt Coating

G00 - Tank Secondary Containment - None C01 - Pipe Location - Aboveground

H00 - Tank Leak Detection - None L00 - Piping Leak Detection - None

E00 - Piping Secondary Containment - None

J02 - Dispenser - Suction

A00 - Tank Internal Protection - None 104 - Overfill - Product Level Gauge (A/G) D01 - Pipe Type - Steel/Carbon Steel/Iron

B01 - Tank External Protection - Painted/Asphalt Coating

Tank Number: 003 Tank Id: 178830 Tank Location:

Steel/Carbon Steel/Iron Tank Type:

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 1/1/2002 Capacity Gallons: 360 Tightness Test Method: NN

Direction Distance

Elevation Site Database(s) EPA ID Number

VANTAGE EQUIPMENT, LLC (Continued)

A100296537

EDR ID Number

Date Test:

Not reported

Next Test Date:

Not reported

Not reported

Not reported

Not reported

True

Modified By:

Last Modified:

Not reported

True

12/6/2004

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron I04 - Overfill - Product Level Gauge (A/G) A00 - Tank Internal Protection - None

B01 - Tank External Protection - Painted/Asphalt Coating

L00 - Piping Leak Detection - None

J02 - Dispenser - Suction

G00 - Tank Secondary Containment - None

H00 - Tank Leak Detection - None C01 - Pipe Location - Aboveground

E00 - Piping Secondary Containment - None

F01 - Pipe External Protection - Painted/Asphalt Coating

K00 - Spill Prevention - None

Tank Number: 004
Tank Id: 178831
Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 1/1/2002
Capacity Gallons: 500
Tightness Test Method: NN

Date Test:
Not reported
Next Test Date:
Not reported
Date Tank Closed:
Register:
Modified By:
Last Modified:
Not reported
True
True
True
TESPERBE
Last Modified:
12/6/2004

Equipment Records:

E00 - Piping Secondary Containment - None

F00 - Pipe External Protection - None I04 - Overfill - Product Level Gauge (A/G)

C00 - Pipe Location - No Piping H00 - Tank Leak Detection - None L00 - Piping Leak Detection - None

G00 - Tank Secondary Containment - None

J02 - Dispenser - Suction D00 - Pipe Type - No Piping

A00 - Tank Internal Protection - None

B01 - Tank External Protection - Painted/Asphalt Coating

K00 - Spill Prevention - None

Affiliation Records:

Site Id: 55612

Affiliation Type: On-Site Operator

Company Name: VANTAGE EQUIPMENT, LLC

Contact Type: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VANTAGE EQUIPMENT, LLC (Continued)

A100296537

Contact Name: VANTAGE EQUIPMENT, LLC

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 220-9500 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TESPERBE** Date Last Modified: 12/6/2004

Site Id: 55612 Affiliation Type: Owner

Company Name: VANTAGE EQUIPMENT, LLC Contact Type: GENERAL SERVICE MANAGER

Contact Name: THOMAS R. JOYCE Address1: 17 NORTHWAY LANE

Address2: Not reported City: LATHAM State: NY Zip Code: 12110 Country Code: 001

Phone: (518) 437-2611 Phone Ext: Not reported Email: Not reported Fax Number: Not reported Modified By: **TESPERBE** Date Last Modified: 12/6/2004

Site Id: 55612

Affiliation Type: **Emergency Contact**

Company Name: VANTAGE EQUIPMENT, LLC

Contact Type: Not reported Contact Name: MIKE WHELAN Address1: Not reported Address2: Not reported City: Not reported

State: NN

Zip Code: Not reported Country Code: 999

Phone: (518) 257-0457 Phone Ext: Not reported Email: Not reported Fax Number: Not reported **TESPERBE** Modified By: Date Last Modified: 12/6/2004

Site Id: 55612 Affiliation Type: Mail Contact

VANTAGE EQUIPMENT, LLC Company Name:

Contact Type: Not reported MIKE WHELAN Contact Name: Address1: 17 NORTHWAY LANE

Address2: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VANTAGE EQUIPMENT, LLC (Continued)

A100296537

City: LATHAM State: NY Zip Code: 12110 Country Code: 001

Phone: (518) 220-9500 Phone Ext: Not reported Not reported Email: Fax Number: Not reported Modified By: **TESPERBE** Date Last Modified: 12/6/2004

S110 DE NOOYER CHEVROLET INC MANIFEST \$109782941

SE 127 WOLF RD 1/8-1/4 **ALBANY, NY 12205** N/A

0.236 mi.

1247 ft.

Site 1 of 5 in cluster S

Relative: Higher

CT MANIFEST:

Actual:

299 ft.

Waste: Manifest No: ctf1084317

Waste Occurence:

UNNA: 1325 Hazard Class: 4.1

US Dot Description: FLAMMABLE SOLIDS, ORGANIC, N.O.S.

No of Containers: Container Type: DM Quantity: 60 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 11/8/2006 DEO Who Last Modified Record: JEB

Waste CD:

Manifest No: ctf1084317 Waste Occurence: EPA Waste Code: F003 Recycled Waste?: Date Record Was Last Modified: 11/8/2006 DEO Who Last Modified Record: JEB

Detail:

2005 Year: Manifest ID: ctf1084317 TSDF EPA ID: CTD021816889

TSDF Name: UNITED OIL RECOVERY, INC. TSDF Address: 136 GRACEY AVENUE

TSDF City,St,Zip: MERIDEN, CT 06451

TSDF Country: USA TSDF Telephone: (203)238-6745 Transport Date: 2/7/2005 Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY, INC.

Transporter Country: USA

Transporter Phone: (203)238-6745 Trans 2 Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DE NOOYER CHEVROLET INC (Continued)

S109782941

Trans 2 EPA ID: Not reported Not reported Trans 2 Name: Trans 2 Address: Not reported Trans 2 City, St, Zip: СТ

Trans 2 Country: **USA** Trans 2 Phone:

Not reported EPA ID: NYD058173915 Generator Phone: Not reported Generator Mailing Addr: 127 WOLF RD Generator Mailing Town: **ALBANY** Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 2/7/2005 Date Received: 2/17/2005 11/8/2006 Last modified date: Last modified by: JEB

Not reported Comments:

Waste:

ctf1053487 Manifest No: Waste Occurence: UNNA: 1325 Hazard Class: 4.1

US Dot Description: FLAMMABLE SOLIDS, ORGANIC, N.O.S.

No of Containers: DM Container Type: Quantity: 30 Weight/Volume: G

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 12/20/2005 DEO Who Last Modified Record: CYF

Waste CD:

Manifest No: ctf1053487 Waste Occurence: 1 **EPA Waste Code:** F003 Recycled Waste?: Date Record Was Last Modified: 12/20/2005 DEO Who Last Modified Record: CYF

Detail:

2005 Year: Manifest ID: ctf1053487 TSDF EPA ID: CTD002593887

TSDF Name: BRIDGEPORT UNITED RECYCLING

TSDF Address: 50 Cross St

TSDF City,St,Zip: BRIDGEPORT, CT 06610-

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 3/18/2005 CTD021816889 Transporter EPA ID:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DE NOOYER CHEVROLET INC (Continued)

S109782941

UNITED OIL RECOVERY, INC. Transporter Name:

Transporter Country: **USA** Transporter Phone: (203)238-6745 Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City, St, Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported EPA ID: nyd058173915 Generator Phone: Not reported 127 WOLF RD Generator Mailing Addr: Generator Mailing Town: **ALBANY** Generator Mailing State: NY Generator Mailing Zip: 12205 Generator Mailing Country: USA

Special Handling: Not reported Discrepancies: Not reported Date Shipped: 3/18/2005 Date Received: 3/30/2005 Last modified date: 12/20/2005 Last modified by: CYF

Comments: Not reported

Waste:

nyg4391676 Manifest No:

Waste Occurence: UNNA: 1325 Hazard Class: 3

US Dot Description: FLAMMABLE LIQUIDS, CORROSIVE, N.O.S.

No of Containers: Container Type: DM Quantity: 315 Weight/Volume:

Additional Description: Not reported Handling Code: Not reported Date Record Was Last Modified: 11/9/2005 DEO Who Last Modified Record: JEB

Waste CD:

Manifest No: nyg4391676

Waste Occurence: F005 EPA Waste Code: Recycled Waste?:

Date Record Was Last Modified: 11/9/2005 DEO Who Last Modified Record: JEB

Detail:

Year: 2004 Manifest ID: nyg4391676 CTD002593887 TSDF EPA ID:

TSDF Name: BRIDGEPORT UNITED RECYCLING

TSDF Address: 50 Cross St

BRIDGEPORT, CT 06610-TSDF City,St,Zip:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DE NOOYER CHEVROLET INC (Continued)

S109782941

TSDF Country: USA TSDF Telephone: Not reported Transport Date: 9/13/2004 Transporter EPA ID: CTD021816889

Transporter Name: UNITED OIL RECOVERY, INC.

Transporter Country: USA

Transporter Phone: (203)238-6745 Trans 2 Date: Not reported Trans 2 EPA ID: Not reported Trans 2 Name: Not reported Trans 2 Address: Not reported

Trans 2 City, St, Zip: CT Trans 2 Country: USA

Trans 2 Phone: Not reported NYD058173915 EPA ID: Generator Phone: Not reported Generator Mailing Addr: 127 WOLF RD ALBANY Generator Mailing Town: Generator Mailing State: NY 12205 Generator Mailing Zip: Generator Mailing Country: USA Special Handling: Not reported Discrepancies: Not reported Date Shipped: 9/13/2004 Date Received: 9/21/2004 Last modified date: 11/9/2005

Last modified by: JEB Comments: Not reported

S111 **DENOOYER CHEVY WOLF RD** SE 127 WOLF RD

1/8-1/4 ALBANY, NY

0.236 mi.

1247 ft. Site 2 of 5 in cluster S

NY Spills:

Relative: Higher Actual:

299 ft.

Site ID: 154647 Facility Addr2: Not reported Facility ID: 0201594 Spill Number: 0201594 Facility Type: ER

SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 5/13/2002 Reported to Dept: 5/13/2002 CID: 365 Spill Cause: Unknown Water Affected: Not reported Spill Source: Commercial/Industrial

Spill Notifier: Affected Persons Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

NY Spills

NY Hist Spills

S102158539

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVY WOLF RD (Continued)

S102158539

EDR ID Number

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/3/2002 Remediation Phase: 0

Date Entered In Computer: 5/13/2002 Spill Record Last Update: 3/3/2008 Spiller Name: Not reported

Spiller Company: UNK DENOOYER CHEVROLET

Spiller Address: 127 WOLF RD Spiller City,St,Zip: ALBANY, ZZ

Spiller Company: 001

Contact Name: MICHAEL CONGERO Contact Phone: (518) 458-2002

DEC Region: 4
DER Facility ID: 131102

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9409603 PBS 4-020095 09/03/02 -Site inspection showed

sheen but washed away by rain. wtc

Remarks: CALLER DIALED 911 TO REPORT AT LEAST 20 GALLONS OF GASOLINE ON THE

GROUND - UNK WHERE IT IS COMING FROM - WITH THE RAIN ITS GOING ALL

OVER THE PLACE - FIRE DEPT IS ENROUTE

Material:

Site ID: 154647 Operable Unit ID: 852556 Operable Unit: 01 Material ID: 523007 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum 20 Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 154648 Facility Addr2: Not reported Facility ID: 9409603 Spill Number: 9409603 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVY WOLF RD (Continued)

S102158539

EDR ID Number

 Spill Date:
 10/18/1994

 Reported to Dept:
 10/18/1994

CID: 21

Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Commercial/Industrial

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 8/10/2005

Remediation Phase: 0

Date Entered In Computer: 10/27/1994
Spill Record Last Update: 8/26/2008
Spiller Name: Not reported

Spiller Company: DENOOYER CHEVROLET

Spiller Address: Not reported Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: Not reported
Contact Phone: Not reported
DEC Region: 4
DER Facility ID: 266807

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was
"CHRISTENSEN" This file has been entered into the E-Doc system. wto

"CHRISTENSEN" This file has been entered into the E-Doc system. wtc See EDOCs for additional information. 0201594 PBS 4-020095 10/23/96 -

REVIEWED G/W INVESTIGATION REPORT SUBMITTED BY CONTINENTAL PLACER INC. FOR SITE. THERE IS FREE PRODUCT IN TWO WELLS AND CONTAMINATION HAS MIGRATED OFF SITE. CONTINENTAL IS DRAWING UP A PROPOSAL FOR DENOOYER. IT IS A VES SYSTEM ALONG WITH A DUEL PUMP SYSTEM TO REMOVE FREE PRODUCT AND DISSOLVED PHASE CONTAMINATION USING A SHALLOW TRAY STRIPPER AND OIL/WATER SEPARATOR. SEE FOLDER. LATEST ANALYTICAL RESULTS RECEIVED 12/22/98 - THE GENERAL TREND IS THAT THE CONTAMINANT LEVALS ARE DECREASING AND THE REMEDIATION SYSTEM IS WORKING. 11/22/99

- Latest results received for quarterly report dated 11/17/99 for analytical samples taken 10/18/99. There is a 9 month period were we

received no reports. 11/30/99 - Letter received from CPI

Environmental Services in reguard to the scheduled pilot test for the SVE/Air Sparging system. Pilot test scheduled for the week of 12/6/99. Upon completion a plan will be submitted for Departmental review. 02/24/00 - Quartely Report received showing that the SVE and the Pump and Treat Sysyem appear to working. The m/w's for this report were taken on November 29, 1999. There is a significant and general decline over time of the petroleum contaminants in the groundwater samples. They are presently evaluating possible alternatives (adding air sparging in conjunction with sve) to help expedite the remediation at the site. 01/15/2001 - Letter sent requesting update on the remediation system. 01/18/2001 - Received a report from CPI Environmental Services Inc. documenting actives conducted at DeNooyer since their last report dated February, 17, 2000. Monitoring Wells were sampled in March and September of 2000. Next sampling is scheduled for January 2001. Plume is spreading slightly. Stripper has had a lot of down time do to iron fouling it.

Map ID Direction Distance Elevation

Site

MAP FINDINGS

Database(s)

EDR ID Number EPA ID Number

DENOOYER CHEVY WOLF RD (Continued)

S102158539

It is in the process of being cleaned again. Sparging may be an option in cleaning up this spill, The VES seens to be working fine. VES combinded with a sparg system may be a better way to go. 05/04/2001 - Received memorandum from CPI Environmental Services. Inc. (Kirby Van Vleet) The pump and treat system was placed back on-line the week of April 16, 2001. Quarterly samples were collected on May2, 2001. A quarterly report will be forwarded to you once the analytical results are received from the lab. Other remedial options will be discussed and consided as you suggested in your letter dated April 20, 2001. We will provide you with a proposed scope of work after our options have been evaluated. wtc 07/27/2001 - Received fax from Kirby Van Vleet, informing me that there will be a delay in the installation of test points. They have scheduled the installation for the week of August 13. The pilot test will be scheduled right after the installation of the test points. wtc 08/23/2001 - The installation of the Air Sparging/VES Pilot Testing will start on August 23, 2001. wtc 10/09/2001 - Received the Pilot Test/ Conceptual Remediation System Design report and approved the remedical plan by sending an approval letter to all parties involved on October 4th. Work is to start within 15 days of receipt of this letter. wtc 10/17/2001 - Received report updating there actives from their last report dated May 2001. Groundwater samples were collected on August 17, 2001 and analysis by EPA Methoid 502.2, plus MtBE, M/Ws-1.4.5 show contamination while M/Ws-2,3 and 6 are clean at this time. The next sampling is scheduled for November 2001. DeNooyer received my approvel letter for the new remediation system on October 9th. Installation work on the Sparge/VES should start no later than October 24th, 2001. wtc 11/23/2001 - Received update from CPI -In-ground subsurface work on the system was completed on November 13, 2001. Aztech will provide a system startup date by December 1st, 2001. Quarterly sampling will be continue. wtc 01/10/2002 - Received quarterly groundwater report for 4th quater. M/W-1 & 2 were not sampled because they were dry. M/Ws-4 & 5 were above groundwater standards. The groundwater pump and treat system was not sampled because it was not operating. The new air sparge/SVE system is being installed with startup, likely in early spring. Next quarterly report due in March 2002. DeNooyer is in compliance with their order, wto 03/20/2002 - CPI Environmental reports that in-ground subsurface work on the remediation system was completed on November 13, 2001. Aztech is in the process of constructing the remediation system but has run into a six to eight week delay in getting the appropriate blower. At present CPI anticipate system start-up in mid-May. Since they have no control over the avaliability of the blower. DeNooyer is in compliance with their order. Quarterly sampling will continue and the next sample period is scheduled for March 2002. wtc 04/15/2002 -Received quarterly report from CPI. M/W-1 was destroyed during construction of remediation system. M/W-2 was dry. These wells need to be redrilled. M/W-5 is the most contaminated well and is off site. We do not know the extent of groundwater contamination because we lack a clean downgradent well. Aztech schedule calls for start up of the remediation system in late May 2002. Will talk to CPI (Kirby Van Vleet) about redrilling M/W-2, replace M/W-1 and finding the extent of downgradent contamination. wtc 05/31/2002 - Received update for system startup. System startup scheduled for the week of 5/27or at the latest 6/03, 2002. tthey also anticipate redeveloping of the monitoring wells to remove silt. Next scheduled sampling is June 02. wtc 10/02/2002 - Received quarterly report from CPI. Samples were

Map ID MAP FINDINGS
Direction

Distance Elevation

Site Database(s) EPA ID Number

DENOOYER CHEVY WOLF RD (Continued)

S102158539

EDR ID Number

collected on July 5th. Analytical results show a sharp decrease in contamination levels in M/W-4 from March 2002. M/W-1 and M/W-5 were similar to he March 2002 results. Next sampling is scheduled for October/November 2002. wtc 12/06/2002 - Received quarterly report from CPI. Samples were colected on September 9, 2002. Analytical results continue to show a sharp decrease of contaminants in M/W-4. M/W-1 M/W-3 was silted over and could not be sampled. M/W-5 showed a sharp decrease from the July 2002 levels. System is working as designed. M/W-1 and M/W-3 will be redeveloped before the December samples are taken. wtc 05/08/2003 - Quarterly report received on April 21, 2003. System working as designed. BTEX in MW-4 dropped from 1,008ppb in March 02 to 1.4ppb and MW-5 dropped from 5,820ppb to 894ppb. Other work is being scheduled for redevelopment of monitoring wells and rebalancing the system. this work should be done in the next few weeks. wtc 05/08/2003 - The Department was notified by Continental Placer that due to high groundwater, the horizontal soil vapor extraction (SVE) laterals have become filled with water. Water was being drawn through the vaccum blowers. The system has been temporarily shut down as of May 5th. Groundwater levels will be checked regulary so that the system can be turned back on as soon as the groundwater drops to a leval below the laterals. wtc 07/15/2003 -Latest quarterly report received and levels continue to decrease. Monitoring wells were sampled on May 20, 2003 and scheduled to be sampled again in August. The system was turned off due to high water on May 5 and is scheduled to be turned on and balanced on July 11, 2003. wtc 11/14/2003 - Received latest quarterly report from Continental Placer. Contamination levels continue to improve. wtc 02/06/2004 - Air Sparge/SVE is temporarily shut down due to a high water table and water in the laterals. When grounwater drops the system will be turned on. wtc 06-02-2004 - Air sparge system is scheduled to be restarted in June. It has been down due to high groundwater levels. Next scheduled sampling is due in July 04. wtc 08-16-2004 -System was restarted and balanced in May. Next sampling is scheduled for October 2004. wtc 11-15-2004 - Latest analytical results meet standards. Remedial system can be shut down but not removed. Quarterly sampling will continue to ascertain that there is no bounce back effect. Letter written to that effect to CPI. wtc 01-31-2005 - Received quarterly sampling report. Analytical results are ND for all monitoring wells for the second time in a row. wtc 04/22/05 - Received quarterly sampling report. Analytical results are ND for all monitoring wells for the third period in a row. Next sampling is scheduled for July and if results are below standards the site will be closed and all wells removed. wtc 08/10/05 - Received quarterly sampling report. Analytical results are ND for all monitoring wells for the forth period in a row. Results are below standards and the site can be closed and all wells removed. wtc 3/4/08 - FOIL 08/058

Remarks:

LEAKY GAS PUMP, DUG UP TANK, STOCKPILING SOIL. 10/24-RP LETTER SENT REQUIRING REMEDIATION. SEE 9408817, CASE RPT.

Material:

 Site ID:
 154648

 Operable Unit ID:
 1003571

 Operable Unit:
 01

 Material ID:
 2096750

 Material Code:
 1213A

Material Name: MTBE (METHYL-TERT-BUTYL ETHER)

Case No.: 01634044

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVY WOLF RD (Continued)

S102158539

Material FA: Hazardous Material Quantity: Not reported Units: Not reported Recovered: Not reported Resource Affected: Not reported Oxygenate: True Site ID: 154648 1003571 Operable Unit ID: Operable Unit: 01 Material ID: 379021 0009 Material Code: Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons No Recovered:

Resource Affected: Not reported

Oxygenate: True

Tank Test:

154648 Site ID: Spill Tank Test: 1543258 Not reported Tank Number:

Tank Size: Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills 10/1/2004 Last Modified: Test Method: Unknown

> Click this hyperlink while viewing on your computer to access REQUIRING REMEDIATION. SEE 9408817, CASE RPT.

NY Hist Spills:

Region of Spill: 4 Spill Number: 9409603 CHRISTENSEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 10/18/1994 15:00 Spill Date/Time: Reported to Dept Date/Time: 10/18/94 15:32

SWIS: 01

Spiller Name: DENOOYER CHEVROLET

Spiller Contact: Not reported Spiller Phone: (518) 458-7700 Spiller Address: Not reported Spiller City,St,Zip: Not reported Spill Cause: **Equipment Failure** Reported to Dept: Groundwater

Direction Distance

Elevation Site **EPA ID Number** Database(s)

DENOOYER CHEVY WOLF RD (Continued)

S102158539

EDR ID Number

Water Affected: Not reported Spill Source: 01 Spill Notifier: Other PBS Number: 4-020095 Cleanup Ceased: 11 Cleanup Meets Std: False

Last Inspection: 11

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: 11 **Enforcement Date:** 11 Invstgn Complete: / / **UST Involvement:** True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 10/27/94 Date Spill Entered In Computer Data File: Not reported

Update Date: 11/26/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: GASOLINE Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

10/23/96 - REVIEWED G/W INVESTIGATION REPORT SUBMITTED BY CONTINENTAL PLACER **DEC Remarks:**

INC. FOR SITE. THERE IS FREE PRODUCT IN TWO WELLS AND CONTAMINATION HAS MIGRATED OFF SITE. CONTINENTAL IS DRAWING UP A PROPOSAL FOR DENOOYER. IT IS A VES SYSTEM ALONG WITHA DUEL PUMP SYSTEM TO REMOVE FREE PRODUCT AND DISSOLVED PHASE CONTAMINATION USING A SHALLOW TRAY STRIPPER AND OIL/WATER SEPARATOR. SEE FOLDER. LATEST ANALYTICAL RESULTS RECEIVED 12/22/98 - THE GENERAL TREND IS THAT THE CONTAMINANT LEVALS ARE DECREASING AND THE REMEDIATION SYSTEM IS

WORKING. 11/22/99 - Latest results received for quarterly report dated 11/17/99 for analytical samples taken 10/18/99. There is a 9 month period were we received no reports. 11/30/99 - Letter received from CPI Environmental Services in reguard to the scheduled pilot test for the SVE/Air Sparging system. Pilot test scheduled for the week of 12/6/99. Upon completion a plan will be submitted for Departmental review. 02/24/00 - Quartely Report

received showing that the SVE and the Pump and Treat Sysyem appear to working.

The m/w s for this report were taken on November 29, 1999. There is a significant and general decline over time of the petroleum contaminants in the Map ID MAP FINDINGS
Direction

Distance Elevation

on Site Database(s) EPA ID Number

DENOOYER CHEVY WOLF RD (Continued)

S102158539

EDR ID Number

groundwater samples. They are presently evaluating possible alternatives adding air sparging in conjunction with sve) to help expedite the remediation at the 01/15/2001 - Letter sent requesting update on the remediation system. 01/18/2001 - Received a report from CPI Environmental Services Inc. documenting actives conducted at DeNooyer since their last report dated February, 17, 2000. Monitoring Wells were sampled in March and September of 2000. Next sampling is scheduled for January 2001. Plume is spreading slightly. Stripper has had a lot of down time do to iron fouling it. It is in the process of being cleaned again. Sparging may be an option in cleaning up this spill, The VES seens to be working fine. VES combinded with a sparg system may be a better way to go. 05/04/2001 - Received memorandum from CPI Environmental Services, Inc. Kirby Van Vleet) The pump and treat system was placed back on-line the week of April 16, 2001. Quarterly samples were collected on May2, 2001. A quarterly report will be forwarded to you once the analytical results are received from the lab. Other remedial options will be discussed and consided as you suggested in your letter dated April 20, 2001. We will provide you with a proposed scope of work afterour options have been evaluated. wtc 07/27/2001 - Received fax from Kirby Van Vleet, informing me that there will be a delay in the installation of test points. They have scheduled the installation for the week of August 13. The pilot test will be scheduled right after the installation of the test points. wtc 08/23/2001 - The installation of the Air Sparging/VES Pilot Testing will start on August 23, 2001, wtc 10/09/2001 - Received the Pilot Test/ Conceptual Remediation System Design report and approved the remedical plan by sending an approval letter to all parties involved on October 4th. Work is to start within 15 days of receipt of this letter. wtc 10/17/2001 - Received report updating there actives from their last report dated May 2001. Groundwater samples were collected on August 17, 2001 and analysis by EPA Methoid 502.2, plus MtBE. M/Ws-1,4,5 show contamination while M/Ws-2,3 and 6 are clean at this time. The next sampling is scheduled for November 2001. DeNooyer received my approvel letter for the new remediation system on October 9th. Installation work on the Sparge/VES should start no later than October 24th, 2001. wtc 11/23/2001 -Received update from CPI - In-ground subsurface work on the system was completed on November 13, 2001. A tech will provide a system startup date by December 1st, 2001. Quarterly sampling will be continue. wtc

Remark:

LEAKY GAS PUMP, DUG UP TANK, STOCKPILING SOIL. 10/24-RP LETTER SENT REQUIRING

REMEDIATION. SEE 9408817, CASE RPT.

S112 DENOOYER CHEVROLET
SE 127 WOLF RD
1/8-1/4 ALBANY, NY 12205

0.236 mi.

1247 ft. Site 3 of 5 in cluster S

Relative: RCRA-CESQG:

Higher Date form received by agency: 01/01/2007

Facility name: DE NOOYER CHEVROLET INC

Actual: Facility address: 127 WOLF RD

ALBANY, NY 12205 EPA ID: NYD058173915

Mailing address: WOLF RD ALBANY, NY 12205

Contact: Not reported Contact address: WOLF RD

ALBANY, NY 12205

Contact country: US

Contact telephone: Not reported Contact email: Not reported

1000318531

NYD058173915

RCRA-CESQG

MANIFEST MANIFEST

FINDS

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

DENOOYER CHEVROLET (Continued)

1000318531

EPA Region: 02

Land type: Facility is not located on Indian land. Additional information is not known.

Conditionally Exempt Small Quantity Generator Classification:

Description: Handler: generates 100 kg or less of hazardous waste per calendar

month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from

the cleanup of a spill, into or on any land or water, of acutely

hazardous waste

Owner/Operator Summary:

DE NOOYER REALTY Owner/operator name:

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country:

Owner/operator telephone: (212) 555-1212 Legal status: Private

Owner/Operator Type: Operator Owner/Op start date: Not reported Owner/Op end date: Not reported

DE NOOYER REALTY Owner/operator name: Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212 Legal status: Private

Owner/Operator Type: Owner Owner/Op start date: Not reported Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown

Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown

Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: DE NOOYER CHEVROLET INC

Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/14/1999

Facility name: DE NOOYER CHEVROLET INC Classification: Small Quantity Generator

Date form received by agency: 02/26/1992

Facility name: DE NOOYER CHEVROLET INC Classification: Large Quantity Generator

Date form received by agency: 08/22/1985

Facility name: DE NOOYER CHEVROLET INC Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General

Date violation determined: 02/16/1989
Date achieved compliance: 06/14/1989
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 03/15/1989
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 03/06/2008

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 06/01/1989

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation:
Date achieved compliance:
Evaluation lead agency:
Not reported
State

Evaluation date: 02/16/1989

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Generators - General

Date achieved compliance: 06/14/1989 Evaluation lead agency: State

FINDS:

Registry ID: 110004361459

Direction
Distance
Elevation

evation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

MANIFEST:

GEN Cert Date: 9/8/2006 Transporter Recpt Date: 9/8/2006 Number Of Containers: 4 Container Type: DM Waste Code1: R003 Waste Code2: R003 F005 Waste Code3: Comment: Not reported Fee Exempt Code: Not reported

TSDF Name: United Oil Recovery Inc

TSDF ID: RID084802842 TSDF Date: 9/8/2006

Date Imported: 9/29/2008 4:08:25 PM

Transporter 2 Name: 8/10/2006 Transporter 2 ID: CTD021816889 Manifest Docket Number: Not reported Waste Description: Not reported Quantity: Not reported WT/Vol Units: Not reported Not reported Item Number: Not reported Transporter Name: Transporter EPA ID: Not reported **GEN Cert Date:** Not reported Transporter Recpt Date: Not reported Transporter 2 Recpt Date: Not reported TSDF Recpt Date: Not reported EPA ID: Not reported Transporter 2 ID: Not reported

NY MANIFEST:

EPA ID: NYD058173915

Country: USA

Mailing Name: DE NOOYER CHEVROLET INC
Mailing Contact: DE NOOYER CHEVROLET INC

Mailing Address: 127 WOLF ROAD
Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12205
Mailing Zip4: Not reported
Mailing Country: USA

Direction Distance Elevation

ion Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Mailing Phone: 518-457-7700

Document ID: NYG5458833 Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: Not reported Generator Ship Date: 03/18/2005 Trans1 Recv Date: 03/18/2005 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/18/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: CTK15358 Trans2 EPA ID: Not reported TSDF ID: NYD080469935 F003 - UNKNOWN Waste Code:

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code:

Document ID: NYG5446035 Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: Not reported Generator Ship Date: 02/01/2005 Trans1 Recv Date: 02/01/2005 Trans2 Recv Date: Not reported TSD Site Recv Date: 02/01/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: CTK15358 Trans2 EPA ID: Not reported TSDF ID: NYD080469935 Waste Code: F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Direction Distance Elevation

n Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: Not reported Manifest Tracking Num: Not reported Not reported Import Ind: Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported

Manifest Ref Num:
Alt Fac RCRA Id:
Alt Fac Sign Date:
Mgmt Method Type Code:
Not reported
Not reported
Not reported
Not reported

Document ID: NYG5461974 Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: Not reported Generator Ship Date: 02/22/2005 Trans1 Recv Date: 02/22/2005 Trans2 Recv Date: Not reported TSD Site Recv Date: 02/22/2005 Part A Recy Date: Not reported Part B Recv Date: Not reported NYD058173915 Generator EPA ID: Trans1 EPA ID: NY60767PA Trans2 EPA ID: Not reported TSDF ID: NYD080469935 Waste Code: F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Not reported

Specific Gravity: 01.00 Not reported Year: Not reported Manifest Tracking Num: Not reported Import Ind: Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Document ID: NYG5458572

Manifest Status: Not reported

Trans1 State ID: CTD021816889

Mgmt Method Type Code:

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Trans2 State ID: Not reported 03/15/2005 Generator Ship Date: Trans1 Recv Date: 03/15/2005 Trans2 Recv Date: Not reported TSD Site Recv Date: 03/15/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: 99449APNY Trans2 EPA ID: Not reported TSDF ID: NYD080469935

Waste Code: D018 - BENZENE 0.5 MG/L TCLP

Quantity: 00055

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported

Discr Full Reject Ind:

Manifest Ref Num:

Alt Fac RCRA Id:

Alt Fac Sign Date:

Mgmt Method Type Code:

Not reported

Not reported

Not reported

Document ID: RIG0242097 Manifest Status: Not reported CTD021816889 Trans1 State ID: CTD002816889 Trans2 State ID: Generator Ship Date: 06/16/2005 Trans1 Recv Date: 06/16/2005 Trans2 Recv Date: 06/22/2005 TSD Site Recv Date: 06/22/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: CTJ71372 Trans2 EPA ID: V37219 TSDF ID: RID084802842 Waste Code: F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00
Year: Not reported
Manifest Tracking Num: Not reported
Import Ind: Not reported

Direction Distance Elevation

evation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Export Ind: Not reported Not reported Discr Quantity Ind: Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Not reported Alt Fac Sign Date: Mgmt Method Type Code: Not reported

RIG0251808 Document ID: Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 04/21/2005 Trans1 Recv Date: 04/21/2005 Trans2 Recv Date: 04/27/2005 TSD Site Recv Date: 04/27/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: 99449AP Trans2 EPA ID: V37219 RID084802842 TSDF ID: Waste Code: F003 - UNKNOWN

Quantity: 00004
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: Not reported Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: RIG0252161 Manifest Status: Not reported CTD021816889 Trans1 State ID: Trans2 State ID: CTD021816889 Generator Ship Date: 05/17/2005 Trans1 Recv Date: 05/17/2005 Trans2 Recy Date: 05/18/2005 05/18/2005 TSD Site Recy Date: Part A Recv Date: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

 Part B Recv Date:
 Not reported

 Generator EPA ID:
 NYD058173915

 Trans1 EPA ID:
 CTK15358

 Trans2 EPA ID:
 TU8919NH

 TSDF ID:
 RID084802842

 Waste Code:
 F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00

Waste Code: F003 - UNKNOWN

Quantity: 00210
Units: P - Pounds
Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method:
Specific Gravity:
01.00
Waste Code:
Quantity:
Units:
Not reported

Handling Method: R Material recovery of more than 75 percent of the total material.

Not reported

Specific Gravity: Not reported Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported

Mgmt Method Type Code:

Document ID: RIG0258160 Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 08/10/2005 Trans1 Recv Date: 08/10/2005 Trans2 Recv Date: 08/18/2005 TSD Site Recv Date: 08/18/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: J89974CT Trans2 EPA ID: V37219 TSDF ID: RID084802842 Waste Code: F003 - UNKNOWN

Quantity: 00005

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

1000318531

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00

F005 - UNKNOWN Waste Code:

Quantity: 00030

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: Not reported 01.00 Specific Gravity: Waste Code: Not reported Quantity: Not reported Units: Not reported Number of Containers: Not reported Not reported Container Type:

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Not reported Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

RIG0260763 Document ID: Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 09/07/2005 Trans1 Recv Date: 09/07/2005 09/14/2005 Trans2 Recv Date: TSD Site Recv Date: 09/14/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 J89974CT Trans1 EPA ID: Trans2 EPA ID: V37219 TSDF ID: RID084802842 Waste Code: F003 - UNKNOWN

80000 Quantity:

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Not reported Year: Manifest Tracking Num: Not reported

Direction Distance Elevation

vation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: RIG0262406 Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 11/30/2005 Trans1 Recv Date: 11/30/2005 Trans2 Recv Date: 12/01/2005 TSD Site Recv Date: 12/01/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: Not reported Trans2 EPA ID: TL8919AH TSDF ID: RID084802842 Waste Code: F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Not reported Alt Fac RCRA Id: Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: RIG0263191 Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: Not reported Generator Ship Date: 10/05/2005 Trans1 Recy Date: 10/05/2005 Trans2 Recv Date: Not reported TSD Site Recv Date: 10/06/2005

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Part A Recv Date:
Part B Recv Date:

Generator EPA ID:
Trans1 EPA ID:
Trans2 EPA ID:
TSDF ID:
Waste Code:

Not reported
NYD058173915
NYD058173915
Not reported
RID084802842
F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00 Year: Not reported Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Not reported Manifest Ref Num: Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 11/02/2005 Trans1 Recv Date: 11/02/2005 Trans2 Recv Date: 11/03/2005 TSD Site Recv Date: 11/03/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported NYD058173915 Generator EPA ID: Trans1 EPA ID: J89974CT Trans2 EPA ID: T68919AH TSDF ID: RID084802842 Waste Code: F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

RIG0258942

Number of Containers: 001

Document ID:

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 01.00

Waste Code: F005 - UNKNOWN

Quantity: 00030

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: Not reported Specific Gravity: 01.00 Waste Code: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Quantity: Not reported Units: Not reported Number of Containers: Not reported Container Type: Not reported

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: Not reported Year: Not reported Manifest Tracking Num: Not reported Not reported Import Ind: Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: RIG0262862 Manifest Status: Not reported Trans1 State ID: CTD021816889 Trans2 State ID: CTD021816889 Generator Ship Date: 07/12/2005 Trans1 Recv Date: 07/12/2005 Trans2 Recv Date: 07/13/2005 TSD Site Recv Date: 07/13/2005 Part A Recv Date: Not reported Part B Recv Date: Not reported Generator EPA ID: NYD058173915 Trans1 EPA ID: CTJ11372 Trans2 EPA ID: TU8919NH TSDF ID: RID084802842 Waste Code: F003 - UNKNOWN

Quantity: 00005

Units: G - Gallons (liquids only)* (8.3 pounds)

Number of Containers: 001

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 01.00 Year: Not reported Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Document ID: NYA3009407 Completed copy Manifest Status:

Trans1 State ID: IL009 Trans2 State ID: Not reported Generator Ship Date: 860521 Trans1 Recv Date: 860521 Trans2 Recv Date: Not reported TSD Site Recy Date: 860521 Part A Recv Date: 860522 Part B Recv Date: 860523 NYD058173915 Generator EPA ID: Trans1 EPA ID: ILD000805911

Trans2 EPA ID: Not reported TSDF ID: NYD000708206

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00405 P - Pounds Units: 006 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Waste Code: Not reported Quantity: 00135 Units: P - Pounds

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 86

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

NYA4240012 Document ID: Manifest Status: Completed copy

Trans1 State ID: IL009 Trans2 State ID: Not reported Generator Ship Date: 861229 Trans1 Recv Date: 861229 Trans2 Recv Date: Not reported TSD Site Recv Date: 861229 Part A Recv Date: 870105 Part B Recv Date: 861231

Generator EPA ID: NYD058173915 Trans1 EPA ID: ILD000805911 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

1000318531

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00375 P - Pounds Units: Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00105 Units: P - Pounds Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 86

Not reported Manifest Tracking Num: Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6676964 Manifest Status: Completed copy Trans1 State ID: NYS88290-Trans2 State ID: Not reported Generator Ship Date: 870521 Trans1 Recv Date: 870521 Trans2 Recv Date: Not reported TSD Site Recv Date: 870521 Part A Recv Date: 870604 Part B Recv Date: 870527 Generator EPA ID: NYD058173915

Trans1 EPA ID: ILD000805911 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00375 Units: P - Pounds Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00105 P - Pounds Units: Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Year: 87 Not reported Manifest Tracking Num: Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA5485671 Completed copy Manifest Status: Trans1 State ID: NYS88290-Trans2 State ID: Not reported 870617 Generator Ship Date: Trans1 Recv Date: 870617 Trans2 Recv Date: Not reported TSD Site Recy Date: 870617 Part A Recv Date: 870623 Part B Recv Date: 870623

 Generator EPA ID:
 NYD058173915

 Trans1 EPA ID:
 ILD000805911

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 NYD000708206

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00375
Units: P - Pounds
Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100
Waste Code: Not reported
Quantity: 00105
Units: P - Pounds
Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Not reported Mgmt Method Type Code:

Direction Distance

Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

1000318531

EDR ID Number

Document ID: NYA6662068 Manifest Status: Completed copy

Trans1 State ID: NYS Trans2 State ID: Not reported Generator Ship Date: 870422 Trans1 Recv Date: 870422 Trans2 Recv Date: Not reported TSD Site Recy Date: 870422 Part A Recv Date: 870427 Part B Recv Date: 870427

NYD058173915 Generator EPA ID: Trans1 EPA ID: ILD000805911 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00375 P - Pounds Units: 006 Number of Containers:

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Waste Code: Not reported Quantity: 00105 Units: P - Pounds

Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Year: 87

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6855557 Manifest Status: Completed copy Trans1 State ID: Not reported Trans2 State ID: Not reported Generator Ship Date: 871103 Trans1 Recv Date: 871103 Trans2 Recv Date: Not reported TSD Site Recv Date: 871103 Part A Recv Date: 871104 871105 Part B Recv Date:

Generator EPA ID: NYD058173915 Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

1000318531

Waste Code: D001 - NON-LISTED IGNITABLE WASTES

Quantity: 00375 P - Pounds Units: Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00105 Units: P - Pounds Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: Year: 87

Manifest Tracking Num: Not reported Not reported Import Ind: **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Not reported Discr Full Reject Ind: Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Document ID: NYA6792939 Manifest Status: Completed copy Trans1 State ID: NYS88290-Trans2 State ID: Not reported Generator Ship Date: 871007 Trans1 Recv Date: 871007 Trans2 Recv Date: Not reported TSD Site Recv Date: 871007 Part A Recv Date: 871014 Part B Recv Date: 871009 Generator EPA ID: NYD058173915

Trans1 EPA ID: ILD051060408 Trans2 EPA ID: Not reported TSDF ID: NYD000708206

D001 - NON-LISTED IGNITABLE WASTES Waste Code:

Quantity: 00375 Units: P - Pounds Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100 Waste Code: Not reported Quantity: 00105 P - Pounds Units: Number of Containers: 003

Container Type: DM - Metal drums, barrels

Handling Method: R Material recovery of more than 75 percent of the total material.

Specific Gravity: 100

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

1000318531

U003075935

N/A

AST

HIST AST

Year: Not reported Manifest Tracking Num: Import Ind: Not reported Export Ind: Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Not reported Discr Residue Ind: Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Click this hyperlink while viewing on your computer to access

Kz(

S113 DENOOYER CHEVROLET HIST UST

SE 127 WOLF ROAD 1/8-1/4 ALBANY, NY 12205 0.236 mi.

1247 ft. Site 4 of 5 in cluster S

Relative:

HIST UST:

Higher

PBS Number: 4-020095

SPDES Number: Not reported

Actual: Emergency Contact: MICHAEL CONGERO

299 ft. Emergency Telephone: (518) 458-7700
Operator: JOEL DENOOYER

Operator Telephone: (518) 458-7700

Owner Name: DENOOYER CHEVROLET
Owner Address: 127 WOLF ROAD

Owner City,St,Zip: ALBANY, NY 12205
Owner Telephone: (518) 458-7700
Owner Type: Corporate/Commercial

Owner Subtype: Not reported
Mailing Name: DENOOYER CHEVROLET

Mailing Address: 127 WOLF ROAD
Mailing Address 2: Not reported
Mailing City,St,Zip: ALBANY, NY 12205
Mailing Contact: MICHAEL CONGERO
Mailing Telephone: (518) 458-7700
Owner Mark: First Owner

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is

greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

or not at the facility.

Facility Addr2: Not reported SWIS ID: 0126
Old PBS Number: Not reported

Facility Type: RETAIL GASOLINE SALES

Facility Type: **OTHER** Inspected Date: Not reported Not reported Inspector: Inspection Result: Not reported Federal ID: Not reported Certification Flag: False Certification Date: 08/10/2001 **Expiration Date:** 09/02/2006

Direction
Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

Renew Flag: False
Renewal Date: Not reported
Total Capacity: 5325
FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data
Tank Screen: No Missing Data

Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26
Region: 4

Tank ld:

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Install Date: 19691201 Capacity (gals): 1000

Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported

Pipe Type: GALVANIZED STEEL

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Suction Dispenser: Date Tested: Not reported Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Not reported Date Closed: Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

Tank ld: 10

Tank Location: UNDERGROUND Tank Status: UNDERGROUND

Install Date: 19861001 Capacity (gals): 2000

Product Stored: UNLEADED GASOLINE

Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Sacrificial Anode
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: None

Second Containment: Vault (w/o access)
Leak Detection: Vapor Well
Overfill Prot: None

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

Dispenser: Suction Not reported Date Tested: Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 08/01/1995 Test Method: Not reported False Deleted: Updated: True Lat/long: Not reported

Tank ld: 11

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19861001
Capacity (gals): 2000

Product Stored: UNLEADED GASOLINE Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Sacrificial Anode
Pipe Location: Underground
Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: None

Vault (w/o access) Second Containment: Leak Detection: Vapor Well Overfill Prot: None Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 08/01/1995 Test Method: Not reported Deleted: False Updated: True

Tank ld: 2

Lat/long:

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

Not reported

Install Date: 19691201 Capacity (gals): 1000

Product Stored: UNLEADED GASOLINE
Tank Type: Steel/carbon steel
Tank Internal: Not reported
Tank External: Not reported
Pipe Location: Not reported

Pipe Type: GALVANIZED STEEL

Not reported Pipe Internal: Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Not reported Lat/long:

Tank Id:

Tank Location: UNDERGROUND

Tank Status: Closed Before April 1, 1991

19691201 Install Date: Capacity (gals): 1000

Product Stored: **UNLEADED GASOLINE** Steel/carbon steel Tank Type: Tank Internal: Not reported Tank External: Not reported Not reported Pipe Location:

GALVANIZED STEEL Pipe Type:

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: Minor Data Missing Date Closed: Not reported Test Method: Not reported Deleted: False Updated: False Lat/long: Not reported

Tank Id:

Tank Location: **UNDERGROUND** Tank Status: Closed-Removed 19691201 Install Date:

Capacity (gals): 1000

UNLEADED GASOLINE Product Stored: Steel/carbon steel Tank Type: Tank Internal: Not reported Not reported Tank External: Not reported Pipe Location:

GALVANIZED STEEL Pipe Type:

Pipe Internal: Not reported Pipe External: Not reported Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Not reported Date Tested: Next Test Date: Not reported Minor Data Missing Missing Data for Tank:

Date Closed: 07/01/1993 Test Method: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

Deleted: False Updated: True

Lat/long: Not reported

Tank ld: 5

UNDERGROUND Tank Location: Tank Status: Closed-Removed Install Date: 19841201 Capacity (gals): 500 UNKNOWN Product Stored: Steel/carbon steel Tank Type: Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported

Pipe Type: GALVANIZED STEEL

Pipe Internal: Not reported Not reported Pipe External: Second Containment: None Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Date Closed: 07/01/1993 Not reported Test Method: Deleted: False Updated: True

Lat/long: Not reported

Tank ld: 6

UNDERGROUND Tank Location: Closed-Removed Tank Status: 19691201 Install Date: 1000 Capacity (gals): UNKNOWN Product Stored: Steel/carbon steel Tank Type: Tank Internal: Not reported Tank External: Not reported Not reported Pipe Location: Pipe Type: **GALVANIZED STEEL**

Pipe Internal: Not reported
Pipe External: Not reported

None Second Containment: Leak Detection: None Overfill Prot: Not reported Dispenser: Suction Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: Minor Data Missing 07/01/1993 Date Closed: Test Method: Not reported Deleted: False Updated: True

Lat/long: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

AST:

 Region:
 STATE

 DEC Region:
 4

 Site Status:
 Active

 Facility Id:
 4-020095

 Program Type:
 PBS

 UTM X:
 597743

 UTM Y:
 4730288

 Expiration Date:
 2011/09/02

Tank Number: 12
Tank Id: 98858
Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 2/1/1992
Capacity Gallons: 500
Tightness Test Method: NN

Date Test:
Not reported
Next Test Date:
Not reported
Date Tank Closed:
Not reported
Register:
True
Modified By:
TESPERBE
Last Modified:
7/14/2006

Equipment Records:

A00 - Tank Internal Protection - None

B01 - Tank External Protection - Painted/Asphalt Coating

100 - Overfill - None

D01 - Pipe Type - Steel/Carbon Steel/Iron C01 - Pipe Location - Aboveground F00 - Pipe External Protection - None

J02 - Dispenser - Suction

E00 - Piping Secondary Containment - None

L09 - Piping Leak Detection - Exempt Suction Piping

H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None

K00 - Spill Prevention - None

Tank Number: 13
Tank Id: 93808
Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 2/1/1992
Capacity Gallons: 500
Tightness Test Method: NN

Date Test:

Not reported

Next Test Date:

Not reported

Date Tank Closed:

Register:

Modified By:

Not reported

True

True

TESPERBE

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

Last Modified: 7/14/2006

Equipment Records:

A00 - Tank Internal Protection - None D01 - Pipe Type - Steel/Carbon Steel/Iron

J02 - Dispenser - Suction

F00 - Pipe External Protection - None

B01 - Tank External Protection - Painted/Asphalt Coating

C01 - Pipe Location - Aboveground

100 - Overfill - None

E00 - Piping Secondary Containment - None

L09 - Piping Leak Detection - Exempt Suction Piping

H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None

K00 - Spill Prevention - None

Tank Number: 14 Tank Id: 93809 Tank Location:

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 2/1/1992 Capacity Gallons: 500 Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Date Tank Closed: Not reported Register: True Modified By: **TESPERBE** Last Modified: 7/14/2006

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating

A00 - Tank Internal Protection - None

100 - Overfill - None

F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None E00 - Piping Secondary Containment - None D01 - Pipe Type - Steel/Carbon Steel/Iron

J02 - Dispenser - Suction

L09 - Piping Leak Detection - Exempt Suction Piping

H00 - Tank Leak Detection - None C01 - Pipe Location - Aboveground K00 - Spill Prevention - None

Tank Number: 15 Tank Id: 96614 Tank Location:

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 8/1/1995 Capacity Gallons: 500

Direction Distance

Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

Tightness Test Method: NN

Date Test: Not reported Not reported Next Test Date: Date Tank Closed: Not reported Register: True Modified By: **TESPERBE** 7/14/2006 Last Modified:

Equipment Records:

K01 - Spill Prevention - Catch Basin F00 - Pipe External Protection - None A00 - Tank Internal Protection - None

B01 - Tank External Protection - Painted/Asphalt Coating

D02 - Pipe Type - Galvanized Steel

J02 - Dispenser - Suction

G01 - Tank Secondary Containment - Diking (Aboveground)

H00 - Tank Leak Detection - None

E00 - Piping Secondary Containment - None

100 - Overfill - None

C01 - Pipe Location - Aboveground L00 - Piping Leak Detection - None

Tank Number: 16 Tank Id: 96615 Tank Location:

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 8/1/1995 Capacity Gallons: 2000 Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Not reported Date Tank Closed: Register: True **TESPERBE** Modified By:

Last Modified: 7/14/2006

Equipment Records:

B01 - Tank External Protection - Painted/Asphalt Coating

F00 - Pipe External Protection - None A00 - Tank Internal Protection - None 104 - Overfill - Product Level Gauge (A/G)

J02 - Dispenser - Suction

D02 - Pipe Type - Galvanized Steel

G01 - Tank Secondary Containment - Diking (Aboveground)

H00 - Tank Leak Detection - None

E00 - Piping Secondary Containment - None

C01 - Pipe Location - Aboveground K00 - Spill Prevention - None L00 - Piping Leak Detection - None

Tank Number: 17 Tank Id: 96616 Tank Location: 3

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 8/1/1995 Capacity Gallons: 275 Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Date Tank Closed: Not reported Register: True Modified By: **TESPERBE** Last Modified: 7/14/2006

Equipment Records:

J01 - Dispenser - Submersible

A00 - Tank Internal Protection - None F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None D01 - Pipe Type - Steel/Carbon Steel/Iron

B01 - Tank External Protection - Painted/Asphalt Coating

100 - Overfill - None

E00 - Piping Secondary Containment - None

H00 - Tank Leak Detection - None C01 - Pipe Location - Aboveground L00 - Piping Leak Detection - None

Tank Number: 18 Tank Id: 96617 Tank Location:

Steel/Carbon Steel/Iron Tank Type:

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported 8/1/1995 Install Date: Capacity Gallons: 275 Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Date Tank Closed: Not reported Register: True Modified By: **TESPERBE** Last Modified: 7/14/2006

Equipment Records:

A00 - Tank Internal Protection - None

F00 - Pipe External Protection - None C01 - Pipe Location - Aboveground

D01 - Pipe Type - Steel/Carbon Steel/Iron

H00 - Tank Leak Detection - None

J01 - Dispenser - Submersible

E00 - Piping Secondary Containment - None

B01 - Tank External Protection - Painted/Asphalt Coating

G00 - Tank Secondary Containment - None

100 - Overfill - None

L00 - Piping Leak Detection - None

K00 - Spill Prevention - None

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

Tank Number: 19 Tank Id: 96618 Tank Location: 3

Steel/Carbon Steel/Iron Tank Type:

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported 8/1/1995 Install Date: 275 Capacity Gallons: Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Date Tank Closed: Not reported Register: True Modified By: **TESPERBE** Last Modified: 7/14/2006

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron A00 - Tank Internal Protection - None

J01 - Dispenser - Submersible

G00 - Tank Secondary Containment - None

B01 - Tank External Protection - Painted/Asphalt Coating

F00 - Pipe External Protection - None C01 - Pipe Location - Aboveground H00 - Tank Leak Detection - None

E00 - Piping Secondary Containment - None

100 - Overfill - None

K00 - Spill Prevention - None L00 - Piping Leak Detection - None

Tank Number: 20 98859 Tank Id: Tank Location:

Steel/Carbon Steel/Iron Tank Type:

Tank Status: In Service Tank Model: Not reported Pipe Model: Not reported Install Date: 2/1/1992 Capacity Gallons: 500 Tightness Test Method: NN

Date Test: Not reported Next Test Date: Not reported Date Tank Closed: Not reported Register: True Modified By: **TESPERBE** Last Modified: 7/14/2006

Equipment Records:

D01 - Pipe Type - Steel/Carbon Steel/Iron

F00 - Pipe External Protection - None

J02 - Dispenser - Suction

B01 - Tank External Protection - Painted/Asphalt Coating

A00 - Tank Internal Protection - None

L09 - Piping Leak Detection - Exempt Suction Piping

E00 - Piping Secondary Containment - None

C01 - Pipe Location - Aboveground

U003075935

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None

100 - Overfill - None K00 - Spill Prevention - None

Tank Number: 9 84796 Tank Id: Tank Location:

Tank Type: Steel/Carbon Steel/Iron Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1984 Capacity Gallons: 500 Tightness Test Method: NN

Date Test: Not reported Not reported Next Test Date: Date Tank Closed: 7/1/1993 Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

F00 - Pipe External Protection - None A00 - Tank Internal Protection - None C00 - Pipe Location - No Piping

G00 - Tank Secondary Containment - None D02 - Pipe Type - Galvanized Steel

H00 - Tank Leak Detection - None

100 - Overfill - None

B00 - Tank External Protection - None

Affiliation Records:

34962 Site Id: Affiliation Type: Mail Contact

Company Name: DENOOYER CHEVROLET

Contact Type: Not reported Contact Name: THERESA RUSSELL Address1: 127 WOLF ROAD Address2: Not reported **ALBANY** City: State: NYZip Code: 12205 Country Code: 001

Phone: (518) 458-7700 Phone Ext: Not reported

TRUSSELL@DENOOYERCHEVROLET.COM Email:

Fax Number: Not reported Modified By: **TESPERBE** Date Last Modified: 7/14/2006

Site Id: 34962

On-Site Operator Affiliation Type:

DENOOYER CHEVROLET Company Name:

Contact Type: Not reported Contact Name: JOEL DENOOYER

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported Country Code: 001

Phone: (518) 458-7700
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 34962

Affiliation Type: Emergency Contact
Company Name: DENOOYER CHEVROLET

Contact Type: Not reported
Contact Name: THERESA RUSSELL

Address1: Not reported
Address2: Not reported
City: Not reported

State: NN

Zip Code: Not reported

Country Code: 999
Phone: (518) 458-7700
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TESPERBE

Site Id: 34962 Affiliation Type: Owner

Date Last Modified:

Company Name: DENOOYER CHEVROLET

7/14/2006

PRESIDENT Contact Type: Contact Name: JOEL DENOOYER Address1: 127 WOLF ROAD Address2: Not reported City: **ALBANY** State: NYZip Code: 12205 Country Code: 001

Phone: (518) 458-7700
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TESPERBE
Date Last Modified: 7/14/2006

HIST AST:

PBS Number: 4-020095 SWIS Code: 0126

Operator: JOEL DENOOYER
Facility Phone: (518) 458-7700
Facility Addr2: Not reported

Facility Type: RETAIL GASOLINE SALES

Facility Type: OTHER

Direction Distance

Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

Emergency: MICHAEL CONGERO (518) 458-7700 **Emergency Tel:** Old PBSNO: Not reported Date Inspected: Not reported Inspector: Not reported Not reported Result of Inspection:

DENOOYER CHEVROLET Owner Name: 127 WOLF ROAD Owner Address: Owner City,St,Zip: ALBANY, NY 12205 Federal ID: Not reported

Owner Tel: (518) 458-7700 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Contact: MICHAEL CONGERO Mailing Name: DENOOYER CHEVROLET

127 WOLF ROAD Mailing Address: Mailing Address 2: Not reported Mailing City,St,Zip: ALBANY, NY 12205 Mailing Telephone: (518) 458-7700 Owner Mark: First Owner

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is

greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

or not at the facility.

Certification Flag: False 08/10/2001 Certification Date: 09/02/2006 Expiration: Renew Flag: False Renew Date: Not reported Total Capacity: 5325 FAMT: True

No Missing Data Facility Screen: Owner Screen: No Missing Data Tank Screen: No Missing Data

Dead Letter: False Not reported CBS Number: COLONIE Town or City: County Code: 01 Town or City Code: 26 Region: 4

Tank ID: 12

Tank Location: **ABOVEGROUND** Tank Status: In Service Install Date: 19920201 Capacity (Gal): 500 **USED OIL** Product Stored: Tank Type: Steel/carbon steel

Tank Internal: Tank External:

Pipe Location: Aboveground STEEL/IRON Pipe Type:

Pipe Internal: None Pipe External: 0 Tank Containment: None Leak Detection: 0 Overfill Protection: 0 Dispenser Method: Suction

Direction Distance Elevation

Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

EDR ID Number

Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: No Missing Data Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported Not reported Lat/Long:

Tank ID: 13

ABOVEGROUND Tank Location: Tank Status: In Service Install Date: 19920201 Capacity (Gal): 500 Product Stored: UNKNOWN Tank Type: Steel/carbon steel

Tank Internal: Tank External: 1

Pipe Location: Aboveground Pipe Type: STEEL/IRON

None Pipe Internal: Pipe External: Tank Containment: None Leak Detection: 0 Overfill Protection: 0 Dispenser Method: Suction Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported

Tank ID: 14

Lat/Long:

ABOVEGROUND Tank Location: Tank Status: In Service Install Date: 19920201 Capacity (Gal): 500 UNKNOWN Product Stored:

Not reported

Tank Type: Steel/carbon steel

Tank Internal: Tank External:

Pipe Location: Aboveground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: Tank Containment: None Leak Detection: 0 Overfill Protection: 0 Dispenser Method: Suction Date Tested: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported Not reported Lat/Long:

Tank ID: 15

Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: 19950801
Capacity (Gal): 500
Product Stored: UNKNOWN
Tank Type: Steel/carbon steel

Tank Internal: 0
Tank External: 1

Pipe Location: Aboveground
Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: 0

Tank Containment: Excavation/Tranch Liner

Leak Detection: 0
Overfill Protection: 5
Dispenser Method: 0

Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported Not reported Lat/Long:

Tank ID: 16

Tank Location: ABOVEGROUND
Tank Status: In Service
Install Date: 19950801
Capacity (Gal): 2000

Product Stored: UNLEADED GASOLINE Tank Type: Steel/carbon steel

Tank Internal: 0
Tank External: 1

Pipe Location: Aboveground Pipe Type: GALVANIZED STEEL

Pipe Internal: None Pipe External: 0

Tank Containment: Excavation/Tranch Liner

Leak Detection:0Overfill Protection:4Dispenser Method:SuctionDate Tested:Not reportedNext Test Date:Not reported

U003075935

EDR ID Number

Direction Distance Elevation

Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

Missing Data for Tank: No Missing Data Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported Not reported

Tank ID: 17

Lat/Long:

ABOVEGROUND Tank Location: Tank Status: In Service 19950801 Install Date: Capacity (Gal): 275 UNKNOWN Product Stored: Tank Type: Steel/carbon steel

Tank Internal: 0 Tank External:

Pipe Location: Aboveground STEEL/IRON Pipe Type:

Pipe Internal: None Pipe External: 0 Tank Containment: None Leak Detection: 0 Overfill Protection: 0

Dispenser Method: Submersible Date Tested: Not reported Next Test Date: Not reported No Missing Data Missing Data for Tank: Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported Not reported Lat/Long:

Tank ID: 18

ABOVEGROUND Tank Location: Tank Status: In Service 19950801 Install Date: 275 Capacity (Gal): UNKNOWN Product Stored: Steel/carbon steel Tank Type:

Tank Internal: 0 Tank External:

Pipe Location: Aboveground STEEL/IRON Pipe Type: Pipe Internal: None

Pipe External: 0 Tank Containment: None Leak Detection: Overfill Protection: 0

Dispenser Method: Submersible Date Tested: Not reported Not reported Next Test Date: Missing Data for Tank: No Missing Data U003075935

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported Not reported Lat/Long:

Tank ID:

Tank Location: **ABOVEGROUND** Tank Status: In Service Install Date: 19950801 Capacity (Gal): 275 Product Stored: UNKNOWN Tank Type: Steel/carbon steel

Tank Internal: Tank External:

Pipe Location: Aboveground Pipe Type: STEEL/IRON Pipe Internal: None

Pipe External: 0 Tank Containment: None Leak Detection: 0 Overfill Protection: Dispenser Method:

Submersible Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: Not reported Test Method: Not reported Deleted: False Updated: True SPDES Number: Not reported Lat/Long: Not reported

Tank ID: 20

ABOVEGROUND Tank Location: Tank Status: In Service Install Date: 19920201 Capacity (Gal): 500 Product Stored: **USED OIL** Tank Type: Steel/carbon steel

Tank Internal: 0 Tank External:

Pipe Location: Aboveground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: 0 None Tank Containment: Leak Detection: 0 Overfill Protection: Dispenser Method: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U003075935

Test Method: Not reported False Deleted: Updated: True SPDES Number: Not reported Lat/Long: Not reported

Tank ID:

Tank Location: ABOVEGROUND ON SADDLES LEGS, STILTS, RACK, OR CRADLE

Tank Status: Closed-Removed 19841201 Install Date: Capacity (Gal): 500 DIESEL Product Stored:

Tank Type: Steel/carbon steel Tank Internal: Not reported Tank External: Not reported Pipe Location: Not reported

GALVANIZED STEEL Pipe Type:

Pipe Internal: Not reported Pipe External: Not reported Tank Containment: None

Leak Detection: 0

Overfill Protection: Not reported Dispenser Method: Gravity Date Tested: Not reported Next Test Date: Not reported Minor Data Missing Missing Data for Tank: Date Closed: 07/01/1993 Test Method: Not reported

Deleted: False Updated: True SPDES Number: Not reported Not reported Lat/Long:

S114 **DENOOYER CHEVROLET** SE 127 WOLF ROAD **ALBANY, NY 12205** 1/8-1/4

0.236 mi.

1247 ft. Site 5 of 5 in cluster S

Relative: Higher

UST:

Facility Id: 4-020095 STATE Region: Actual: DEC Region: 299 ft. Site Status: Active Program Type: **PBS**

Expiration Date: 2011/09/02 UTM X: 597743 UTM Y: 4730288 Site ID: 34962

Tank Number: 1 Tank ID: 84790

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1969 Capacity Gallons: 1000

UST

U004080530

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

EDR ID Number

U004080530

Tightness Test Method: NN

Next Test Date: Not reported
Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

A00 - Tank Internal Protection - None

100 - Overfill - None J02 - Dispenser - Suction

H00 - Tank Leak Detection - None

G00 - Tank Secondary Containment - None

C00 - Pipe Location - No Piping F00 - Pipe External Protection - None D02 - Pipe Type - Galvanized Steel B00 - Tank External Protection - None

Tank Number: 10 Tank ID: 84797

Tank Status:

Closed - Removed
Tank Model:

Not reported
Not reported
Install Date:

Capacity Gallons:

Tightness Test Method:

Closed - Removed
Not reported
Not reported
10/1/1986
2000
NN

Next Test Date: Not reported
Date Tank Closed: 8/1/1995

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

H03 - Tank Leak Detection - Vapor Well

B02 - Tank External Protection - Original Sacrificial Anode

D02 - Pipe Type - Galvanized Steel

J02 - Dispenser - Suction

F00 - Pipe External Protection - None

C02 - Pipe Location - Underground/On-ground

A00 - Tank Internal Protection - None

100 - Overfill - None

G07 - Tank Secondary Containment - Excavation/Trench Liner System

Tank Number: 11 Tank ID: 84798

Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 10/1/1986
Capacity Gallons: 2000

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

U004080530

EDR ID Number

Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: 8/1/1995
Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

J02 - Dispenser - Suction

D02 - Pipe Type - Galvanized Steel A00 - Tank Internal Protection - None F00 - Pipe External Protection - None

G07 - Tank Secondary Containment - Excavation/Trench Liner System

B02 - Tank External Protection - Original Sacrificial Anode

H03 - Tank Leak Detection - Vapor Well

100 - Overfill - None

C02 - Pipe Location - Underground/On-ground

Tank Number: 2
Tank ID: 84791

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1969 Capacity Gallons: 1000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

C00 - Pipe Location - No Piping H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None

J02 - Dispenser - Suction

G00 - Tank Secondary Containment - None D02 - Pipe Type - Galvanized Steel F00 - Pipe External Protection - None

100 - Overfill - None

B00 - Tank External Protection - None

Tank Number: 3
Tank ID: 84792

Tank Status: Closed Prior to Micro Conversion, 03/91

Tank Model: Not reported Pipe Model: Not reported Install Date: 12/1/1969 Capacity Gallons: 1000

Direction Distance

Elevation Site Database(s) EPA ID Number

DENOOYER CHEVROLET (Continued)

Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None

H00 - Tank Leak Detection - None

100 - Overfill - None

A00 - Tank Internal Protection - None D02 - Pipe Type - Galvanized Steel

J02 - Dispenser - Suction

F00 - Pipe External Protection - None C00 - Pipe Location - No Piping B00 - Tank External Protection - None

Tank Number: 4
Tank ID: 84793

Tank Status:

Closed - Removed
Tank Model:

Pipe Model:

Install Date:

Capacity Gallons:

Tightness Test Method:

Closed - Removed
Not reported
12/1/1969
12/1/1969
1000
NN

Next Test Date: Not reported Date Tank Closed: 7/1/1993

Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

G00 - Tank Secondary Containment - None

J02 - Dispenser - Suction C00 - Pipe Location - No Piping D02 - Pipe Type - Galvanized Steel F00 - Pipe External Protection - None A00 - Tank Internal Protection - None

100 - Overfill - None

H00 - Tank Leak Detection - None B00 - Tank External Protection - None

Tank Number: 5
Tank ID: 84794

Tank Status: Closed - Removed
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 12/1/1984
Capacity Gallons: 500

EDR ID Number

U004080530

Direction Distance

Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

Tightness Test Method: NN

Not reported Next Test Date: Date Tank Closed: 7/1/1993 Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

C00 - Pipe Location - No Piping D02 - Pipe Type - Galvanized Steel

J02 - Dispenser - Suction

F00 - Pipe External Protection - None A00 - Tank Internal Protection - None G00 - Tank Secondary Containment - None

100 - Overfill - None

H00 - Tank Leak Detection - None B00 - Tank External Protection - None

Tank Number: 6 Tank ID: 84795

Closed - Removed Tank Status: Not reported Tank Model: Pipe Model: Not reported Install Date: 12/1/1969 Capacity Gallons: 1000 Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: 7/1/1993

Tank Location:

Tank Type: Steel/carbon steel Date Test: Not reported Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None A00 - Tank Internal Protection - None F00 - Pipe External Protection - None C00 - Pipe Location - No Piping D02 - Pipe Type - Galvanized Steel J02 - Dispenser - Suction

G00 - Tank Secondary Containment - None

100 - Overfill - None

B00 - Tank External Protection - None

Affiliation Records:

Site Id: 34962 Affiliation Type: Mail Contact

Company Name: DENOOYER CHEVROLET

Contact Type: Not reported Contact Name: THERESA RUSSELL Address1: 127 WOLF ROAD Address2: Not reported

EDR ID Number

U004080530

Direction Distance

Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

U004080530

EDR ID Number

City: **ALBANY** State: NYZip Code: 12205 Country Code: 001

(518) 458-7700 Phone: Phone Ext: Not reported

TRUSSELL@DENOOYERCHEVROLET.COM Email:

Fax Number: Not reported Modified By: **TESPERBE** Date Last Modified: 7/14/2006

Site Id: 34962

On-Site Operator Affiliation Type:

Company Name: DENOOYER CHEVROLET

Contact Type: Not reported Contact Name: JOEL DENOOYER Address1: Not reported Address2: Not reported City: Not reported

State: NN

Zip Code: Not reported Country Code: 001 Phone: (518) 458-7700 Phone Ext: Not reported Not reported Email: Fax Number: Not reported **TRANSLAT** Modified By: Date Last Modified: 3/4/2004

Site Id: 34962

Affiliation Type: **Emergency Contact** Company Name: DENOOYER CHEVROLET

Contact Type: Not reported THERESA RUSSELL Contact Name:

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code:

Not reported Country Code: 999

(518) 458-7700 Phone: Phone Ext: Not reported Email: Not reported Not reported Fax Number: Modified By: **TESPERBE** Date Last Modified: 7/14/2006

Site Id: 34962 Affiliation Type: Owner

Zip Code:

Company Name: **DENOOYER CHEVROLET**

12205

Contact Type: **PRESIDENT** JOEL DENOOYER Contact Name: 127 WOLF ROAD Address1: Address2: Not reported City: **ALBANY** State: NY

TC2896934.2s Page 578

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DENOOYER CHEVROLET (Continued)

Country Code: 001

(518) 458-7700 Phone: Phone Ext: Not reported Email: Not reported Fax Number: Not reported **TESPERBE** Modified By: Date Last Modified: 7/14/2006

T115 JOHN CERONE, INC. U002259933 UST 70 SUNSET BLVD. **HIST UST** NW N/A 1/8-1/4 COLONIE, NY 12205

0.237 mi.

1253 ft. Site 1 of 2 in cluster T

Relative: Lower

UST:

4-388203 Facility Id: Region: STATE DEC Region:

Actual: 291 ft. Site Status: Unregulated

Program Type: **PBS Expiration Date:** N/A

UTM X: 571583.70016999997 UTM Y: 4698628.2769600004

Site ID: 36438

Tank Number: 1 Tank ID: 93095

Tank Status: Closed - Removed Tank Model: Not reported Pipe Model: Not reported Install Date: 3/1/1979 2000 Capacity Gallons: Tightness Test Method: 03 Next Test Date: Not reported 12/1/1997 Date Tank Closed:

Tank Location:

Tank Type: Steel/carbon steel 11/1/1995 Date Test: Register: True Modified By: **TRANSLAT** Last Modified: 3/4/2004

Equipment Records:

105 - Overfill - Vent Whistle

D01 - Pipe Type - Steel/Carbon Steel/Iron A00 - Tank Internal Protection - None H00 - Tank Leak Detection - None

C02 - Pipe Location - Underground/On-ground

F00 - Pipe External Protection - None G00 - Tank Secondary Containment - None

B01 - Tank External Protection - Painted/Asphalt Coating

J02 - Dispenser - Suction

Tank Number: 2 Tank ID: 95809

Tank Status: Closed - Removed Tank Model: Not reported

U004080530

Direction Distance

Elevation Site Database(s) EPA ID Number

JOHN CERONE, INC. (Continued)

U002259933

EDR ID Number

Pipe Model: Not reported Install Date: Not reported Capacity Gallons: 1000 Tightness Test Method: NN

Next Test Date: Not reported
Date Tank Closed: 12/1/1997
Tank Location: 5

Tank Type: Steel/carbon steel
Date Test: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 3/4/2004

Equipment Records:

H00 - Tank Leak Detection - None

105 - Overfill - Vent Whistle

C02 - Pipe Location - Underground/On-ground

B01 - Tank External Protection - Painted/Asphalt Coating

A00 - Tank Internal Protection - None G00 - Tank Secondary Containment - None D01 - Pipe Type - Steel/Carbon Steel/Iron

J02 - Dispenser - Suction

F00 - Pipe External Protection - None

Affiliation Records:

Site Id: 36438

Affiliation Type: On-Site Operator
Company Name: JOHN CERONE, INC.
Contact Type: Not reported

Contact Name: JOHN CERONE INC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 869-8602
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 36438
Affiliation Type: Mail Contact

Company Name: JOHN CERONE, INC.

Contact Type: Not reported Contact Name: Not reported Address1: 70 SUNSET BLVD. Address2: Not reported City: **ALBANY** State: NY 12205 Zip Code: Country Code: 001

Phone: (518) 869-8602
Phone Ext: Not reported
Email: Not reported

Direction
Distance
Elevation

ation Site Database(s) EPA ID Number

JOHN CERONE, INC. (Continued)

U002259933

EDR ID Number

Fax Number: Not reported Modified By: TESPERBE Date Last Modified: 10/27/2005

Site Id: 36438

Affiliation Type: Emergency Contact Company Name: JOHN CERONE, INC.

Contact Type: Not reported

Contact Name: JOHN CERONE INC

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported

Country Code: 001

Phone: (518) 869-8602
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 3/4/2004

Site Id: 36438 Affiliation Type: Owner

Company Name: JOHN CERONE, INC.

Contact Type: Not reported
Contact Name: Not reported
Address1: 70 SUNSET BLVD.
Address2: Not reported
City: ALBANY
State: NY

Zip Code: 12205
Country Code: 001

Phone: (518) 869-8602
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TESPERBE
Date Last Modified: 10/27/2005

HIST UST:

PBS Number: 4-388203 SPDES Number: Not reported JOHN CERONE INC **Emergency Contact: Emergency Telephone:** (518) 785-0046 JOHN CERONE INC Operator: Operator Telephone: (518) 869-8602 Owner Name: JOHN CERONE, INC. Owner Address: 70 SUNSET BLVD. ALBANY, NY 12305 Owner City, St, Zip: Owner Telephone: (518) 869-8602 Owner Type: Corporate/Commercial

Owner Subtype: Not reported

Mailing Name: JOHN CERONE, INC.
Mailing Address: 70 SUNSET BLVD.
Mailing Address 2: Not reported
Mailing City, St, Zip: ALBANY, NY 12305

Direction
Distance

Elevation Site Database(s) EPA ID Number

JOHN CERONE, INC. (Continued)

U002259933

EDR ID Number

Mailing Contact: Not reported
Mailing Telephone: (518) 869-8602
Owner Mark: First Owner

Facility Status: 2 - Unregulated by PBS (the total capacity is less than 1,101 gallons)

and Subpart 360-14.

Facility Addr2: Not reported SWIS ID: 0126

Old PBS Number: Not reported OTHER Facility Type: Inspected Date: Not reported Inspector: Not reported Inspection Result: Not reported Federal ID: Not reported Certification Flag: False 01/27/1997 Certification Date: 01/30/2002 **Expiration Date:** Renew Flag: False Renewal Date: Not reported

Total Capacity: 0 FAMT: True

Facility Screen: No Missing Data
Owner Screen: No Missing Data

Tank Screen:

Dead Letter: False
CBS Number: Not reported
Town or City: COLONIE
County Code: 01
Town or City: 26
Region: 4

Tank Id:

Tank Location: UNDERGROUND
Tank Status: Closed-Removed
Install Date: 19790301
Capacity (gals): 2000

Product Stored: DIESEL

Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Painted/Asphalt Coating

Pipe Location: Underground Pipe Type: STEEL/IRON

Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Vent Whistle Overfill Prot: Dispenser: Suction Date Tested: 11/01/1995 Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 12/01/1997 Test Method: Horner EZ Check

Deleted: False
Updated: True
Lat/long: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

JOHN CERONE, INC. (Continued)

U002259933

RCRA-NonGen 1000446683

NYD986909190

FINDS

MANIFEST

Tank Id:

UNDERGROUND Tank Location: Closed-Removed Tank Status: Install Date: Not reported Capacity (gals): 1000 DIESEL Product Stored:

Tank Type: Steel/carbon steel

Tank Internal: None

Tank External: Painted/Asphalt Coating

Pipe Location: Underground STEEL/IRON Pipe Type: Pipe Internal: None Pipe External: None Second Containment: None Leak Detection: None Overfill Prot: Vent Whistle Dispenser: Suction Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Date Closed: 12/01/1997 Test Method: Not reported Deleted: False

Updated: True Not reported Lat/long:

U116 **NYSDOT BIN 1033131** I-87 OVER SAND CRK RD BRG 5 SSW

1/8-1/4 COLONIE, NY 12205

0.237 mi.

1253 ft. Site 1 of 3 in cluster U

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

Facility name: **NYSDOT BIN 1033131**

Actual: Facility address: I-87 OVER SAND CRK RD BRG 5 298 ft. COLONIE, NY 12205

EPA ID: NYD986909190 **HOLLAND AVE** Mailing address:

ALBANY, NY 12208

Contact: Not reported Contact address: HOLLAND AVE ALBANY, NY 12208

US Contact country:

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: NYSDOT Owner/operator address: **NOT REQUIRED**

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: State

Direction Distance Elevation

ion Site Database(s) EPA ID Number

NYSDOT BIN 1033131 (Continued)

1000446683

EDR ID Number

Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NYSDOT

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: State
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: Nο Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: Nο User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: NYSDOT BIN 1033131 Classification: Not a generator, verified

Date form received by agency: 04/19/1995

Facility name: NYSDOT BIN 1033131

Classification: Unverified

Date form received by agency: 08/07/1990

Facility name: NYSDOT BIN 1033131 Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004451156

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

Direction Distance Elevation

ation Site Database(s) EPA ID Number

NYSDOT BIN 1033131 (Continued)

1000446683

EDR ID Number

program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986909190

Country: USA Mailing Name: NYSDOT

Mailing Contact: DAVID W. JANESKI
Mailing Address: 84 HOLLAND AVENUE

Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12208
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 518-486-1179

Document ID: NYB2323935

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 945W132OH Trans2 State ID: Not reported 900917 Generator Ship Date: 900917 Trans1 Recv Date: Trans2 Recv Date: Not reported TSD Site Recy Date: 900925 Part A Recv Date: 900928 Part B Recv Date: 901023

 Generator EPA ID:
 NYD986909190

 Trans1 EPA ID:
 OHD986966190

 Trans2 EPA ID:
 Not reported

 TSDF ID:
 OHD066060609

Waste Code: D008 - LEAD 5.0 MG/L TCLP

Quantity: 03900 Units: P - Pounds

Number of Containers: 006

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 140 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported Not reported Export Ind: Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

U117 NYSDOT BIN 1033132 RCRA-NonGen 1000446684
SSW I-87 OVER SAND CRK RD BRG 6 FINDS NYD986909208

COLONIE, NY 12205 MANIFEST

1/8-1/4 0.237 mi.

1253 ft. Site 2 of 3 in cluster U

Relative: RCRA-NonGen:

Higher Date form received by agency: 01/01/2007

Facility name: NYSDOT BIN 1033132

Actual: Facility address: I-87 OVER SAND CRK RD BRG 6
298 ft. COLONIE NY 12205

COLONIE, NY 12205 EPA ID: NYD986909208

Mailing address: HOLLAND AVE

ALBANY, NY 12208

Contact: Not reported
Contact address: HOLLAND AVE

ALBANY, NY 12208

Contact country: US

Contact telephone: Not reported Contact email: Not reported

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: NYSDOT

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: State
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NYSDOT

Owner/operator address: NOT REQUIRED

NOT REQUIRED, WY 99999

Owner/operator country: US

Owner/operator telephone: (212) 555-1212

Legal status: State
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: No Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No

Direction Distance

Elevation Site Database(s) EPA ID Number

NYSDOT BIN 1033132 (Continued)

1000446684

EDR ID Number

Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: NYSDOT BIN 1033132 Classification: Not a generator, verified

Date form received by agency: 04/19/1995

Facility name: NYSDOT BIN 1033132

Classification: Unverified

Date form received by agency: 08/07/1990

Facility name: NYSDOT BIN 1033132 Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110004451165

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY MANIFEST:

EPA ID: NYD986909208

Country: USA Mailing Name: NYSDOT

Mailing Contact: DAVID W. JANESKI
Mailing Address: 84 HOLLAND AVENUE

Mailing Address 2: Not reported
Mailing City: ALBANY
Mailing State: NY
Mailing Zip: 12208
Mailing Zip4: Not reported
Mailing Country: USA

Mailing Phone: 518-486-1179

Document ID: NYB2323944

Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC

Trans1 State ID: 945W13OHI
Trans2 State ID: Not reported
Generator Ship Date: 900917
Trans1 Recv Date: 900917
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900925

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NYSDOT BIN 1033132 (Continued)

1000446684

Part A Recv Date: 900928 Part B Recv Date: 901023 NYD986909208 Generator EPA ID: Trans1 EPA ID: OHD986966190

Trans2 EPA ID: Not reported TSDF ID: OHD066060609

D008 - LEAD 5.0 MG/L TCLP Waste Code:

Quantity: 04550 P - Pounds Units: Number of Containers: 007

Container Type: DM - Metal drums, barrels

Handling Method: T Chemical, physical, or biological treatment.

Specific Gravity: 140 Year: 90

Manifest Tracking Num: Not reported Import Ind: Not reported **Export Ind:** Not reported Discr Quantity Ind: Not reported Discr Type Ind: Not reported Discr Residue Ind: Not reported Discr Partial Reject Ind: Not reported Discr Full Reject Ind: Not reported Manifest Ref Num: Not reported Alt Fac RCRA Id: Not reported Alt Fac Sign Date: Not reported Mgmt Method Type Code: Not reported

S102960319 T118 **CERONE EXCAVATING SUNSET LTANKS** NW **70 SUNSET BLVD HIST LTANKS** N/A

1/8-1/4 COLONIE, NY

0.238 mi.

1257 ft. Site 2 of 2 in cluster T

LTANKS: Relative:

74991 Site ID: Lower 9710528 Spill No: Actual: Spill Date: 12/15/1997 291 ft. Spill Cause: Tank Failure

Commercial/Industrial Spill Source:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 4/26/2000 Facility Addr2: Not reported Cleanup Ceased: Not reported Cleanup Meets Standard: False SWIS: 0126 WTCHRIST Investigator: Not reported Referred To: 12/15/1997 Reported to Dept: CID: 21

Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True Remediation Phase: 0 Date Entered In Computer: 12/15/1997 Spill Record Last Update: 11/23/2009

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

CERONE EXCAVATING SUNSET (Continued)

S102960319

JOHN CERONE, INC. Spiller Name: Spiller Company: CERONE EXCAVATING Spiller Address: 70 SUNSET BLVD Spiller City, St, Zip: COLONIE, NY 12205-

Spiller County: 001

Spiller Contact: JEFF KALETA Spiller Phone: (518) 462-0400 Not reported Spiller Extention:

DEC Region: 4 DER Facility ID: 70274

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 12/07/98 - REPORT RECEIVED FROM KLEEN RESOURSES. LETTER

WRITTEN TO FIND OUT DISPOSAL OF CONTAMINATED SOIL. PBS 4-388203

4/26/00 - Closure report received on May 12, 1999. Minor contamination

remained in the area of the diesel tank pit. The domestic water supply well was tested and found clean except for a reading of 3ppb Tetrachloroethene which is below the 5ppb standard value for class GA

SHEEN ON GROUNDWATER - DEC REP CHRISTIANSON ON SCENE - STOCK PILING Remarks:

CONTAMINATED SOIL NOW

Material:

Site ID: 74991 Operable Unit ID: 1053520 Operable Unit: 01 Material ID: 328828 Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Not reported Site ID: Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

HIST LTANKS:

Region of Spill: Spill Number: 9710528 Spill Date: 12/15/1997 Spill Time: 10:00

Spill Cause: Tank Failure Resource Affectd: Groundwater

Direction Distance

Elevation Site Database(s) EPA ID Number

CERONE EXCAVATING SUNSET (Continued)

S102960319

EDR ID Number

Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 04/26/00
Cleanup Ceased: / /
Cleanup Meets Standard: False

CHRISTENSEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Not reported Caller Extension: Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 12/15/97 Reported to Department Time: 11:01 SWIS:

Spiller Contact: JEFF KALETA
Spiller Phone: (518) 462-0400
Spiller Extention: Not reported

Spiller Name: CERONE EXCAVATING
Spiller Address: 70 SUNSET BLVD
Spiller City,St,Zip: COLONIE, NY 12205-

Spiller Cleanup Date:

Facility Contact: JOHN CERONE, INC.

Facility Phone: () Facility Extention: Not reported
Spill Notifier: Other
PBS Number: 4-388203
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/15/97
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 04/26/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0

Direction Distance

Elevation Site Database(s) EPA ID Number

CERONE EXCAVATING SUNSET (Continued)

S102960319

NY Hist Spills

EDR ID Number

Unkonwn Quantity Recovered: True

Material:
Class Type:
DIESEL
Times Material Entry In File:
CAS Number:
Last Date:
Unkonwn Quantity Recovered: True
DIESEL
10625
Not reported
19940728

DEC Remarks: 12/07/98 - REPORT RECEIVED FROM KLEEN RESOURSES. LETTER WRITTEN TO FIND OUT

DISPOSAL OF CONTAMINATED SOIL. 4/26/00 - Closure report received on May 12,

1999.Minor contamination remained in the area of the diesel tank pit. The domestic water supply well was tested and found clean except for a reading of 3ppb Tetrachloroethene which is below the 5ppb standard value for class GA

water.

Spill Cause: SHEEN ON GROUNDWATER - DEC REP CHRISTIANSON ON SCENE - STOCK PILING

CONTAMINATED SOIL NOW

R119 COLONIE PD WOLF RD HIST LTANKS S101174833
North 312 WOLF RD NY Spills N/A

1/8-1/4 LATHAM (COLONIE), NY 0.240 mi.

1265 ft. Site 26 of 29 in cluster R

Relative: HIST LTANKS:
Higher Region of Spill: 4

Spill Cause: Tank Overfill
Resource Affectd: On Land
Water Affected: Not reported
Spill Source: Tank Truck

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 06/28/94
Cleanup Ceased: 06/13/94
Cleanup Meets Standard: True

Investigator: CHRISTENSEN Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 06/13/94 Reported to Department Time: 08:48 SWIS: 01

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: OIL CO
Spiller Address: Not reported
Spiller City, St, Zip: Not reported

Spiller Cleanup Date: / /

Facility Contact: Not reported
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Affected Persons

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE PD WOLF RD (Continued)

S101174833

PBS Number: 4-600554

Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: / / **UST Involvement:** True

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: Date Spill Entered In Computer Data File: 06/28/94 Time Spill Entered In Computer Data File: Not reported

02/01/01 Spill Record Last Update: Is Updated: False

Tank:

PBS Number: Not reported Not reported Tank Number: Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 20 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: **GASOLINE GASOLINE** Class Type: Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 9000404, 9206986, 9611362, 9908968, 0001530), 0011743.

OIL CO OVERFILLED UGT, FD CLEANED. WTC TELECON-CLEAN-UP SATISFACTORY. Spill Cause:

NY Spills: Site ID:

217298 Facility Addr2: Not reported Facility ID: 9403492 Spill Number: 9403492 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 6/13/1994 Spill Date: Reported to Dept: 6/13/1994 CID: Not reported Human Error Spill Cause: Water Affected: Not reported Spill Source: Tank Truck Spill Notifier: Affected Persons Cleanup Ceased: 6/13/1994 Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Direction Distance Elevation

stance EDR ID Number evation Site Database(s) EPA ID Number

COLONIE PD WOLF RD (Continued)

S101174833

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/28/1994
Remediation Phase: 0
Date Entered In Computer: 6/28/1994
Spill Record Last Update: 2/1/2008
Spiller Name: Not reported
Spiller Company: OIL CO
Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 342630

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9000404, 9206986, 9611362, 9908968, (0001530), 0011743.

Remarks: OIL CO OVERFILLED UGT, FD CLEANED. WTC TELECON-CLEAN-UP SATISFACTORY.

Material:

217298 Site ID: Operable Unit ID: 997263 Operable Unit: 01 Material ID: 383668 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 20 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 217299 Facility Addr2: Not reported Facility ID: 9611362 Spill Number: 9611362 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 12/16/1996 Spill Date: Reported to Dept: 12/16/1996

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE PD WOLF RD (Continued)

S101174833

CID: 322

Spill Cause: **Equipment Failure** Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: Responsible Party Cleanup Ceased: 12/16/1996 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Known release with minimal potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Remediation Phase:

Date Entered In Computer: 12/16/1996 Spill Record Last Update: 2/1/2001

Spiller Name: TOWN OF COLONIE Spiller Company: COLONIE POLICE DEPT

Spiller Address: 312 WOLF RD Spiller City, St, Zip: LATHAM, ZZ

Spiller Company: 001

Contact Name: Not reported (518) 783-2811 Contact Phone: 4

DEC Region:

DER Facility ID: 342630

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 12/31/96 - NO DEC RESPONSE. 9000404, 9206986, 9403492,

9908968, (0001530), 0011743.

GASOLINE PUMP SHUT OFF NOT WORKING PROPERLY - CAUSED SPILL - FD Remarks:

ENROUTE FOR CLEAN UP

Material:

Site ID: 217299 Operable Unit ID: 1039394 Operable Unit: 01 Material ID: 343560 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 10 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE PD WOLF RD (Continued)

S101174833

Click this hyperlink while viewing on your computer to access **ENROUTE FOR CLEAN UP**

NY Hist Spills:

Region of Spill: 4

Spill Number: 9611362 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 12/16/1996 10:00 Reported to Dept Date/Time: 12/16/96 10:08

SWIS: 01

Spiller Name: COLONIE POLICE DEPT Spiller Contact: TOWN OF COLONIE Spiller Phone: (518) 783-2811 Spiller Phone: (518) 783-2811 Spiller Address: 312 WOLF RD Spiller City, St, Zip: LATHAM

Spill Cause: **Equipment Failure**

Reported to Dept: On Land Water Affected: Not reported

Spill Source:

Spill Notifier: Responsible Party

PBS Number: 4-600554 Cleanup Ceased: 12/16/96 Cleanup Meets Std: True Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: Enforcement Date: 11 Invstgn Complete: 11 **UST Involvement:**

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

12/16/96 Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 12/16/96 Date Spill Entered In Computer Data File: Not reported

Update Date: 02/01/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 10

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE PD WOLF RD (Continued)

S101174833

Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: True Material: GASOLINE GASOLINE Class Type: Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: 12/31/96 - NO DEC RESPONSE. 9000404, 9206986, 9403492, 9908968, 0001530),

0011743.

Remark:

CLEAN UP

Region of Spill:

Spill Number: 9708643

Investigator: **CENTRAL OFFICE** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 10/23/1997 16:38 10/23/97 16:38 Reported to Dept Date/Time: SWIS: 01 Spiller Name: Not reported

Spiller Contact: Not reported Spiller Phone: Not reported

Spiller Contact: COMMUNICATIONS TOC

Spiller Phone: (518) 783-2811 Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: **Equipment Failure**

Reported to Dept: On Land Water Affected: Not reported

Spill Source:

Spill Notifier: Affected Persons PBS Number: Not reported

Cleanup Ceased: // Cleanup Meets Std: False Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: / / **Enforcement Date:** 11 Invstgn Complete: // **UST Involvement:**

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 10/23/97 Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 10/23/97 Date Spill Entered In Computer Data File: Not reported

10/24/97 Update Date: Is Updated: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE PD WOLF RD (Continued)

S101174833

NY Spills

S110309386

N/A

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Hazardous Material

Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: True Material: **CONDOMS** CONDOMS Class Type: Times Material Entry In File:

CAS Number: Not reported Last Date: Not reported

DEC Remarks: Not reported

Remark: information not avaliable at this time ---- this is a test message only -

testing windows nt program installation

R120 **COLONIE PUBLIC SAFETY BLDG WOLF RD**

312 WOLF RD

North 1/8-1/4 LATHAM COLONIE, NY

0.241 mi.

Site 27 of 29 in cluster R 1275 ft.

NY Spills: Relative: Site ID:

Higher 148422 312 WOLF RD Facility Addr2: Actual: Facility ID: 9908968 297 ft. Spill Number: 9908968

> Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Spill Date: 10/23/1999 Reported to Dept: 10/23/1999 CID: 196

Spill Cause: Human Error Water Affected: Not reported Spill Source: Commercial Vehicle Spill Notifier: Police Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/28/1999

Remediation Phase:

Date Entered In Computer: 10/23/1999 Spill Record Last Update: 4/9/2010 Spiller Name: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE PUBLIC SAFETY BLDG WOLF RD (Continued)

S110309386

Spiller Company: **AGWAY**

Spiller Address: 312 OLD WOLF ROAD

Spiller City, St, Zip: LATHAM, NY

Spiller Company: 001

Contact Name: TOM VOGEL Contact Phone: (518) 783-2811

DEC Region: 4 DER Facility ID: 126318

DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was

"CHRISTENSEN" [SHOULD BE TANK TRUCK NOT Comm VEHICLE] 14:45-RELAYED

TO WTC. 9000404, 9206986, 9403492, 9611362, 0011743. 10/28/99 - Spill

Date 10/23/99, Driver measured 77 " of product in an 8,000 gallon tank. He figured he could unload 900 gallons and have 200 gallons to spare. He was wrong. Gasoline was forced out of the gasoline pump. It by passed the vent. Valley Equipment was called to check out the pump and clean up the surface spill. They also pumped out 2 storm drains. Tank was retested on Sunday to make sure that the over pressurization

of the tank did not damage it.

Remarks: local agway driver states he has listed 900 gallon stop at the town of

colonie public safety center. the tank only took 698 gal. spilling 25 t 50 gallons on the ground. Shaker Road Fire Dept. on scene along with

the west albany fire dept hazm team. need dec rep to scene.

Material:

148422 Site ID: Operable Unit ID: 1083425 Operable Unit: 01 Material ID: 298064 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: 50 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

R121 TOWN OF COLONIE PUBLIC SAFETY UST U003297881
North 312 WOLF RD HIST UST N/A

North 312 WOLF RD 1/8-1/4 LATHAM, NY 12110

0.242 mi.

1280 ft. Site 28 of 29 in cluster R

Relative: UST:

 Higher
 Facility Id:
 4-600554

 Region:
 STATE

 Actual:
 DEC Region:
 4

 297 ft.
 Site Status:
 Active

Program Type: PBS
Expiration Date: 2013/02/20
UTM X: 598889
UTM Y: 4732163
Site ID: 37888

Tank Number: 1
Tank ID: 97282
Tank Status: In Service
Tank Model: Not reported
Pipe Model: Not reported
Install Date: 9/1/1991
Capacity Gallons: 8000
Tightness Test Method: NN

Next Test Date: Not reported Date Tank Closed: Not reported

Tank Location:

Tank Type: Equivalent technology

Date Test: Not reported Register: True Modified By: tesperbe Last Modified: 12/19/2007

Equipment Records:

K01 - Spill Prevention - Catch Basin

F04 - Pipe External Protection - Fiberglass

L09 - Piping Leak Detection - Exempt Suction Piping

J02 - Dispenser - Suction

A00 - Tank Internal Protection - None

C02 - Pipe Location - Underground/On-ground

H01 - Tank Leak Detection - Interstitial - Electronic Monitoring G04 - Tank Secondary Containment - Double-Walled (Underground)

D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)

B04 - Tank External Protection - Fiberglass

101 - Overfill - Float Vent Valve

E00 - Piping Secondary Containment - None

Affiliation Records:

Site Id: 37888
Affiliation Type: Mail Contact

Company Name: TOWN OF COLONIE

Contact Type: Not reported

Contact Name: DOUGLAS W. SIPPEL Address1: MEMORIAL TOWN HALL

Address2: P.O. BOX 508
City: NEWTONVILLE

State: NY
Zip Code: 12128

EDR ID Number

Direction Distance

Elevation Site Database(s) EPA ID Number

TOWN OF COLONIE PUBLIC SAFETY (Continued)

U003297881

EDR ID Number

Country Code: 001

Phone: (518) 783-2726
Phone Ext: Not reported

Email: SIPPELD@COLONIE.ORG

Fax Number: Not reported Modified By: tesperbe Date Last Modified: 5/14/2010

Site Id: 37888 Affiliation Type: Owner

Company Name: TOWN OF COLONIE

Contact Type: Not reported Contact Name: Not reported

Address1: MEMORIAL TOWN HALL, PO BOX 508

Address2: Not reported City: NEWTONVILLE

State: NY
Zip Code: 12128
Country Code: 001

Phone: (518) 783-2726
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TMKOCH
Date Last Modified: 6/8/2005

Site Id: 37888

Affiliation Type: On-Site Operator

Company Name: TOWN OF COLONIE PUBLIC SAFETY

Contact Type: Not reported
Contact Name: TOWN OF COLONIE

Address1: Not reported Address2: Not reported City: Not reported State: NY

Zip Code: Not reported

Country Code: 001

Phone: (518) 783-2712
Phone Ext: Not reported
Email: Not reported
Fax Number: Not reported
Modified By: TMKOCH
Date Last Modified: 6/8/2005

Site Id: 37888

Affiliation Type: Emergency Contact Company Name: TOWN OF COLONIE

Contact Type: Not reported

Contact Name: DEPT OF FIRE PREVENTION

Address1: Not reported Address2: Not reported City: Not reported State: NN

Zip Code: Not reported Country Code: 999

Phone: (518) 783-2811
Phone Ext: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

TOWN OF COLONIE PUBLIC SAFETY (Continued)

U003297881

Email: Not reported Fax Number: Not reported Modified By: **TMKOCH** Date Last Modified: 6/8/2005

HIST UST:

4-600554 PBS Number: Not reported SPDES Number:

Emergency Contact: DEPT OF FIRE PREVENTION

Emergency Telephone: (518) 783-2811

Operator: TOWN OF COLONIE Operator Telephone: (518) 783-2712 Owner Name: TOWN OF COLONIE

MEMORIAL TOWN HALL, PO BOX 508 Owner Address:

Owner City, St, Zip: NEWTONVILLE, NY 12128

Owner Telephone: (518) 783-2726 Owner Type: Local Government Owner Subtype: Not reported Mailing Name: TOWN OF COLONIE Mailing Address: MEMORIAL TOWN HALL

P.O. BOX 508 Mailing Address 2:

Mailing City, St, Zip: NEWTONVILLE, NY 12128 Mailing Contact: VINCENT A. MARINI Mailing Telephone: (518) 783-2726 Owner Mark: First Owner

Facility Status: 1 - Active PBS facility, i.e. total capacity of the PBS tanks is

greater than 1,100 gallons, regardless if Subpart 360-14 tanks exist

or not at the facility.

Facility Addr2: Not reported

SWIS ID: 0126

Old PBS Number: Not reported Facility Type: **OTHER** Inspected Date: Not reported Not reported Inspector: Not reported Inspection Result: Federal ID: Not reported Certification Flag: False Certification Date: 02/20/1998 02/20/2003 **Expiration Date:** Renew Flag: False Renewal Date: Not reported **Total Capacity:** 8000 FAMT: True

Facility Screen: No Missing Data Owner Screen: No Missing Data No Missing Data Tank Screen:

Dead Letter: False Not reported CBS Number: COLONIE Town or City: County Code: 01 26

Town or City: Region: 4

Tank Id:

UNDERGROUND Tank Location:

Tank Status: In Service Install Date: 19910901

Direction Distance

Elevation Site Database(s) **EPA ID Number**

TOWN OF COLONIE PUBLIC SAFETY (Continued)

U003297881

EDR ID Number

Capacity (gals): 8000

UNLEADED GASOLINE Product Stored:

Fiberglass reinforced plastic [FRP] Tank Type:

Tank Internal: None Tank External: **Fiberglass** Underground Pipe Location:

STAINLESS STEEL ALLOY Pipe Type:

Pipe Internal: None Pipe External: Fiberglass Second Containment: Vault (w/access) Leak Detection: Electronic

Overfill Prot: Float Vent Valve, Catch Basin

Dispenser: Submersible Date Tested: Not reported Next Test Date: Not reported Missing Data for Tank: No Missing Data Not reported Date Closed: Test Method: Not reported Deleted: False Updated: True Not reported Lat/long:

R122

COLONIE TOWN FACILITY S104952482 **NY Hist Spills** 312 WOLF RD N/A

1/8-1/4 LATHAM, NY

0.242 mi.

North

Site 29 of 29 in cluster R 1280 ft.

NY Hist Spills: Relative: Region of Spill: Higher Spill Number:

Actual: 297 ft.

CHRISTENSEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 01/31/2001 09:00 Spill Date/Time: Reported to Dept Date/Time: 01/31/01 10:35

0011743

SWIS:

Spiller Name: TOWN OF COLONIE Spiller Contact: LAURENCE ISABELLE Spiller Phone: (518) 783-2712 Spiller Contact: LAURENCE ISABELLE

Spiller Phone: (518) 783-2712 Spiller Address: Not reported Spiller City, St, Zip: NEWTONVILLE, NY Spill Cause: Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 01

Last Inspection:

Spill Notifier: Fire Department PBS Number: 4-600554 Cleanup Ceased: / / Cleanup Meets Std: True

Penalty Not Recommended Recommended Penalty:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

COLONIE TOWN FACILITY (Continued)

S104952482

Spiller Cleanup Dt: **Enforcement Date:** / / Invstgn Complete: // UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/15/01

Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / 01/31/01 Date Spill Entered In Computer Data File: Date Spill Entered In Computer Data File: Not reported

Update Date: 11/23/01 Is Updated: False

Tank:

PBS Number: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 55 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False

Material: HYDRAULIC OIL HYDRAULIC OIL Class Type:

Times Material Entry In File: 1846 CAS Number: Not reported Last Date: 19940728

DEC Remarks: 02/01/2001 - Town called in the spill of hydraulic oil, which leaked fron an

> elavator piston. It will take approx. 6 weeks before it is fixed. Should not pose any environmental problems. 07/31/2001 - Mr. Isabella called and informed me that the repair work is scheduled for August 6, 2001. 10/15/2001 - Received call last week from Mr. Isabella. Elavator fixed, hydraulic oil was sucked out of pit. Nothing got out of elavator shaft. closed wtc 11/23/2001 - Received disposal receiptsfor contaminated material. wtc

9000404, 9206986, 9403492, 9611362, 9908968

Remark: crack in elevator piston caused leak. contained in casing. clean up will take

approx 6 weeks to get elevator contractor to replace piston and remove

contaminated oil.

U123 NIMO SAND CREEK TRANSFRMR

SSW **479 SAND CREEK RD**

1/4-1/2 COLONIE, NY

0.259 mi.

1370 ft. Site 3 of 3 in cluster U

NY Spills: Relative:

192337 Site ID: Higher Facility Addr2: Not reported

Actual: Facility ID: 9700020 298 ft. Spill Number: 9700020 Facility Type: ER

SWIS: 0126 S102560983

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) **EPA ID Number**

NIMO SAND CREEK TRANSFRMR (Continued)

S102560983

EDR ID Number

Investigator: WTCHRIST Referred To: Not reported Spill Date: 3/31/1997 Reported to Dept: 4/1/1997 CID: 21

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Fire Department Cleanup Ceased: Not reported

Cleanup Meets Std: True

Not reported Last Inspection:

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/14/2001

Remediation Phase: Date Entered In Computer: 4/1/1997 Spill Record Last Update: 2/14/2001 Spiller Name: Not reported

Spiller Company: NIAGARA MOHAWK NIMO

160357

Spiller Address: **BROADWAY** Spiller City, St, Zip: ALBANY, NY -Spiller Company: 001 Contact Name: PAUL MULLER

Contact Phone: (518) 869-6562 DEC Region:

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN" 01/10/2001 - Letter written to NiMO for information on

transformer leak. 02/14/2001 - Transformer labeled non-PCB.

Remarks: FD RESPONDED FOR A TRANSFORMER LEAKING FLUID - FOUND A BLACKENED AREA

ON THE BAFFLE PLATES AND SEVERAL HOLES IN SAME THAT WERE LEAKING FLUID TO THE GROUND - NIAGARA MOHAWK CONTACTED BY COLONIE POLICE - NIMO WAS

THERE LATER THAT NIGHT

Material:

DER Facility ID:

Site ID: 192337 Operable Unit ID: 1042627 Operable Unit: 01 Material ID: 336640 Material Code: 0020A

Material Name: TRANSFORMER OIL

Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No Resource Affected:

Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

NIMO SAND CREEK TRANSFRMR (Continued)

S102560983

EDR ID Number

Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 9700020 Spill Number: Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 03/31/1997 17:41 Reported to Dept Date/Time: 04/01/97 12:15

SWIS: 01

Spiller Name: NIAGARA MOHAWK NIMO

Spiller Contact:

Spiller Phone:

Spiller Contact:

Spiller Contact:

Spiller Phone:

Spiller Phone:

Spiller Address:

Spiller City,St,Zip:

Spill Cause:

Not reported

()
PAUL MULLER

Spaller Moduler

Spaller Address:

BROADWAY

ALBANY, NY
Equipment Failure

Reported to Dept: On Land Water Affected: Not reported

Spill Source: 01

Spill Notifier: Fire Department PBS Number: Not reported Cleanup Ceased: / /

Cleanup Meets Std: True
Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 02/14/01
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 04/01/97
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/14/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO SAND CREEK TRANSFRMR (Continued)

S102560983

Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Gallons Units: Quantity Recovered: 0 Unkonwn Quantity Recovered: False

Material: TRANSFORMER OIL TRANSFORMER OIL Class Type:

Times Material Entry In File: 533 CAS Number: Not reported Last Date: 19940926

DEC Remarks: 01/10/2001 - Letter written to NiMO for information on transformer leak.

02/14/2001 - Transformer labeled non-PCB.

FD RESPONDED FOR A TRANSFORMER LEAKING FLUID - FOUND A BLACKENED AREA ON THE Remark:

> BAFFLE PLATES AND SEVERAL HOLES IN SAME THAT WERE LEAKING FLUID TO THE GROUND -NIAGARA MOHAWK CONTACTED BY COLONIE POLICE - NIMO WAS THERE LATER THAT NIGHT

124 PETER GRIMM **HIST LTANKS** S100132922 NW **ALBANY SHAKER RD** N/A

1/4-1/2 COLONIE, NY

0.296 mi. 1562 ft.

HIST LTANKS: Relative: Region of Spill: Lower

Spill Number: 8807027 Actual: Spill Date: 11/21/1988 272 ft. Spill Time: 11:00 Spill Cause: Tank Failure Resource Affectd: Groundwater

Water Affected: Not reported Other Commercial/Industrial Spill Source:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/22/89 Cleanup Ceased: 03/22/89 Cleanup Meets Standard: True Investigator:

MCDONALD Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 11/21/88 Reported to Department Time: 11:10 SWIS:

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: PETER GRIMM

Spiller Address: ALBANY SHAKER ROAD

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PETER GRIMM (Continued)

S100132922

Spiller City, St, Zip: COLONIE

Spiller Cleanup Date: 11

Facility Contact: Not reported Facility Phone: (518) 272-1100 Facility Extention: Not reported Spill Notifier: Other PBS Number: 4-443271 Last Inspection: 11

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: // **UST Involvement:** True

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: Date Spill Entered In Computer Data File: 11/23/88 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 11/22/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

CAS Number:

Last Date:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False **GASOLINE** Material: **GASOLINE** Class Type: Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929 Material Class Type: Petroleum 0 Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625

DEC Remarks: 09/28/95: This is additional information about material spilled from the translation of the old spill file: DIESEL 5). SEE 8504693 FILE), 9103369.

MCDONALD ON SCENE - 2-4000G UGTS BEING REMOVED - 1 DIESEL, 1 GASOLINE. HEAVY Spill Cause:

CONTAMINATION FROM BOTH TANKS. DIESEL TANK HAD MANY HOLES. SOIL REMOVED, CLAY,

CLEAN-UP COMPLETE. SEE 8504693,9103369.

Not reported 19940728

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

125 LATHAM WATER DIST WOLF RD **HIST LTANKS** S100135551 North **312 WOLF RD NY Spills** N/A

1/4-1/2 COLONIE, NY

0.297 mi. 1566 ft.

HIST LTANKS: Relative:

Region of Spill: Lower

Spill Number: 9206986 Actual: Spill Date: 09/17/1992 294 ft. Spill Time: 10:00 Spill Cause:

Tank Overfill Resource Affectd: On Land Not reported Water Affected:

Spill Source: Other Non Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 09/22/92 Cleanup Ceased: 09/18/92 Cleanup Meets Standard: True

Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 09/17/92 Reported to Department Time: 10:43 SWIS: 01

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: COLONIE TOWN WATER DEPT

Spiller Address: Not reported Spiller City, St, Zip: Not reported

Spiller Cleanup Date:

TOWN OF COLONIE Facility Contact:

Facility Phone: Not reported Facility Extention: Not reported Spill Notifier: Responsible Party PBS Number: Not reported

Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: // Investigation Complete: // **UST Involvement:** False

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted:

Date Spill Entered In Computer Data File: 09/22/92 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/01/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LATHAM WATER DIST WOLF RD (Continued)

S100135551

Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False **GASOLINE** Material: GASOLINE Class Type: Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: SEE 8809646, 9000393, 9206986, 9210246, 9304149, 9314252. 312 WOLF - 9000404,

9403492, 9611362, 9908968, 0001530), 0011743. WATER Dept 108 WOLF Rd PBS

4-600124?, PUBLIC SAFETY Bldg PBS 4-600554??

FOUND CONT. SOIL @ TANK PULL. SM QUAN SOIL, REMOVED TO COLONIE LF VIA LATTANZIO. Spill Cause:

Region of Spill:

Spill Number: 9000404 Spill Date: 04/05/1990 Spill Time: 12:00 Spill Cause: Tank Failure Resource Affectd: Groundwater Water Affected: Not reported

Spill Source: Other Non Commercial/Industrial

Known release that creates potential for fire or hazard. DEC Response. Spill Class:

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 06/06/90 04/20/90 Cleanup Ceased: Cleanup Meets Standard: True

Investigator: MCCULLOUCH/SPER

Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 04/12/90 Reported to Department Time: 09:45 SWIS:

Spiller Contact: **GARY MOSTART** Spiller Phone: Not reported Not reported Spiller Extention:

Spiller Name: LATHAM WATER GARY MOSTART

Spiller Address: Not reported Spiller City, St, Zip: Not reported

Spiller Cleanup Date:

Facility Contact: COLONIE TOWN PURE WATER?

Facility Phone: Not reported Facility Extention: Not reported Spill Notifier: Local Agency

Direction
Distance

Elevation Site Database(s) EPA ID Number

LATHAM WATER DIST WOLF RD (Continued)

S100135551

EDR ID Number

PBS Number: Not reported Last Inspection: 04/20/90

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/25/90
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/01/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported Last Date: 19940728

DEC Remarks: 06/06/90: AT COLONIE LANDFILL, BACKFILLED W/ CLEAN SAND. COMPLETE. 9206986,

9403492, 9611362, 9908968, 0001530), 0011743. 108 WOLF Rd PBS 4-600124?, 312

WOLF Rd PBS 4-600554??

Spill Cause: LWD PULLED 1K UGT W/O NOTIFYING, FOUND HOLE, CONT. SOIL, SENT TO LF, FILLED

HOLE. 4/20,8:00-GPM ON SITE, LWD HELD CONT. SOIL IN PERMITTED TRUCK, EMER.

PERMIT PETRO) ISSUED FOR DISPOSAL>>

NY Spills:

Site ID: 217297 Facility Addr2: Not reported Facility ID: 9206986 Spill Number: 9206986 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 9/17/1992 Spill Date: Reported to Dept: 9/17/1992 CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: Responsible Party

Cleanup Ceased: 9/18/1992

Direction Distance

Elevation Site Database(s) EPA ID Number

LATHAM WATER DIST WOLF RD (Continued)

S100135551

EDR ID Number

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/22/1992

Remediation Phase: 0

Date Entered In Computer: 9/22/1992 Spill Record Last Update: 1/31/2008

Spiller Name: TOWN OF COLONIE

Spiller Company: COLONIE TOWN WATER DEPT

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4

DER Facility ID: 342604

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" SEE 8809646, 9000393, 9206986, 9210246, 9304149, 9314252. 312 WOLF - 9000404, 9403492, 9611362, 9908968, (0001530),

0011743. WATER Dept 108 WOLF Rd PBS 4-600124?, PUBLIC SAFETY Bldg PBS

4-600554??

Remarks: FOUND CONT. SOIL @ TANK PULL. SM QUAN SOIL, REMOVED TO COLONIE LF VIA

LATTANZIO.

False

Material:

Site ID: 217297 Operable Unit ID: 974027 Operable Unit: 01 Material ID: 407662 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Petroleum Material FA: Quantity: Units: Gallons Recovered: No Not reported Resource Affected:

Tank Test:

Oxygenate:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Not reported Test Method:

Site ID: 217296 Facility Addr2: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

LATHAM WATER DIST WOLF RD (Continued)

S100135551

EDR ID Number

 Facility ID:
 9000404

 Spill Number:
 9000404

 Facility Type:
 ER

 SWIS:
 0126

Investigator: MCCULLOUCH
Referred To: Not reported
Spill Date: 4/5/1990
Reported to Dept: 4/12/1990
CID: Not reported
Spill Cause: Equipment Failure
Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Spill Notifier: Local Agency
Cleanup Ceased: 4/20/1990
Cleanup Meets Std: True
Last Inspection: 4/20/1990

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/6/1990
Remediation Phase: 0
Date Entered In Computer: 4/25/1990
Spill Record Last Update: 1/31/2008

Spiller Name: COLONIE TOWN PURE WATER?
Spiller Company: LATHAM WATER GARY MOSTART

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: GARY MOSTART Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 342604

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"MCCULLOUCH/SPER" 06/06/90: AT COLONIE LANDFILL, BACKFILLED W/ CLEAN

SAND. COMPLETE. 9206986, 9403492, 9611362, 9908968, (0001530), 0011743. 108 WOLF Rd PBS 4-600124?, 312 WOLF Rd PBS 4-600554??

Remarks: LWD PULLED 1K UGT W/O NOTIFYING, FOUND HOLE, CONT. SOIL, SENT TO LF,

FILLED HOLE. 4/20,8:00-GPM ON SITE, LWD HELD CONT. SOIL IN PERMITTED

TRUCK, EMER. PERMIT (PETRO) ISSUED FOR DISPOSAL>>

Material:

Site ID: 217296 Operable Unit ID: 939793 Operable Unit: 01 Material ID: 438796 8000 Material Code: Material Name: Diesel Not reported Case No.: Petroleum Material FA: Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LATHAM WATER DIST WOLF RD (Continued)

S100135551

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

> Click this hyperlink while viewing on your computer to access TRUCK, EMER. PERMIT (PETRO) ISSUED FOR DISPOSAL>>

126 MUNK RES MARGARET DR SE 3 MARGARET DR OIL IN SEWR

S103936175 **NY Spills NY Hist Spills** N/A

1/4-1/2 LOUDONVILLE, NY

0.301 mi. 1591 ft.

NY Spills: Relative:

Site ID: 69010 Higher

Facility Addr2: Not reported Actual: Facility ID: 9900461 310 ft. Spill Number: 9900461

Facility Type: ER SWIS: 0126 Investigator: WTCHRIST

Referred To: LAW ENFOREMENT

Spill Date: 4/13/1999 Reported to Dept: 4/13/1999 CID: 366 Spill Cause: Deliberate Water Affected: Not reported

Spill Source: Passenger Vehicle Spill Notifier: Citizen Cleanup Ceased: Not reported Cleanup Meets Std: False

Last Inspection: Not reported Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

4/13/1999 Spill Closed Dt: Remediation Phase:

Date Entered In Computer: 4/13/1999 Spill Record Last Update: 3/5/2008 Spiller Name: Not reported Spiller Company: **BERNARD MUNK** Spiller Address: 3 MARGARET DR Spiller City,St,Zip: LOUDONVILLE, NY 12211-

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4 DER Facility ID: 65653

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Direction Distance

Elevation Site Database(s) **EPA ID Number**

MUNK RES MARGARET DR (Continued)

S103936175

EDR ID Number

"CHRISTENSEN/ECOS" WTC TELECON W/Col PD, REFd TO ECO HAYES FOR TICKET; OIL IN STORM SEWER, TOWN Hwy Dept PUT PADS IN SEWER, OIL TRAVELED TO ALBANY SHAKER Rd, TOWN WILL REMOVE PADS IN A DAY OR 2. CALLER REPORTED WATCHING SPILLER CHANGE CAR OIL AND DUMP IN SEWER. POLICE INVESTIGATING. SPILLER DENIES DUMPING, BUT WAS OBSERVED BY CALLER. LOCAL HIGHWAY DEPT ADVISED. VEHICLE NYS REG AAE518.

Material:

Remarks:

69010 Site ID: Operable Unit ID: 1075228 Operable Unit: 01 307597 Material ID: Material Code: 0015 Material Name: Motor Oil Case No.: Not reported Material FA: Petroleum

Quantity: Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

Spill Number: 9900461

CHRISTENSEN/ECOS Investigator:

Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 04/13/1999 12:42 04/13/99 13:17 Reported to Dept Date/Time:

SWIS: 01

Spiller Name: BERNARD MUNK Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: 3 MARGARET DR

Spiller City,St,Zip: LOUDONVILLE, NY 12211-

Spill Cause: Deliberate Reported to Dept: On Land Water Affected: Not reported

Spill Source: 06

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MUNK RES MARGARET DR (Continued)

S103936175

Spill Notifier: Citizen PBS Number: Not reported

Cleanup Ceased: 11 Cleanup Meets Std: False Last Inspection: 11

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: 11 **Enforcement Date:** 11 Invstgn Complete: // **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 04/13/99 Date Spill Entered In Computer Data File: Not reported

04/14/99 Update Date: Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False MOTOR OIL Material: MOTOR OIL Class Type: Times Material Entry In File: 508 CAS Number: Not reported Last Date: 19940728

WTC TELECON W/Col PD, REFd TO ECO HAYES FOR TICKET; OIL IN STORM SEWER, TOWN DEC Remarks:

Hwy Dept PUT PADS IN SEWER, OIL TRAVELED TO ALBANY SHAKER Rd, TOWN WILL REMOVE

PADS IN A DAY OR 2.

CALLER REPORTED WATCHING SPILLER CHANGE CAR OIL AND DUMP IN SEWER. POLICE Remark:

INVESTIGATING. SPILLER DENIES DUMPING, BUT WAS OBSERVED BY CALLER. LOCAL

HIGHWAY DEPT ADVISED. VEHICLE NYS REG AAE518.

V127 HANNAFORD PLAZA WOLF RD **NY Spills** S103829718 South 98 WOLF RD **NY Hist Spills** N/A

ALBANY, NY 1/4-1/2

0.309 mi.

Site 1 of 5 in cluster V 1630 ft.

NY Spills: Relative:

Site ID: 82902 Higher Facility Addr2: Not reported Actual: 9900075

Facility ID: 299 ft. Spill Number: 9900075 Facility Type: ER

Direction Distance

Elevation Site Database(s) EPA ID Number

HANNAFORD PLAZA WOLF RD (Continued)

S103829718

EDR ID Number

SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 4/2/1999 Reported to Dept: 4/2/1999 CID: 382 Spill Cause: Deliberate Water Affected: Not reported

Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/26/2000

Remediation Phase: 0
Date Entered In Computer: 4/2/1999
Spill Record Last Update: 2/1/2008
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller City,St,Zip: NY

Spiller Company: 999

Contact Name: JOHN EDDY Contact Phone: (518) 281-7594

DEC Region: 4
DER Facility ID: 76361

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" DIDN'T KNOW SUPERMARKETS WERE NOT COMMERCIAL

ENTERPRISES. 9303217 spill was cooking fat awaiting for pick. It was

a non-petroleum spill.

Remarks: CALLER STATES THAT DRUMS IN BACK OF THE BUILDING THAT WERE AWAITING

PICK UP WERE TIPPED OVER BY UNKNOWN PERSONS. SPEEDY DRY WAS PLACED.

AND CLEAN UP WILL BE ACCOMPLISHED BY CALLER.

Material:

 Site ID:
 82902

 Operable Unit ID:
 1074988

 Operable Unit:
 01

 Material ID:
 307215

 Material Code:
 0066A

Material Name: UNKNOWN PETROLEUM

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Resource Affected:

Oxygenate:

Not reported

Petroleum

State

Petroleum

State

Petroleum

State

Petroleum

State

Petroleum

State

Not Reallons

Not reported

False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported

Direction
Distance

Elevation Site Database(s) EPA ID Number

HANNAFORD PLAZA WOLF RD (Continued)

S103829718

EDR ID Number

Tank Size: Not reported
Test Method: Not reported
Leak Rate: Not reported
Gross Fail: Not reported
Modified By: Not reported
Last Modified: Not reported
Test Method: Not reported

NY Hist Spills:

Region of Spill: 4 9900075 Spill Number: Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 04/02/1999 03:00 Spill Date/Time: Reported to Dept Date/Time: 04/02/99 12:10

SWIS: 01

Spiller Name: UNKNOWN Spiller Contact: Not reported Not reported Spiller Phone: Spiller Contact: JOHN EDDY Spiller Phone: (518) 281-7594 Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Deliberate Reported to Dept: On Land Water Affected: Not reported

Spill Source: 02

Spill Notifier: Affected Persons
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 01/26/00
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /

Date Spill Entered In Computer Data File: 04/02/99
Date Spill Entered In Computer Data File: Not reported

Update Date: 01/26/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HANNAFORD PLAZA WOLF RD (Continued)

S103829718

Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Petroleum Quantity Spilled: 55 Unkonwn Quantity Spilled: False Gallons Units: Quantity Recovered: 0 Unkonwn Quantity Recovered: False

UNKNOWN PETROLEUM Material: Class Type: UNKNOWN PETROLEUM

Times Material Entry In File: 16414 CAS Number: Not reported Last Date: 19940929

DEC Remarks: DIDN T KNOW SUPERMARKETS WERE NOT COMMERCIAL ENTERPRISES. 9303217 spill was

cooking fat awaiting for pick. It was a non-petroleum spill.

Remark: CALLER STATES THAT DRUMS IN BACK OF THE BUILDING THAT WERE AWAITING PICK UP

WERE TIPPED OVER BY UNKNOWN PERSONS. SPEEDY DRY WAS PLACED. AND CLEAN UP WILL

BE ACCOMPLISHED BY CALLER.

EXAM MANAGEMENT COMPUTER DR NY Spills S109206229 N/A

SSW 14 COMPUTER DR E. **ALBANY COLONIE, NY 12205** 1/4-1/2

0.328 mi. 1732 ft.

128

NY Spills: Relative: Site ID: 401185 Higher

Facility Addr2: **EXAM MANAGMENT 14 COMPUTER DRIVE EAST**

Actual: Facility ID: 0804301 303 ft. Spill Number: 0804301

Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 7/15/2008 Reported to Dept: 7/15/2008 CID: 444

Spill Cause: Human Error Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Police Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. (Highly

Improbable) Spill Closed Dt: 8/6/2008

Remediation Phase:

Date Entered In Computer: 7/15/2008 Spill Record Last Update: 8/6/2008

Spiller Name: **COLONIE POLICE** Spiller Company: **EXAM MANAGMENT** Spiller Address: 14 COMPUTER DRIVE EAST

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

EXAM MANAGEMENT COMPUTER DR (Continued)

S109206229

Spiller City, St, Zip: ALBANY, NY 12205

Spiller Company: 999

Contact Name: **COLONIE POLICE** Contact Phone: (518) 783-2811

DEC Region: 4 DER Facility ID: 350449

DEC Memo: 08/06/08 - No Dec response. No municipa-public notification. wtc

8-10 CC-- BROKE A BP CUFF- AND FIRE DEPT ON SCENE AND POLICE AND EMS Remarks:

Material:

Site ID: 401185 Operable Unit ID: 1157988 Operable Unit: 01 Material ID: 2149032 Material Code: 0031A **MERCURY** Material Name: 07439976 Case No.:

Material FA: Hazardous Material

Quantity: Units: Gallons Recovered: No Not reported Resource Affected:

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

V129 **MEYERS GARAGE WOLF RD WOLF RD @ SAND CREEK RD** South

1/4-1/2 COLONIE, NY

0.335 mi.

1769 ft. Site 2 of 5 in cluster V

Relative: Higher

NY Spills:

Spill Source:

Site ID: 84059 Facility Addr2: Not reported

Actual: 299 ft.

Facility ID: 8805788 Spill Number: 8805788 Facility Type: ER SWIS: 0126 Investigator: ajkokock Referred To: Not reported Spill Date: 10/5/1988 Reported to Dept: 10/7/1988 CID: Not reported Spill Cause: Deliberate Water Affected: Not reported

Private Dwelling

NY Spills

NY Hist Spills

S103034968

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MEYERS GARAGE WOLF RD (Continued)

S103034968

Spill Notifier: Other Cleanup Ceased: 10/17/1988 Cleanup Meets Std: True Last Inspection: 10/17/1988

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/17/1988

Remediation Phase:

Date Entered In Computer: 10/24/1988 Spill Record Last Update: 11/15/2007 Spiller Name: Not reported Spiller Company: **MEYERS GRAAGE** Spiller Address: Not reported

Spiller City, St, Zip: ΖZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported 4

DEC Region: DER Facility ID: 77324

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Remarks: DRAIN OIL SPILLED ON GROUND/POOR HOUSEKEEPING AREA HAS BEEN CLEANED

Material:

Site ID: 84059 Operable Unit ID: 920950 Operable Unit: 01 457697 Material ID: 0022 Material Code:

Material Name: Waste Oil/Used Oil Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons

Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

Spill Number: 8805788 Investigator: KOKOCKI

Direction Distance Elevation

Site Database(s) EPA ID Number

Not reported

MEYERS GARAGE WOLF RD (Continued)

S103034968

EDR ID Number

Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 10/05/1988 13:00 Spill Date/Time: Reported to Dept Date/Time: 10/07/88 12:13

SWIS: 01

Spiller Name: MEYERS GRAAGE Spiller Contact: Not reported (518) 459-1165 Spiller Phone: Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Deliberate Reported to Dept: On Land Water Affected: Not reported Spill Source: 09

Spill Source: 09
Spill Notifier: Other
PBS Number: Not reported
Cleanup Ceased: 10/17/88
Cleanup Meets Std: True
Last Inspection: 10/17/88

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False
Spill Class: Not reported
Spill Closed Dt: 10/17/88
Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 10/24/88

Date Spill Entered In Computer Data File:
Update Date: 03/30/98
Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: WASTE OIL WASTE OIL Class Type: Times Material Entry In File: 9509 CAS Number: Not reported 19940927 Last Date:

DEC Remarks: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MEYERS GARAGE WOLF RD (Continued)

S103034968

Remark: DRAIN OIL SPILLED ON GROUND/POOR HOUSEKEEPING AREA HAS BEEN CLEANED

W130 S103571924 **MOBIL WOLF @ SAND CREEK** NY Spills SSW 88 WOLF RD @ SAND CREEK **NY Hist Spills** N/A 1/4-1/2 ALBANY (COLONIE), NY

0.341 mi.

1803 ft. Site 1 of 7 in cluster W

NY Spills: Relative: Site ID: Higher

Facility Addr2: Not reported Actual: Facility ID: 9800073 299 ft. Spill Number: 9800073 Facility Type: ER SWIS:

0126 Investigator: wtchrist Referred To: Not reported Spill Date: 4/2/1998 4/2/1998 Reported to Dept: CID: 366 Spill Cause: Other Water Affected: Not reported Spill Source: **Gasoline Station**

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

172166

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. No DEC

Response. No corrective action required.

Spill Closed Dt: 4/2/1998 Remediation Phase: 0 Date Entered In Computer: 4/2/1998 Spill Record Last Update: 4/9/2010 Spiller Name: Not reported

Spiller Company: UNKNOWN @ MOBIL

Spiller Address: Not reported

Spiller City,St,Zip: NY 999 Spiller Company:

Contact Name: Not reported Contact Phone: Not reported

DEC Region: **DER Facility ID:** 144908

DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was

"CHRISTENSEN" NO DEC RESPONSE PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948, 0011968, 0411682, 0506498,

0507841, 0606868, 0903903.

CALLER NOTICED APPROXIMATELY A CUP OF PRODUCT ON GROUND FROM SPILLAGE Remarks:

FROM NOZZLE. MANAGEMENT ADVISED.

Material:

Site ID: 172166 Operable Unit ID: 1060594 Operable Unit: 01 Material ID: 325631 Material Code: 0009 Material Name: Gasoline

Direction Distance

Elevation Site Database(s) EPA ID Number

MOBIL WOLF @ SAND CREEK (Continued)

Not reported

Material FA: Petroleum Quantity: 1

Units: Gallons
Recovered: No
Resource Affected: Not reported

Oxygenate: False

Tank Test:

Case No.:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 9800073 Investigator: **CHRISTENSEN** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 04/02/1998 08:15 Reported to Dept Date/Time: 04/02/98 10:49

SWIS: 01

Spiller Name: UNKNOWN Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Other Reported to Dept: On Land Water Affected: Not reported

Spill Source: 05
Spill Notifier: Other
PBS Number: 4-132284
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. No DEC

Response. No corrective action required.

Spill Closed Dt: 04/02/98

EDR ID Number

S103571924

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

MOBIL WOLF @ SAND CREEK (Continued)

S103571924

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 04/02/98
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: NO DEC RESPONSE 8602161, 9212927, 9413716, 9708903, 9911948, 0011968.

Remark: CALLER NOTICED APPROXIMATELY A CUP OF PRODUCT ON GROUND FROM SPILLAGE FROM

NOZZLE. MANAGEMENT ADVISED.

 W131
 MOBIL WOLF RD @ SAND CRK
 NY Spills
 S102115918

 SSW
 88 WOLF RD @ SAND CREEK
 NY Hist Spills
 N/A

1/4-1/2 COLONIE, NY

0.341 mi.

1803 ft. Site 2 of 7 in cluster W

NY Spills:

Relative: Higher Actual: 299 ft.

Site ID: 172165
Facility Addr2: Not reported
Facility ID: 9413716
Spill Number: 9413716
Facility Type: ER
SWIS: 0126
Investigator: DOMAGALA

Referred To: Not reported Spill Date: 1/14/1995 Reported to Dept: 1/14/1995 Not reported CID: Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Gasoline Station Spill Notifier: Citizen

Cleanup Ceased: 1/14/1995
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MOBIL WOLF RD @ SAND CRK (Continued)

S102115918

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/30/1995

Remediation Phase: 0 Date Entered In Computer: 1/30/1995

Spill Record Last Update: 4/9/2010 Spiller Name: Not reported Spiller Company: **MOBIL** Spiller Address: 88 WOLF RD Spiller City, St, Zip: COLONIE, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 274547

PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948, DEC Memo:

0011968, 0411682, 0506498, 0507841, 0606868, 0903903.

PUMP #6 LEAKING SM AMT GAS. 20:45-MD CALLED MOBIL. PUMP SHUT OFF. Remarks:

CALLED ADIRONDACK TO FIX WEEPING HOSE, NO ACCUMULATION ON GROUND.

Material:

Site ID: 172165 Operable Unit ID: 1011277 Operable Unit: 01 Material ID: 372457 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons

No Recovered: Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 9413716 Investigator: **DOMAGALA** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

MOBIL WOLF RD @ SAND CRK (Continued)

S102115918

EDR ID Number

Spill Date/Time: 01/14/1995 20:25
Reported to Dept Date/Time: 01/14/95 20:29

SWIS: 01
Spiller Name: MOBIL
Spiller Contact: Not reported
Spiller Phone: (518) 869-5354
Spiller Address: 88 WOLF RD
Spiller City,St,Zip: COLONIE
Spill Cause: Equipment Failure

Reported to Dept:

Water Affected:

Spill Source:

Spill Notifier:

PBS Number:

Cleanup Ceased:

Cleanup Meets Std:

On Land

Not reported

O5

Citizen

4-132284

Cleanup Ceased:

O1/14/95

True

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: True

Last Inspection:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 01/30/95

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 01/30/95
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: True Material: GASOLINE **GASOLINE** Class Type: 21329 Times Material Entry In File: Not reported CAS Number: 19940929 Last Date:

DEC Remarks: 8602161, 9212927, 9413716, 9708903, 9800073, 9911948, 0011968.

Remark: PUMP 6 LEAKING SM AMT GAS. 20:45-MD CALLED MOBIL, PUMP SHUT OFF, CALLED

ADIRONDACK TO FIX WEEPING HOSE, NO ACCUMULATION ON GROUND.

Direction Distance

Distance EDR ID Number Elevation Site EDR ID Number Database(s) EPA ID Number

 V132
 MOBIL WOLF RD
 NY Spills
 S102112457

 South
 88 WOLF RD
 NY Hist Spills
 N/A

1/4-1/2 COLONIE, NY

0.342 mi.

1806 ft. Site 3 of 5 in cluster V

Relative: Higher

Actual:

299 ft.

NY Spills:
Site ID: 101163
Facility Addr2: Not reported
Facility ID: 8602161
Spill Number: 8602161
Facility Type: ER

Facility Type: ER
SWIS: 0126
Investigator: LENO
Referred To: Not reported
Spill Date: 7/1/1986
Reported to Dept: 7/1/1986
CID: 21

Spill Cause: Equipment Failure
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Responsible Party

Cleanup Ceased: 7/10/1986
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 7/10/1986 Remediation Phase: 0

Date Entered In Computer: 7/16/1986
Spill Record Last Update: 4/9/2010
Spiller Name: Not reported
Spiller Company: MOBIL OIL
Spiller Address: 88 WOLF RD
Spiller City,St,Zip: ALBANY, NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 89668

DEC Memo: PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948,

0011968, 0411682, 0506498, 0507841, 0606868, 0903903.

Remarks: MODERATE AMOUNT SPILLED & MODERATE AMOUNT RECOVERED

Material:

Site ID: 101163 Operable Unit ID: 898723 Operable Unit: 01 Material ID: 552153 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Direction Distance

Elevation Site Database(s) EPA ID Number

MOBIL WOLF RD (Continued)

S102112457

EDR ID Number

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 101162 Facility Addr2: Not reported Facility ID: 0011968 Spill Number: 0011968 Facility Type: ER SWIS: 0126 Investigator: wtchrist Referred To: Not reported Spill Date: 2/6/2001 Reported to Dept: 2/6/2001 CID: 21

Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Passenger Vehicle
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Last Inspection: Not reported
Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/7/2001
Remediation Phase: 0
Date Entered In Computer: 2/6/2001
Spill Record Last Update: 4/9/2010
Spiller Name: Not reported

Spiller Company: UNK VILLAGE MOBIL MART

Spiller Address: 88 WOLF ROAD Spiller City, St, Zip: COLONIE, ZZ

Spiller Company: 001

Contact Name: RANDY STANTON Contact Phone: (518) 869-5354

DEC Region: 4
DER Facility ID: 89668

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 01/07/2001 - Spoke to Colonie Fire Prevention, who were

on site. Spill contained to black top. Fire Department used Speedie Dri to remediate spill. No sewers or drains impacted. PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948, 0011968,

0411682, 0506498, 0507841, 0606868, 0903903.

Remarks: SPILLER (INFORMATION TO FOLLOW) USED HIS GAS CAP TO PROP OPEN THE

NOZZLE WHILE FUELING HIS VEHICLE. VEHICLE NORMALLY TAKES \$25.00 WORTH OF GAS. PUMP HAD PUMPED \$75.00 WORTH OF GASOLINE BEFORE SPILLER

Direction Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

MOBIL WOLF RD (Continued)

S102112457

NOTICED THAT IT HADN'T SHUT OFF. SPILLED ONTO CONCRETE AND PAVEMENT IN PARKING LOT. NO SEWERS OR STORM DRAINS AFFECTED. COLONIE FIRE COMPANY ON SCENE. ATTEMPTING TO CLEAN UP WITH SPEEDY-DRI AND PADS. CALLER REQUEST DEC RESPONSE.

Material:

101162 Site ID: Operable Unit ID: 833872 Operable Unit: 01 Material ID: 542255 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 35 Units: Gallons Recovered: No Not reported Resource Affected: Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

> Click this hyperlink while viewing on your computer to access REQUEST DEC RESPONSE.

NY Hist Spills:

SWIS:

Region of Spill: 4 Spill Number: 9708903 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 10/30/1997 11:36 Reported to Dept Date/Time: 10/30/97 11:36

01 UNKNOWN [NYS DEC VAN] Spiller Name:

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Contact: CHRIS BROWN Spiller Phone: (518) 869-5354 Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: **Equipment Failure**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MOBIL WOLF RD (Continued)

S102112457

Reported to Dept: On Land Not reported Water Affected:

Spill Source: 07

Spill Notifier: Police Department

PBS Number: 4-132284 Cleanup Ceased: // Cleanup Meets Std: False Last Inspection: 11

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** // Invstgn Complete: // **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/30/97

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 10/30/97 Date Spill Entered In Computer Data File: Not reported

Update Date: 02/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: True Material: GASOLINE Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: WTC Insp FOUND MINOR SPILL CLEANED UP, 2-3gal FROM DEC VAN. 8602161,

9212927, 9413716, 9800073, 9911948, 0011968.

SPILLER WAS FUELING A VAN AND THE GASOLINE POURED OUT OF THE BOTTOM OF THE Remark:

VEHICLE. QUITE A LARGE SPILL ACCORDING TO THE NOTIFIER. COLONIE FIRE COMPANY

RESPONDING. UPDATE TO FOLLOW.

Region of Spill: Spill Number: 8602161 Investigator: **LENO** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

MOBIL WOLF RD (Continued)

S102112457

EDR ID Number

Spill Date/Time: 07/01/1986 08:00 Reported to Dept Date/Time: 07/01/86 09:05

SWIS: 01

Spiller Name: MOBIL OIL Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: 88 WOLF RD Spiller City,St,Zip: ALBANY, NY Spill Cause: **Equipment Failure** Reported to Dept: Groundwater Water Affected: Not reported

Spill Source: 05

Spill Notifier: Responsible Party

PBS Number: 4-132284
Cleanup Ceased: 07/10/86
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 07/10/86

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 07/16/86
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE **GASOLINE** Class Type: Times Material Entry In File: 21329 Not reported CAS Number: 19940929 Last Date:

DEC Remarks: //:REMOVING TANKS CONTAMINATED SOIL PUTTING IN A STOCK PILE UNTIL DEC

TELLS THEM WHAT TO DO. 9212927, 9413716, 9708903, 9800073, 9911948, 0011968.

Remark: MODERATE AMOUNT SPILLED MODERATE AMOUNT RECOVERED

Region of Spill: 4
Spill Number: 9212927

Direction
Distance

Elevation Site Database(s) EPA ID Number

MOBIL WOLF RD (Continued)

S102112457

EDR ID Number

Investigator: KOKOCKI Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Spill Date/Time: 02/17/1993 16:45 Reported to Dept Date/Time: 02/17/93 17:39

SWIS: 01

Spiller Name: TERRANCE HOLDEN @ MOBIL

Spiller Contact:

Spiller Phone:

Spiller Address:

Spiller City, St, Zip:

Spill Cause:

Reported to Dept:

Water Affected:

Not reported

Not reported

Not reported

On Land

Not reported

Spill Source: 05

Spill Notifier: Responsible Party

 PBS Number:
 4-132284

 Cleanup Ceased:
 02/19/93

 Cleanup Meets Std:
 True

 Last Inspection:
 02/19/93

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/09/93 Corrective Action Plan Submitted:

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 03/09/93
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 5 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False **GASOLINE** Material: Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported

Direction
Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

MOBIL WOLF RD (Continued)

S102112457

Last Date: 19940929

DEC Remarks: 8602161, 9413716, 9708903, 9800073, 9911948, 0011968.

Remark: OVERFILLED TANK, NO CLEAN-UP. 2/19-TK @ SITE, CLEANED W/SPEEDIDRY BY MOBIL.

Region of Spill: Spill Number: 0011968 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Spill Date/Time: 02/06/2001 17:13 Reported to Dept Date/Time: 02/06/01 17:23

SWIS: 01

Spiller Name: UNK "VILLAGE MOBIL MART

Spiller Contact: Not reported

Spiller Phone: () -

Spiller Contact:

Spiller Phone:

Spiller Phone:

Spiller Address:

Spiller City, St, Zip:

Spill Cause:

Reported to Dept:

Water Affected:

RANDY STANTON

(518) 869-5354

88 WOLF ROAD

COLONIE"

Human Error

On Land

Not reported

Spill Source: 06
Spill Notifier: Fire Department
PBS Number: 4-132284
Cleanup Ceased: //
Cleanup Meets Std: False
Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 02/07/01

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 02/06/01
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/07/01 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 35

Direction Distance

EDR ID Number Elevation Site **EPA ID Number** Database(s)

MOBIL WOLF RD (Continued)

S102112457

Unkonwn Quantity Spilled: False Gallons Units: Quantity Recovered: O Unkonwn Quantity Recovered: True Material: **GASOLINE** GASOLINE Class Type: Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: 01/07/2001 - Spoke to Colonie Fire Prevention, who were on site. Spill

> contained to black top. Fire Department used Speedie Dri to remediate spill. No sewers or drains impacted. 8602161, 9212927, 9413716, 9708903, 9800073,

9911948

Remark: SPILLER INFORMATION TO FOLLOW) USED HIS GAS CAP TO PROP OPEN THE NOZZLE WHILE

> FUELING HIS VEHICLE. VEHICLE NORMALLY TAKES 25.00 WORTH OF GAS. PUMP HAD PUMPED 75.00 WORTH OF GASOLINE BEFORE SPILLER NOTICED THAT IT HADN T SHUT OFF. SPILLED ONTOCONCRETE AND PAVEMENT IN PARKING LOT. NO SEWERS OR STORM DRAINS

AFFECTED. COLONIE FIRE COMPANY ON SCENE. ATTEMPTING TO CLEAN UP WITH

SPEEDY-DRI AND PADS. CALLER REQUEST DEC RESPONSE.

Click this hyperlink while viewing on your computer to access

Willing Responsible Party. Corrective action taken.

V133 HESS #32413 WOLF RD **NY Spills** S104501777 South 89 WOLF RD **NY Hist Spills** N/A

1/4-1/2 COLONIE, NY

0.342 mi.

Site 4 of 5 in cluster V 1806 ft.

NY Spills: Relative:

Higher Site ID: 253275 Facility Addr2: Not reported Actual: Facility ID: 9602992 299 ft. Spill Number: 9602992 Facility Type: ER

Spill Notifier:

SWIS: 0126 Investigator: **KDGOERTZ** Referred To: Not reported 6/3/1996 Spill Date: 6/3/1996 Reported to Dept: CID: 21 Spill Cause: Unknown Water Affected: Not reported Spill Source: Tank Truck

Cleanup Ceased: Not reported Cleanup Meets Std: True 6/29/1998 Last Inspection:

Recommended Penalty: Penalty Not Recommended

Responsible Party

UST Trust:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/21/1998

Remediation Phase: 0 Date Entered In Computer: 6/3/1996 Spill Record Last Update: 10/22/2004 Spiller Name: **DAWN JOHNSON** Spiller Company: AMERADA HESS

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS #32413 WOLF RD (Continued)

S104501777

EDR ID Number

Spiller Address: ONE HESS PLAZA
Spiller City, St, Zip: WOODBRIDGE, NJ 07095-

Spiller Company: 001
Contact Name: Not reported
Contact Phone: (518) 438-4811

DEC Region: 4
DER Facility ID: 207486

DEC Memo: 6/17/96: ON 6/3/96 INSPECTED SITE AND MET WITH WHEELER PERSONAL.

RETURN LINE FROM SPILL CATCH BASIN FOR OVERFILLS WAS NOT CONNECTED AND APPROX. 100 GALLONS WAS LOST BUT MOST WAS RECOVERED. HESS SUBMITTED A LETTER DATED 7/25/96 STATING THAT THEY HAVE VACUUMED A TOTAL OF 8,800 GALLONS OF PRODUCT/WATER MIXTURE OVER THE COURSE OF

THE TWO DAYS(6/3 & 6/4). HESS GOES ON TO STATE THAT THE LEAK

DETECTION WELLS WERE CHECKED DAILY FOR FREE PRODUCT AND NO FREE PRODUCT WAS OBSERVED SINCE. POST-EX SAMPLES MEETS STARS, AND MW DATA

MEETS GW STANDARDS. SPILL HAS BEEN CLOSED. (KG)

Remarks: on delivery product was found in the tank monitoring wells - still on

scene investigating

Material:

Site ID: 253275 Operable Unit ID: 1034275 Operable Unit: 01 Material ID: 349226 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 87 Units: Gallons No Recovered:

Resource Affected: Not reported
Oxygenate: False
Site ID: 253275
Operable Unit ID: 1034275
Operable Unit: 01
Material ID: 2096812
Material Code: 1213A

Material Name: MTBE (METHYL-TERT-BUTYL ETHER)

Case No.: 01634044

Material FA: Hazardous Material
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

 Site ID:
 253275

 Spill Tank Test:
 1544559

 Tank Number:
 0

 Tank Size:
 0

 Test Method:
 00

 Leak Rate:
 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004

Direction Distance

Elevation Site Database(s) EPA ID Number

HESS #32413 WOLF RD (Continued)

S104501777

EDR ID Number

Test Method: Unknown
Site ID: 253275
Spill Tank Test: 1544560
Tank Number: Not reported

Tank Size: 0
Test Method: 00
Leak Rate: 0

Gross Fail: Not reported Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

NY Hist Spills:

Region of Spill: Spill Number: 9602992 **GOERTZ** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported 06/03/1996 08:00 Spill Date/Time:

SWIS: 01

Reported to Dept Date/Time:

Spiller Name: AMERADA HESS
Spiller Contact: DAWN JOHNSON
Spiller Phone: (908) 750-7068
Spiller Phone: (518) 438-4811
Spiller Address: ONE HESS PLAZA

06/03/96 08:48

Spiller City, St, Zip: WOODBRIDGE, NJ 07095-Spill Cause: Unknown

Spill Cause: Unknown
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 08

Spill Notifier: Responsible Party

PBS Number: 4-163813
Cleanup Ceased: / /
Cleanup Meets Std: True
Last Inspection: 06/29/98

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/21/98 Corrective Action Plan Submitted:

Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 06/03/96
Date Spill Entered In Computer Data File: Not reported

Update Date: 06/28/00 Is Updated: False

Tank:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HESS #32413 WOLF RD (Continued)

S104501777

PBS Number: Not reported

Tank Number: 0 0 Tank Size:

Test Method: Not reported

Leak Rate Failed Tank: 0.00

Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: True Material: **GASOLINE** Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: 6/17/96 0N 6/3/96 INSPECTED SITE AND MET WITH WHEELER PERSONAL. RETURN LINE

FROM SPILL CATCH BASIN FOR OVERFILLS WAS NOT CONNECTED AND APPROX. 100 GALLONS WAS LOST BUT MOST WAS RECOVERED. HESS SUBMITTED A LETTER DATED 7/25/96 STATING THAT THEY HAVE VACUUMED A TOTAL OF 8,800 GALLONS OF PRODUCT/WATER MIXTURE OVER THE COURSE OF THE TWO DAYS 6/3 6/4). HESS GOES ON TO STATE THAT THE LEAK DETECTION WELLS WERE CHECKED DAILY FOR FREE PRODUCT AND NO FREE PRODUCT WAS OBSERVED SINCE. POST-EX SAMPLES MEETS STARS, AND MW DATA MEETS

GW STANDARDS. SPILL HAS BEEN CLOSED. KG) SEE FOLDER.

Remark: on delivery product was found in the tank monitoring wells - still on scene

investigating

110138

V134 **AAMCO TRANSMISSION** SAND CREEK RD / WOLF RD South

1/4-1/2 ALBANY, NY

0.342 mi.

Site 5 of 5 in cluster V 1807 ft.

NY Spills:

Relative:

Site ID: Higher

Actual: 299 ft.

Facility Addr2: Not reported Facility ID: 8702678 Spill Number: 8702678 Facility Type: ER SWIS: 0126 Investigator: **WEBLAIN** Referred To: Not reported Spill Date: 7/1/1987

Reported to Dept: 7/1/1987 CID: Not reported Spill Cause: Other Water Affected: Not reported Spill Source: Gasoline Station

Spill Notifier: Other 7/2/1987 Cleanup Ceased: Cleanup Meets Std: True Last Inspection: 7/2/1987

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

NY Spills

NY Hist Spills

S103560814

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AAMCO TRANSMISSION (Continued)

S103560814

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 7/2/1987 Remediation Phase: O Date Entered In Computer: 7/2/1987 Spill Record Last Update: 2/1/2008 Spiller Name: Not reported

Spiller Company: **AAMCO TRANSMISSION** Spiller Address: SAND CREEK RD & WOLF RD

Spiller City, St, Zip: ALBANY, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: DER Facility ID: 96562

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BLAIN"

DEC NOT NOTIFIED OF TANK REMOVAL. TURNED OUT TANKS WERE Remarks:

ABANDONED/FILLED W/ SAND YEARS AGO.

Material:

110138 Site ID: Operable Unit ID: 909195 Operable Unit: 01 Material ID: 468946 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons No Recovered:

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Not reported Last Modified: Test Method: Not reported

NY Hist Spills:

Region of Spill: 4 Spill Number: 8702678 Investigator: **BLAIN** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

AAMCO TRANSMISSION (Continued)

S103560814

EDR ID Number

Spill Date/Time: 07/01/1987 10:00 Reported to Dept Date/Time: 07/01/87 10:10

SWIS: 01

Spiller Name: AAMCO TRANSMISSION

Spiller Contact: Not reported Spiller Phone: Not reported

Spiller Address: SAND CREEK RD & WOLF RD

Spiller City,St,Zip: ALBANY
Spill Cause: Other
Reported to Dept: Groundwater
Water Affected: Not reported
Spill Source: 05
Spill Notifier: Other

PBS Number: Not reported
Cleanup Ceased: 07/02/87
Cleanup Meets Std: True
Last Inspection: 07/02/87

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 07/02/87

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 07/02/87
Date Spill Entered In Computer Data File: Not reported

Update Date: 01/14/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: GASOLINE **GASOLINE** Class Type: 21329 Times Material Entry In File: CAS Number: Not reported Last Date: 19940929

DEC Remarks: Not reported

Remark: DEC NOT NOTIFIED OF TANK REMOVAL. TURNED OUT TANKS WERE ABANDONED/FILLED W/

SAND YEARS AGO.

Direction Distance

Distance EDR ID Number
Elevation Site EPA ID Number

W135 EXXON MOBIL WOLF RD NY Spills S107408513
South 88 WOLF ROAD N/A

South 88 WOLF ROAD 1/4-1/2 COLONIE ALBANY, NY

0.356 mi.

1879 ft. Site 3 of 7 in cluster W

Relative: Higher NY Spills: Site ID: 351

Actual: 299 ft.

 Site ID:
 351728

 Facility Addr2:
 EXXON MOBIL

 Facility ID:
 0506498

 Spill Number:
 0506498

 Facility Type:
 ER

 SWIS:
 0126

 Investigator:
 ajkokock

Referred To:

Spill Date:

Reported to Dept:

CID:

Spill Cause:

Wot reported

8/26/2005

8/26/2005

444

Spill Cause:

Other

Water Affected:

Spill Source:

Gasoline Station

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/7/2008 Remediation Phase: 0

Date Entered In Computer: 8/26/2005
Spill Record Last Update: 4/12/2010
Spiller Name: JOHN CLEMMER
Spiller Company: EXXON MOBIL
Spiller Address: 88 WOLF ROAD
Spiller City,St,Zip: ALBANY, NY

Spiller Company: 999

Contact Name: JOHN CLEMMER
Contact Phone: (518) 869-5354

DEC Region: 4
DER Facility ID: 298996

DEC Memo: See Edocs; PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073,

9911948, 0011968, 0411682, 0506498 (Edocs), 0507841, 0606868, 0903903. 11/07/2008 Site remediation, Tank closure and facility upgrades completed. Site wells decommissioned. Klienfelder as submitted all reuired documentation. No further action required. File

closed. 4/12/10 - FOIL 10/099, Edoc CD

Remarks: TESTING AROUND MONITORING #1 STILL INVESTIGATING: SOIL SAMPLES WERE

TAKEN:

Material:

Site ID: 351728 Operable Unit ID: 1109230 Operable Unit: 01 Material ID: 2099217 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

EXXON MOBIL WOLF RD (Continued)

S107408513

Quantity: 0 Gallons Units: Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

X136 **DEC AIR LAB HEMLOCK ST HIST LTANKS** S100494434 NNW 10 HEMLOCK ST **NY Spills** N/A

1/4-1/2 0.357 mi.

1887 ft. Site 1 of 3 in cluster X

LATHAM, NY

Relative: Lower

HIST LTANKS:

Actual:

Region of Spill: Spill Number: 9210220

289 ft.

Spill Date: 12/03/1992 Spill Time: 11:00 Spill Cause: Tank Failure Resource Affectd: On Land Water Affected: Not reported

Spill Source: Other Non Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 01/13/93 Cleanup Ceased: 12/03/92 Cleanup Meets Standard: True

Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 12/03/92 Reported to Department Time: 13:53 SWIS: 01

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: NYS DEC AIR EMISSION LAB

Spiller Address: SAME Spiller City, St, Zip: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

DEC AIR LAB HEMLOCK ST (Continued)

S100494434

EDR ID Number

Spiller Cleanup Date: / /
Facility Contact: Not reported
Facility Phone: (518) 453-1800
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: Not reported

Last Inspection: 12/03/92

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 12/04/92
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/06/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: False Gallons Units: Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: DIESEL DIESEL Class Type: Times Material Entry In File: 10625 CAS Number: Not reported Last Date: 19940728

DEC Remarks: Not reported

Spill Cause: FOUND CONT. SOIL @ TANK PULL. MINOR CONT., SAMPLES TAKEN. SOIL DISPOSED OF AT

AMEREC.

NY Spills:

Site ID: 235986 Facility Addr2: Not reported Facility ID: 9210220 Spill Number: 9210220 Facility Type: ER SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported 12/3/1992 Spill Date: Reported to Dept: 12/3/1992 CID: 21

Spill Cause: Equipment Failure Water Affected: Not reported

Spill Source: Institutional, Educational, Gov., Other

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

DEC AIR LAB HEMLOCK ST (Continued)

S100494434

Spill Notifier: Responsible Party Cleanup Ceased: 12/3/1992 Cleanup Meets Std: True Last Inspection: 12/3/1992

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/13/1993 Remediation Phase:

Date Entered In Computer: 12/4/1992 Spill Record Last Update: 3/13/2008 Spiller Name: Not reported

Spiller Company: NYS DEC AIR EMISSION LAB

Spiller Address: SAME Spiller City, St, Zip: ΖZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported DEC Region: 4 194401 DER Facility ID:

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN'

235986

FOUND CONT. SOIL @ TANK PULL. MINOR CONT., SAMPLES TAKEN. SOIL Remarks:

DISPOSED OF AT AMEREC.

Material: Site ID:

> Operable Unit ID: 976690 Operable Unit: 01 407223 Material ID: Material Code: 8000 Material Name: Diesel Case No.: Not reported Petroleum Material FA: Quantity: Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

Y137 PRIVATE RESIDENCE NIMO NY Spills S106469320 SSW 17 COMPUTER DRIVE EAST N/A

1/4-1/2 COLONIE, NY

0.360 mi.

1899 ft. Site 1 of 4 in cluster Y

Relative: Higher NY Spills:
Site ID: 264587
Facility Addr2: Not reported

Actual: 306 ft.

Facility ID: 0401959 Spill Number: 0401959 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 5/22/2004 Reported to Dept: 5/22/2004

CID: 21

Spill Cause: Equipment Failure Water Affected: Not reported

Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/21/2004
Remediation Phase: 0
Date Entered In Computer: 5/22/2004

Spill Record Last Update: 6/21/2004

Spiller Name: "NIAGRA MOWHAWK" [SP]
Spiller Company: NIMO "PRIVATE RESIDENCE
Spiller Address: 300 ERIE ? 17 COMPUTER DR
Spiller City,St,Zip: SYRACUSE ??? COLONIE", NY

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 215634

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" [COMPUTER SEARCH CONFIRMS COMPUTER Dr E CONTAINS COMPANIES, NOT RESIDENCES, SPILL IS FROM TRANSFORMER SO SOURCE IS COMMERCIAL NOT "PRIVATE RESIDENCE" & NOTIFIER IS RP NOT "LOCAL AGENCY"] 06-21-2004 - Results received from NiMo is <1ppm. CLosed wtc

Caller reports top of a transformer ruptured. Transformer was on a

pole. Nimo employees will be doing the cleanup. Unknown if it is PCB

oil.

Material:

Remarks:

 Site ID:
 264587

 Operable Unit ID:
 883801

 Operable Unit:
 01

 Material ID:
 493144

 Material Code:
 0020A

Material Name: TRANSFORMER OIL

Case No.: Not reported Material FA: Petroleum

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

PRIVATE RESIDENCE NIMO (Continued)

S106469320

Quantity: 2 Gallons Units: Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Spills

HATHAWAY RES MARGARET RD 138 **ESE** 21 MARGARET RD

S104787486 **NY Hist Spills** N/A

1/4-1/2 LOUDONVILLE, NY

0.363 mi. 1916 ft.

Relative: Higher

Actual: 319 ft.

NY Spills:

Site ID: 260950 Facility Addr2: Not reported Facility ID: 0004779 Spill Number: 0004779 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST

Referred To: Not reported Spill Date: 7/16/2000 Reported to Dept: 7/21/2000 CID: 21 Spill Cause: Deliberate Water Affected: Not reported

Spill Source: Private Dwelling Spill Notifier: Citizen Cleanup Ceased: Not reported

Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 7/28/2000 Remediation Phase:

Date Entered In Computer: 7/21/2000 Spill Record Last Update: 3/5/2008

HATHAWAY RES. Spiller Name: Spiller Company: HATHAWAY RES Spiller Address: 21 MARGARET RD Spiller City, St, Zip: LOUDONVILLE, ZZ

Spiller Company: 001

Direction Distance

Elevation Site Database(s) EPA ID Number

HATHAWAY RES MARGARET RD (Continued)

S104787486

EDR ID Number

Contact Name: HATHAWAY RES. Contact Phone: (518) 489-1590

DEC Region: 4
DER Facility ID: 213116

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 13:45-PNB CALLED CALLER, SHE HAD CALLED Col. PD, THEY

FOUND NO ODOR, THEY TOLD HER TO CALL FD IF ODOR RECURS.

Remarks: caller states that neighbor is trying to kill chipmunks by pouring gasoline into thier holes. caller states that the odor of gas is very

strong in the area. caller would like to stay anonymous.

Material:

Site ID: 260950 Operable Unit ID: 825844 Operable Unit: 01 Material ID: 549512 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: Gallons Units: Recovered: No

Resource Affected: Not reported

Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: Spill Number: 0004779 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Spill Date/Time: 07/16/2000 12:00 Reported to Dept Date/Time: 07/21/00 09:46

SWIS: 01

Spiller Name: HATHAWAY RES
Spiller Contact: HATHAWAY RES.
Spiller Phone: (518) 489-1590
Spiller Contact: HATHAWAY RES.
Spiller Phone: (518) 489-1590

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

HATHAWAY RES MARGARET RD (Continued)

S104787486

Spiller Address: 21 MARGARET RD LOUDONVILLE Spiller City, St, Zip: Spill Cause: Deliberate Reported to Dept: On Land Water Affected: Not reported Spill Source: 09 Spill Notifier: Citizen PBS Number: Not reported

Cleanup Ceased: // Cleanup Meets Std: True Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** / / Invstgn Complete: **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 07/28/00

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 07/21/00 Date Spill Entered In Computer Data File: Not reported

Update Date: 10/16/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: O Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: True Material: **GASOLINE** GASOLINE Class Type: Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

13:45-PNB CALLED CALLER, SHE HAD CALLED Col. PD, THEY FOUND NO ODOR, THEY TOLD DEC Remarks:

HER TO CALL FD IF ODOR RECURS.

Remark: caller states that neighbor is trying to kill chipmunks by pouring gasoline

into thier holes. caller states that the odor of gas is very strong in the

area. caller would like to stay anonymous.

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

W139 FIRESTONE WOLF RD **LTANKS** S104513602 South 83 WOLF RD **HIST LTANKS** N/A

COLONIE, NY 1/4-1/2

0.372 mi.

Site 4 of 7 in cluster W 1963 ft.

LTANKS: Relative:

311955 Higher Site ID: Spill No: 9307553 Actual: Spill Date: 9/7/1993

299 ft. Spill Cause: Tank Overfill

Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/12/1994 Facility Addr2: Not reported Cleanup Ceased: 8/31/1994 Cleanup Meets Standard: True SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Reported to Dept: 9/22/1993

CID: 21

Water Affected: Not reported Spill Notifier: Other Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: False Remediation Phase: Date Entered In Computer: 10/14/1993 Spill Record Last Update: 1/25/2000 Spiller Name: Not reported Spiller Company: FIRESTONE Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: 4 DER Facility ID: 251643

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN/TS"

550 GAL WO TANK REMOVED, SOIL SAMPLES TAKEN, MINOR CONT. IDD, SEE Remarks:

FOLDER, NO FURTHER ACTION REQUIRED.

Material:

311955 Site ID: Operable Unit ID: 988629 Operable Unit: 01 393809 Material ID: Material Code: 0022

Waste Oil/Used Oil Material Name: Case No.: Not reported Petroleum Material FA: Quantity: Units: Gallons Recovered: No

Not reported Resource Affected:

MAP FINDINGS Map ID Direction

Distance Elevation

EDR ID Number Site Database(s) **EPA ID Number**

FIRESTONE WOLF RD (Continued)

S104513602

Tank Test: Site ID:

Oxygenate:

Not reported Spill Tank Test: Not reported Not reported Tank Number:

False

Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

HIST LTANKS:

Region of Spill:

Spill Number: 9307553 Spill Date: 09/07/1993 Spill Time: 09:00

Spill Cause: Tank Overfill Resource Affectd: On Land Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 10/12/94 08/31/94 Cleanup Ceased: Cleanup Meets Standard: True

Investigator: CHRISTENSEN/TS Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 09/22/93 Reported to Department Time: 10:06 SWIS:

Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: FIRESTONE Spiller Address: Not reported Spiller City, St, Zip: Not reported Spiller Cleanup Date: Facility Contact: Not reported Facility Phone: (216) 379-3737 Facility Extention: Not reported Spill Notifier: Other

PBS Number: Not reported Last Inspection:

Recommended Penalty: Penalty Not Recommended

Not reported

Enforcement Date:

Spiller Contact:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FIRESTONE WOLF RD (Continued)

S104513602

Investigation Complete: UST Involvement: False

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: Date Spill Entered In Computer Data File: 10/14/93 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 01/25/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False WASTE OIL Material: WASTE OIL Class Type: Times Material Entry In File: 9509 CAS Number: Not reported

DEC Remarks: Not reported

550 GAL WO TANK REMOVED, SOIL SAMPLES TAKEN, MINOR CONT. IDD, SEE FOLDER, NO Spill Cause:

FURTHER ACTION REQUIRED.

265070

19940927

Z140 **BIG A AUTO PARTS HEMLOCK** NY Spills S102158536 NNE 20 HEMLOCK ST **NY Hist Spills**

1/4-1/2 0.372 mi.

Site 1 of 3 in cluster Z 1964 ft.

LATHAM, NY

Relative:

NY Spills:

Site ID: Lower Facility Addr2:

Last Date:

Actual: 290 ft.

Not reported Facility ID: 9409445 Spill Number: 9409445 Facility Type: ER SWIS: 0126 **PNBENTIE** Investigator:

Referred To: LAW ENFOREMENT

Spill Date: 8/15/1994 Reported to Dept: 10/14/1994 CID: 21 Spill Cause: Deliberate Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Citizen 10/14/1994 Cleanup Ceased: Cleanup Meets Std: True

Last Inspection: Not reported N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BIG A AUTO PARTS HEMLOCK (Continued)

S102158536

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 10/21/1994

Remediation Phase: 0

Date Entered In Computer: 10/21/1994 Spill Record Last Update: 3/13/2008 Spiller Name: Not reported Spiller Company: **BIG A AUTO PARTS**

Spiller Address: 20 HEMLOCK ST Spiller City, St, Zip: LATHAM, ZZ

Spiller Company: 001

Contact Name: Not reported Contact Phone: (518) 786-1177

DEC Region:

DER Facility ID: 215983

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BENTIEN/ECOs" 09/28/95: This is additional information about

material spilled from the translation of the old spill file:

ANTIFREEZE, CHEMICALS.

Remarks: THROW ANTIFREEZE, OIL, CHEMICALS IN DUMPSTER, OOZES OUT TO STORM DRAIN

, REFD TO ECOS.

Material:

Site ID: 265070 Operable Unit ID: 1003409 Operable Unit: 01 378872 Material ID: Material Code: 0022

Material Name: Waste Oil/Used Oil Case No.: Not reported Material FA: Petroleum Quantity: Units: Pounds

Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

Spill Number: 9409445 BENTIEN/ECOs Investigator:

Direction Distance

Elevation Site Database(s) EPA ID Number

BIG A AUTO PARTS HEMLOCK (Continued)

S102158536

EDR ID Number

Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Not reported Notifier Phone: 08/15/1994 12:00 Spill Date/Time: Reported to Dept Date/Time: 10/14/94 16:00

SWIS: 0°

Spiller Name: BIG A AUTO PARTS

Spiller Contact: Not reported
Spiller Phone: (518) 786-1177

Spiller Address: SAME
Spiller City,St,Zip: Not reported
Spill Cause: Deliberate
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 01
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 10/14/94
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 10/21/94
Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 10/21/94
Date Spill Entered In Computer Data File: Not reported

Update Date: //
Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Not reported

Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: WASTE OIL
Class Type: WASTE OIL
Times Material Entry In File: 9509
CAS Number: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

BIG A AUTO PARTS HEMLOCK (Continued)

S102158536

N/A

Last Date: 19940927

DEC Remarks: 09/28/95: This is additional information about material spilled from the

translation of the old spill file: ANTIFREEZE, CHEMICALS.

THROW ANTIFREEZE, OIL, CHEMICALS IN DUMPSTER, OOZES OUT TO STORM DRAIN, REFD Remark:

TO ECOS.

W141 **EXXON MOBIL #11329 WOLF RD NY Spills** S107409932

South 88 WOLF ROAD

1/4-1/2 **ALBANY COLONIE, NY 12205**

0.372 mi.

1966 ft. Site 5 of 7 in cluster W

Relative: Higher

Actual:

299 ft.

NY Spills:

Site ID: 353329 Not reported Facility Addr2: 0507841 Facility ID: Spill Number: 0507841

Facility Type: ER SWIS: 0126 Investigator: ajkokock Referred To: Not reported Spill Date: 9/29/2005 9/29/2005 Reported to Dept: CID: 409 Spill Cause: Unknown Water Affected: Not reported Spill Source: Gasoline Station

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Penalty Not Recommended Recommended Penalty:

UST Trust: False

Spill Closed Dt:

Spill Class: Known release that creates potential for fire or hazard. (Highly

Improbable) 8/21/2008

Remediation Phase: Date Entered In Computer: 9/29/2005 Spill Record Last Update: 4/9/2010 Spiller Name: UNKNOWN

Spiller Company: UNKNOWN= [EXXON MOBIL #11329]

Spiller Address: **UNKNOWN** Spiller City, St, Zip: UNKNOWN, ZZ

Spiller Company: 999

ADAM ETRINGER Contact Name: Contact Phone: (845) 561-9890

DEC Region: 4 DER Facility ID: 300650

DEC Memo: PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948,

0011968, 0411682, 0506498, 0507841, 0606868, 0903903. 08/21/2008 File

closed see spill # 0506498.

ARSINIC, LEAD, MERCURY AND CRONIUM. WAS FOUND IN WATER SAMPLE. Remarks:

TESTING IS PENDING ON DEC AND CLEINT.

Material:

Site ID: 353329 Operable Unit ID: 1110792 Operable Unit: 01

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

EXXON MOBIL #11329 WOLF RD (Continued)

S107409932

Material ID: 2100833 0031A Material Code: Material Name: **MERCURY** Case No.: 07439976 Material FA: Hazardous Material

Quantity: Not reported Units: Gallons Recovered: No Resource Affected: Not reported

Oxygenate: False Site ID: 353329 Operable Unit ID: 1110792 Operable Unit: 01 Material ID: 2100832 Material Code: 0030A Material Name: **LEAD** 07439921 Case No.:

Hazardous Material Material FA: Quantity: Not reported Units: Gallons Recovered: No

Resource Affected: Not reported False Oxygenate:

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

W142 MOBIL OIL CORP SS K9M

88 WOLF RD South 1/4-1/2 **ALBANY, NY 12205**

0.372 mi.

1966 ft. Site 6 of 7 in cluster W

RCRA-NonGen: Relative:

Date form received by agency: 01/01/2007 Higher

Facility name: MOBIL OIL CORP SS K9M Actual: Facility address: 88 WOLF RD

299 ft. ALBANY, NY 122052604 NYD986955490 EPA ID:

Mailing address: GALLOWS RD MKTG ENVIRON

FAIRFAX, NY 22037

Contact: Not reported

GALLOWS RD MKTG ENVIRON Contact address:

FAIRFAX, NY 22037

Contact country: US

Contact telephone: Not reported Contact email: Not reported 1000553137

NYD986955490

RCRA-NonGen

NY Hist Spills

FINDS

NY Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

MOBIL OIL CORP SS K9M (Continued)

1000553137

EDR ID Number

EPA Region: 02

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: MOBIL OIL CORP
Owner/operator address: 3225 GALLOWS RD
FAIRFAX, VA 22037

Owner/operator country: US

Owner/operator telephone: (703) 849-3330

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: MOBIL OIL CORP
Owner/operator address: 3225 GALLOWS RD

FAIRFAX, VA 22037

Owner/operator country: US

Owner/operator telephone: (703) 849-3330
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler accessibilty indicator: Transferred to the program or state equivalent.

Handler Activities Summary:

U.S. importer of hazardous waste: Unknown Mixed waste (haz. and radioactive): Unknown Recycler of hazardous waste: Nο Transporter of hazardous waste: Unknown Treater, storer or disposer of HW: No Underground injection activity: No On-site burner exemption: Unknown Furnace exemption: Unknown Used oil fuel burner: No Used oil processor: No User oil refiner: No Used oil fuel marketer to burner: No Used oil Specification marketer: No Used oil transfer facility: No Used oil transporter: No

Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 01/01/2006

Facility name: MOBIL OIL CORP SS K9M Classification: Not a generator, verified

Date form received by agency: 07/08/1999

Facility name: MOBIL OIL CORP SS K9M Classification: Not a generator, verified

Date form received by agency: 04/10/1991

Facility name: MOBIL OIL CORP SS K9M Classification: Small Quantity Generator

Distance

Elevation Site Database(s) EPA ID Number

MOBIL OIL CORP SS K9M (Continued)

1000553137

EDR ID Number

Violation Status: No violations found

FINDS:

Registry ID: 110004468317

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and

corrective action activities required under RCRA.

NY Spills:

Site ID: 416040

Facility Addr2: VILLAGE MOBIL 88 WOLF RD

Facility ID: 0903903 0903903 Spill Number: Facility Type: ER SWIS: 0126 Investigator: pnbentie Referred To: Not reported 7/2/2009 Spill Date: Reported to Dept: 7/3/2009 CID: 21

Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 7/3/2009
Remediation Phase: 0
Date Entered In Computer: 7/3/2009
Spill Record Last Update: 4/9/2010
Spiller Name: Not reported

Spiller Company: JEANNE CASPER @ MOBIL

Spiller Address: Not reported Spiller City,St,Zip: NY

Spiller Company: 999

Contact Name: TODD CLEMMER
Contact Phone: (518) 869-5354

DEC Region: 4

DER Facility ID: 365346

DEC Memo: 7/3 - PNB rec'd call from Ms. Casper around 16:00 7/3. She was

incensed that the Mobil station mgr. had not responded with more concern to the spill (which she estimated at less than one gallon as it amounted to about \$2). However, since she waited nearly 24 hours to report the incident and there has been heavy rain since then, there doesn't seem to be much concern from a Spills point of view at

Map ID Direction Distance Elevation

Site Database(s) EPA ID Number

MOBIL OIL CORP SS K9M (Continued)

1000553137

EDR ID Number

this time. Probably more a PBS issue. PNB advised Ms. Casper to call the Hotline to make the report (the DEC phone # she received from the police officer at the scene yesterday was incorrect). I also suggested she have her vehicle checked in case the fault was in the connection to her gas tank & not the Mobil equipment. Ref'd to WTC & PBS (Sperbeck). PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948, 0011968, 0411682, 0506498, 0507841, 0606868,

0903903.

Remarks: Gasoline overfilled from the tank. Gas station did not clean up the

gasoline. Went onto the concrete

Material:

Site ID: 416040 Operable Unit ID: 1172357 Operable Unit: 01 Material ID: 2164221 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum

Quantity: 1

Units: Gallons
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Site ID: 101166 Facility Addr2: Not reported Facility ID: 9911948 Spill Number: 9911948 Facility Type: ER SWIS: 0126 Investigator: pnbentie Referred To: Not reported Spill Date: 1/14/2000 1/14/2000 Reported to Dept: CID: 21

Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Gasoline Station
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported

Cleanup Meets Std: True

Last Inspection: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MOBIL OIL CORP SS K9M (Continued)

1000553137

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/14/2000

Remediation Phase:

Date Entered In Computer: 1/14/2000 Spill Record Last Update: 4/9/2010 Spiller Name: TOM

Spiller Company: MOBIL STATION #17-K9M

Spiller Address: 88 WOLF ROAD COLONIE, NY Spiller City, St, Zip:

Spiller Company: 001 Contact Name: TOM

Contact Phone: (518) 869-5354

DEC Region: DER Facility ID: 89668

Prior to Sept, 2004 data translation this spill Lead DEC Field was DEC Memo:

> "BENTIEN" PBS 4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948, 0011968, 0411682, 0506498, 0507841, 0606868, 0903903. NO DEC

RESPONSE.

Remarks: customer drove off with nozzle in tank - fd on scene - repair crew on

way and pump now out of service

Material:

101166 Site ID: 1090648 Operable Unit ID: Operable Unit: 01 Material ID: 297380 Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 15 Gallons Units: Recovered: 15

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Click this hyperlink while viewing on your computer to access

way and pump now out of service

NY Hist Spills:

Region of Spill: 4

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MOBIL OIL CORP SS K9M (Continued)

1000553137

Spill Number: 9911948 BENTIEN Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 01/14/2000 23:20 Reported to Dept Date/Time: 01/14/00 23:53

SWIS: 01

Spiller Name: MOBIL STATION #17-K9M

Spiller Contact: TOM

Spiller Phone: (518) 869-5354

Spiller Contact: TOM

Spiller Phone: (518) 869-5354 Spiller Address: 88 WOLF ROAD Spiller City,St,Zip: COLONIE, NY Spill Cause: Human Error Reported to Dept: On Land Water Affected: Not reported

Spill Source: 05

Spill Notifier: Affected Persons PBS Number: 4-132284 Cleanup Ceased: // Cleanup Meets Std: True Last Inspection: 11

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** / / Invstgn Complete: / / **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

01/14/00 Spill Closed Dt: Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 01/14/00 Date Spill Entered In Computer Data File: Not reported

Update Date: 02/07/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 15 False Unkonwn Quantity Spilled: Units: Gallons Quantity Recovered: 15 Unkonwn Quantity Recovered: False Material: **GASOLINE**

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MOBIL OIL CORP SS K9M (Continued)

1000553137

Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: 8602161, 9212927, 9413716, 9708903, 9800073, 0011968. NO DEC RESPONSE.

Remark: customer drove off with no le in tank - fd on scene - repair crew on way and

pump now out of service

NY Spills W143 **MOBIL MART WOLF RD** S106737168 N/A

88 WOLF RD South

1/4-1/2 **ALBANY COLONIE, NY 12205**

0.372 mi.

1966 ft. Site 7 of 7 in cluster W

Relative: Higher

299 ft.

NY Spills:

Site ID: 336977 Facility Addr2: Not reported Actual: Facility ID: 0411682 Spill Number: 0411682 Facility Type: ER

SWIS: 0126 Investigator: wtchrist Referred To: Not reported Spill Date: 2/1/2005 Reported to Dept: 2/1/2005 CID: 444 Spill Cause:

Human Error Water Affected: Not reported Spill Source: **Gasoline Station** Spill Notifier: Police Department Cleanup Ceased: Not reported Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

2/3/2005 Spill Closed Dt: Remediation Phase: 0 Date Entered In Computer: 2/2/2005 Spill Record Last Update: 4/9/2010 Spiller Name: Not reported

Spiller Company: CUSTOMER @ MOBILE MART [SP]

Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller Company: 999

BENNY KIRKER Contact Name: Contact Phone: (518) 869-5354

DEC Region: 4 **DER Facility ID:** 342657

DEC Memo: 02/03/2005 - No DEC response. FD put down sdeedie-dry. wtc PBS

4-132284; 8602161, 9212927, 9413716, 9708903, 9800073, 9911948,

0011968, 0411682, 0506498, 0507841, 0606868, 0903903.

Remarks: THE NOZZEL [sp] WAS LFET IN CAR AND CAR PULLED AWAY: NO INFO ON CAR:

FIRE DEPT. ON SCENE

Material:

336977 Site ID:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MOBIL MART WOLF RD (Continued)

S106737168

S103482303

N/A

NY Spills

NY Hist Spills

Operable Unit ID: 1098970 Operable Unit: 01 Material ID: 579276 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Petroleum Material FA: Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported False

Oxygenate:

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Z144 ST JOHNSBURY NORTHWAY LN 9 NORTHWAY LN N. NNE

1/4-1/2 **COLONIE, NY** 0.374 mi.

Site 2 of 3 in cluster Z 1974 ft.

Relative:

Actual:

290 ft.

NY Spills:

Lower

Site ID: 181844 Facility Addr2: Not reported Facility ID: 9604075 Spill Number: 9604075

Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 6/25/1996 Reported to Dept: 6/25/1996 CID: 266

Spill Cause: Housekeeping Water Affected: Not reported Spill Source: Commercial/Industrial

Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/5/2001 Remediation Phase: 0

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ST JOHNSBURY NORTHWAY LN (Continued)

S103482303

Date Entered In Computer: 6/25/1996 Spill Record Last Update: 4/20/2001 Spiller Name: Not reported

Spiller Company: S J T REAL ESTATE HOLDING

Spiller Address: Not reported Spiller City, St, Zip: ZZ -Spiller Company: 001 Contact Name: Not reported

Contact Phone: Not reported DEC Region: DER Facility ID: 152473

Prior to Sept, 2004 data translation this spill Lead_DEC Field was DEC Memo:

"CHRISTENSEN" SEE 8604254, 9200206; 8801295?. 08/04/97 -

INVESTIGATION AND REMEDIATION PLAN RECEIVED AND OK'd. WORK WILL START THIS MONTH. M/W TO BE SAMPLED, UPDATE CONTOR MAP, SAMPLE SOIL PILE. 7-9 NORTHWAY Ln HAS 3 PBS REGs: 4-020214 (St JOHNSBURY), 4-020206 (St

JOHNSBURY), 4-133795 (SULZER TURBO).

SITE INVESTIGATION FOR A PROSPECTIVE BUYER. SOIL SAMPLES INDICATE Remarks:

CONTAMINATION. SOME READINGS AS HIGH AS 200 PPM. GROUNDWATER SAMPLES

PENDING.

Material:

Site ID: 181844 Operable Unit ID: 1031734 Operable Unit: 01 Material ID: 350355 Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum 0 Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 181844 Spill Tank Test: 1544599 Tank Number: 0 Tank Size: 0 Test Method: 00 Leak Rate:

Not reported Gross Fail: Modified By: Spills Last Modified: 10/1/2004 Test Method: Unknown

NY Hist Spills:

Region of Spill: 4

Spill Number: 9604075 Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

ST JOHNSBURY NORTHWAY LN (Continued)

S103482303

EDR ID Number

Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 06/25/1996 11:00
Reported to Dept Date/Time: 06/25/96 13:07

SWIS: 01

Spiller Name: S J T REAL ESTATE HOLDING

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: Not reported

Spiller City,St,Zip:

Spill Cause: Housekeeping
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 01
Spill Notifier: Other
PBS Number: 4-020214
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 01/05/01

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 06/25/96
Date Spill Entered In Computer Data File: Not reported

Update Date: 04/20/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: 0
Tank Size: 0
Test Method: Not reported

Leak Rate Failed Tank: 0.00

Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported Last Date: 19940728

DEC Remarks: SEE 8604254, 9200206; 8801295?. 08/04/97 - INVESTIGATION AND REMEDIATION

PLAN RECEIVED AND OK d. WORK WILL START THIS MONTH. M/W TO BE SAMPLED, UPDATE

CONTOR MAP, SAMPLE SOIL PILE. 7-9 NORTHWAY Ln HAS 3 PBS REGs: 4-020214 St

JOHNSBURY), 4-020206 St JOHNSBURY), 4-133795 SULZER TURBO).

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

ST JOHNSBURY NORTHWAY LN (Continued)

S103482303

Remark: SITE INVESTIGATION FOR A PROSPECTIVE BUYER. SOIL SAMPLES INDICATE

CONTAMINATION. SOME READINGS AS HIGH AS 200 PPM. GROUNDWATER SAMPLES PENDING.

Z145 LYONS TRKG NORTHWAY LN N HIST LTANKS S103478424
NNE 9 NORTHWAY LN N. NY Spills N/A

1/4-1/2 LATHAM COLONIE, NY

0.375 mi.

1981 ft. Site 3 of 3 in cluster Z

Relative: HIST LTANKS:
Lower Region of Spill:

Spill Number: 8604254

Actual: Spill Date: 10/01/1986

290 ft. Spill Time: 10:00

Spill Cause: Tank Failure

Spill Cause: Tank Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Other Composite

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/31/87 Cleanup Ceased: 03/31/87 Cleanup Meets Standard: True Investigator: **BLAIN** Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Caller Extension: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 10/01/86 Reported to Department Time: 10:30 SWIS: 01

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: LYON'S TRUCKING
Spiller Address: Not reported
Spiller City,St,Zip: Not reported

Spiller Cleanup Date: / /

Facility Contact:

Facility Phone:

Facility Phone:

Facility Extention:

Spill Notifier:

PBS Number:

Not reported

Not reported

Fire Department

4-020214

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/06/86
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 03/21/00 Is Updated: False

Direction Distance

Elevation Site Database(s) EPA ID Number

LYONS TRKG NORTHWAY LN N (Continued)

S103478424

EDR ID Number

Tank:

PBS Number: Not reported

Tank Number: 0
Tank Size: 0

Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 10 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: //: OWNER CONTRACTED FOR CLEANUP. SEE 9200206, 9604075; 8801295?. 7-9

NORTHWAY Ln HAS 3 PBS REGs: 4-020214 St JOHNSBURY), 4-020206 St JOHNSBURY),

4-133795 SULZER TURBO).

Spill Cause: DISCOVERED DURING TANK REMOVAL

181843

NY Spills: Site ID:

> Facility Addr2: Not reported Facility ID: 8604254 Spill Number: 8604254 Facility Type: ER SWIS: 0126 Investigator: weblain Referred To: Not reported Spill Date: 10/1/1986 10/1/1986 Reported to Dept: CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Fire Department

Cleanup Ceased: 3/31/1987
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: True

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 3/31/1987
Remediation Phase: 0
Date Entered In Computer: 10/6/1986
Spill Record Last Update: 1/31/2008
Spiller Name: Not reported
Spiller Company: LYON'S TRUCKING

Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

LYONS TRKG NORTHWAY LN N (Continued)

S103478424

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4 DER Facility ID: 278853

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BLAIN" //: OWNER CONTRACTED FOR CLEANUP. SEE 9200206, 9604075; 8801295?. 7-9 NORTHWAY Ln HAS 3 PBS REGs: 4-020214 (St JOHNSBURY),

4-020206 (St JOHNSBURY), 4-133795 (SULZER TURBO).

DISCOVERED DURING TANK REMOVAL Remarks:

Material:

Site ID: 181843 Operable Unit ID: 901492 Operable Unit: 01 477071 Material ID: Material Code: 0009 Gasoline Material Name: Case No.: Not reported Material FA: Petroleum Quantity: 10 Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 181843 Spill Tank Test: 1530257 Tank Number: 0 Tank Size: 0 Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills 10/1/2004 Last Modified: Test Method: Unknown

Y146 **NIMO TRANSFORMER POLE #4** South 25 COMPUTER DR E POLE #4

1/4-1/2 COLONIE, NY

0.381 mi.

Site 2 of 4 in cluster Y 2013 ft.

Relative: Higher

NY Spills:

Site ID: 274811 Facility Addr2: Not reported

Actual: 0209108 Facility ID: 306 ft. Spill Number: 0209108 Facility Type: ER SWIS: 0126

WTCHRIST Investigator: Referred To: Not reported 12/4/2002 Spill Date: Reported to Dept: 12/4/2002 CID: 397

Spill Cause: **Equipment Failure** Water Affected: Not reported

NY Spills

S106009788

N/A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO TRANSFORMER POLE #4 (Continued)

S106009788

Spill Source: Commercial/Industrial Spill Notifier: Responsible Party Cleanup Ceased: Not reported

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 12/17/2002

Remediation Phase:

Date Entered In Computer: 12/4/2002 Spill Record Last Update: 12/17/2002 Spiller Name: Not reported Spiller Company: NIMO IFO POLE #4 Spiller Address: 25 COMPUTER DR EAST

Spiller City, St, Zip: COLONIE, ZZ

Spiller Company: 001 CALLER Contact Name: Not reported Contact Phone:

DEC Region: 4

DER Facility ID: 223527

DEC Memo: Prior to Sept. 2004 data translation this spill Lead DEC Field was

"CHRISTENSEN" 12/11/2002 - Received from NiMO analytical results on

the PCB oil in transformer. PCB = 16.6ppm. Soil confirmation will follow. wtc 12/17/2002 - Soil Confirmation received. Analytical

results show <1ppm for PCB's. Closed wtc

Remarks: poss leak in tank in transformer poss crim mis

Material:

274811 Site ID: Operable Unit ID: 860513 Operable Unit: 01 Material ID: 516090 Material Code: 0020A

Material Name: TRANSFORMER OIL

Case No.: Not reported Material FA: Petroleum Quantity: 5 Units: Gallons Recovered: No Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Distance Elevation Site EDR ID Number Database(s) EPA ID Number

Y147 CYTOLOGY SCREENING INC NY Spills S106002175
South 26 COMPUTER DR EAST N/A

1/4-1/2 ALBANY, NY

0.383 mi.

2023 ft. Site 3 of 4 in cluster Y

Relative: Higher NY Spills:
Site ID: 250432
Facility Addr2: Not reported

Actual: 306 ft.

Facility ID: 0112196 Spill Number: 0112196 Facility Type: ER SWIS: 0101 WTCHRIST Investigator: Referred To: Not reported Spill Date: 3/26/2002 Reported to Dept: 3/27/2002

CID: 21
Spill Cause: Human Error
Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. (Highly

Spill Closed Dt: 5/31/2002
Remediation Phase: 0

Remediation Phase: 0

Date Entered In Computer: 3/2

Date Entered In Computer: 3/27/2002 Spill Record Last Update: 5/31/2002 Spiller Name: JEAN COLLINS

Spiller Company: CYTOLOGY SCREENING INC Spiller Address: 26 COMPUTER DR EAST

Spiller City,St,Zip: ALBANY, ZZ

Spiller Company: 001

Contact Name: JEAN COLLINS
Contact Phone: (518) 458-9694

DEC Region: 4
DER Facility ID: 205265

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 05/31/2002 - No DEC response. Clean Harbors did clean

up. wtc

Remarks: CLEANERS ACCIDENTALLY HIT VALVE WHICH CAUSED MATERIAL TO LEAK ONTO

FLOOR OVERNIGHT-HAZMAT TEAM WAS CALLED OUT ALONG WITH CLEAN HARBOR FOR

CLEAN UP.

Material:

 Site ID:
 250432

 Operable Unit ID:
 850993

 Operable Unit:
 01

 Material ID:
 526207

 Material Code:
 0080A

Material Name: FORMALDEHYDE

Case No.: 00050000

Material FA: Hazardous Material

Quantity: 5
Units: Gallons

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

CYTOLOGY SCREENING INC (Continued)

S106002175

Recovered: 5

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

148 HESS WOLF RD HIST LTANKS S104275800 SSW WOLF RD @ SAND CREEK N/A

1/4-1/2 ALBANY, NY

0.390 mi. 2057 ft.

Relative: HIST LTANKS:

Higher Region of Spill: 4
Spill Number: 8706298

 Actual:
 Spill Date:
 10/21/1987

 299 ft.
 Spill Time:
 13:45

 Spill Course
 Took Failure

Spill Cause: Tank Failure
Resource Affectd: Groundwater
Water Affected: Not reported
Spill Source: Gas Station

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/13/87 Cleanup Ceased: 11/13/87 Cleanup Meets Standard: True Investigator: **BLAIN** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Not reported Caller Extension: Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 10/21/87 Reported to Department Time: 13:48 SWIS: 01

Spiller Contact:

Spiller Phone:

Spiller Extention:

Spiller Name:

Spiller Address:

Spiller City, St, Zip:

Not reported

Not reported

Not reported

Not reported

Not reported

Spiller Cleanup Date: / /

Facility Contact: Not reported

Direction Distance

Distance Elevation Site EDR ID Number

Database(s) EPA ID Number

HESS WOLF RD (Continued)

S104275800

Facility Phone: (438) 481Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: Not reported

Last Inspection: /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 10/26/87
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 11/22/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: GASOLINE Times Material Entry In File: 21329 CAS Number: Not reported 19940929 Last Date:

DEC Remarks: //: TANKS REMOVED. SOIL HAULED TO DUANESBURG LANDFILL. //: EXCAVATED,

REMOVED. CLOSED.

Spill Cause: WHILE REMOVING UGT S, DISCOVERED GAS ON WATER.

Y149 NIMO TRANSFORMER
SSW 10 AVIATION DRIVE

1/4-1/2 COLONIE, NY

0.394 mi.

2082 ft. Site 4 of 4 in cluster Y

Relative: Higher NY Spills:

Site ID: 382213
Facility Addr2: PADMOUNT TRANSFORMER

 Actual:
 Facility ID:
 0702479

 305 ft.
 Spill Number:
 0702479

 Spill Number:
 0702479

 Facility Type:
 ER

 SWIS:
 0126

 Investigator:
 wtchrist

 Referred To:
 Not reported

 Spill Date:
 5/30/2007

 Reported to Dept:
 5/30/2007

 CID:
 21

S108637661

N/A

NY Spills

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO TRANSFORMER (Continued)

S108637661

Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Responsible Party Cleanup Ceased: Not reported

Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: Remediation Phase: Date Entered In Computer: 5/30/2007 Spill Record Last Update: 2/1/2008

Spiller Name: BARBARASCHEURER

Spiller Company: PADMOUNT TRANSFORMER NIMO

Spiller Address: 10 AVIATION DRIVE Spiller City, St, Zip: COLONIE, NY

999 Spiller Company:

Contact Name: BARBARASCHEURER Contact Phone: (518) 433-3696

DEC Region:

DER Facility ID: 331636

DEC Memo: 07/31/07 - Will need PCB analytical data fron National Grid. wtc

02/01/08 - Oil tested at <1ppm. wtc

AGED EQUIPMENT AND IS ALL CLEANED UP Remarks:

Material:

Site ID: 382213 1139616 Operable Unit ID: Operable Unit: 01 Material ID: 2129657 Material Code: 0020A

TRANSFORMER OIL Material Name: Not reported Case No.:

Petroleum Material FA: Quantity: Units: Gallons Recovered: Yes Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Not reported Spill Tank Test: Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Direction Distance

Distance EDR ID Number
Elevation Site EDR ID Number

X150 VALLANO BROTHERS LTANKS S102232875
NNW 7 HEMLOCK ST LTANKS N/A

1/4-1/2 LATHAM, NY

0.395 mi.

Actual:

289 ft.

2086 ft. Site 2 of 3 in cluster X

Relative: LTANKS:

Lower Site ID: 151517

 Spill No:
 9604705

 Spill Date:
 7/10/1996

 Spill Cause:
 Tank Test F

Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/21/1997

Facility Addr2: VALLANO BROTHERS

Cleanup Ceased: Not reported
Cleanup Meets Standard: False
SWIS: 0126
Investigator: WTCHRIST
Referred To: Not reported
Reported to Dept: 7/10/1996

CID: 21

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 7/10/1996
Spill Record Last Update: 8/5/2008
Spiller Name: BILL MAROHN
Spiller Company: VELLANO BROTHERS

Spiller Address: 7 HEMLOCK ST VALLANO BROTHERS

Spiller City, St, Zip: LATHAM, NY

Spiller County: 999

Spiller Contact: BILL MAROHN
Spiller Phone: (518) 462-1000
Spiller Extention: Not reported

DEC Region: 4
DER Facility ID: 128768

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 11/21/97 - RECEIVED CLOSURE REPORT. SITE MEETS NY STATE

GROUNDWATER STANDARDS. 9204593

Remarks: TESTER WAS UNABLE TO GET VACCUUM ON THE TANK - OWNER WILL EXCAVATE

Material:

Site ID: 151517 Operable Unit ID: 1035683 Operable Unit: 01 347454 Material ID: Material Code: 0009 Material Name: Gasoline Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No

Resource Affected: Not reported

Direction Distance

Elevation Site Database(s) EPA ID Number

VALLANO BROTHERS (Continued)

S102232875

EDR ID Number

Oxygenate: False

Tank Test:

 Site ID:
 151517

 Spill Tank Test:
 1544632

 Tank Number:
 Not reported

 Tank Size:
 1000

 Test Method:
 03

 Lock Petro:
 0

Leak Rate: 0
Gross Fail: F
Modified By: Spills
Last Modified: 10/1/2004

Test Method: Horner EZ Check I or II

HIST LTANKS:

Region of Spill: 4

 Spill Number:
 9604705

 Spill Date:
 07/10/1996

 Spill Time:
 13:00

Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/21/97 Cleanup Ceased: / / Cleanup Meets Standard: False

Investigator: CHRISTENSEN Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Not reported Notifier Extension: Reported to Department Date: 07/10/96 Reported to Department Time: 13:21 SWIS:

Spiller Contact: BILL MAROHN
Spiller Phone: (518) 462-1000
Spiller Extention: Not reported

Spiller Name: VALLANO BROTHERS
Spiller Address: 7 HEMLOCK ST
Spiller City,St,Zip: LATHAM, NY

Spiller Cleanup Date: / /
Facility Contact: BILL MAROHN
Facility Phone: (518) 462-1000
Facility Extention: Not reported

PBS Number: 4-433446 Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Tank Tester

Enforcement Date: //

Spill Notifier:

Direction Distance

Distance Elevation Site EDR ID Number

EDR ID Number

EPA ID Number

VALLANO BROTHERS (Continued)

S102232875

Investigation Complete: //
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 07/10/96
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 01/14/98
Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: 1000

Test Method: Horner EZ Check

Leak Rate Failed Tank: 0.00

Gross Leak Rate: Talk Test Failures only pass or fail

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: False
Material: GASOLINE
Class Type: GASOLINE

Class Type: GASOLINE
Times Material Entry In File: 21329
CAS Number: Not reported
Last Date: 19940929

DEC Remarks: 11/21/97 - RECEIVED CLOSURE REPORT. SITE MEETS NY STATE GROUNDWATER STANDARDS.

Spill Cause: TESTER WAS UNABLE TO GET VACCUUM ON THE TANK - OWNER WILL EXCAVATE

X151 VELLANO BROS HEMLOCK ST NY Spills S102156312
NNW 7 HEMLOCK ST NY Hist Spills N/A
1/4-1/2 LATHAM, NY

0.395 mi.

2086 ft. Site 3 of 3 in cluster X

Relative:

NY Spills:

Lower

Site ID: 151516

Facility Addr2: (@ WATERVLIET SHAKER?)
Facility ID: 9204593

Actual: 289 ft.

 Spill Number:
 9204593

 Facility Type:
 ER

 SWIS:
 0126

 Investigator:
 WTCHRIST

 Referred To:
 Not reported

 Spill Date:
 7/15/1990

 Reported to Dept:
 7/21/1992

CID: 21
Spill Cause: Equipment Failure
Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Citizen
Cleanup Ceased: 7/21/1992
Cleanup Meets Std: True

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

Direction
Distance

Elevation Site Database(s) EPA ID Number

VELLANO BROS HEMLOCK ST (Continued)

S102156312

EDR ID Number

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 8/6/1992
Remediation Phase: 0
Date Entered In Computer: 8/6/1992
Spill Record Last Update: 3/14/2008
Spiller Name: Not reported
Spiller Company: VELLANO BROS.
Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4
DER Facility ID: 308752

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" PBS 4-433446; see 9604705, 0511170.

Remarks: 7/15/90-NOZZLE FAILED, CLEANED BUT NOT RPTD. 7/21/92-NO DEC ACTION AT

THIS TIME.

Material:

Site ID: 151516 Operable Unit ID: 972108 Operable Unit: 01 Material ID: 412298 Material Code: 8000 Material Name: Diesel Case No.: Not reported Material FA: Petroleum 50 Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 9204593
Investigator: CHRISTENSEN
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported
Notifier Name: Not reported

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

VELLANO BROS HEMLOCK ST (Continued)

S102156312

Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 07/15/1990 12:00 Reported to Dept Date/Time: 07/21/92 16:19

SWIS:

Spiller Name: VELLANO BROS. Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: **Equipment Failure**

Reported to Dept: On Land Water Affected: Not reported

Spill Source: Spill Notifier: Citizen PBS Number: Not reported 07/21/92 Cleanup Ceased: Cleanup Meets Std: True Last Inspection:

Penalty Not Recommended Recommended Penalty:

Spiller Cleanup Dt: **Enforcement Date:** 11 Invstgn Complete: 11 **UST Involvement:** False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 08/06/92

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / 08/06/92 Date Spill Entered In Computer Data File: Date Spill Entered In Computer Data File: Not reported

Update Date: 08/10/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 50 Unkonwn Quantity Spilled: False Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: DIESEL Class Type: DIESEL Times Material Entry In File: 10625 CAS Number: Not reported Last Date: 19940728

DEC Remarks: Not reported

7/15/90-NOZZLE FAILED, CLEANED BUT NOT RPTD. 7/21/92-NO DEC ACTION AT THIS TIME. Remark:

Direction Distance

Elevation Site Database(s) EPA ID Number

152 NIMO TRANSFORMER NY Spills S108637881 SSW 2 AVIATION DR N/A

1/4-1/2 0.411 mi. 2171 ft.

COLONIE, NY

Relative:

Higher Actual:

305 ft.

 NY Spills:
 382555

 Facility Addr2:
 POLE

 Facility ID:
 0702767

 Spill Number:
 0702767

 Facility Type:
 ER

Facility Type: ER
SWIS: 0126
Investigator: wtchrist
Referred To: Not reported
Spill Date: 6/6/2007
Reported to Dept: 6/6/2007
CID: 21

Spill Cause: Equipment Failure Water Affected: Not reported

Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/21/2007 Remediation Phase: 0 Date Entered In Computer: 6/6/2007 Spill Record Last Update: 11/21/2007

Spiller Name: BARBARASCHEURER
Spiller Company: POLE (NIMO NAT GRID)
Spiller Address: 2 AVIATION DRIVE
Spiller City,St,Zip: COLONIE, NY

Spiller Company: 999

Contact Name: BARBARASCHEURER

Contact Phone: (518) 433-3696

DEC Region: 4
DER Facility ID: 331981

DEC Memo: 07/31/07 - Will need PCB analytical data. wtc 11/21/07 - Received

analytical, lab tested at <1ppm for pcb. wtc

Remarks: UNKNOWN PCB WENT ONTO LAND AND HAZMAT ENROUTE

Material:

 Site ID:
 382555

 Operable Unit ID:
 1139948

 Operable Unit:
 01

 Material ID:
 2129995

 Material Code:
 0020A

Material Name: TRANSFORMER OIL

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Not reported

Petroleum

Not reported

Not reported

Not reported

No

Resource Affected: Not reported Oxygenate: False

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NIMO TRANSFORMER (Continued)

S108637881

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

S100559978 153 **FEDERAL EXPRESS RT 155 LTANKS** NNE **RT 155 HIST LTANKS** N/A

1/4-1/2 COLONIE, NY

0.411 mi. 2172 ft.

LTANKS: Relative:

293521 Site ID: Lower Spill No: 9212321 Actual: Spill Date: 1/29/1993 282 ft.

Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/3/1993 Facility Addr2: Not reported Cleanup Ceased: 11/3/1993 Cleanup Meets Standard: True SWIS: 0126 WTCHRIST Investigator: Not reported Referred To: Reported to Dept: 1/29/1993 CID: Not reported Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: False Remediation Phase: Date Entered In Computer: 6/10/1993 Spill Record Last Update: 1/7/1998 Spiller Name: Not reported

Spiller Company: FEDERAL EXPRESS

Spiller Address: RT 155 COLONIE, ZZ Spiller City, St, Zip: Spiller County: 001 Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: DER Facility ID: 333659

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN/SPERBECK"

Remarks: .3GAL UGT FAILED PETROTITE @ -.217GPH, TO EMPTY & ABANDON.

Direction Distance

Elevation Site Database(s) EPA ID Number

FEDERAL EXPRESS RT 155 (Continued)

S100559978

EDR ID Number

9/14/93-INV ESTIGATION REQD. SEE 9212441.

Material:

 Site ID:
 293521

 Operable Unit ID:
 979323

 Operable Unit:
 01

 Material ID:
 402176

 Material Code:
 0022

 Material Name:
 Waste Oil/Used Oil

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Resource Affected:

Oxygenate:

Not reported

Petroleum

O

Not reported

No

No

Resource Affected:

Not reported

False

Tank Test:

Site ID: 293521
Spill Tank Test: 1541120
Tank Number: Not reported

Tank Size: 0
Test Method: 00
Leak Rate: 0

Gross Fail: Not reported Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill:

 Spill Number:
 9212321

 Spill Date:
 01/29/1993

 Spill Time:
 13:50

Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/03/93 Cleanup Ceased: 11/03/93 Cleanup Meets Standard: True

Investigator: CHRISTENSEN/SPERBECK

Caller Name: Not reported Caller Agency: Not reported Not reported Caller Phone: Not reported Caller Extension: Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 01/29/93 Reported to Department Time: 14:26 SWIS: 01

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

FEDERAL EXPRESS RT 155 (Continued)

S100559978

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: FEDERAL EXPRESS

Spiller Address: RT 155 Spiller City, St, Zip: COLONIE Spiller Cleanup Date: //

Facility Contact: Not reported Facility Phone: (518) 456-1120 Facility Extention: Not reported Spill Notifier: Tank Tester PBS Number: Not reported

Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: Investigation Complete: // UST Involvement: False

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted: Date Spill Entered In Computer Data File: 06/10/93 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 01/07/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported

Tank Size:

Test Method: Not reported Leak Rate Failed Tank: 0.00

Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: **Pounds** Quantity Recovered: Unkonwn Quantity Recovered: True WASTE OIL Material: Class Type: WASTE OIL Times Material Entry In File: 9509 CAS Number: Not reported 19940927 Last Date:

DEC Remarks: Not reported

.3GAL UGT FAILED PETROTITE @ -.217GPH, TO EMPTY ABANDON. 9/14/93-INV ESTIGATION Spill Cause:

REQD. SEE 9212441.

Direction Distance

Elevation Site Database(s) EPA ID Number

154 AVIS ALBANY SHAKER RD NY Spills S110043772 NNW 737 ALBANY SHAKER RD N/A

1/4-1/2 0.421 mi. 2225 ft.

Relative: NY Spills:

Lower Site ID: 420170

COLONIE ALBANY, NY 12205

Facility Addr2: AVIS 737 ALBANY SHAKER RD

 Actual:
 Facility ID:
 0907633

 275 ft.
 Spill Number:
 0907633

 Facility Type:
 ER

SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 10/7/2009 Reported to Dept: 10/7/2009 CID: Not reported Spill Cause: Unknown Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier:

Cleanup Ceased:
Cleanup Meets Std:
Last Inspection:

Other

Not reported

Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. (Highly

Improbable)

Spill Closed Dt: Not Closed

Remediation Phase: 1

Date Entered In Computer: 10/7/2009
Spill Record Last Update: 7/15/2010
Spiller Name: ROSE PELINO
Spiller Company: AVIS RENT A CAR
Spiller Address: 737 ALBANY SHAKER RD
Spiller City,St,Zip: ALBANY, NY 12205

Spiller Company: 999

Contact Name: ANGELA OLDENBURG

Contact Phone: (212) 221-7822

DEC Region: 4
DER Facility ID: 369192

DEC Memo: 10-07-09 - Spoke to Angela Oldenburg from TRC Environmental. They

were asked to take samples around dispenser. Analytical data indicates contamination. Data will be forwarded to the Department. wtc 10/19/09 - Received site map where samples were taken and analytical results which show some soil contamination. These have been entered into e-doc. wtc 11/06/09 - From: Jakubowska, Eva

(NYC,NY-US) Sent: Friday, November 06, 2009 12:07 PMI would like to

inform you of the excavation activities that will commence this

coming Tuesday, Wednesday and possibly Thursday (November 17, 18 and 19, 2009) at Avis Rent a Car Systems (737 Albany Shaker Road, Albany, NY). On Tuesday a concrete slab will be broken and the following day Wednesday we will proceed with the excavation of contaminated soil.

The excavated soil will be placed in a roll-off container for off-site disposal. Post excavation samples will be collected in

accordance with DER-10. Once the laboratory results are ready a Spill Closure Report will be prepared. I do apologize but I made a mistake with the dates. The work will actually begin next week, November 10,

EDR ID Number

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AVIS ALBANY SHAKER RD (Continued)

S110043772

11 and 12, 2009. Please disregard the dates in previous e-mail. Thank you Eva 01/13/2010 - Soil was dug out, minor amount, waiting for closure report. wtc 03/29/2010 - Avis plans on removing more soil this spring. wtc 05/05/2010 - Nothing new. wtc 07/15/2010 - Spoke to Daniel Warren and he wil talk to the project manager about its status

and e-mail me a report. wtc

SOIL SAMPLES TAKEN AROUND A DISPENSER SOIL CONTAMINATION FOUND CLEAN Remarks:

UP UNK.

Material:

Site ID: 420170 Operable Unit ID: 1176153 Operable Unit: 01 Material ID: 2168813 Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity: Not reported Units: Gallons Recovered: Not reported Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Not reported Leak Rate: Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

AA155 NYNEX KENLYN DR SAND CRK **KENLYN @ SAND CREEK** South

1/4-1/2 COLONIE, NY

0.438 mi.

Site 1 of 2 in cluster AA 2312 ft.

Relative: Higher

Actual:

299 ft.

NY Spills: Site ID:

212846 Facility Addr2: Not reported Facility ID: 9009981 Spill Number: 9009981 Facility Type: ER SWIS: 0126

Investigator: MCCULLOUCH Referred To: Not reported 12/12/1990 Spill Date: Reported to Dept: 12/13/1990 CID: Not reported Spill Cause: Unknown Water Affected: Not reported Spill Source: Unknown

NY Spills

NY Hist Spills

S102114625

N/A

Direction Distance

Elevation Site Database(s) EPA ID Number

NYNEX KENLYN DR SAND CRK (Continued)

S102114625

EDR ID Number

Spill Notifier: Other
Cleanup Ceased: 12/13/1990
Cleanup Meets Std: True
Last Inspection: 12/13/1991

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 3/5/1991 Remediation Phase: 0

Date Entered In Computer: 12/13/1990
Spill Record Last Update: 1/6/2009
Spiller Name: Not reported
Spiller Company: NYNEX?
Spiller Address: Not reported

Spiller City,St,Zip: ZZ Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported DEC Region: 4

DER Facility ID: 176340
DEC Memo: Not reported

Remarks: NY TEL RPTS CABLE FAILED DUE TO CORROSIVE MATERIAL IN MANHOLE. CLEAN

HARBORS ANALYSED & DISPOSED, TYPICAL MANHOLE SLUDGE. NO FURTHER ACTION

REQ.

Material:

 Site ID:
 212846

 Operable Unit ID:
 947015

 Operable Unit:
 01

 Material ID:
 430160

 Material Code:
 0064A

Material Name: UNKNOWN MATERIAL

Case No.:

Material FA:

Quantity:

Units:

Recovered:

Resource Affected:

Oxygenate:

Not reported

Not reported

Not reported

Not reported

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Not reported Gross Fail: Not reported Modified By: Last Modified: Not reported Not reported Test Method:

NY Hist Spills:

Region of Spill: 4

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NYNEX KENLYN DR SAND CRK (Continued)

S102114625

Spill Number: 9009981 MCCULLOUCH Investigator: Caller Name: Not reported Not reported Caller Agency: Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 12/12/1990 23:00 Reported to Dept Date/Time: 12/13/90 12:42

SWIS: 01 Spiller Name: NYNEX? Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Unknown Reported to Dept: On Land

Water Affected: GROUNDWATER?

Spill Source: 12 Spill Notifier: Other PBS Number: Not reported Cleanup Ceased: 12/13/90 Cleanup Meets Std: True Last Inspection: 12/13/91

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: 11 **Enforcement Date:** // Invstgn Complete: / / **UST Involvement:** False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 03/05/91 Corrective Action Plan Submitted: // Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 12/13/90 Date Spill Entered In Computer Data File: Not reported

Update Date: 04/11/96 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False

UNKNOWN MATERIAL Material: Class Type: UNKNOWN MATERIAL

Direction Distance

Distance Elevation Site EDR ID Number Database(s) EPA ID Number

NYNEX KENLYN DR SAND CRK (Continued)

S102114625

Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109

DEC Remarks: Not reported

Remark: NY TEL RPTS CABLE FAILED DUE TO CORROSIVE MATERIAL IN MANHOLE. CLEAN HARBORS

ANALYSED DISPOSED, TYPICAL MANHOLE SLUDGE. NO FURTHER ACTION REQ.

156 NAT GRID TRANSFORMER HAWTHORNE CT

NY Spills S109582007

N/A

22 HAWTHORNE CT POLE # 1 LOUNDONVILLE, NY 12211

1/4-1/2 0.440 mi. 2325 ft.

ESE

Relative: NY Spills:

Higher Site ID: 412636

Facility Addr2: POLE # 1 22 HAWTHRONE COURT

 Actual:
 Facility ID:
 0900683

 317 ft.
 Spill Number:
 0900683

Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported 4/17/2009 Spill Date: Reported to Dept: 4/17/2009 CID: Not reported Spill Cause: **Equipment Failure** Water Affected: Not reported Spill Source: Commercial/Industrial

Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 6/1/2009 Remediation Phase: 0

Date Entered In Computer: 4/17/2009 Spill Record Last Update: 6/1/2009 Spiller Name: Not reported

Spiller Company: NATIONAL GRID NIMO

Spiller Address: Not reported Spiller City,St,Zip: NY 12211 Spiller Company: 999

Contact Name: BARB SCHEUREER Contact Phone: (518) 433-3696

DEC Region: 4
DER Facility ID: 361822

DEC Memo: 05/18/09 - Require pcb data. wtc 06/01/09 - Laboratory analytical

showed <1 ppm. wtc

Remarks: 1755 The caller advised dispatch the spill was due to a faulty part.

No water ways affected. The clean up is pending at this time. The

caller is awaiting a call back from Hazmat.

Material:

Site ID: 412636 Operable Unit ID: 412636

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

NAT GRID TRANSFORMER HAWTHORNE CT (Continued)

S109582007

Operable Unit: 01 2160741 Material ID: Material Code: 0020A

Material Name: TRANSFORMER OIL

False

Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: Not reported Resource Affected: Not reported Oxygenate:

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

AA157 SLICK ON SWIMMING POOL NY Spills S102113835 South **7 KENLYN DR NY Hist Spills** N/A

1/4-1/2 0.441 mi.

COLONIE, NY 2331 ft. Site 2 of 2 in cluster AA

Relative: Higher

NY Spills: Site ID:

Facility Addr2: Not reported Actual: Facility ID: 8903696 299 ft. Spill Number: 8903696 Facility Type: ER

SWIS: 0126 Investigator: **ANGEISEN** Referred To: Not reported Spill Date: 7/12/1989 Reported to Dept: 7/13/1989 CID: 21

Spill Cause: Unknown

Water Affected: **SWIMMING POOL** Spill Source: Unknown Spill Notifier: Affected Persons

Cleanup Ceased: 9/12/1989 Cleanup Meets Std: True Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

111475

UST Trust:

Spill Class: Known release with minimal potential for fire or hazard. No DEC

Response. No corrective action required.

Spill Closed Dt: 9/12/1989 Remediation Phase:

Date Entered In Computer: 7/14/1989

Direction Distance

Elevation Site Database(s) **EPA ID Number**

SLICK ON SWIMMING POOL (Continued)

S102113835

EDR ID Number

Spill Record Last Update: 6/9/2008 Spiller Name: Not reported

Spiller Company: UNKNOWN AIRPLANE

Spiller Address: Not reported

Spiller City, St, Zip: ZZ Spiller Company: 001

Contact Name: Not reported Not reported Contact Phone:

DEC Region: DER Facility ID: 97497

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"GEISENDORFER" 08/25/89: C.T. MALE TO SAMPLE PETROLEUM ID & 503.1.

09/12/89: TEST RESULTS NEGATIVE.

SLICK ON POOL, BELIEVES TO BE FROM PLANES (IN FLIGHT PATTERN). Remarks:

> 15:50-ANG ON SITE, NO SIGN OR ODOR OF PETRO, SAMPLED SOIL, SPOKE W/HORTON, RESIDUE ON RETURN LINE & AROUND POOL, 5 KENLYN ALSO. SEE

HIST

Material:

Site ID: 111475 Operable Unit ID: 931322 Operable Unit: 01 Material ID: 447775 Material Code: 0022

Waste Oil/Used Oil Material Name: Not reported Case No.: Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported False Oxygenate:

Tank Test:

Not reported Site ID: Spill Tank Test: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Not reported Test Method:

NY Hist Spills:

Region of Spill: 4

Spill Number: 8903696

GEISENDORFER Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported 07/12/1989 12:00 Spill Date/Time:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

SLICK ON SWIMMING POOL (Continued)

S102113835

Reported to Dept Date/Time: 07/13/89 09:54

SWIS:

Spiller Name: **UNKNOWN AIRPLANE**

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City,St,Zip: Not reported Spill Cause: Unknown Reported to Dept: Surface Water Water Affected: **SWIMMING POOL**

Spill Source: 12

Spill Notifier: Affected Persons PBS Number: Not reported Cleanup Ceased: 09/12/89 Cleanup Meets Std: True Last Inspection:

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** Invstgn Complete: / / **UST Involvement:** False Spill Class: Not reported Spill Closed Dt: 09/12/89 Corrective Action Plan Submitted:

Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 07/14/89 Date Spill Entered In Computer Data File: Not reported

Update Date: 01/26/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Not reported Test Method: Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: WASTE OIL WASTE OIL Class Type: Times Material Entry In File: 9509 CAS Number: Not reported Last Date: 19940927

DEC Remarks: 08/25/89: C.T. MALE TO SAMPLE PETROLEUM ID 503.1. 09/12/89: TEST RESULTS

NEGATIVE.

SLICK ON POOL, BELIEVES TO BE FROM PLANES IN FLIGHT PATTERN). 15:50-ANG ON Remark:

SITE, NO SIGN OR ODOR OF PETRO, SAMPLED SOIL, SPOKE W/HORTON, RESIDUE ON RETURN

LINE AROUND POOL, 5 KENLYN ALSO. SEE HIST

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AB158 AT&T 65 WOLF RD **LTANKS** S104275786 SSW 65 WOLF RD **HIST LTANKS** N/A

1/4-1/2 COLONIE, NY

0.449 mi.

Site 1 of 2 in cluster AB 2369 ft.

LTANKS: Relative:

146501 Higher Site ID: Spill No: 8702350 Actual: Spill Date: 6/17/1987

297 ft. Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

> Spill Class: Known release that creates potential for fire or hazard. DEC Response.

> > Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 9/11/1987 Facility Addr2: Not reported Cleanup Ceased: 9/11/1987 Cleanup Meets Standard: True SWIS: 0126 **WEBLAIN** Investigator: Referred To: Not reported Reported to Dept: 6/17/1987 CID: 21

Water Affected: Not reported Spill Notifier: Responsible Party Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: False Remediation Phase: Date Entered In Computer: 6/23/1987 Spill Record Last Update: 10/29/1999 Spiller Name: Not reported Spiller Company: AT&T Spiller Address: 65 WOLF RD

Spiller City, St, Zip: COLONIE, NY

Spiller County: 001

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: DER Facility ID: 124757

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"BLAIN"

2K UGT FAILED TEST @ .224GPH, WILL RETEST. SEE 9401418. Remarks:

Material:

Site ID: 146501 Operable Unit ID: 906643 Operable Unit: 01 Material ID: 468646 Material Code: 0001 Material Name: #2 Fuel Oil Case No.: Not reported Material FA: Petroleum Quantity: 0 Gallons Units: Recovered: No

Resource Affected: Not reported Oxygenate: False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AT&T 65 WOLF RD (Continued)

S104275786

Tank Test:

146501 Site ID: 1530994 Spill Tank Test: Tank Number: Not reported

Tank Size: 00 Test Method: Leak Rate: 0

Gross Fail: Not reported Modified By: Spills 10/1/2004 Last Modified: Test Method: Unknown

HIST LTANKS:

Region of Spill:

Spill Number: 8702350 06/17/1987 Spill Date: Spill Time: 12:00

Spill Cause: Tank Test Failure Resource Affectd: Groundwater Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 09/11/87 09/11/87 Cleanup Ceased: Cleanup Meets Standard: True **BLAIN** Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Not reported Notifier Agency: Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 06/17/87 Reported to Department Time: 16:00 SWIS: 01

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported Spiller Name: AT&T

Spiller Address: 65 WOLF RD Spiller City, St, Zip: COLONIE, NY

Spiller Cleanup Date:

Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Notifier: Responsible Party

PBS Number: 4-134325 Last Inspection:

Recommended Penalty: Penalty Not Recommended

Enforcement Date: 11 Investigation Complete: 11 **UST Involvement:** False

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AT&T 65 WOLF RD (Continued)

S104275786

Date Region Sent Summary to Central Office: / / Corrective Action Plan Submitted:

Date Spill Entered In Computer Data File: 06/23/87 Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 10/29/99 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: 0 Test Method: Not reported Leak Rate Failed Tank: 0.00 Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: True

#2 FUEL OIL Material: Class Type: #2 FUEL OIL Times Material Entry In File: 24464 CAS Number: Not reported Last Date: 19941207

DEC Remarks: Not reported

2K UGT FAILED TEST @ .224GPH, WILL RETEST. SEE 9401418. Spill Cause:

AB159 AT&T WOLF RD **LTANKS** S104275983 SSW 65 WOLF RD **HIST LTANKS** N/A

1/4-1/2 **COLONIE, NY**

0.449 mi.

2369 ft. Site 2 of 2 in cluster AB

LTANKS: Relative: Site ID: Higher

146502 Spill No: 9401418 Actual: Spill Date: 4/29/1994 297 ft. Spill Cause: Tank Test Failure Spill Source: Commercial/Industrial

> Spill Class: Known release that creates potential for fire or hazard. DEC Response.

> > Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 8/30/1995 Facility Addr2: Not reported Cleanup Ceased: Not reported Cleanup Meets Standard: True SWIS: 0126 Investigator: **TESPERBE** Referred To: Not reported Reported to Dept: 4/29/1994 CID: 21

Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: False

Direction Distance

Elevation Site Database(s) EPA ID Number

AT&T WOLF RD (Continued)

S104275983

EDR ID Number

Remediation Phase: 0

Date Entered In Computer: 6/10/1994
Spill Record Last Update: 2/1/2000
Spiller Name: Not reported
Spiller Company: AT&T
Spiller Address: 65 WOLF RD
Spiller City,St,Zip: COLONIE, NY

Spiller County: 001

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

DEC Region: 4
DER Facility ID: 124757

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"SPERBECK" TANK PASSED RETEST. TANK REMOVED 8/96 CLOSURE REPORT

RECEIVED. SOIL SAMPLE LAB RESULTS ND.

Remarks: 5K UGT FAILED VACUTECT, EIR. SEE 8702350.

Material:

146502 Site ID: Operable Unit ID: 995187 Operable Unit: 01 Material ID: 385173 Material Code: 0001 #2 Fuel Oil Material Name: Case No.: Not reported Material FA: Petroleum Quantity: Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 146502 Spill Tank Test: 1542660 Tank Number: Not reported

Tank Size: 0
Test Method: 00
Leak Rate: 0

Gross Fail: Not reported Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

HIST LTANKS:

Region of Spill: 4

 Spill Number:
 9401418

 Spill Date:
 04/29/1994

 Spill Time:
 10:30

Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported

Spill Source: Other Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Direction
Distance
Elevation

vation Site Database(s) EPA ID Number

AT&T WOLF RD (Continued)

S104275983

EDR ID Number

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 08/30/95 Cleanup Ceased: / / Cleanup Meets Standard: True Investigator: **SPERBECK** Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported Notifier Name: Not reported Notifier Agency: Not reported Not reported Notifier Phone: Notifier Extension: Not reported Reported to Department Date: 04/29/94 Reported to Department Time: 10:44

SWIS: 01
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
Spiller Name: AT&T

Spiller Address: 65 WOLF RD

Spiller City,St,Zip: COLONIE
Spiller Cleanup Date: //

Facility Contact: Not reported Facility Phone: Not reported Facility Extention: Not reported Spill Notifier: Tank Tester PBS Number: 4-134325

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: / /
Investigation Complete: / /
UST Involvement: False

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 06/10/94
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 02/01/00 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported

Tank Size: 0

Test Method: Not reported Leak Rate Failed Tank: 0.00

Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True
Material: #2 FUEL OI

Material: #2 FUEL OIL Class Type: #2 FUEL OIL

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

AT&T WOLF RD (Continued) S104275983

Times Material Entry In File: 24464 CAS Number: Not reported 19941207 Last Date:

DEC Remarks: TANK PASSED RETEST. TANK REMOVED 8/96 CLOSURE REPORT RECEIVED. SOIL SAMPLE LAB

RESULTS ND.

5K UGT FAILED VACUTECT, EIR. SEE 8702350. Spill Cause:

160 ANN LEE HOME SHAKER RD **LTANKS** S100495066 NNW WATERVLIET SHAKER RD **HIST LTANKS** N/A

1/4-1/2 COLONIE, NY

0.455 mi. 2403 ft.

LTANKS: Relative:

Site ID: 234878 Lower

Spill Closed Dt:

Spill No: 9301018 Actual: Spill Date: 4/20/1993 273 ft. Spill Cause: Tank Test Failure

> Spill Source: Institutional, Educational, Gov., Other

Spill Class: Known release that creates potential for fire or hazard. (Minimal

Occurrence) 3/17/1994

Facility Addr2: Not reported Cleanup Ceased: 3/17/1994 Cleanup Meets Standard: True SWIS: 0126 Investigator: **TESPERBE** Referred To: Not reported Reported to Dept: 4/21/1993 CID: Not reported Water Affected: Not reported Spill Notifier: Tank Tester Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Involvement: True Remediation Phase: Date Entered In Computer: 4/28/1993 Spill Record Last Update: 4/26/2000 Spiller Name: Not reported

Spiller Company: ALBANY CO NURSING HOME

Spiller Address: Not reported

Spiller City, St, Zip: ΖZ 001 Spiller County:

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Extention: Not reported

DEC Region: 4 DER Facility ID: 323073

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"SPERBECK"

Remarks: 5K UGT FAILED HORNER @ GROSS RATE, EIR. 3/17/94 PASSED.

Material:

Site ID: 234878 Operable Unit ID: 982757 Operable Unit: 01 Material ID: 567373

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

ANN LEE HOME SHAKER RD (Continued)

S100495066

Material Code: 0009 Material Name: Gasoline Not reported Case No.: Material FA: Petroleum Quantity:

Units: Gallons Recovered: No

Resource Affected: Not reported Oxygenate: False

Tank Test:

Site ID: 234878 Spill Tank Test: 1541434 Tank Number: Not reported

Tank Size: Test Method: 00 Leak Rate: 0

Gross Fail: Not reported Modified By: Spills 10/1/2004 Last Modified: Test Method: Unknown

HIST LTANKS:

Region of Spill:

Spill Number: 9314252 Spill Date: 03/04/1994 Spill Time: 13:00 Spill Cause: Tank Overfill Resource Affectd: On Land Water Affected: Not reported

Spill Source: Other Non Commercial/Industrial

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 03/07/94 Cleanup Ceased: 03/04/94 Cleanup Meets Standard: True

Investigator: CHRISTENSEN/TS Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Caller Extension: Not reported

Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Notifier Extension: Not reported Reported to Department Date: 03/07/94 Reported to Department Time: 08:53 SWIS: 01 Spiller Contact: Not reported

Spiller Phone: Not reported Spiller Extention: Not reported

Spiller Name: COLONIE TOWN HWY DEPT

Spiller Address: Not reported Spiller City, St, Zip: Not reported

Spiller Cleanup Date:

Direction Distance

Elevation Site Database(s) EPA ID Number

ANN LEE HOME SHAKER RD (Continued)

S100495066

EDR ID Number

Facility Contact: TOWN OF COLONIE
Facility Phone: Not reported
Facility Extention: Not reported
Spill Notifier: Responsible Party
PBS Number: Not reported

Last Inspection: /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: //
Investigation Complete: //
UST Involvement: False

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 03/07/94
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 07/26/99 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Raw Sewage
Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0

Unkonwn Quantity Recovered: False

Material: UNKNOWN MATERIAL

Class Type: UNKNOWN MATERIAL
Times Material Entry In File: 9140
CAS Number: Not reported
Last Date: 19941109

DEC Remarks: SEE 8809646, 9000393, 9206986, 9210246, 9304149, 9314252. Spill Cause: CONT. SOIL @ FILL PICKED UP. NO DEC RESPONSE.

 Region of Spill:
 4

 Spill Number:
 9301018

 Spill Date:
 04/20/1993

 Spill Time:
 14:30

Spill Cause: Tank Test Failure
Resource Affectd: On Land
Water Affected: Not reported

Spill Source: Other Non Commercial/Industrial

Spill Class: Known release that creates potential for fire or hazard. (Minimal

Occurrence) 03/17/94

Spill Closed Dt: 03/17/94
Cleanup Ceased: 03/17/94
Cleanup Meets Standard: True
Investigator: SPERBECK
Caller Name: Not reported
Caller Agency: Not reported
Caller Phone: Not reported

Direction
Distance
Elevation

tion Site Database(s) EPA ID Number

ANN LEE HOME SHAKER RD (Continued)

S100495066

EDR ID Number

Caller Extension: Not reported
Notifier Name: Not reported
Notifier Agency: Not reported
Notifier Phone: Not reported
Notifier Extension: Not reported
Reported to Department Date: 04/21/93
Reported to Department Time: 11:05
SWIS: 01

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported

Spiller Name: ALBANY CO NURSING HOME

Spiller Address: Not reported
Spiller City,St,Zip: Not reported
Spiller Cleanup Date: / /

Facility Contact: Not reported
Facility Phone: (518) 869-9985
Facility Extention: Not reported
Spill Notifier: Tank Tester
PBS Number: 4-442968

Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Enforcement Date: / /
Investigation Complete: / /
UST Involvement: True

Date Region Sent Summary to Central Office: / /
Corrective Action Plan Submitted: / /
Date Spill Entered In Computer Data File: 04/28/93
Time Spill Entered In Computer Data File: Not reported

Spill Record Last Update: 04/26/00 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: 0
Test Method: Not reported
Leak Rate Failed Tank: 0.00
Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: Unkonwn Quantity Recovered: False Material: **GASOLINE** Class Type: **GASOLINE** Times Material Entry In File: 21329 CAS Number: Not reported Last Date: 19940929

DEC Remarks: Not reported

Spill Cause: 5K UGT FAILED HORNER @ GROSS RATE, EIR. 3/17/94 PASSED.

Direction Distance

Elevation Site Database(s) EPA ID Number

161 CONSOLIDATED FRIEGHT NY Spills S103828419
NE 845 WATERVLIET SHAKER RD NY Hist Spills N/A

1/4-1/2 LATHAM, NY

0.456 mi. 2408 ft.

Actual:

285 ft.

Relative: NY Spills:

Lower Site ID: 125673

Facility Addr2: Not reported
Facility ID: 0300864
Spill Number: 0300864
Facility Type: ER

 SWIS:
 0126

 Investigator:
 WTCHRIST

 Referred To:
 Not reported

 Spill Date:
 4/24/2003

 Reported to Dept:
 4/24/2003

CID: 21

Spill Cause: Equipment Failure
Water Affected: Not reported

Spill Source: Commercial/Industrial

Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False

Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 11/10/2003

Remediation Phase: 0

Date Entered In Computer: 4/24/2003 Spill Record Last Update: 2/6/2006

Spiller Name: BLYMER ENGINEERING-MIKE
Spiller Company: CONSOLIDATED FRIEGHTWAYS
Spiller Address: 845 WATERVLIET SHAKER RD

Spiller City, St, Zip: LATHAM, NY

Spiller Company: 001

Contact Name: BLYMER ENGINEERING-MIKE

Contact Phone: (510) 521-3773

DEC Region: 4
DER Facility ID: 293278

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" 9006802, 9814111 05/02/2003 - Three ust have been removed. There is a 550 waste oil tank that still has to be removed.

Contaminated soil will also have to be disposed of. Further

remediation will be determed by the analytical results when they are reviewed. wtc 09/05/2003 - Excavation of the pump island was completed on 9/4/03. Approx. 100-150 tons of contaminated soil was removed. Samples were taken. Groundwater was encounted at about 7 feet. It had a slight sheen on it. wtc 11/05/2003 - Received closure report from Hennessy Engineering Consulting. Analytical results show a slite exceedence for MtBE at 1,700ppb were TAGMs is at 120ppb and total Xylenes at 1,550ppb were TAGMs is 1,200ppb. These samples were

only in certain area of the excavation. No further remediation is

required. Closed wtc

Remarks: approx 10 yards of soil stockpiled - contaminated soil found

underneith [SP] the diesel pump probably from a leaky union - they are

on site removing tanks

EDR ID Number

Direction Distance Elevation

ation Site Database(s) EPA ID Number

CONSOLIDATED FRIEGHT (Continued)

S103828419

EDR ID Number

Material: Site ID:

Operable Unit ID: 867234 Operable Unit: 01 Material ID: 508937 Material Code: 8000 Diesel Material Name: Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons Recovered: No Not reported Resource Affected: Oxygenate: True 125673 Site ID: Operable Unit ID: 867234 Operable Unit: 01 Material ID: 2106566 Material Code: 1213A

Material Name: MTBE (METHYL-TERT-BUTYL ETHER)

125673

Case No.: 01634044

Material FA: Hazardous Material Quantity: Not reported Units: Not reported Recovered: Not reported Not reported Resource Affected: Not reported

Oxygenate: True

Tank Test:

Site ID: 125673
Spill Tank Test: 1528298
Tank Number: Not reported

Tank Size: 0
Test Method: 00
Leak Rate: 0

Gross Fail: Not reported Modified By: Spills
Last Modified: 10/1/2004
Test Method: Unknown

Site ID: 125675 Facility Addr2: Not reported Facility ID: 9814111 Spill Number: 9814111 Facility Type: ER SWIS: 0126 Investigator: WTCHRIST Referred To: Not reported Spill Date: 2/23/1999 Reported to Dept: 2/23/1999 CID: 21

Spill Cause: Human Error
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Responsible Party

Direction Distance

Elevation Site Database(s) EPA ID Number

CONSOLIDATED FRIEGHT (Continued)

S103828419

EDR ID Number

Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 2/23/1999
Remediation Phase: 0
Date Entered In Computer: 2/23/1999
Spill Record Last Update: 3/14/2008

Spiller Name: ARMAN SIEPER

Spiller Company: CONSOLIDATED FRIEGHT
Spiller Address: 845 WATERVLIET SHAKER RD

Spiller City, St, Zip: LATHAM, NY

Spiller Company: 001

Contact Name: ARMAN SIEPER Contact Phone: (518) 785-4882

DEC Region: 4

DER Facility ID: 108698

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"CHRISTENSEN" NO DEC RESPONSE 9006802, 0300864

Remarks: DUMB [SP] WAS STRUCK WITH A FORK TRUCK VENDER IS ON THE SCENE STARTING

CLEANUP - (VENDER IS ENVIRORMENTAL [SP] SERVICES)

Material:

 Site ID:
 125675

 Operable Unit ID:
 1071547

 Operable Unit:
 01

 Material ID:
 310817

 Material Code:
 0042A

Material Name: XYLENE (MIXED)

Case No.: 01330207

Material FA: Hazardous Material

Quantity: 30
Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

Click this hyperlink while viewing on your computer to access CLEANUP - (VENDER IS ENVIRORMENTAL [SP] SERVICES)

Direction Distance

Elevation Site Database(s) EPA ID Number

CONSOLIDATED FRIEGHT (Continued)

S103828419

EDR ID Number

NY Hist Spills:

Region of Spill:

Spill Number:

Investigator:

Caller Name:

Caller Agency:

Caller Phone:

Not reported

Not reported

Not reported

Not reported

Not reported

Not reported

Notifier Agency: Not reported
Notifier Phone: Not reported
Spill Date/Time: 02/23/1999 06:00
Reported to Dept Date/Time: 02/23/99 12:11

SWIS: 01

Spiller Name: CONSOLIDATED FRIEGHT

Spiller Contact: ARMAN SIEPER
Spiller Phone: (518) 785-4882
Spiller Contact: ARMAN SIEPER
Spiller Phone: (518) 785-4882

Spiller Address: 845 WATERVLIET SHAKER RD

Spiller City,St,Zip: LATHAM, NY
Spill Cause: Human Error
Reported to Dept: On Land
Water Affected: Not reported

Spill Source: 07

Spill Notifier: Responsible Party

PBS Number: 4-006610
Cleanup Ceased: / /
Cleanup Meets Std: False
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 02/23/99

Corrective Action Plan Submitted: / /
Date Region Sent Summary to Central Office: / /
Date Spill Entered In Computer Data File: 02/23/99
Date Spill Entered In Computer Data File: Not reported

Update Date: 02/24/99 Is Updated: False

Tank:

PBS Number: Not reported
Tank Number: Not reported
Tank Size: Not reported
Test Method: Not reported
Leak Rate Failed Tank: Not reported
Gross Leak Rate: Not reported

Material:

Material Class Type: Nonpetroleum/Nonhazardous

Quantity Spilled: 30
Unkonwn Quantity Spilled: False
Units: Gallons
Quantity Recovered: 0

Direction Distance

Distance Elevation Site EDR ID Number Database(s) EPA ID Number

CONSOLIDATED FRIEGHT (Continued)

S103828419

Unkonwn Quantity Recovered: False

Material: XYLENE (MIXED)
Class Type: XYLENE (MIXED)

Times Material Entry In File: 0
CAS Number: 01330207
Last Date: Not reported
DEC Remarks: NO DEC RESPONSE 9006802

Remark: DUMB WAS STRUCK WITH A FORK TRUCK VENDER IS ON THE SCENE STARTING CLEANUP -

VENDER IS ENVIRORMENTAL SP SERVICES)

162KELLY RES ROSEBUD LNNY Spills\$104496350SE5 ROSEBUD LANENY Hist SpillsN/A

1/4-1/2 0.477 mi. 2518 ft.

Relative: NY Spills: Higher Site ID:

Facility Addr2: Not reported

Actual: Facility ID: 8801148

320 ft. Spill Number: 8801148

Facility Type: ER

SWIS: 0126

Investigator: ANGEISEN

LOUDONVILLE, NY

Investigator: ANGEISEN
Referred To: Not reported
Spill Date: 5/4/1988
Reported to Dept: 5/4/1988
CID: 21
Spill Cause: Deliberate

Water Affected: Not reported
Spill Source: Private Dwelling
Spill Notifier: Citizen
Cleanus Coased: 5/0/1988

Cleanup Ceased: 5/9/1988
Cleanup Meets Std: True
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

297336

UST Trust: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 5/9/1988 Remediation Phase: 0

Date Entered In Computer: 5/10/1988
Spill Record Last Update: 3/5/2008
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported

Spiller City,St,Zip: NY Spiller Company: 999

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4 DER Facility ID: 240576

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"GEISENDORFER"

Remarks: 5/9 GEISENDORFER ON SITE. OBSERVED 1/2 FULL PAN OF OIL ON GRATE-HAD

BEEN CHANGING OIL. INSTRUCTED SUSPECTED SPILLER ON WASTE OIL

REQUIREMENTS. I.E. DISPOSAL AT JIFFY LUBE, ETC.

Direction Distance Elevation

evation Site Database(s) EPA ID Number

KELLY RES ROSEBUD LN (Continued)

S104496350

EDR ID Number

Material:

 Site ID:
 297336

 Operable Unit ID:
 918290

 Operable Unit:
 01

 Material ID:
 460302

 Material Code:
 0022

 Material Name:
 Waste Oil/Used Oil

Case No.:

Material FA:

Quantity:

Units:

Recovered:

No

Resource Affected:

Not reported

Not reported

False

Oxygenate:

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill:

Spill Number: 8801148

GEISENDORFER Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 05/04/1988 12:00 Reported to Dept Date/Time: 05/04/88 08:55

SWIS: 01

Spiller Name: UNKNOWN Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: Not reported Spiller City, St, Zip: Not reported Spill Cause: Deliberate Reported to Dept: In Sewer Water Affected: Not reported 09

Spill Source: 09
Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: 05/09/88
Cleanup Meets Std: True
Last Inspection: / /

Recommended Penalty: Penalty Not Recommended

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

KELLY RES ROSEBUD LN (Continued)

S104496350

Spiller Cleanup Dt: **Enforcement Date:** // Invstgn Complete: // UST Involvement: False

Spill Class: Known release with minimal potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 05/09/88

Corrective Action Plan Submitted: 11 Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 05/10/88 Date Spill Entered In Computer Data File: Not reported

Update Date: 09/15/97 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Petroleum Quantity Spilled: 0 Unkonwn Quantity Spilled: False Units: Gallons Quantity Recovered: O Unkonwn Quantity Recovered: False Material: WASTE OIL Class Type: WASTE OIL Times Material Entry In File: 9509 CAS Number: Not reported Last Date: 19940927

DEC Remarks: Not reported

5/9 GEISENDORFER ON SITE. OBSERVED 1/2 FULL PAN OF OIL ON GRATE-HAD BEEN Remark:

CHANGING OIL. INSTRUCTED SUSPECTED SPILLER ON WASTE OIL REQUIREMENTS. I.E.

DISPOSAL AT JIFFY LUBE, ETC.

MACFARLAND NORTHWAY LN 4 NORTHWAY LN N.

1/4-1/2 LATHAM COLONIE, NY 0.488 mi. 2577 ft.

163

NNE

NY Spills: Relative: Lower

Site ID: 286654 Facility Addr2:

Not reported Actual: Facility ID: 9200241 289 ft. Spill Number: 9200241 Facility Type: ER

SWIS: 0126 WTCHRIST Investigator: Referred To: Not reported Spill Date: 6/3/1991 Reported to Dept: 4/6/1992 CID: Not reported Spill Cause: Deliberate Water Affected: Not reported S103482074

N/A

NY Spills

NY Hist Spills

Direction Distance

Elevation Site Database(s) EPA ID Number

MACFARLAND NORTHWAY LN (Continued)

S103482074

EDR ID Number

Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported

Recommended Penalty: Penalty Not Recommended

UST Trust: False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt: 1/14/2008

Remediation Phase: 0
Date Entered In Computer: 4/8/1992
Spill Record Last Update: 1/6/2009
Spiller Name: Not reported

Spiller Company: NORRIS MACFARLAND

Spiller Address: 41 STATE ST Spiller City,St,Zip: ALBANY, NY 12207

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported DEC Region: 4

DER Facility ID: 232329

DEC Memo: Prior to Sept, 2004 data translation this spill Lead_DEC Field was

"GEISENDORFER" 09/28/95: This is additional information about

material spilled from the translation of the old spill file:

UGT,AGT,DRUMS,BATTS See file. 01/14/08 - Site visit was done on 01/11/08 and pictures were taken. No above ground tanks or

underground tanks were observed. The tanks that were there in 1992 have been removed. The leaking drums and bad housekeeping have been

taken care of. There are some trailers parked on the property but present no problems. There may be pockets of contamination remaining on the property but a site investigation would need to be done to confirm it. At this time the Department is not concerned with

residual contamination and is closing the spill number as not meeting standards. The file has been entered into e-doc along with old and

new pictures. wtc

Remarks: 1 AGT, 2 UGTS (AT LEAST), LEAKING DRUMS, BATTERIES, POSS DUMPING OF

ACID MATERIAL.

Material:

 Site ID:
 286654

 Operable Unit ID:
 964246

 Operable Unit:
 01

 Material ID:
 415058

 Material Code:
 0064A

Material Name: UNKNOWN MATERIAL

Case No.:

Mot reported

Material FA:

Other

Quantity:

Units:

Gallons

Recovered:

No

Resource Affected:

Not reported

Oxygenate: False
Site ID: 286654
Operable Unit ID: 964246
Operable Unit: 01
Material ID: 415056
Material Code: 0066A

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MACFARLAND NORTHWAY LN (Continued)

UNKNOWN PETROLEUM Material Name:

Case No.: Not reported Material FA: Petroleum Quantity: 0 Units: Gallons

Recovered: No Not reported Resource Affected: Oxygenate: False Site ID: 286654 Operable Unit ID: 964246 Operable Unit: 01 Material ID: 415057 Material Code: 0455A Material Name: **BATTERIES** Case No.: Not reported Material FA: Other 0 Quantity: Pounds Units:

Resource Affected: Not reported Oxygenate: False

No

Tank Test:

Recovered:

Not reported Site ID: Spill Tank Test: Not reported Tank Number: Not reported Not reported Tank Size: Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Modified By: Not reported Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

Spill Number: 9200241

GEISENDORFER Investigator: Caller Name: Not reported Caller Agency: Not reported Caller Phone: Not reported Notifier Name: Not reported Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 06/03/1991 12:00 Reported to Dept Date/Time: 04/06/92 12:00 SWIS: 01

Spiller Name: NORRIS MACFARLAND

Spiller Contact: Not reported Spiller Phone: Not reported Spiller Address: 41 STATE ST Spiller City,St,Zip: **ALBANY 12207** Spill Cause: Deliberate Reported to Dept: On Land

Water Affected: **GROUNDWATER** S103482074

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MACFARLAND NORTHWAY LN (Continued)

S103482074

Spill Source: 01

Spill Notifier: Fire Department PBS Number: Not reported

Cleanup Ceased: Cleanup Meets Std: False Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Spiller Cleanup Dt: **Enforcement Date:** / / Invstgn Complete: // **UST Involvement:** False

Spill Class: Known release that creates potential for fire or hazard. DEC Response.

Willing Responsible Party. Corrective action taken.

Spill Closed Dt:

Corrective Action Plan Submitted: Date Region Sent Summary to Central Office: / / Date Spill Entered In Computer Data File: 04/08/92 Date Spill Entered In Computer Data File: Not reported

Update Date: 09/09/98 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Not reported Gross Leak Rate:

Material:

Material Class Type: Raw Sewage

Quantity Spilled: O Unkonwn Quantity Spilled: True Gallons Quantity Recovered: Unkonwn Quantity Recovered: False

UNKNOWN MATERIAL Material: **UNKNOWN MATERIAL** Class Type:

Times Material Entry In File: 9140 CAS Number: Not reported Last Date: 19941109

Material Class Type: Hazardous Material

Quantity Spilled: 0 Unkonwn Quantity Spilled: True Units: Pounds Quantity Recovered: 0 Unkonwn Quantity Recovered: False Material: **BATTERIES** Class Type: **BATTERIES**

Times Material Entry In File: 38

Unkonwn Quantity Recovered: False

CAS Number: Not reported Last Date: Not reported Material Class Type: Petroleum Quantity Spilled: Unkonwn Quantity Spilled: True Units: Gallons Quantity Recovered:

Direction Distance

EDR ID Number Elevation Site Database(s) **EPA ID Number**

MACFARLAND NORTHWAY LN (Continued)

S103482074

UNKNOWN PETROLEUM Material: UNKNOWN PETROLEUM Class Type:

Times Material Entry In File: 16414 CAS Number: Not reported Last Date: 19940929

09/28/95: This is additional information about material spilled from the DEC Remarks:

translation of the old spill file: UGT,AGT,DRUMS,BATTS

1 AGT, 2 UGTS AT LEAST), LEAKING DRUMS, BATTERIES, POSS DUMPING OF ACID Remark:

MATERIAL.

HOUSE ASBESTOS SAND CREEK NY Spills S105058004 164 WNW **542 SAND CREEK RD NY Hist Spills** N/A

1/4-1/2 0.495 mi. 2611 ft.

Actual:

300 ft.

NY Spills: Relative: Site ID: Higher

ALBANY, NY

223997 Facility Addr2: Not reported Facility ID: 0102646 Spill Number: 0102646 Facility Type: ER SWIS: 0126

WTCHRIST Investigator: Referred To: Not reported 6/8/2001 Spill Date: Reported to Dept: 6/8/2001 CID: 196 Spill Cause: Deliberate Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Citizen

Cleanup Ceased: Not reported Cleanup Meets Std: True Last Inspection: Not reported

Penalty Not Recommended Recommended Penalty:

UST Trust: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 7/6/2001 Remediation Phase: Date Entered In Computer: 6/8/2001 Spill Record Last Update: 4/4/2008 Spiller Name: Not reported Spiller Company: UNKNOWN

Spiller Address: 542 SAND CREEK RD Spiller City, St, Zip: ALBANY, NY 12205

Spiller Company: 001

Contact Name: Not reported Contact Phone: Not reported

DEC Region: 4 DER Facility ID: 185145

DEC Memo: Prior to Sept, 2004 data translation this spill Lead DEC Field was

"CHRISTENSEN" No DEC response. wtc

Remarks: caller states that people are doing work on a house at 542 sand creek

> rd. in colonie and a dumpster is in front of the house it is full of isbestos [SP]. citizen would like a call tonight ask for amanda.

Direction Distance Elevation

tion Site Database(s) EPA ID Number

HOUSE ASBESTOS SAND CREEK (Continued)

S105058004

EDR ID Number

Material:

 Site ID:
 223997

 Operable Unit ID:
 839326

 Operable Unit:
 01

 Material ID:
 534759

 Material Code:
 0026A

 Material Name:
 ASBESTOS

 Case No.:
 01332214

Material FA: Hazardous Material

0

Quantity:

Units: Gallons
Recovered: No
Resource Affected: Not reported
Oxygenate: False

Tank Test:

Site ID: Not reported Spill Tank Test: Not reported Not reported Tank Number: Tank Size: Not reported Test Method: Not reported Leak Rate: Not reported Gross Fail: Not reported Not reported Modified By: Last Modified: Not reported Test Method: Not reported

NY Hist Spills:

Region of Spill: 4

0102646 Spill Number: **CHRISTENSEN** Investigator: Not reported Caller Name: Caller Agency: Not reported Caller Phone: Not reported Not reported Notifier Name: Notifier Agency: Not reported Notifier Phone: Not reported Spill Date/Time: 06/08/2001 19:04 Reported to Dept Date/Time: 06/08/01 19:04

SWIS: 01

Spiller Name: UNKNOWN "542

Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Address: SAND CREEK RD
Spiller City,St,Zip: ALBANY", NY 12205-

Spill Cause: Deliberate
Reported to Dept: On Land
Water Affected: Not reported
Spill Source: 02
Spill Notifier: Citizen

Spill Notifier: Citizen
PBS Number: Not reported
Cleanup Ceased: / /
Cleanup Mosto Std. True

Cleanup Meets Std: True Last Inspection: //

Recommended Penalty: Penalty Not Recommended

Direction Distance

Elevation Site Database(s) EPA ID Number

HOUSE ASBESTOS SAND CREEK (Continued)

S105058004

EDR ID Number

Spiller Cleanup Dt: //
Enforcement Date: //
Invstgn Complete: //
UST Involvement: False

Spill Class: Possible release with minimal potential for fire or hazard or Known

release with no damage. No DEC Response. No corrective action

required.

Spill Closed Dt: 07/06/01

Corrective Action Plan Submitted: //
Date Region Sent Summary to Central Office: //
Date Spill Entered In Computer Data File: 06/08/01
Date Spill Entered In Computer Data File: Not reported

Update Date: 07/06/01 Is Updated: False

Tank:

PBS Number: Not reported Tank Number: Not reported Tank Size: Not reported Test Method: Not reported Leak Rate Failed Tank: Not reported Gross Leak Rate: Not reported

Material:

Material Class Type: Nonpetroleum/Nonhazardous

Quantity Spilled: 0
Unkonwn Quantity Spilled: True
Units: Gallons
Quantity Recovered: 0
Unkonwn Quantity Recovered: True

Material: ASBESTOS Class Type: ASBESTOS

Times Material Entry In File: 0

CAS Number: 01332214
Last Date: Not reported
DEC Remarks: No DEC response. wtc

Remark: caller states that people are doing work on a house at 542 sand creek rd. in

colonie and a dumpster is in front of the house it is full of isbestos SP .

citi en would like a call tonight ask for amanda.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip Database(s)
ГАТНАМ	1000239238	NIAGARA MOHAWK POWER CORP	LATHAM SUB - TROY RD	12110 FINDS.RCRA-NLR.MANIFEST
ALBANY	1001028491	NYS DEPT OF CIVIL SRVC	STATE OFFICE BLDG C	12239 FINDS, MANIFEST, RCRA-NLR
ALBANY	1001968785	NYSDOT - REGION 1	I-90 OVER RTE 5 BIN# 1034519	12205 FINDS, MANIFEST, RCRA-NLR
COLONIE	1003863719	COLONIE SANITARY LF	RTE 9 & CRESCENT RD	12212 CERCLIS-NFRAP
ALBANY	1004760793	NYSDOT GRAPHIC ARTS	STATE CAMPUS BLDG 18	12226 FINDS, RCRA-NLR
ALBANY	1004761852	SCHUYLER MEADOWS CLUB	SPRING ST	12211 FINDS, MANIFEST, RCRA-NLR
ALBANY	1009225534	NYS DMV 244B INSERTING	EMPIRE STATE PLAZA-SWAN ST	12228 MANIFEST
LATHAM	1009225966	CUMBERLAND FARMS INC	ROUTE 9	12110 MANIFEST
ALBANY	1009226139	NYSDEC	MONTAUK HWY / WALKER AV	12233 MANIFEST
ALBANY	1009231497	SPANCRETE	RT 155	MANIFEST
LATHAM	1009233295	NYNEX	RT 155 WADE / WOLF RD EXIT	12110 MANIFEST
ALBANY	1009233540	NYNEX	MH23 RTE 9W	MANIFEST
ALBANY	1009235374	NYSDEC	RT 112 / SUNRISE HWY	12233 MANIFEST
COLONIE	1012186364	NYSDOT BIN 1004250	RTE 7 OVER I-87	12110 RCRA-LQG
COLONIE	1012186367	NYSDOT BIN 1072440	MILLER RD OVER RTE 7	12110 RCRA-LQG
COLONIE	S107408664	DRUM RAILROAD @ INTERSTATE RR AVE	RAILROAD AVE @ INTERSTATE A	12205 SPILLS
COLONIE	S109785059	ALBANY COUNTY AIRPORT	RTE 155 / SHAKER RD	12211 MANIFEST
COLONIE	S109785306	CUMBERLAND FARMS 3141	RTE 9 / BOUGHT ST	12205 MANIFEST
COLONIE	S110044614	CDTA BUS INTERSTATE @ CENTRAL	INTERSTATE @ CENTRAL AVE RT 5	SPILLS
LATHAM	U004079215	LATHAM MOTORS, INC.	OLD LOUDON RD & ROUTE 9R	12110 UST NCFM

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 07/02/2010 Source: EPA
Date Data Arrived at EDR: 07/14/2010 Telephone: N/A

Date Made Active in Reports: 10/04/2010 Last EDR Contact: 10/13/2010

Number of Days to Update: 82 Next Scheduled EDR Contact: 01/24/2011
Data Release Frequency: Quarterly

NPL Site Boundaries

Sources

EPA's Environmental Photographic Interpretation Center (EPIC)

Telephone: 202-564-7333

EPA Region 1 EPA Region 6

Telephone 617-918-1143 Telephone: 214-655-6659

EPA Region 3 EPA Region 7

Telephone 215-814-5418 Telephone: 913-551-7247

EPA Region 4 EPA Region 8

Telephone 404-562-8033 Telephone: 303-312-6774

EPA Region 5 EPA Region 9

Telephone 312-886-6686 Telephone: 415-947-4246

EPA Region 10

Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 07/02/2010 Source: EPA
Date Data Arrived at EDR: 07/14/2010 Telephone: N/A

Date Made Active in Reports: 10/04/2010 Last EDR Contact: 10/13/2010

Number of Days to Update: 82 Next Scheduled EDR Contact: 01/24/2011
Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Source: EPA

Date of Government Version: 10/15/1991 Date Data Arrived at EDR: 02/02/1994 Date Made Active in Reports: 03/30/1994

Number of Days to Update: 56

Telephone: 202-564-4267 Last EDR Contact: 08/16/2010

Next Scheduled EDR Contact: 11/29/2010
Data Release Frequency: No Update Planned

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 07/02/2010 Date Data Arrived at EDR: 07/14/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 82

Source: EPA Telephone: N/A

Last EDR Contact: 10/13/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 01/29/2010 Date Data Arrived at EDR: 02/09/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 62

Source: EPA

Telephone: 703-412-9810 Last EDR Contact: 10/01/2010

Next Scheduled EDR Contact: 01/10/2011 Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPAa??s Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 06/23/2009 Date Data Arrived at EDR: 01/15/2010 Date Made Active in Reports: 02/10/2010

Number of Days to Update: 26

Source: Environmental Protection Agency

Telephone: 703-603-8704 Last EDR Contact: 10/13/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 06/23/2009 Date Data Arrived at EDR: 09/02/2009 Date Made Active in Reports: 09/21/2009

Number of Days to Update: 19

Source: EPA

Telephone: 703-412-9810 Last EDR Contact: 10/01/2010

Next Scheduled EDR Contact: 12/13/2010 Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 05/25/2010 Date Data Arrived at EDR: 06/02/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 124

Source: EPA

Telephone: 800-424-9346 Last EDR Contact: 08/16/2010

Next Scheduled EDR Contact: 11/29/2010 Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 02/17/2010 Date Data Arrived at EDR: 02/19/2010 Date Made Active in Reports: 05/17/2010

Number of Days to Update: 87

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/07/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2010 Date Data Arrived at EDR: 02/19/2010 Date Made Active in Reports: 05/17/2010

Number of Days to Update: 87

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/07/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 02/17/2010 Date Data Arrived at EDR: 02/19/2010 Date Made Active in Reports: 05/17/2010

Number of Days to Update: 87

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/07/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2010 Date Data Arrived at EDR: 02/19/2010 Date Made Active in Reports: 05/17/2010

Number of Days to Update: 87

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/07/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Varies

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 12/20/2009 Date Data Arrived at EDR: 01/20/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 82

Source: Environmental Protection Agency

Telephone: 703-603-0695 Last EDR Contact: 09/13/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 12/20/2009 Date Data Arrived at EDR: 01/20/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 82

Source: Environmental Protection Agency

Telephone: 703-603-0695 Last EDR Contact: 09/13/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 07/09/2010 Date Data Arrived at EDR: 07/09/2010 Date Made Active in Reports: 08/17/2010

Number of Days to Update: 39

Source: National Response Center, United States Coast Guard

Telephone: 202-267-2180 Last EDR Contact: 10/06/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Annually

State- and tribal - equivalent CERCLIS

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9622 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Annually

VAPOR REOPENED: Vapor Intrustion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

Date of Government Version: 08/13/2010
Date Data Arrived at EDR: 08/25/2010
Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmenal Conservation

Telephone: 518-402-9814 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Varies

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites

Date of Government Version: 07/14/2010 Date Data Arrived at EDR: 07/16/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 25

Source: Department of Environmental Conservation

Telephone: 518-457-2051 Last EDR Contact: 10/08/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: Semi-Annually

State and tribal leaking storage tank lists

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/15/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Varies

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 07/08/2005 Date Made Active in Reports: 07/14/2005

Number of Days to Update: 6

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 07/07/2005 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 08/27/2010 Date Data Arrived at EDR: 08/30/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 35

Source: EPA Region 4 Telephone: 404-562-8677 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Semi-Annually

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 08/30/2010 Date Data Arrived at EDR: 08/30/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 35

Source: Environmental Protection Agency

Telephone: 415-972-3372 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Quarterly

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 08/05/2010 Date Data Arrived at EDR: 08/06/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 59

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Quarterly

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 02/19/2009 Date Data Arrived at EDR: 02/19/2009 Date Made Active in Reports: 03/16/2009

Number of Days to Update: 25

Source: EPA Region 1 Telephone: 617-918-1313 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 08/05/2010 Date Data Arrived at EDR: 08/06/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 59

Source: EPA Region 6 Telephone: 214-665-6597 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 11/04/2009 Date Data Arrived at EDR: 05/04/2010 Date Made Active in Reports: 07/07/2010

Number of Days to Update: 64

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 08/11/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 05/24/2010 Date Data Arrived at EDR: 05/27/2010 Date Made Active in Reports: 08/09/2010

Number of Days to Update: 74

Source: EPA Region 8 Telephone: 303-312-6271 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Quarterly

State and tribal registered storage tank lists

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 06/17/2010 Date Data Arrived at EDR: 06/18/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 53

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/06/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 10/24/2005

Next Scheduled EDR Contact: 01/23/2006 Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005

Next Scheduled EDR Contact: 10/24/2005

Data Release Frequency: Varies

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 06/17/2010 Date Data Arrived at EDR: 06/18/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 53

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/06/2010

Next Scheduled EDR Contact: 01/17/2011
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005

Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 02/20/2002 Date Made Active in Reports: 03/22/2002

Number of Days to Update: 30

Source: NYSDEC Telephone: 518-402-9549 Last EDR Contact: 07/25/2005

Next Scheduled EDR Contact: 10/24/2005 Data Release Frequency: No Update Planned

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 06/17/2010 Date Data Arrived at EDR: 06/18/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 53

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/06/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Quarterly

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 06/17/2010 Date Data Arrived at EDR: 06/18/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 53

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/06/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Quarterly

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 08/03/2010 Date Data Arrived at EDR: 08/04/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 61

Source: EPA Region 6 Telephone: 214-665-7591 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Semi-Annually

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 02/11/2010 Date Data Arrived at EDR: 02/11/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 60

Source: EPA Region 5 Telephone: 312-886-6136 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 08/27/2010 Date Data Arrived at EDR: 08/30/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 35

Source: EPA Region 4 Telephone: 404-562-9424 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Semi-Annually

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 08/30/2010 Date Data Arrived at EDR: 08/30/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 35

Source: EPA Region 9 Telephone: 415-972-3368 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Quarterly

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 05/24/2010 Date Data Arrived at EDR: 05/27/2010 Date Made Active in Reports: 08/09/2010

Number of Days to Update: 74

Source: EPA Region 8 Telephone: 303-312-6137 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Quarterly

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 04/01/2008 Date Data Arrived at EDR: 12/30/2008 Date Made Active in Reports: 03/16/2009

Number of Days to Update: 76

Source: EPA Region 7 Telephone: 913-551-7003 Last EDR Contact: 08/11/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 08/05/2010 Date Data Arrived at EDR: 08/06/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 59

Source: EPA Region 10 Telephone: 206-553-2857 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Quarterly

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 02/19/2009 Date Data Arrived at EDR: 02/19/2009 Date Made Active in Reports: 03/16/2009

Number of Days to Update: 25

Source: EPA, Region 1 Telephone: 617-918-1313 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010 Date Data Arrived at EDR: 02/16/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 55

Source: FEMA

Telephone: 202-646-5797 Last EDR Contact: 07/19/2010

Next Scheduled EDR Contact: 11/01/2010 Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9553 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9553 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Quarterly

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 12/31/1992 Date Data Arrived at EDR: 01/31/2007 Date Made Active in Reports: 04/19/2007

Number of Days to Update: 78

Source: NYC Department of City Planning

Telephone: 212-720-3401 Last EDR Contact: 09/27/2010

Next Scheduled EDR Contact: 01/10/2011 Data Release Frequency: No Update Planned

State and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9711 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Semi-Annually

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 04/02/2008 Date Data Arrived at EDR: 04/22/2008 Date Made Active in Reports: 05/19/2008

Number of Days to Update: 27

Source: EPA, Region 1 Telephone: 617-918-1102 Last EDR Contact: 10/04/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Lisitng

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008 Date Data Arrived at EDR: 04/22/2008 Date Made Active in Reports: 05/19/2008

Number of Days to Update: 27

Source: EPA, Region 7 Telephone: 913-551-7365 Last EDR Contact: 04/20/2009

Next Scheduled EDR Contact: 07/20/2009 Data Release Frequency: Varies

State and tribal Brownfields sites

ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a \$200 million Environmental Restoration or Brownfields Fund as part of the \$1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9622 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Quarterly

BROWNFIELDS: Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9764 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Semi-Annually

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 06/24/2010 Date Data Arrived at EDR: 06/25/2010 Date Made Active in Reports: 08/17/2010

Number of Days to Update: 53

Source: Environmental Protection Agency

Telephone: 202-566-2777 Last EDR Contact: 09/29/2010

Next Scheduled EDR Contact: 01/10/2011 Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985 Date Data Arrived at EDR: 08/09/2004 Date Made Active in Reports: 09/17/2004 Number of Days to Update: 39 Source: Environmental Protection Agency Telephone: 800-424-9346

Last EDR Contact: 06/09/2004 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009 Date Data Arrived at EDR: 05/07/2009 Date Made Active in Reports: 09/21/2009

Number of Days to Update: 137

Source: EPA, Region 9 Telephone: 415-947-4219 Last EDR Contact: 10/18/2010

Next Scheduled EDR Contact: 01/10/2011 Data Release Frequency: Varies

SWTIRE: Registered Waste Tire Storage & Facility List
A listing of facilities registered to accept waste tires.

Date of Government Version: 08/01/2006 Date Data Arrived at EDR: 11/15/2006 Date Made Active in Reports: 11/30/2006

Number of Days to Update: 15

Source: Department of Environmental Conservation

Telephone: 518-402-8694 Last EDR Contact: 07/30/2010

Next Scheduled EDR Contact: 11/08/2010 Data Release Frequency: Annually

SWRCY: Registered Recycling Facility List A listing of recycling facilities.

Date of Government Version: 07/14/2010 Date Data Arrived at EDR: 07/16/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 25

Source: Department of Environmental Conservation

Telephone: 518-402-8705 Last EDR Contact: 10/08/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: Semi-Annually

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998 Date Data Arrived at EDR: 12/03/2007 Date Made Active in Reports: 01/24/2008

Number of Days to Update: 52

Source: Environmental Protection Agency

Telephone: 703-308-8245 Last EDR Contact: 09/07/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 05/07/2010 Date Data Arrived at EDR: 06/18/2010 Date Made Active in Reports: 08/17/2010

Number of Days to Update: 60

Source: Drug Enforcement Administration

Telephone: 202-307-1000 Last EDR Contact: 09/17/2010

Next Scheduled EDR Contact: 12/20/2010 Data Release Frequency: Quarterly

DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9622 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Annually

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/01/2007 Date Data Arrived at EDR: 11/19/2008 Date Made Active in Reports: 03/30/2009

Number of Days to Update: 131

Source: Drug Enforcement Administration

Telephone: 202-307-1000 Last EDR Contact: 03/23/2009

Next Scheduled EDR Contact: 06/22/2009 Data Release Frequency: No Update Planned

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006

Number of Days to Update: 48

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/23/2006

Next Scheduled EDR Contact: 01/22/2007

Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 06/02/2006 Date Made Active in Reports: 07/20/2006

Number of Days to Update: 48

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/23/2006

Next Scheduled EDR Contact: 01/22/2007 Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 05/06/2010 Date Data Arrived at EDR: 05/11/2010 Date Made Active in Reports: 08/09/2010

Number of Days to Update: 90

Source: Environmental Protection Agency

Telephone: 202-564-6023 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005 Date Data Arrived at EDR: 12/11/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 31

Source: Department of the Navy Telephone: 843-820-7326 Last EDR Contact: 09/08/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Varies

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 04/06/2010 Date Data Arrived at EDR: 04/07/2010 Date Made Active in Reports: 05/27/2010

Number of Days to Update: 50

Source: U.S. Department of Transportation

Telephone: 202-366-4555 Last EDR Contact: 10/07/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Annually

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 08/24/2010 Date Data Arrived at EDR: 08/25/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 30

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 10/15/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002 Date Data Arrived at EDR: 07/08/2005 Date Made Active in Reports: 07/14/2005

Number of Days to Update: 6

Source: Department of Environmental Conservation

Telephone: 518-402-9549 Last EDR Contact: 07/07/2005 Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA-NonGen: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous

waste.

Date of Government Version: 02/17/2010 Date Data Arrived at EDR: 02/19/2010 Date Made Active in Reports: 05/17/2010

Number of Days to Update: 87

Source: Environmental Protection Agency

Telephone: (212) 637-3660 Last EDR Contact: 10/07/2010

Next Scheduled EDR Contact: 01/17/2011 Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transporation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/12/2010 Date Data Arrived at EDR: 02/09/2010 Date Made Active in Reports: 04/12/2010

Number of Days to Update: 62

Source: Department of Transporation, Office of Pipeline Safety

Telephone: 202-366-4595 Last EDR Contact: 08/11/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 11/10/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 62

Source: USGS

Telephone: 703-692-8801 Last EDR Contact: 07/22/2010

Next Scheduled EDR Contact: 11/01/2010 Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2008 Date Data Arrived at EDR: 09/30/2009 Date Made Active in Reports: 12/01/2009

Number of Days to Update: 62

Source: U.S. Army Corps of Engineers

Telephone: 202-528-4285 Last EDR Contact: 09/14/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 04/11/2010 Date Data Arrived at EDR: 04/19/2010 Date Made Active in Reports: 05/17/2010

Number of Days to Update: 28

Source: Department of Justice, Consent Decree Library

Telephone: Varies

Last EDR Contact: 10/04/2010

Next Scheduled EDR Contact: 01/17/2011

Data Release Frequency: Varies

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 06/01/2010 Date Data Arrived at EDR: 06/16/2010 Date Made Active in Reports: 08/17/2010

Number of Days to Update: 62

Source: EPA

Telephone: 703-416-0223 Last EDR Contact: 09/15/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 12/14/2009 Date Data Arrived at EDR: 09/29/2010 Date Made Active in Reports: 10/04/2010

Number of Days to Update: 5

Source: Department of Energy Telephone: 505-845-0011 Last EDR Contact: 09/01/2010

Next Scheduled EDR Contact: 12/13/2010 Data Release Frequency: Varies

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 05/07/2010 Date Data Arrived at EDR: 06/09/2010 Date Made Active in Reports: 08/30/2010

Number of Days to Update: 82

Source: Department of Labor, Mine Safety and Health Administration

Telephone: 303-231-5959 Last EDR Contact: 09/09/2010

Next Scheduled EDR Contact: 12/20/2010 Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2008 Date Data Arrived at EDR: 01/13/2010 Date Made Active in Reports: 02/18/2010

Number of Days to Update: 36

Source: EPA

Telephone: 202-566-0250 Last EDR Contact: 09/01/2010

Next Scheduled EDR Contact: 12/13/2010 Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2002 Date Data Arrived at EDR: 04/14/2006 Date Made Active in Reports: 05/30/2006

Number of Days to Update: 46

Source: EPA

Telephone: 202-260-5521 Last EDR Contact: 10/01/2010

Next Scheduled EDR Contact: 01/10/2011 Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances

Telephone: 202-566-1667 Last EDR Contact: 08/30/2010

Next Scheduled EDR Contact: 12/13/2010 Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009 Date Data Arrived at EDR: 04/16/2009 Date Made Active in Reports: 05/11/2009

Number of Days to Update: 25

Source: EPA

Telephone: 202-566-1667 Last EDR Contact: 08/30/2010

Next Scheduled EDR Contact: 12/13/2010 Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2007

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006 Date Data Arrived at EDR: 03/01/2007 Date Made Active in Reports: 04/10/2007

Number of Days to Update: 40

Source: Environmental Protection Agency

Telephone: 202-564-2501 Last EDR Contact: 12/17/2008

Next Scheduled EDR Contact: 03/17/2008 Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2008 Date Data Arrived at EDR: 01/06/2010 Date Made Active in Reports: 02/10/2010

Number of Days to Update: 35

Source: EPA

Telephone: 202-564-4203 Last EDR Contact: 08/16/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 04/24/2010 Date Data Arrived at EDR: 04/29/2010 Date Made Active in Reports: 05/17/2010

Number of Days to Update: 18

Source: Environmental Protection Agency

Telephone: 202-564-5088 Last EDR Contact: 09/27/2010

Next Scheduled EDR Contact: 01/10/2011 Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 02/01/2010
Date Data Arrived at EDR: 04/22/2010
Date Made Active in Reports: 08/09/2010

Number of Days to Update: 109

Source: EPA

Telephone: 202-566-0500 Last EDR Contact: 07/30/2010

Next Scheduled EDR Contact: 11/01/2010 Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 03/18/2010 Date Data Arrived at EDR: 04/06/2010 Date Made Active in Reports: 05/27/2010

Number of Days to Update: 51

Source: Nuclear Regulatory Commission

Telephone: 301-415-7169 Last EDR Contact: 09/13/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/13/2010 Date Data Arrived at EDR: 07/14/2010 Date Made Active in Reports: 08/09/2010

Number of Days to Update: 26

Source: Environmental Protection Agency

Telephone: 202-343-9775 Last EDR Contact: 10/14/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 04/14/2010 Date Data Arrived at EDR: 04/16/2010 Date Made Active in Reports: 05/27/2010

Number of Days to Update: 41

Source: EPA

Telephone: (212) 637-3000 Last EDR Contact: 09/15/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995 Date Data Arrived at EDR: 07/03/1995 Date Made Active in Reports: 08/07/1995

Number of Days to Update: 35

Source: EPA

Telephone: 202-564-4104 Last EDR Contact: 06/02/2008

Next Scheduled EDR Contact: 09/01/2008

Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2007 Date Data Arrived at EDR: 02/25/2010 Date Made Active in Reports: 05/12/2010

Number of Days to Update: 76

Source: EPA/NTIS Telephone: 800-424-9346 Last EDR Contact: 08/24/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Biennially

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003 Date Data Arrived at EDR: 10/20/2006 Date Made Active in Reports: 11/30/2006

Number of Days to Update: 41

Source: Department of Environmental Conservation

Telephone: 518-402-9564 Last EDR Contact: 05/26/2009

Next Scheduled EDR Contact: 08/24/2009 Data Release Frequency: No Update Planned

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 07/28/2010 Date Data Arrived at EDR: 08/11/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 44

Source: Department of Environmental Conservation

Telephone: 518-402-8651 Last EDR Contact: 08/11/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Annually

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 03/23/2010 Date Data Arrived at EDR: 03/25/2010 Date Made Active in Reports: 05/06/2010

Number of Days to Update: 42

Source: Department of Environmental Conservation

Telephone: 518-402-8403 Last EDR Contact: 09/20/2010

Next Scheduled EDR Contact: 01/03/2011 Data Release Frequency: Varies

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 07/19/2010 Date Data Arrived at EDR: 07/19/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 22

Source: Department of Environmental Conservation

Telephone: 518-402-8233 Last EDR Contact: 10/18/2010

Next Scheduled EDR Contact: 01/31/2011 Data Release Frequency: No Update Planned

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 12/31/2008 Date Data Arrived at EDR: 08/06/2010 Date Made Active in Reports: 09/24/2010

Number of Days to Update: 49

Source: Department of Environmental Conservation

Telephone: 518-402-8452 Last EDR Contact: 08/02/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 05/25/2010 Date Data Arrived at EDR: 07/06/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 35

Source: New York City Department of City Planning

Telephone: 718-595-6658 Last EDR Contact: 09/28/2010

Next Scheduled EDR Contact: 01/10/2011 Data Release Frequency: Varies

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 12/08/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 34

Source: USGS

Telephone: 202-208-3710 Last EDR Contact: 07/22/2010

Next Scheduled EDR Contact: 11/01/2010 Data Release Frequency: Semi-Annually

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 05/12/2010 Date Data Arrived at EDR: 05/13/2010 Date Made Active in Reports: 08/17/2010

Number of Days to Update: 96

Source: Environmental Protection Agency

Telephone: 615-532-8599 Last EDR Contact: 08/23/2010

Next Scheduled EDR Contact: 11/08/2010 Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 11/09/2009 Date Data Arrived at EDR: 12/18/2009 Date Made Active in Reports: 02/10/2010

Number of Days to Update: 54

Source: Environmental Protection Agency

Telephone: N/A

Last EDR Contact: 09/15/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 02/06/2006 Date Made Active in Reports: 01/11/2007

Number of Days to Update: 339

Source: U.S. Geological Survey Telephone: 888-275-8747 Last EDR Contact: 07/22/2010

Next Scheduled EDR Contact: 11/01/2010

Data Release Frequency: N/A

COAL ASH DOE: Sleam-Electric Plan Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005 Date Data Arrived at EDR: 08/07/2009 Date Made Active in Reports: 10/22/2009

Number of Days to Update: 76

COAL ASH: Coal Ash Disposal Site Listing
A listing of coal ash disposal site locations.

Date of Government Version: 07/14/2010 Date Data Arrived at EDR: 07/16/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 25

Source: Department of Energy Telephone: 202-586-8719 Last EDR Contact: 07/21/2010 Next Scheduled EDR Contact: 11/01/2010

Data Release Frequency: Varies

Source: Department of Environmental Conservation

Telephone: 518-402-8660 Last EDR Contact: 10/08/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: Varies

FINANCIAL ASSURANCE 2: Financial Assurance Information Listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 10/31/2008 Date Data Arrived at EDR: 11/25/2008 Date Made Active in Reports: 12/11/2008

Number of Days to Update: 16

Source: Department of Environmental Conservation

Telephone: 518-402-8712 Last EDR Contact: 10/12/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: Varies

FINANCIAL ASSURANCE: Financial Assurance Information Listing

Financial assurance information.

Date of Government Version: 07/13/2010 Date Data Arrived at EDR: 07/14/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 27

Source: Department of Environmental Conservation

Telephone: 518-402-8660 Last EDR Contact: 07/12/2010

Next Scheduled EDR Contact: 10/25/2010 Data Release Frequency: Quarterly

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 01/01/2008 Date Data Arrived at EDR: 02/18/2009 Date Made Active in Reports: 05/29/2009

Number of Days to Update: 100

Source: Environmental Protection Agency

Telephone: 202-566-0517 Last EDR Contact: 08/10/2010

Next Scheduled EDR Contact: 11/15/2010 Data Release Frequency: Varies

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A Date Data Arrived at EDR: N/A Date Made Active in Reports: N/A Number of Days to Update: N/A Source: EDR, Inc. Telephone: N/A Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

COUNTY RECORDS

CORTLAND COUNTY:

Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 04/22/2010 Date Data Arrived at EDR: 04/22/2010 Date Made Active in Reports: 05/10/2010

Number of Days to Update: 18

Source: Cortland County Health Department

Telephone: 607-753-5035 Last EDR Contact: 08/23/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Quarterly

Cortland County Storage Tank Listing

A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 04/22/2010 Date Data Arrived at EDR: 04/22/2010 Date Made Active in Reports: 05/10/2010

Number of Days to Update: 18

Source: Cortland County Health Department

Telephone: 607-753-5035 Last EDR Contact: 08/23/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Quarterly

NASSAU COUNTY:

Registered Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003 Date Data Arrived at EDR: 05/27/2003 Date Made Active in Reports: 06/09/2003

Number of Days to Update: 13

Source: Nassau County Health Department

Telephone: 516-571-3314 Last EDR Contact: 10/12/2010

Next Scheduled EDR Contact: 01/24/2011 Data Release Frequency: No Update Planned

Storage Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 04/13/2010 Date Data Arrived at EDR: 06/23/2010 Date Made Active in Reports: 06/28/2010

Number of Days to Update: 5

Source: Nassau County Office of the Fire Marshal

Telephone: 516-572-1000 Last EDR Contact: 08/09/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Varies

Registered Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 05/21/2003 Date Data Arrived at EDR: 05/27/2003 Date Made Active in Reports: 06/09/2003

Number of Days to Update: 13

Source: Nassau County Health Department

Telephone: 516-571-3314 Last EDR Contact: 10/12/2010

Next Scheduled EDR Contact: 01/24/2011
Data Release Frequency: No Update Planned

Storage Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 04/13/2010 Date Data Arrived at EDR: 06/23/2010 Date Made Active in Reports: 06/28/2010

Number of Days to Update: 5

Source: Nassau County Office of the Fire Marshal

Telephone: 516-572-1000 Last EDR Contact: 08/09/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Varies

ROCKLAND COUNTY:

Petroleum Bulk Storage Database

A listing of aboveground storage tank sites located in Rockland County.

Date of Government Version: 06/25/2010 Date Data Arrived at EDR: 06/25/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 46

Source: Rockland County Health Department

Telephone: 914-364-2605 Last EDR Contact: 09/13/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Quarterly

Petroleum Bulk Storage Database

A listing of underground storage tank sites located in Rockland County.

Date of Government Version: 06/25/2010 Date Data Arrived at EDR: 06/25/2010 Date Made Active in Reports: 08/10/2010

Number of Days to Update: 46

Source: Rockland County Health Department

Telephone: 914-364-2605 Last EDR Contact: 09/13/2010

Next Scheduled EDR Contact: 12/27/2010 Data Release Frequency: Quarterly

SUFFOLK COUNTY:

Storage Tank Database

A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006 Date Data Arrived at EDR: 01/11/2007 Date Made Active in Reports: 02/07/2007

Number of Days to Update: 27

Source: Suffolk County Department of Health Services

Telephone: 631-854-2521 Last EDR Contact: 08/09/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Annually

Storage Tank Database

A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 09/13/2006 Date Data Arrived at EDR: 01/11/2007 Date Made Active in Reports: 02/07/2007

Number of Days to Update: 27

Source: Suffolk County Department of Health Services

Telephone: 631-854-2521 Last EDR Contact: 08/09/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Annually

WESTCHESTER COUNTY:

Listing of Storage Tanks

A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 05/05/2005 Date Data Arrived at EDR: 05/31/2005 Date Made Active in Reports: 06/30/2005

Number of Days to Update: 30

Source: Westchester County Department of Health

Telephone: 914-813-5161 Last EDR Contact: 08/11/2010

Next Scheduled EDR Contact: 11/22/2010 Data Release Frequency: Varies

Listing of Storage Tanks

A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 05/05/2005 Date Data Arrived at EDR: 05/31/2005 Date Made Active in Reports: 06/30/2005

Number of Days to Update: 30

Source: Westchester County Department of Health

Telephone: 914-813-5161 Last EDR Contact: 08/11/2010

Next Scheduled EDR Contact: 11/22/2010

Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2007 Date Data Arrived at EDR: 08/26/2009 Date Made Active in Reports: 09/11/2009

Number of Days to Update: 16

Source: Department of Environmental Protection

Telephone: 860-424-3375 Last EDR Contact: 08/25/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Annually

NJ MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2009 Date Data Arrived at EDR: 07/22/2010 Date Made Active in Reports: 08/26/2010

Number of Days to Update: 35

Source: Department of Environmental Protection

Telephone: N/A

Last EDR Contact: 07/22/2010

Next Scheduled EDR Contact: 11/01/2010 Data Release Frequency: Annually

PA MANIFEST: Manifest Information
Hazardous waste manifest information.

Date of Government Version: 12/31/2008 Date Data Arrived at EDR: 12/01/2009 Date Made Active in Reports: 12/14/2009

Number of Days to Update: 13

Source: Department of Environmental Protection

Telephone: 717-783-8990 Last EDR Contact: 08/23/2010

Next Scheduled EDR Contact: 12/06/2010 Data Release Frequency: Annually

RI MANIFEST: Manifest information Hazardous waste manifest information

> Date of Government Version: 12/31/2009 Date Data Arrived at EDR: 07/19/2010 Date Made Active in Reports: 08/26/2010

Number of Days to Update: 38

Source: Department of Environmental Management

Telephone: 401-222-2797 Last EDR Contact: 08/30/2010

Next Scheduled EDR Contact: 12/13/2010 Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data Hazardous waste manifest information.

Date of Government Version: 03/29/2010 Date Data Arrived at EDR: 05/14/2010 Date Made Active in Reports: 06/22/2010

Number of Days to Update: 39

Source: Department of Environmental Conservation

Telephone: 802-241-3443 Last EDR Contact: 07/26/2010

Next Scheduled EDR Contact: 11/08/2010 Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2009 Date Data Arrived at EDR: 07/06/2010 Date Made Active in Reports: 07/26/2010

Number of Days to Update: 20

Source: Department of Natural Resources

Telephone: N/A

Last EDR Contact: 09/20/2010

Next Scheduled EDR Contact: 01/03/2011 Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data Source: Rextag Strategies Corp. Telephone: (281) 769-2247

U.S. Electric Transmission and Power Plants Systems Digital GIS Data

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services,

a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary

and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers Source: Department of Health Telephone: 212-676-2444

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2009 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK®-PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

INTERSTATE 87 EXIT 3 AIRPORT CONNECTOR WOLF ROAD AND ALBANY SHAKER ROAD ALBANY, NY 12211

TARGET PROPERTY COORDINATES

Latitude (North): 42.72770 - 42° 43' 39.7" Longitude (West): 73.8033 - 73° 48' 11.9"

Universal Tranverse Mercator: Zone 18 UTM X (Meters): 597974.0 UTM Y (Meters): 4731056.5

Elevation: 295 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map: 42073-F7 ALBANY, NY

Most Recent Revision: 1994

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

- 1. Groundwater flow direction, and
- 2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General NNW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

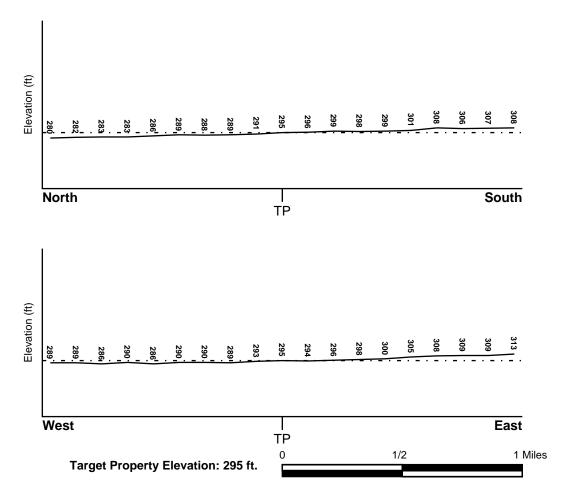

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

FEMA Flood

Target Property County ALBANY, NY Electronic Data
YES - refer to the Overview Map and Detail Map

Flood Plain Panel at Target Property:

3600070010C - FEMA Q3 Flood data

Additional Panels in search area:

0000000000 - FEMA Q3 Flood data

NATIONAL WETLAND INVENTORY

NWI Electronic

NWI Quad at Target Property

Data Coverage

ALBANY

YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius: 1.25 miles Status: Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

 MAP ID
 FROM TP
 GROUNDWATER FLOW

 Not Reported
 GROUNDWATER FLOW

^{*©1996} Site—specific hydrogeological data gathered by CERCLIS Alerts, Inc., Bainbridge Island, WA. All rights reserved. All of the information and opinions presented are those of the cited EPA report(s), which were completed under a Comprehensive Environmental Response Compensation and Liability Information System (CERCLIS) investigation.

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT

GEOLOGIC AGE IDENTIFICATION

Era: Paleozoic Category: Stratified Sequence


System: Ordovician

Series: Middle Ordovician (Mohawkian)

Code: O2 (decoded above as Era, System & Series)

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 2896934.2s

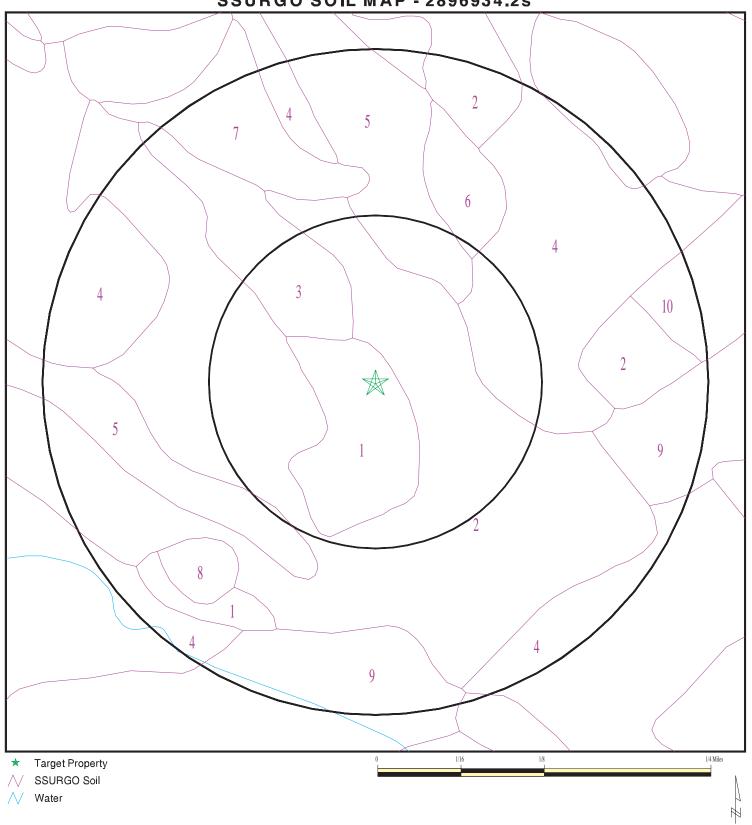

SITE NAME: Interstate 87 Exit 3 Airport Connector ADDRESS: Wolf Road and Albany Shaker Road Albany NY 12211 LAT/LONG: 42.7277/73.8033

CLIENT: Shumaker Cons. Engineering CONTACT: Jeff Mt. Pleasant INQUIRY #: 2896934.2s

October 18, 2010 3:07 pm DATE:

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Colonie

Soil Surface Texture: loamy fine sand

Hydrologic Group: Class A - High infiltration rates. Soils are deep, well drained to

excessively drained sands and gravels.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

			Soil Layer	r Information			
	Вои	ındary		Classi	fication	Saturated hydraulic	
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec	
1	0 inches	7 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6
2	7 inches	68 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6
3	68 inches	74 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6

Soil Map ID: 2

Soil Component Name: Elnora

Soil Surface Texture: loamy fine sand

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep,

moderately well and well drained soils with moderately coarse

textures.

> 54 inches

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Depth to Watertable Min:

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Soil Layer Information Saturated **Boundary** Classification hydraulic conductivity Layer Upper Lower Soil Texture Class **AASHTO Group Unified Soil Soil Reaction** micro m/sec (pH) 1 0 inches 11 inches loamy fine sand Silt-Clay **COARSE-GRAINED** Max: 141 Max: 7.3 Materials (more SOILS, Sands, Min: 42 Min: 5.1 than 35 pct. Sands with fines, passing No. Silty Sand. 200), Silty Soils. 2 11 inches 27 inches COARSE-GRAINED Max: 141 Max: 7.3 fine sand Silt-Clay Materials (more SOILS, Sands, Min: 42 Min: 5.1 than 35 pct. Sands with fines, Silty Sand. passing No. 200), Silty Soils. 3 COARSE-GRAINED 27 inches 64 inches Silt-Clay Max: 141 Max: 7.3 loamy fine sand Materials (more SOILS, Sands, Min: 42 Min: 5.1 than 35 pct. Sands with fines, passing No. Silty Sand. 200), Silty Soils.

Soil Map ID: 3

Soil Component Name: Colonie

Soil Surface Texture: loamy fine sand

Hydrologic Group: Class A - High infiltration rates. Soils are deep, well drained to

excessively drained sands and gravels.

Soil Drainage Class: Somewhat excessively drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

	Soil Layer Information									
	Bou	ındary		Classi	fication	Saturated hydraulic				
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec				
1	0 inches	7 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6			
2	7 inches	68 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6			
3	68 inches	74 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6			

Soil Map ID: 4

Soil Component Name: Stafford

Soil Surface Texture: loamy fine sand

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward

movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 31 inches

	Soil Layer Information									
	Вои	ındary	Soil Texture Class	Classi	fication	Saturated hydraulic				
Layer	Upper	Lower		AASHTO Group	Unified Soil	conductivity micro m/sec				
1	0 inches	11 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 6.5 Min: 5.1			
2	11 inches	29 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 6.5 Min: 5.1			
3	29 inches	59 inches	fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 6.5 Min: 5.1			

Soil Map ID: 5

Soil Component Name: Granby

Soil Surface Texture: loamy fine sand

Hydrologic Group: Class A/D - Drained/undrained hydrology class of soils that can be

drained and are classified.

Soil Drainage Class: Very poorly drained

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

	Soil Layer Information									
	Вои	ındary		Classi	fication	Saturated hydraulic				
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec	Soil Reaction (pH)			
1	0 inches	11 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 8.4 Min: 6.6			
2	11 inches	25 inches	fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 8.4 Min: 6.6			
3	25 inches	59 inches	sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 8.4 Min: 6.6			

Soil Map ID: 6

Soil Component Name: Unadilla
Soil Surface Texture: silt loam

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep,

moderately well and well drained soils with moderately coarse

textures.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

	Soil Layer Information									
	Воц	ındary		Classi	fication	Saturated hydraulic				
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec				
1	0 inches	9 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay. FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5			
2	9 inches	64 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay. FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), silt.	Max: 14 Min: 4	Max: 6 Min: 4.5			

Soil Map ID: 7

Soil Component Name: Elmridge

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward

movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 61 inches

	Soil Layer Information									
	Воц	ındary		Classi	fication	Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)			
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil					
1	0 inches	9 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 7.8 Min: 5.6			
2	9 inches	20 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 7.8 Min: 5.6			
3	20 inches	59 inches	clay	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 1.4 Min: 0.42	Max: 7.8 Min: 5.6			

Soil Map ID: 8

Soil Component Name: Colonie

Soil Surface Texture: loamy fine sand

Hydrologic Group: Class A - High infiltration rates. Soils are deep, well drained to

excessively drained sands and gravels.

Soil Drainage Class: Somewhat excessively drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

	Soil Layer Information									
	Воц	ındary		Classi	fication	Saturated hydraulic				
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec				
1	0 inches	7 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6			
2	7 inches	68 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6			
3	68 inches	74 inches	loamy fine sand	Granular materials (35 pct. or less passing No. 200), Silty, or Clayey Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 14	Max: 7.3 Min: 5.6			

Soil Map ID: 9

Soil Component Name: Udipsamments

Soil Surface Texture: coarse sand

Hydrologic Group: Class A - High infiltration rates. Soils are deep, well drained to

excessively drained sands and gravels.

Soil Drainage Class: Well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

	Soil Layer Information									
	Boundary			Classi	fication	Saturated hydraulic				
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity	Soil Reaction (pH)			
1	0 inches	70 inches	coarse sand	Granular materials (35 pct. or less passing No. 200), Stone Fragments, Gravel and Sand.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 141	Max: 5.5 Min: 3.6			

Soil Map ID: 10

Soil Component Name: Urban land

Soil Surface Texture: variable

Hydrologic Group: Class A - High infiltration rates. Soils are deep, well drained to

excessively drained sands and gravels.

Soil Drainage Class: Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

	Soil Layer Information								
	Boui	ndary		Classification		Saturated hydraulic			
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil		Soil Reaction (pH)		
1	0 inches	5 inches	variable	Not reported	Not reported	Max: 0.0015 Min: 0	Max: Min:		

Soil Map ID: 11

Soil Component Name: Elnora

Soil Surface Texture: loamy fine sand

Hydrologic Group: Class B - Moderate infiltration rates. Deep and moderately deep,

moderately well and well drained soils with moderately coarse

textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Low

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 54 inches

	Soil Layer Information									
	Bou	ındary		Classi	fication	Saturated hydraulic				
Layer	Upper	Lower	Soil Texture Class	AASHTO Group	Unified Soil	conductivity micro m/sec				
1	0 inches	11 inches	loamy fine sand	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 7.3 Min: 5.1			
2	11 inches	27 inches	fine sand	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 7.3 Min: 5.1			
3	27 inches	64 inches	loamy fine sand	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 141 Min: 42	Max: 7.3 Min: 5.1			

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

DATABASE SEARCH DISTANCE (miles)

Federal USGS 1.000

Federal FRDS PWS Nearest PWS within 1 mile

State Database 1.000

FEDERAL USGS WELL INFORMATION

MAP ID WELL ID LOCATION FROM TP

FEDERAL USGS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	USGS2130219	1/4 - 1/2 Mile East
2	USGS2130032	1/4 - 1/2 Mile NE
3	USGS2130202	1/2 - 1 Mile South
A4	USGS2130050	1/2 - 1 Mile NE
A5	USGS2130053	1/2 - 1 Mile NE
A6	USGS2130052	1/2 - 1 Mile NE
7	USGS2130170	1/2 - 1 Mile SSW
8	USGS2130216	1/2 - 1 Mile East
9	USGS2130056	1/2 - 1 Mile NW

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION


MAP ID	WELL ID	FROM TP
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

		LOCATION
MAP ID	WELL ID	FROM TP
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 2896934.2s

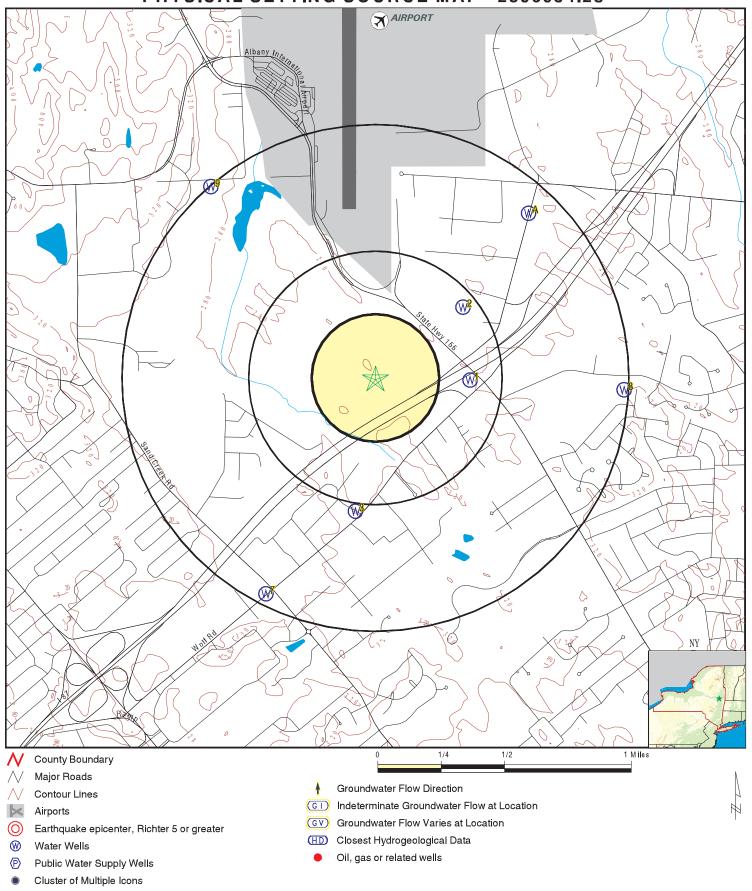

SITE NAME: Interstate 87 Exit 3 Airport Connector ADDRESS: Wolf Road and Albany Shaker Road

Albany NY 12211 LAT/LONG: 42.7277 / 73.8033 CLIENT: Shumaker Cons. Engineering CONTACT: Jeff Mt. Pleasant

INQUIRY #: 2896934.2s

DATE: October 18, 2010 3:07 pm

Copyright © 2010 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

Map ID Direction Distance

Elevation Database EDR ID Number

Higher

Agency cd: USGS Site no: 424339073474701

Site name: A 17

424339 Latitude: EDR Site id: USGS2130219 0734747 Longitude: Dec lat: 42.72757814 Dec Ion: -73.79595433 Coor meth: Coor accr: Latlong datum: NAD27 Dec latlong datum: NAD83 District: 36 001 State: 36 County:

Country: US Land net: Not Reported

Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 310.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929 Hydrologic: Mohawk. New York. Area = 2550 sq.mi.

Topographic: Flat surface

Site type: Ground-water other than Spring Date construction: 19420101

Date inventoried: Not Reported Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Not Reported

Aquifer: SAND

Well depth: 24.0 Hole depth: 24.0

Source of depth data: Not Reported

Project number: Not Reported

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data begin date: 0000-00-00
Peak flow data count: 0 Water quality data begin date: 0000-00-00
Water quality data end date:0000-00-00
Water quality data count: 0

Ground water data begin date: 1945-12-01 Ground water data end date: 1945-12-01

Ground water data count: 1

Ground-water levels, Number of Measurements: 0

2 NE FED USGS USGS2130032

1/4 - 1/2 Mile Lower

Agency cd: USGS Site no: 424354073474901

Site name: A 5

 Latitude:
 424354
 EDR Site id:
 USGS2130032

 Longitude:
 0734749
 Dec lat:
 42.73174476

 Dec lon:
 -73.79650986
 Coor meth:
 M

Coor accr:SLatlong datum:NAD27Dec latlong datum:NAD83District:36State:36County:001Country:USLand net:Not Re

Country: US Land net: Not Reported Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 305.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929 Hydrologic: Mohawk. New York. Area = 2550 sq.mi.

Topographic: Dunes

Site type: Ground-water other than Spring Date construction: 19760621

Date inventoried: Not Reported Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Not Reported Aquifer: BEDROCK

Well depth: Not Reported Hole depth: 399

Source of depth data: Not Reported Project number: Not Reported

Real time data flag: Not Reported Daily flow data begin date: Not Reported Daily flow data end date: Not Reported Daily flow data count: Not Reported Not Reported Peak flow data begin date: Not Reported Peak flow data end date: Peak flow data count: Not Reported Water quality data begin date: Not Reported Water quality data end date: Not Reported Water quality data count: Not Reported Ground water data end date: Not Reported Ground water data begin date: Not Reported

Ground water data count: Not Reported

Ground-water levels, Number of Measurements: 0

3 South FED USGS USGS2130202

1/2 - 1 Mile Higher

Agency cd: USGS Site no: 424312073481901

Site name: A 20

424312 EDR Site id: USGS2130202 Latitude: Longitude: 0734819 Dec lat: 42.72007818 Dec Ion: -73.80484351 Coor meth: Μ Coor accr: Latlong datum: NAD27 Dec latlong datum: NAD83 District: 36

State: 36 Country: 001
Country: US Land net: Not Reported

Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 300.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929 Hydrologic: Mohawk. New York. Area = 2550 sq.mi.

Topographic: Flat surface

Site type: Ground-water other than Spring Date construction: 19300101
Date inventoried: Not Reported Date construction: 19300101
Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Not Reported

Aquifer: SAND

Well depth: 20.0 Hole depth: 20.0

Source of depth data: Not Reported

Project number: Not Reported

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data begin date: 0000-00-00 Peak flow data end date: 0000-00-00

Peak flow data count: Water quality data begin date: 0000-00-00

Water quality data end date:0000-00-00 Water quality data count:

Ground water data begin date: 1945-12-01 Ground water data end date: 1945-12-01

Ground water data count:

Ground-water levels, Number of Measurements: 0

ΝE **FED USGS** USGS2130050

1/2 - 1 Mile Higher

> Agency cd: **USGS** Site no: 424412073473101 Site name: A 266

Latitude: 424412 EDR Site id: USGS2130050 42.73674473

Longitude: 0734731 Dec lat: Dec Ion: -73.79150969 Coor meth: Latlong datum: NAD27 Coor accr: Dec latlong datum: NAD83 District: 36 State: 36 County: 001

US Land net: Not Reported Country: Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 300.00

Altitude method: Interpolated from topographic map

Altitude accuracy:

Altitude datum: National Geodetic Vertical Datum of 1929 Hydrologic: Mohawk. New York. Area = 2550 sq.mi.

Topographic: Flat surface

Site type: Ground-water other than Spring Date construction: 19311028 Date inventoried: Not Reported Mean greenwich time offset: **EST**

Local standard time flag:

Type of ground water site: Single well, other than collector or Ranney type

Not Reported Aquifer Type:

Aquifer: SAND AND GRAVEL

Well depth: 303 Hole depth: 308

Source of depth data: Not Reported Project number: Not Reported

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data end date: Peak flow data begin date: 0000-00-00 0000-00-00 Peak flow data count: Water quality data begin date: 0000-00-00

Water quality data end date:0000-00-00 Water quality data count:

Ground water data begin date: 1931-12-16 Ground water data end date: 1931-12-16

Ground water data count:

Ground-water levels, Number of Measurements: 0

FED USGS USGS2130053

1/2 - 1 Mile Higher

Agency cd: USGS Site no: 424414073473101

Site name: A 264

 Latitude:
 424414
 EDR Site id:
 USGS2130053

 Longitude:
 0734731
 Dec lat:
 42.73730028

 Dec Ion:
 -73.79150969
 Coor meth:
 M

 Coor accr:
 F
 Latlong datum:
 NAD27

 Dec latlong datum:
 NAD83
 District:
 36

 State:
 36
 County:
 001

Country: US Land net: Not Reported

Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 300.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929 Hydrologic: Mohawk. New York. Area = 2550 sq.mi.

Topographic: Flat surface

Site type: Ground-water other than Spring Date construction: 19300514

Date inventoried: Not Reported Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Not Reported

Aquifer: SAND AND GRAVEL

Well depth: 224 Hole depth: 243

Source of depth data: Not Reported Project number: Not Reported

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data begin date: 0000-00-00 Peak flow data end date: 0000-00-00 Peak flow data count: 0 Water quality data begin date: 0000-00-00

Water quality data end date:0000-00-00 Water quality data count: 0

Ground water data begin date: 1930-06-03 Ground water data end date: 1930-06-03

Ground water data count: 1

Ground-water levels, Number of Measurements: 0

A6
NE FED USGS USGS2130052

1/2 - 1 Mile Higher

Agency cd: USGS Site no: 424414073473001

 Site name:
 A 265

 Latitude:
 424414
 EDR Site id:
 USGS2130052

 Longitude:
 0734730
 Dec lat:
 42.73730028

 Dec Ion:
 -73.7912319
 Coor meth:
 M

 Coor accr:
 F
 Latlong datum:
 NAD27

 Dec latlong datum:
 NAD83
 District:
 36

 State:
 36
 County:
 001

Country: US Land net: Not Reported Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 300.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929 Hydrologic: Mohawk. New York. Area = 2550 sq.mi.

Topographic: Flat surface

Site type: Ground-water other than Spring Date construction: 19300607

Date inventoried: Not Reported Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Not Reported

Aquifer: SAND AND GRAVEL

Well depth: 244 Hole depth: 246

Source of depth data: Not Reported

Project number: Not Reported

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data begin date: 0000-00-00 Peak flow data end date: 0000-00-00 Water quality data begin date: 0000-00-00

Water quality data end date:0000-00-00 Water quality data count: 0

Ground water data begin date: 1930-07-10 Ground water data end date: 1930-07-10

Ground water data count:

Ground-water levels, Number of Measurements: 0

7
SSW
FED USGS USGS2130170
1/2 - 1 Mile

Higher

Agency cd: USGS Site no: 424255073484401

Site name: A 19

 Latitude:
 424255
 EDR Site id:
 USGS2130170

 Longitude:
 0734844
 Dec lat:
 42.71535596

 Dec Ion:
 -73.81178818
 Coor meth:
 M

 Coor accr:
 F
 Latlong datum:
 NAD27

 Dec latlong datum:
 NAD83
 District:
 36

 State:
 36
 County:
 001

Country: US Land net: Not Reported

Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 295.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929

Hydrologic: Middle Hudson. Massachusetts, New York. Area = 2390 sq.mi.

Topographic: Flat surface

Site type: Ground-water other than Spring Date construction: 19400101
Date inventoried: Not Reported Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Not Reported

Aquifer: SAND

Well depth: 45.0 Hole depth: 51.0

Source of depth data: Not Reported

Project number: Not Reported

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data begin date: 0000-00-00 Peak flow data end date: 0000-00-00 Water quality data begin date: 0000-00-00

Water quality data end date:0000-00-00 Water quality data count: 0

Ground water data begin date: 1945-12-01 Ground water data end date: 1945-12-01

Ground water data count: 1

Ground-water levels, Number of Measurements: 0

Map ID Direction Distance

Elevation Database EDR ID Number

8 East FED USGS USGS2130216

1/2 - 1 Mile Higher

Agency cd: USGS Site no: 424337073470401

Site name: A 271

424337 Latitude: EDR Site id: USGS2130216 0734704 Longitude: Dec lat: 42.72702267 Dec Ion: -73.7840096 Coor meth: Μ Coor accr: Latlong datum: NAD27 Dec latlong datum: NAD83 District: 36 001 State: 36 County:

Country: US Land net: Not Reported

Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 320.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929 Hydrologic: Mohawk. New York. Area = 2550 sq.mi.

Topographic: Flat surface

Site type: Ground-water other than Spring Date construction: 19410731

Date inventoried: Not Reported Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Not Reported

Aquifer: SAND AND GRAVEL

Well depth: 121 Hole depth: 147

Source of depth data: Not Reported

Project number: Not Reported

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data begin date:0000-00-00Peak flow data end date:0000-00-00Peak flow data count:0Water quality data begin date:0000-00-00

Water quality data end date:0000-00-00 Water quality data count: 0

Ground water data begin date: 1941-09-02 Ground water data end date: 1941-09-02

Ground water data count: 1

Ground-water levels, Number of Measurements: 0

9 NW FED USGS USGS2130056 1/2 - 1 Mile

1/2 - 1 M Lower

Agency cd: USGS Site no: 424418073485601

Site name: A 640

 Latitude:
 424419.1
 EDR Site id:
 USGS2130056

 Longitude:
 0734857.8
 Dec lat:
 42.73863889

 Dec lon:
 -73.81605556
 Coor meth:
 M

NAD83 Coor accr: 5 Latlong datum: NAD83 District: 36 Dec latlong datum: State: 36 County: 001 Not Reported Country: US Land net:

Location map: ALBANY K-25-2 Map scale: 24000

Altitude: 285.00

Altitude method: Interpolated from topographic map

Altitude accuracy: 5

Altitude datum: National Geodetic Vertical Datum of 1929

Hydrologic: Middle Hudson. Massachusetts, New York. Area = 2390 sq.mi.

Topographic: Not Reported

Site type: Ground-water other than Spring Date construction: 19930608
Date inventoried: 19930709 Date construction: 19930608
Mean greenwich time offset: EST

Local standard time flag: N

Type of ground water site: Single well, other than collector or Ranney type

Aquifer Type: Unconfined single aquifer

Aquifer: SAND

Well depth: 20 Hole depth: 21

Source of depth data: reporting agency (generally USGS)

Project number: 443619900

Real time data flag: 0 Daily flow data begin date: 0000-00-00

Daily flow data end date: 0000-00-00 Daily flow data count: 0

Peak flow data begin date: 0000-00-00 Peak flow data end date: 0000-00-00 Water quality data begin date: 1993-07-13

Water quality data end date:1993-07-13 Water quality data count:

Ground water data begin date: 1993-06-21 Ground water data end date: 1993-07-13

Ground water data count: 2

Ground-water levels, Number of Measurements: 0

AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

Zip	Num Sites	< 4 Pci/L	>= 4 Pci/L	>= 20 Pci/L	Avg > 4 Pci/L	Max Pci/L
_						
12211	111	71 (64%)	34 (30.6%)	6 (5.4%)	5.93	57.9
12211	1	0 (0%)	1 (100%)	0 (0%)	17.70	17.7
12211	1	1 (100%)	0 (0%)	0 (0%)	3.90	3.9

Federal EPA Radon Zone for ALBANY County: 1

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for ALBANY COUNTY, NY

Number of sites tested: 141

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	0.780 pCi/L	92%	5%	3%
Basement	1.600 pCi/L	82%	17%	1%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2009 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells

Source: New York Department of Health

Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database

Department of Environmental Conservation

Telephone: 518-402-8056

These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon Source: Department of Health Telephone: 518-402-7556 Radon Test Results

Area Radon Information Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency

(USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor

radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.